



Landusky Metals Total Maximum Daily Loads and Framework Water Quality Improvement Plan



March 2012

Brian Schweitzer, Governor
Richard Opper, Director DEQ



Prepared by:

Water Quality Planning Bureau
Watershed Management Section

Contributors:

Water Quality Planning Bureau
Watershed Management Section
Tim Byron, Senior TMDL Planner and Project Manager
Eric Sivers, Senior TMDL Planner

Co Contributors:

Permitting and Compliance Division
Environmental Management Bureau
Wayne Jepson

Spectrum Engineering
William Maehl, P.E.

Montana Department of Environmental Quality
Water Quality Planning Bureau
1520 E. Sixth Avenue
P.O. Box 200901
Helena, MT 59620-0901

Suggested citation: Montana DEQ. 2012. Landusky Metals Total Maximum Daily Loads and Framework Water Quality Restoration Plan. Helena, MT: Montana Dept. of Environmental Quality.

ERRATA SHEET FOR THE “LANDUSKY METALS TOTAL MAXIMUM DAILY LOADS AND FRAMEWORK WATER QUALITY IMPROVEMENT PLAN”

This TMDL was approved by EPA on March 12, 2012. Several copies were printed and spiral bound for distribution, or sent electronically on compact disks. The original version had minor changes that are explained and corrected on this errata sheet. If you have a bound copy, please note the corrections listed below or simply print out the errata sheet and insert it in your copy of the TMDL. If you have a compact disk please add this errata sheet to your disk or download the updated version from our website.

Appropriate corrections have already been made in the downloadable version of the TMDL located on our website at: <http://deq.mt.gov/wqinfo/TMDL/finalReports.mcp>

The following table contains corrections to the TMDL. The first column cites the page and paragraph where there is a text error. The second column contains the original text that was in error. The third column contains the new text that has been corrected for the “Landusky Metals Total Maximum Daily Loads and Framework Water Quality Improvement Plan” document. The text in error and the correct text are underlined>.

Location in the TMDL	Original Text	Corrected Text
Suggested citation on the back of the cover page	Montana DEQ. 2012. Landusky Metals and Cyanide Total Maximum Daily Loads and Framework Water Quality Restoration Plan. Helena, MT: Montana Dept. of Environmental Quality.	Montana DEQ. 2012. Landusky Metals Total Maximum Daily Loads and Framework Water Quality Restoration Plan. Helena, MT: Montana Dept. of Environmental Quality.
Section 1.3, Page 1-6, description for Section 7	Describes a water quality monitoring plan for evaluating the long-term effectiveness of the Landusky Metals and Cyanide TMDLs and Framework Water Quality Restoration Plan.	Describes a water quality monitoring plan for evaluating the long-term effectiveness of the Landusky Metals TMDLs and Framework Water Quality Restoration Plan.
Page 5-25, First sentence of first paragraph	Twelve stream segments in the Landusky TPA require the development of 60 TMDLs for metals and cyanide (<u>Table 5-21</u>).	Twelve stream segments in the Landusky TPA require the development of 63 TMDLs for metals and cyanide (<u>Table 5-21</u>).
Page 5-25, Last sentence of the second paragraph	These include cadmium and iron in Beaver Creek, lead in Mill Gulch, arsenic and copper in Montana Gulch, copper, lead, and zinc in Ruby Gulch, and selenium and lead in Swift Gulch Creek.	These include cadmium and iron in Beaver Creek, lead in Mill Gulch, copper in Montana Gulch, copper in Ruby Gulch, and selenium and lead in Swift Gulch Creek.
Page 8-2, second paragraph under Section 8.2	The formal public comment period for the “Landusky Metals and Cyanide TMDLs and Framework Water Quality Restoration Plan” was initiated on August 17, 2011 and closed on October 12, 2011.	The formal public comment period for the “Landusky Metals TMDLs and Framework Water Quality Restoration Plan” was initiated on August 17, 2011 and closed on October 12, 2011.

ACKNOWLEDGEMENTS

Advice and input on interpretation of the Zortman-Landusky water quality database were provided by Don Sutton and William Maehl of Spectrum Engineering. Mike Flatt, also of Spectrum, provided helpful descriptions of mine facilities and the wastewater plumbing system. Wayne Jepson, hydrologist with DEQ's Environmental Management Bureau, provided a host of background documentation on the regulatory history at the mine sites. Wayne's familiarity with the project history, hydrologic setting mine reclamation sequence and prospective future reclamation efforts were helpful in drafting a number of the document sections. Wayne also conducted informative on-site tours of both mines for TMDL planning staff and local stakeholder groups. Pat Anderson, administrator for the Phillips County Conservation District, and Jennifer Kenck, coordinator for the Milk River Watershed Alliance provided valuable forums for TMDL planning staff to explain the TMDL process and facilitated an educational gathering of local stakeholders at the mine sites. Ina Nez Perce and Morris Belgard, of the Fort Belknap Environmental Department, also provided a forum for discussion of TMDL development for the planning area and led an on-site tour of water quality impacts in Swift Gulch and South Big Horn creeks.

The authors take sole responsibility for the contents of the report and will consider additional review comments for future publication or additional efforts derived from this report. The participation of all contributors led to substantial improvements in our understanding of the available water quality data and water management issues at the mines. Their generous contributions of time and effort are greatly appreciated.

TABLE OF CONTENTS

Acronymsxiii

Document Summary 1

1.0 Introduction 1-1

 1.1 Background 1-1

 1.2 Water Quality Impairments and TMDLs Addressed by this Document..... 1-2

 1.3 Document Layout..... 1-6

2.0 Landusky planning area description 2-1

 2.1 Physical Parameters 2-1

 2.1.1 Location..... 2-1

 2.1.2 Topography 2-2

 2.1.3 Geology 2-2

 2.2 Surface Water 2-3

 2.2.1 Stream Gaging Stations..... 2-3

 2.2.2 Stream Flow 2-4

 2.2.3 Surface Water Quality..... 2-4

 2.3 Groundwater..... 2-5

 2.3.1 Hydrogeology 2-5

 2.3.2 Groundwater Quality 2-5

 2.4 Climate 2-6

 2.4.1 Climate Stations 2-6

 2.5 Ecological Parameters..... 2-6

 2.5.1 Vegetation..... 2-6

 2.5.2 Aquatic Life 2-7

 2.5.3 Fires..... 2-7

 2.6 Cultural parameters 2-7

 2.6.1 Population..... 2-7

 2.7 Transportation Networks..... 2-8

 2.7.1 Roads..... 2-8

 2.7.2 Railroads..... 2-8

 2.8 Land Ownership 2-8

 2.9 Land Use & Cover 2-8

 2.9.1 Mining 2-9

 2.9.2 Timber Harvests 2-9

 2.9.3 Livestock Operations..... 2-9

 2.10 Wastewater..... 2-9

3.0 TMDL Regulatory Framework 3-1

 3.1 TMDL Development Requirements 3-1

 3.2 Waterbodies and Pollutants of Concern..... 3-1

 3.3 Applicable Water Quality Standards..... 3-2

 3.3.1 Classification and Beneficial Uses 3-2

 3.3.2 Standards 3-4

4.0 Description of TMDL Components..... 4-1

 4.1 Target Development 4-2

 4.2 Quantifying Pollutant Sources 4-2

 4.3 Establishing the Total Allowable Load 4-3

4.4 Determining Allocations.....	4-3
5.0 Metals TMDL Components	5-1
5.1 Excess Metals Effects on Beneficial Uses.....	5-1
5.2 Stream Segments of Concern	5-2
5.3 Information Sources and Assessment Methods	5-3
5.3.1 Natural Background Water Quality.....	5-8
5.3.2 Abandoned Mines and Associated Wastes.....	5-10
5.3.3 Point Sources	5-11
5.4 Water Quality Targets.....	5-12
5.4.1 Supplemental Indicators	5-13
5.4.2 Target Summary.....	5-15
5.4.3 Targets, Supplemental Indicators, and the Need for TMDLs.....	5-16
5.4.4 Achievability of Water Quality Targets	5-17
5.5 Existing Conditions and Departures from Water Quality Targets	5-18
5.5.1 TMDL Development Summary	5-25
5.6 TMDLs	5-25
5.6.1 TMDLS for Non-Hardness Dependent Metals and Cyanide.....	5-26
5.6.2 Example TMDLS for Metals and Cyanide for Listed Streams.....	5-27
5.7 Loading Summaries and Allocations	5-32
5.7.1 Alder Gulch (MT40E002_051).....	5-32
5.7.2 Beaver Creek, (MT40M001_011).....	5-35
5.7.3 South Big Horn Creek, (MT40I001_030)	5-35
5.7.4 King Creek (MT40I001_040).....	5-37
5.7.5 Lodge Pole Creek (MT40I001_050).....	5-38
5.7.6 Mill Gulch (MT40E002_100)	5-39
5.7.7 Montana Gulch (MT40E002_010).....	5-41
5.7.8 Rock Creek (MT40E002_090).....	5-45
5.7.9 Ruby Gulch (MT40E002_070)	5-46
5.7.10 Ruby Creek (MT40E002_060)	5-48
5.7.11 Sullivan Creek (MT40E002_110)	5-51
5.7.12 Swift Gulch Creek (MT40I002_010)	5-52
5.8 Seasonality and Margin of Safety	5-54
5.8.1 Seasonality	5-54
5.8.2 Margin of Safety.....	5-54
5.9 Uncertainty and Adaptive Management	5-55
6.0 Framework Water Quality Restoration Strategy	6-1
6.1 Summary of Restoration Strategy.....	6-1
6.2 Role of DEQ, Other Agencies, and Stakeholders.....	6-1
6.3 Watershed Restoration Goals.....	6-2
6.4 Overview of Water Management Recommendations.....	6-2
6.4.1 Water Treatment System Repairs.....	6-3
6.4.2 Water Treatment Improvement Options.....	6-3
6.4.3 Source Control Evaluation.....	6-5
6.5 General Mine Reclamation Approaches	6-5
6.5.1 Pollution Restoration Approach.....	6-5
7.0 Monitoring Strategy and Adaptive Management	7-1
7.1 Introduction	7-1
7.2 Adaptive Management Approach.....	7-1

7.3 Future Monitoring Guidance	7-1
7.3.1 Strengthening the Source Assessment	7-2
7.3.2 Increase and Update Available Data	7-2
7.3.3 Consistent Data Collection and Methodologies	7-3
7.3.4 Specific Recommendations for Metals Monitoring	7-3
7.3.5 Effectiveness Monitoring for Reclamation Activities	7-4
7.3.6 Reclamation in Areas Affected by Mining	7-5
7.3.7 Watershed Wide Analyses	7-5
8.0 Public Involvement & Comments	8-1
8.1 Participants and Roles	8-1
8.2 Response to Public Comments	8-2
8.3 Public Comments and Responses	8-3
9.0 References	9-1

APPENDICES

- Appendix A – TMDL Status Summary Table and Maps
- Appendix B – Surface Water Chemistry Data
- Appendix C – Surface Water Chemistry Data – Selected Background Sites
- Appendix D – Groundwater Chemistry Examples Zortman and Landusky Mines
- Appendix E – Landusky TMDL Planning Area Fish Distribution Report
- Appendix F – Target Departure Analysis

LIST OF TABLES

Table DS-1. List of impaired waterbodies, corresponding metals and cyanide TMDLs prepared in this document, and impaired uses in the Landusky TPA	2
Table 1-1. Water quality impairment causes for the Landusky TPA addressed within this document	1-3
Table 2-1. Stream Gage	2-4
Table 2-2. Monthly Climate Summary: Zortman	2-6
Table 2-3. Land Ownership	2-8
Table 2-4. Land Use and Cover	2-8
Table 3-1. Landusky impaired waterbody segments and beneficial use support status	3-2
Table 3-2. Montana Surface Water Classifications and Designated Beneficial Uses Applicable to the Landusky TPA	3-3
Table 3-3. Montana Numeric Surface Water Quality Standards Guide for Metals and Cyanide.	3-5
Table 3-4. Coefficients for Calculating Metals Freshwater Aquatic Life Standards (Montana Department of Environmental Quality, 2010a)	3-6
Table 5-1. Waterbody segments in the Landusky TPA with metals-related impairments on the 2010 303(d) List	5-3
Table 5-2. Monitoring stations and data timeframes used to characterize existing water quality conditions of impaired stream segments	5-4
Table 5-3. Monitoring stations and data timeframes used to characterize natural background water quality conditions of impaired stream segments	5-6
Table 5-4. Summary statistics for water quality data from sites Z-60, Z-61 and Z-62 showing minimal ARD effects in upper Alder Gulch	5-8

Table 5-5. Summary statistics for water quality data from sites Z-21, Z-27, Z-28, and Z-30 showing minimal ARD effects in upper Beaver, Lodge Pole and South Big Horn creeks5-9

Table 5-6. Comparison of high and low flow summary statistics for ARD-related parameters and flow from 18 monitoring sites representing natural background conditions 5-9

Table 5-7. Screening criteria for sediment metals concentrations used as supplemental indicators.....5-15

Table 5-8. Targets and Supplemental Indicators for the Landusky TPA5-16

Table 5-9. Metals decision factors and TMDL conclusions for Alder Gulch.....5-19

Table 5-10. Metals decision factors and TMDL conclusions for Beaver Creek5-19

Table 5-11. Metals decision factors and TMDL conclusions for South Big Horn Creek5-20

Table 5-12. Metals decision factors and TMDL conclusions for King Creek5-20

Table 5-13. Metals decision factors and TMDL conclusions for Lodge Pole Creek.....5-20

Table 5-14. Metals decision factors and TMDL conclusions for Mill Gulch5-21

Table 5-15. Metals decision factors and TMDL conclusions for Montana Gulch5-21

Table 5-16. Metals decision factors and TMDL conclusions for Rock Creek5-22

Table 5-17. Metals decision factors and TMDL conclusions for Ruby Gulch5-22

Table 5-18. Metals decision factors and TMDL conclusions for Ruby Creek5-23

Table 5-19. Metals decision factors and TMDL conclusions for Sullivan Creek.....5-23

Table 5-20. Metals decision factors and TMDL conclusions for Swift Gulch Creek5-24

Table 5-21. Streams requiring TMDLs for metal and cyanide pollutants.5-25

Table 5-22. Example metals TMDLs for waterbodies in the Landusky TPA5-29

Table 5-23. Cadmium, copper, lead, mercury, selenium and zinc TMDLs and load- and wasteload allocation examples for Alder Gulch at site Z-8.5-34

Table 5-24. Aluminum, arsenic, cadmium, iron, nickel, and zinc TMDLs and allocation examples for South Big Horn Creek at site L-48.....5-36

Table 5-25. Arsenic, cadmium, and selenium TMDLs and allocation examples for arsenic, cadmium, and selenium in King Creek at site L-5.5-38

Table 5-26. Cadmium and mercury TMDLs and allocation examples for cadmium and mercury in Lodge Pole Creek at site Z-75-39

Table 5-27. Copper, mercury, and selenium TMDLs and load allocation examples for Mill Gulch at L-75-40

Table 5-28. Aluminum, arsenic, cadmium, cyanide, nickel, selenium, and zinc TMDLs and allocation examples for Montana Gulch at site L-25-44

Table 5-29. Cadmium, selenium and zinc TMDLs and allocation examples for Rock Creek at site L-235-45

Table 5-30. Copper, lead and mercury TMDLs and example composite allocations for Rock Creek at site L-23.5-46

Table 5-31. Aluminum, cadmium, cyanide, chromium, mercury, and selenium TMDL and allocation examples for Ruby Gulch at L-155-48

Table 5-32. Cadmium, lead, selenium and zinc TMDLs and allocation examples for Ruby Creek at Z-325-50

Table 5-33. Aluminum, copper, and mercury TMDLs and allocation examples for Ruby Creek at Z-325-50

Table 5-34. Cadmium, iron, lead, selenium, and zinc TMDLs and allocation examples for Sullivan Creek at D-75-51

Table 5-35. Metals and cyanide TMDLs and allocation examples for Swift Gulch Creek at L-195-53

Table 5-36. Thallium TMDLs and allocation examples for Swift Gulch Creek at L-19.....5-54

Table 6-1. Pollution Impairments in the Landusky TPA.6-5

Table 7-1. Metals Monitoring Recommendations for Landusky TPA by stream segment.7-3

Table 7-2. Effectiveness monitoring recommendations for mine site reclamation. 7-5

LIST OF FIGURES

Figure 2-1. Map of the northern half of the Landusky TPA showing locations of impaired waters. 2-2

Figure 2-2. Mean daily discharge of Rock Creek at USGS Station 06115350 near Landusky, Montana.... 2-4

Figure 2-3. Metals and cyanide concentrations in untreated and treated wastewater at the Landusky (A) and Zortman (B) treatment plants..... 2-10

Figure 2-4. Median June through August cadmium and zinc concentrations in Swift Gulch Creek at sites upstream (L-19) and downstream (L-49) of the treatment plant during 2010. 2-11

Figure 4-1. Schematic example of TMDL development 4-2

Figure 4-2. Schematic diagram of TMDL and allocations..... 4-4

Figure 5-1. ARD-related iron oxide turbidity and substrate coating in Swift Gulch Creek 5-2

Figure 5-2. Monitoring sites selected as representing current water quality conditions 5-5

Figure 5-3. Locations of sites representing natural background water quality relative to bedrock shear zones in the Zortman (upper right) and Landusky (lower left) mine areas. 5-7

Figure 5-4. Wastewater treatment plant and Goslin LAD point source locations..... 5-12

Figure 5-5. Surface water sulfate monitoring record for site L-19 in Swift Gulch Creek. 5-14

Figure 5-6. Graphs of TMDLs (lbs/day) for iron (Fe), aluminum (Al), arsenic (As), selenium (Se), cyanide (CN), thallium (Tl), and Mercury (Hg) with increasing stream discharge 5-27

Figure 5-7. Sulfate concentration record at site Z-8 in Alder Gulch. 5-33

Figure 5-8. Graph of the sulfate concentration in the Montana Gulch pond discharge during the past 10 years..... 5-42

Figure 5-9. Graphs of surface water sulfate concentration at sites L-16, L-47, and L-2 during the past 10 years..... 5-42

Figure 5-10. Graph of the arsenic concentration in the Montana Gulch pond discharge during the past 10 years..... 5-43

Figure 5-11. Graph of copper concentration in the Montana Gulch pond discharge during the past 10 years..... 5-43

Figure 5-12. Graphs of arsenic, copper, and iron concentration at site L-19 in Swift Gulch Creek through 2010. 5-52

ACRONYMS

Acronym	Definition
AAL	Acute Aquatic Life
AML	Abandoned Mine Lands
ARARS	Applicable or Relevant and Appropriate Requirements
ARD	Acid Rock Drainage
ARM	Administrative Rules of Montana
BER	Board of Environmental Review (Montana)
BLM	Bureau of Land Management (federal)
BMP	Best Management Practices
CAL	Chronic Aquatic Life
CAMA	Computer Assisted Mass Appraisal
CERCLA	Comprehensive Environmental Response, Compensation, and Liability Act
CFR	Code of Federal Regulations
CN	Cyanide
CWA	Clean Water Act
DEM	Digital Elevation Model
DEQ	Department of Environmental Quality (Montana)
EIS	Environmental Impact Statement
EPA	Environmental Protection Agency (US)
FWP	Fish, Wildlife, and Parks
GIS	Geographic Information System
GPM	Gallons Per Minute
HH	Human Health
IR	Integrated Report
LA	Load Allocation
LAD	Land Application Area
LULC	Land Use and Land Cover
MBMG	Montana Bureau of Mines and Geology
MCA	Montana Codes Annotated
MCL	Maximum Contaminant Level
MDL	Method Detection Limit
MMI	Multimetric Indices
MOS	Margin of Safety
MPDES	Montana Pollutant Discharge Elimination System
NAIP	National Agricultural Imagery Program
NHD	National Hydrography Data(set)
NLCD	National Land Cover Dataset
NOAA	National Oceanographic and Atmospheric Administration
NPL	National Priorities List
NRCS	National Resources Conservation Service
NRIS	Natural Resource Information System (Montana)
NWIS	National Water Information System
PEL	Probable Effects Levels
RAWS	Remote Automatic Weather Stations
RIT/RDG	Resource Indemnity Trust/Reclamation and Development Grants Program

Acronym	Definition
RIT	Reach Indexing Tool
SDWIS	Safe Drinking Water Information System
SEIS	Supplemental Environmental Impact Statement
SILC	Satellite Imagery Land Cover
SSURGO	Soil Survey Geographic database
STORET	EPA STORage and RETrieval database
TDS	Total Dissolved Solids
TMDL	Total Maximum Daily Load
TPA	TMDL Planning Area
TSS	Total Suspended Solids
UAA	Use Attainability Analysis
USDA	United States Department of Agriculture
USGS	United States Geological Survey
USLE	Universal Soil Loss Equation
UTMS	Untreated Mining Sources
WLA	Waste Load Allocation
WQ	Water Quality
WQA	Water Quality Act
WRP	Watershed Restoration Plans
WWTP	Waste Water Treatment Plant
ZMI	Zortman Mining, Inc.

DOCUMENT SUMMARY

This document presents total Maximum Daily Loads (TMDL) and a framework water quality improvement plan for 12 impaired headwater tributaries to the Missouri and Milk rivers located in the Little Rocky mountain range in north-central Montana (**Appendix A, Figure A-7**).

The Montana Department of Environmental Quality (DEQ) develops TMDLs and submits them to the U.S. Environmental Protection Agency (EPA) for approval. The Montana Water Quality Act requires DEQ to develop TMDLs for streams and lakes that do not meet, or are not expected to meet, Montana water quality standards. A TMDL is the maximum amount of a pollutant a waterbody can receive and still meet water quality standards. TMDLs provide an approach to improve water quality so that streams and lakes can support and maintain their state-designated beneficial uses.

The Landusky TMDL Planning Area (TPA) is located in southwestern Phillips County. The tributaries originate in the Little Rocky Mountains. The Landusky TPA encompasses about 81,900 acres, with federal, state, and private land ownership.

The scope of the TMDLs in this document addresses problems with trace metals and cyanide (see **Table DS-1**). DEQ determined that 12 tributaries do not meet the applicable water quality standards. This document establishes 63 TMDLs for metals and cyanide on the 12 stream segments. In addition, seven impairments caused by low pH are addressed by TMDLs through application of surrogate metal parameters. Therefore, 70 impairment causes related to trace metals, cyanide and pH are addressed in this document. Although DEQ recognizes the fecal coliform impairment cause on Rock Creek and the nitrate nitrogen impairment cause on Mill Gulch, this document addresses only cyanide, metals, and pH impairments. A future TMDL project will be developed to address the coliform and nitrogen TMDLs for this planning area.

The chronic and acute toxicity of metal and cyanide pollutants were identified as impairing cold water fishes, warm water fishes, drinking water uses, primary contact recreation, and agricultural and industrial uses in planning area streams. Water quality restoration goals in this document for metals and cyanide are based on the numeric water quality criteria for these pollutants published in Circular DEQ-7 (DEQ 2010). DEQ believes that once these water quality goals are met, all water uses currently affected by pH, metals, and cyanide will be restored.

Recommended framework strategies for achieving the pollutant reduction goals are also presented in this plan. They include best management practices (BMPs) such as repair and maintenance of existing wastewater treatment components, continued lime treatment of collected wastewater, conversion from sodium hydroxide to lime treatment for leach pad drainage, and improvements in capture system efficiency.

Implementation of most water quality improvement measures described in this plan is based on required compliance with numeric water quality standards for treatment plant point sources and waste loads allocated to mining sources of metals and cyanide. Local, state, federal and tribal agency stakeholders will, ideally, use this TMDL, and associated information, as a guidance tool for water quality improvements. Such activities will be documented in an updated engineering evaluation and cost analysis document that is consistent with achievable local, state, federal and tribal recommendations.

A flexible approach to control of point source TMDL implementation activities is necessary in the Landusky TPA as water quality managers respond to a combination of extreme climate events, changing acidity conditions within waste streams, and escalating costs for power supplies, labor, equipment and materials. Flexibility is also crucial in formulating new water treatment strategies as more knowledge is gained through on-going treatment operations and future monitoring. The plan includes broad monitoring recommendations to improve knowledge of how treatment options are affecting downstream water quality and to update water quality analyses for a more precise comparison with standards.

Table DS-1. List of impaired waterbodies, corresponding metals and cyanide TMDLs prepared in this document, and impaired uses in the Landusky TPA

Waterbody & Location Description	TMDLs Prepared	Impaired Uses
ALDER GULCH , headwaters to mouth (Ruby Creek)	Cadmium, Copper, Lead, Mercury, Selenium, Zinc	Aquatic Life Drinking Water Warm Water Fishes
BEAVER CREEK , headwaters to Fort Belknap Reservation boundary	Lead	Aquatic Life Warm Water Fishes
SOUTH BIG HORN CREEK , Zortman Mine to Fort Belknap Reservation boundary	Aluminum, Arsenic, Cadmium, Iron, Nickel, Zinc	Aquatic Life Cold Water Fishes Drinking Water
KING CREEK , headwaters to Fort Belknap Reservation boundary	Arsenic, Cadmium, Selenium	Aquatic Life Cold Water Fishes Drinking Water
LODGE POLE CREEK , headwaters to Fort Belknap Reservation boundary	Cadmium, Mercury	Aquatic Life Cold Water Fishes Drinking Water
MILL GULCH , headwaters to mouth (Rock Creek)	Copper, Mercury, Selenium	Agriculture Aquatic Life Drinking Water Industrial Primary Contact Recreation Warm Water Fishes
MONTANA GULCH , headwaters to mouth (Rock Creek)	Aluminum, Arsenic, Cadmium, Cyanide, Nickel, Selenium, Zinc	Aquatic Life Drinking Water Warm Water Fishes
ROCK CREEK , headwaters to mouth (Missouri River)	Cadmium, Copper, Lead, Mercury, Selenium, Zinc	Aquatic Life Drinking Water Primary Contact Recreation Warm Water Fishes
RUBY CREEK , un-named tributary T25N R25E S21 to mouth (CK Creek)	Aluminum, Cadmium, Copper, Lead, Mercury, Selenium, Zinc	Aquatic Life Drinking Water Warm Water Fishes
RUBY GULCH , headwaters to confluence of Alder Gulch	Aluminum, Cadmium, Cyanide, Chromium, Lead, Mercury, Selenium, Zinc	Aquatic Life Drinking Water Warm Water Fishes
SULLIVAN CREEK , headwaters to mouth (Rock Creek)	Cadmium, Iron, Lead, Selenium, Zinc	Aquatic Life Drinking Water Primary Contact Recreation Warm Water Fishes

Table DS-1. List of impaired waterbodies, corresponding metals and cyanide TMDLs prepared in this document, and impaired uses in the Landusky TPA

Waterbody & Location Description	TMDLs Prepared	Impaired Uses
SWIFT GULCH CREEK , headwaters to mouth (South Big Horn Creek)	Aluminum, Arsenic, Cadmium, Copper, Cyanide, Iron, Nickel, Thallium, Zinc	Aquatic Life Cold Water Fishes Drinking Water

1.0 INTRODUCTION

This document presents an analysis of water quality information and establishes total maximum daily loads (TMDLs) for pH, metals, and cyanide problems in the Landusky TPA. This document also presents a general framework for resolving these problems. **Figure A-7**, found in **Appendix A**, shows a map of waterbodies in the Landusky TPA with metals and cyanide pollutant listings.

1.1 BACKGROUND

In 1972, the U.S. Congress passed the Water Pollution Control Act, more commonly known as the Clean Water Act (CWA). The CWA's goal is to "restore and maintain the chemical, physical, and biological integrity of the Nation's waters." The CWA requires each state to designate uses of their waters and to develop water quality standards to protect those uses.

Montana's water quality designated use classification system includes the following:

- fish and aquatic life
- wildlife
- recreation
- agriculture
- industry
- drinking water

Each waterbody in Montana has a set of designated uses from the above list. Montana has established water quality standards to protect these uses, and a waterbody that does not meet one or more standards is called an impaired water. Each state must monitor their waters to determine whether they are supporting their designated uses and every two years DEQ must prepare a Water Quality Integrated Report (IR), which lists all impaired waterbodies and their identified impairment causes. Impairment causes fall within two main categories: pollutant and non-pollutant.

Montana's biennial IR identifies all the state's impaired waterbody segments. The 303(d) list portion of the IR includes all of those waterbody segments impaired by a pollutant, which require a TMDL, whereas TMDLs are not required for non-pollutant causes of impairment. **Table A-1** in **Appendix A** identifies impaired waters for the Landusky TPA from Montana's 2010 303(d) List, as well as non-pollutant impairment causes included in Montana's "2010 Water Quality Integrated Report." **Table A-1** also provides the current status of each impairment cause, identifying whether it has been addressed by TMDL development.

Both Montana state law (Section 75-5-701 of the Montana Water Quality Act) and section 303(d) of the federal CWA require the development of total maximum daily loads for all impaired waterbodies when water quality is impaired by a pollutant. A TMDL is the maximum amount of a pollutant that a waterbody can receive and still meet water quality standards.

Developing TMDLs and water quality improvement strategies includes the following components, which are further defined in **Section 4.0**:

- Determining measurable target values to help evaluate the waterbody's condition in relation to the applicable water quality standards

- Quantifying the magnitude of pollutant contributions from their sources
- Determining the TMDL for each pollutant based on the allowable loading limits for each waterbody-pollutant combination
- Allocating the total allowable load (TMDL) into individual loads for each source

In Montana, restoration strategies and monitoring recommendations are also incorporated in TMDL documents to help facilitate TMDL implementation.

Basically, developing a TMDL for an impaired waterbody is a problem-solving exercise. The problem is excess pollutant loading that impairs a designated use. The solution is developed by identifying the total acceptable pollutant load (the TMDL), identifying all the significant pollutant-contributing sources, and identifying where pollutant loading reductions should be applied to achieve the acceptable load.

1.2 WATER QUALITY IMPAIRMENTS AND TMDLS ADDRESSED BY THIS DOCUMENT

Table 1-1 below lists all of the impairment causes from the “2010 Water Quality Integrated Report (IR)” that are addressed in this document. Data assessed during this project identified new impairment causes for five waterbodies. These impairment causes are identified in **Table 1-1** and noted as not being on the 2010 303(d) List (within the integrated report) or within the more recent draft 2012 IR. New impairments will be documented in the DEQ assessment files and incorporated into the 2014 IR.

This document contains 63 TMDLs for metal and cyanide impairment causes (**Table 1-1**). In addition, seven impairment listings for pH are addressed by TMDLs developed through application of surrogate metal parameters. It is assumed that corrective action to reduce loading to meet the surrogate metal TMDL will adequately address water quality problems caused by low pH. Non-pollutant impairment causes are not addressed in this document. **Section 7.0** provides some basic water quality solutions to addressing metals impairments that also serve to address pH impairments.

Although DEQ recognizes the pollutant listings for fecal coliform bacteria on Rock Creek and nitrate nitrogen on Mill Gulch (**Table A-1** in **Appendix A**), this document addresses only the cyanide, metal, and pH impairments identified in **Table 1-1**. This is because DEQ sometimes develops TMDLs in a watershed at varying phases, with a focus on one or a couple of specific pollutant types. **Table A-1** in **Appendix A** includes impairment causes with completed TMDLs, as well as pollutant and non-pollutant impairment causes that need to be addressed by future TMDL development.

Table 1-1. Water quality impairment causes for the Landusky TPA addressed within this document

Waterbody & Location Description^a	Waterbody ID	Impairment Cause	Pollutant Category	Impairment Cause Status	Included in 2010 Integrated Report^{ab}
ALDER GULCH , headwaters to mouth (Ruby Creek)	MT40E002_050	Cadmium	Metals	Cadmium TMDL completed	Yes
		Copper	Metals	Cooper TMDL completed	Yes
		Lead	Metals	Lead TMDL completed	No
		Mercury	Metals	Mercury TMDL completed	Yes
		Selenium	Metals	Selenium TMDL completed	Yes
		Zinc	Metals	Zinc TMDL completed	Yes
		pH	pH/Acidity/Caustic Conditions	Addressed by cadmium TMDL as a surrogate	Yes
BEAVER CREEK , headwaters to Fort Belknap Reservation boundary	MT40M001_011	Lead	Metals	Lead TMDL completed	Yes
SOUTH BIG HORN CREEK , Zortman Mine to Fort Belknap Reservation boundary	MT40I001_030	Aluminum	Metals	Aluminum TMDL completed	Yes
		Arsenic	Metals	Arsenic TMDL completed	Yes
		Cadmium	Metals	Cadmium TMDL completed	Yes
		Iron	Metals	Iron TMDL completed	No
		Nickel	Metals	Nickel TMDL completed	Yes
		Zinc	Metals	Zinc TMDL completed	Yes
KING CREEK , headwaters to Fort Belknap Reservation boundary	MT40I001_040	Arsenic	Metals	Arsenic TMDL completed	No
		Cadmium	Metals	Cadmium TMDL completed	No
		Selenium	Metals	Selenium, TMDL completed	Yes
LODGE POLE CREEK , headwaters to Fort Belknap Reservation boundary	MT40I001_050	Cadmium	Metals	Cadmium TMDL completed	Yes
		Mercury	Metals	Cadmium TMDL completed	Yes
MILL GULCH , headwaters to mouth (Rock Creek)	MT40E002_100	Copper	Metals	Copper TMDL completed	Yes
		Mercury	Metals	Mercury TMDL completed	Yes
		Selenium	Metals	Selenium TMDL completed	Yes
		pH	pH/Acidity/Caustic Conditions	Addressed by Cu TMDL as a surrogate	Yes

Table 1-1. Water quality impairment causes for the Landusky TPA addressed within this document

Waterbody & Location Description^a	Waterbody ID	Impairment Cause	Pollutant Category	Impairment Cause Status	Included in 2010 Integrated Report^{ab}
MONTANA GULCH , headwaters to mouth (Rock Creek)	MT40E002_010	Aluminum	Metals	Aluminum TMDL Completed	No
		Arsenic	Metals	Arsenic TMDL completed	No
		Cadmium	Metals	Cadmium TMDL completed	Yes
		Cyanide	Toxin	Cyanide TMDL completed	No
		Nickel	Metals	Nickel TMDL completed	No
		Selenium	Metals	Selenium TMDL completed	No
		Zinc	Metals	Zinc TMDL completed	No
		pH	pH/Acidity/Caustic Conditions	Addressed by Cd TMDL as a surrogate	Yes
ROCK CREEK , headwaters to mouth (Missouri River)	MT40E002_090	Cadmium	Metals	Cadmium TMDL completed	Yes
		Copper	Metals	Copper TMDL completed	Yes
		Mercury	Metals	Mercury TMDL completed	Yes
		Lead	Metals	Lead TMDL completed	Yes
		Selenium	Metals	Selenium TMDL completed	Yes
		Zinc	Metals	Zinc TMDL completed	Yes
		pH	pH/Acidity/Caustic Conditions	Addressed by Cd TMDL as a surrogate	Yes
RUBY CREEK , un-named tributary T25N R25E S21 to mouth (CK Creek)	MT40E002_060	Aluminum	Metals	Aluminum TMDL completed	Yes
		Cadmium	Metals	Cadmium TMDL completed	Yes
		Copper	Metals	Cooper TMDL completed	Yes
		Mercury	Metals	Mercury TMDL completed	Yes
		Lead	Metals	Lead TMDL completed	Yes
		Selenium	Metals	Selenium TMDL completed	Yes
		Zinc	Metals	Zinc TMDL completed	Yes
		pH	pH/Acidity/Caustic Conditions	Addressed by Cd TMDL as a surrogate	Yes
RUBY GULCH , headwaters to confluence of Alder Gulch	MT40E002_070	Aluminum	Metals	Aluminum TMDL completed	No
		Cadmium	Metals	Cadmium TMDL completed	Yes
		Cyanide	Toxin	Cyanide TMDL completed	No
		Chromium	Metals	Chromium TMDL completed	Yes
		Lead	Metals	Lead TMDL completed	Yes
		Mercury	Metal	Mercury TMDL complete	Yes
		Selenium	Metals	Selenium TMDL completed	Yes
		Zinc	Metals	Zinc TMDL completed	Yes
		pH	pH/Acidity/Caustic Conditions	Addressed by Cd TMDL as a surrogate	Yes

Table 1-1. Water quality impairment causes for the Landusky TPA addressed within this document

Waterbody & Location Description^a	Waterbody ID	Impairment Cause	Pollutant Category	Impairment Cause Status	Included in 2010 Integrated Report^{ab}
SULLIVAN CREEK, headwaters to mouth (Rock Creek)	MT40E002_110	Cadmium	Metals	Cadmium TMDL completed	No
		Lead	Metals	Lead TMDL completed	No
		Iron	Metals	Iron TMDL completed	No
		Selenium	Metals	Selenium TMDL completed	No
		Zinc	Metals	Zinc TMDL completed	No
SWIFT GULCH CREEK, headwaters to mouth (South Big Horn Creek)	MT40I002_010	Aluminum	Metals	Aluminum TMDL completed	Yes
		Arsenic	Metals	Arsenic TMDL completed	Yes
		Cadmium	Metals	Cadmium TMDL completed	Yes
		Copper	Metals	Cadmium TMDL completed	Yes
		Cyanide	Toxin	Cyanide TMDL completed	Yes
		Iron	Metals	Iron TMDL completed	Yes
		Nickel	Metals	Nickel TMDL completed	Yes
		Thallium	Metals	Zinc TMDL completed	Yes
		Zinc	Metals	Zinc TMDL completed	Yes
pH	pH/Acidity/Caustic Conditions	Addressed by Cd TMDL as a surrogate	Yes		

^a All waterbody segments within the IR are indexed to the National Hydrography Dataset (NHD)

^{ab} Impairment causes not in the “2010 or draft 2012 Water Quality Integrated Report” were recently identified and will be included in the 2014 Integrated Report.

1.3 DOCUMENT LAYOUT

This document addresses all of the required components of a TMDL and includes a framework implementation and monitoring strategy. The TMDL components are summarized within the main body of the document. Additional technical details are contained in the appendices. In addition to this introductory section, this document includes:

Section 2.0 Landusky TMDL planning area description:

Describes the physical characteristics and social profile of the watershed.

Section 3.0 Montana Water Quality Standards

Discusses the water quality standards that apply to the Landusky TPA.

Section 4.0 Defining TMDLs and Their Components

Defines the components of TMDLs and how each is developed.

Sections 5.0 Metals TMDL Components

Each section includes (a) a discussion of the affected waterbodies and the pollutant's effect on designated beneficial uses, (b) the information sources and assessment methods used to evaluate stream health and pollutant source contributions, (c) water quality targets and existing water quality conditions, (d) the quantified pollutant loading from the identified sources, (e) the determined TMDL for each waterbody, (f) the allocations of the allowable pollutant load to the identified sources.

Section 6.0 Framework Water Quality Restoration Strategy:

Discusses water quality restoration objectives and presents a framework for implementing a strategy to meet the identified objectives and TMDLs.

Section 7.0 Monitoring Strategy and Adaptive Management:

Describes a water quality monitoring plan for evaluating the long-term effectiveness of the Landusky Metals TMDLs and Framework Water Quality Restoration Plan.

2.0 LANDUSKY PLANNING AREA DESCRIPTION

This report describes the physical, ecological, and cultural characteristics of the Rock Creek watershed and nearby areas in the uplands of the Little Rocky Mountains. The characterization establishes a context for impaired waters to support total maximum daily load (TMDL) planning. The area described is known as the Landusky TMDL Planning Area (TPA).

The Montana Department of Environmental Quality (DEQ) has identified 12 impaired (Category 5 and 4C) waterbodies within the Landusky TPA: Alder Gulch, Beaver Creek, South Big Horn Creek, King Creek, Lodge Pole Creek, Mill Gulch, Montana Gulch, Rock Creek, Ruby Creek, Ruby Gulch, Swift Gulch Creek, and Sullivan Creek. Sullivan Creek is classified Category 4C; the other streams are Category 5. The impairments are detailed in DEQ's Integrated 305(b)/303(d) Water Quality Report (Montana Department of Environmental Quality, Water Quality Planning Bureau, 2010), and are not discussed in this report. For the reader's convenience, listings extracted from the report are listed in **Table 3-1**. A total of 69.8 miles of streams in the TPA are listed as impaired. The map figures referenced in the following discussion are contained in **Appendix A**.

2.1 PHYSICAL PARAMETERS

2.1.1 Location

The Landusky TPA is within Phillips County. The total extent is 81,900 acres, or approximately 128 square miles. The TPA is located in the Middle Missouri Basin (Accounting Unit 100401) of central Montana, and within the Fort Peck Reservoir fourth-code watershed, as shown in **Appendix A, Figure A-1**. The TPA is coincident with the 1004010406 fifth-code watershed (Rock Creek), enlarged northward to include areas of the Little Rocky Mountains not located within the Fort Belknap Indian Reservation. **Figure 2-1** illustrates the northern half of the Landusky planning area, the locations of the towns of Zortman and Landusky, and the locations of impaired streams. The TPA is bounded by the drainage divides to the east, west, and south, and the boundary of the Fort Belknap Reservation to the north. Note that the listed segments of King Creek, South Big Horn Creek, Lodge Pole Creek, and Beaver Creek terminate at the Fort Belknap Reservation Boundary.

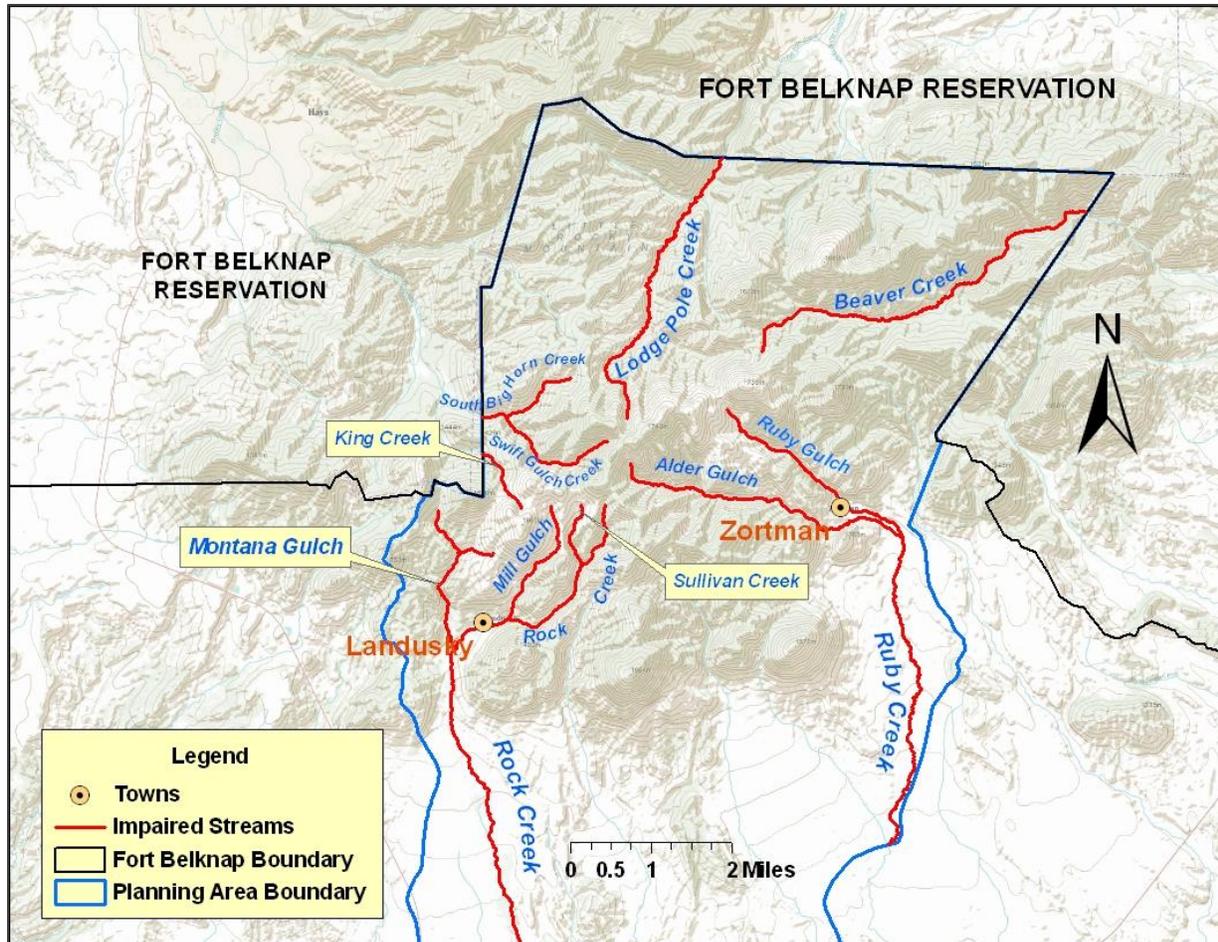


Figure 2-1. Map of the northern half of the Landusky TPA showing locations of impaired waters.

The TPA spans three Level III Ecoregions: Middle Rockies (17), Northwestern Glaciated Plains (42), and Northwestern Great Plains (43). Four Level IV Ecoregions are mapped within the TPA (Woods, et al., 2002), as shown on **Appendix A, Figure A-2**. These include: Foothill Grassland (42r), Glaciated Northern Grassland (42j), Missouri Breaks Woodland-Scrubland (43l), and Scattered Eastern Igneous-Core Mountains (17r).

2.1.2 Topography

Elevations in the Landusky TPA range from approximately 686 to 1,748 meters (2,250 – 5,733 feet) above mean sea level (**Appendix A, Figure A-3**). The lowest point is the confluence of Rock Creek and the Missouri River. The highest point is Antoine Butte, in the heart of the Little Rocky Mountains. The landscape is characterized by mountains, plains and badlands.

2.1.3 Geology

Appendix A, Figure A-4 provides an overview of the geology, based on a geologic map of the Zortman quadrangle (Porter and Wilde, 2001).

2.1.3.1 Bedrock

The bedrock of the TPA includes Precambrian (pre-Belt Series) metamorphic rocks, Paleozoic and Mesozoic sedimentary rocks, and Tertiary igneous rocks. Tertiary igneous rocks form the core of the Little Rocky Mountains, and their emplacement caused the surrounding rocks to deform into a dome around and over the intrusion. Later erosion stripped much of this rock away from the igneous rocks, leaving the older rocks exposed on the margins of the Little Rocky Mountains. The plains are dominated by Mesozoic sedimentary rocks, of which the Cretaceous section is the most aerially extensive. These rocks underlie wide expanses of the northern plains, including much of the Landusky TPA.

2.1.3.2 Recent Sediments

Older Tertiary and Quaternary alluvial sediments are present on dissected pediments surrounding the Little Rocky Mountains. More recent alluvial deposits are located within modern stream channels that are incised into the Cretaceous sedimentary rocks.

2.1.3.3 Soils

The USGS Water Resources Division (Schwarz and Alexander, 1995) created a dataset of hydrology-relevant soil attributes, based on the USDA Natural Resources Conservation Service (NRCS) STATSGO soil database. The STATSGO data are intended for small-scale (watershed or larger) mapping, and is too general to be used at scales larger than 1:250,000. It is important to realize, therefore, that each soil unit in the STATSGO data may include up to 21 soil components. Soil analysis at a larger scale should use NRCS SSURGO data. The soil attributes considered in this characterization are erodibility and slope. Soil erodibility is based on the Universal Soil Loss Equation (USLE) K-factor (Wischmeier and Smith, 1978). K-factor values range from 0 to 1, with a greater value corresponding to greater potential for erosion. Susceptibility to erosion is mapped on **Appendix A, Figure A-5**, with soil units assigned to the following ranges: low (0.0-0.2), moderate-low (0.2-0.29) and moderate-high (0.3-0.4). Values of >0.4 are considered highly susceptible to erosion. No values greater than 0.39 are mapped in the TPA. The majority of the TPA (70%) is mapped with moderate-low susceptibility soils. Nearly a third of the TPA is mapped with moderate-high susceptibility (29%) soils. Low susceptibility soils are mapped in less than 1% of the TPA. The entire area of the Little Rocky Mountains is mapped with moderate-low susceptibility soils.

Appendix A, Figure A-6, which shows slope interpreted from a 30-meter digital elevation model (DEM), illustrates that the TPA is characterized by three landscapes: mountains, plains and badlands. The mountains and to a lesser extent, the badlands, have locally steep slopes.

2.2 SURFACE WATER

The TPA includes the 5th code watershed 1004010406, and extends northward to the Fort Belknap Indian Reservation. The TPA therefore includes the headwaters of streams that radiate outward from the center of the Little Rocky Mountains into other watersheds (including the Milk River 4th code watershed to the north). Hydrography of the Landusky TPA is illustrated on **Appendix A, Figure A-7**. The National Hydrography Dataset (NHD) medium resolution data (U.S. Geological Survey, 1999) includes 123 miles of streams mapped in the TPA. This data is compiled at 1:100,000.

2.2.1 Stream Gaging Stations

The United States Geological Survey (USGS) formerly maintained one gaging station within the TPA, as detailed below in **Table 2-1**. The gaging station location is shown in **Appendix A, Figure A-7**.

Table 2-1. Stream Gage

Name	Number	Drainage Area	Agency	Period of Record
Rock Creek near Landusky, MT	06115350	72.9 miles ²	USGS	11/1999-9/2004

2.2.2 Stream Flow

Stream flow data are based on records from the USGS stream gage on Rock Creek near Landusky described above, and are available via the Internet from the USGS NWIS site (United States Department of the Interior, 2008). Flows in Rock Creek vary considerably over a calendar year. A hydrograph summarizing mean daily discharge at this station is shown below in **Figure 2-2**

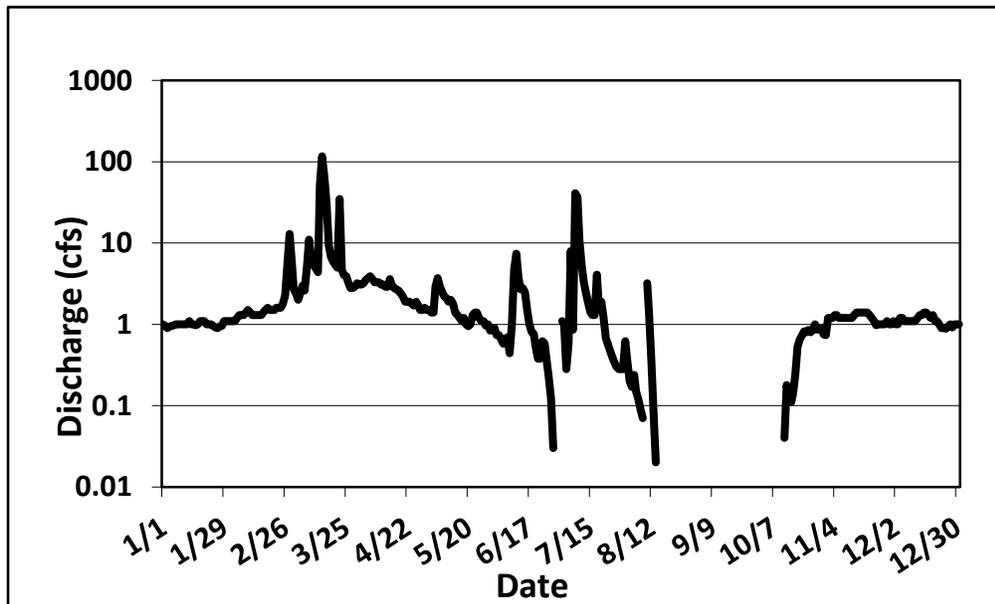


Figure 2-2. Mean daily discharge of Rock Creek at USGS Station 06115350 near Landusky, Montana

Flow is variable from year to year, but on average (over a 5-year period of record), peak flows occur in late winter (February-March) or in July. The highest recorded flow is 567 cubic feet per second (cfs) in March 2003, and probably represents a rain-on-snow event. Annual peaks have ranged from 567 cfs to 12 cfs (March 9, 2001).

Over the period of record, mean high flow occurs in March (13 cfs), and mean low flow occurs in September (0 cfs). Daily discharge data demonstrate that Rock Creek is commonly dry in late summer.

2.2.3 Surface Water Quality

Approximately 290 surface water monitoring stations occur within the TPA boundaries. About 105 of these are listed in the STORET water quality database maintained by the United States Environmental Protection Agency (EPA). The most inclusive water quality database for the planning area is that created and maintained by Spectrum Engineering, Inc. (2005). The database contains water quality analytical results and field measurements for surface and groundwater. It includes pre-mine baseline data, compliance monitoring during active mining by Zortman Mining, Inc. (ZMI), and post-mine reclamation monitoring by Spectrum field staff. **Appendix B** contains a subset of the entire Z-L ACCESS database used

to describe the existing surface water quality of listed streams. **Appendix C** contains water quality records for sites selected as representing natural background for surface waters.

Surface waters exhibit a wide range in chemical characteristics depending upon the degree of influence from mining sources and distance from the core of the Little Rockies range. Waters remote from mining disturbances are typically low in trace metal and dissolved solids and have a neutral pH. Waters affected by mining are high in dissolved solids, particularly sulfate, have elevated metals concentrations, and have pH values ranging from 3.0 to 9.0. Dissolved solids and pH values increase as streams flow from the Little Rocky Mountain uplands onto the surrounding sedimentary plains.

2.3 GROUNDWATER

2.3.1 Hydrogeology

No comprehensive hydrogeology study is available for the entire TPA. Osborne and Gallagher (2001) described the groundwater system within the Zortman and Landusky mine areas as part of the Final Supplemental Environmental Impact Statement (SEIS) prepared by the Bureau of Land Management (BLM) and DEQ (2001). The study described the groundwater flow paths as affected by geologic and mine features, described water balance and chemical mass loading processes, and presented a water quality classification system based on the degree of mine influence on groundwater quality. A groundwater flow divide occurs at the crest of the Little Rocky Mountains. Groundwater flow within the shallowest aquifer generally mimics surface water flows that radiate outward from the mountain core to the surrounding plains. Surface and groundwater flows south toward the Missouri River and north toward the Milk River from the highest elevations.

Natural groundwater recharge occurs from infiltration of precipitation and loss from stream channels. The extensive open pits, disturbed areas, and underground mine workings at both mine sites has likely increased the rate of groundwater recharge compared to pre-mine conditions (Osborne and Gallagher, 2001). Groundwater affected by bedrock mineralization and mining disturbance has acidic pH and elevated dissolved solids, including metals, compared to groundwaters outside of mineralized zones or mine disturbances.

2.3.2 Groundwater Quality

The Spectrum ACCESS database contains groundwater quality data from over 150 locations that include either wells or springs that were monitored at some point during mine operations. Because of the large datasets for individual sites, the chemistry of samples from wells RG-110 and ZL-136 is given in **Appendix D** to represent shallow aquifer conditions at the Zortman and Landusky mines respectively. The locations of these wells are shown in **Appendix A, Figure A-8**.

The water quality data include general physical parameters: temperature, pH and specific conductance, in addition to inorganic chemistry (common ions, metals and trace elements). Most of the mined rock contains sufficient sulfide minerals to produce acidity when exposed to oxygen and water. Therefore, elevated metals concentrations are common in groundwater. The use of blasting agents and cyanide for ore processing and fertilizers for reclamation have increased groundwater levels of nitrogen. Elevated selenium has resulted from accelerated rock weathering with mining and high selenium concentrations in clay materials used for leach pad liners.

The TPA has one public water supply well operated by the Zortman Water Users Association. This well is completed in the Paleozoic Madison Limestone aquifer. Pump test data from within the planning area indicate little connection between the shallow igneous bedrock aquifer and the deeper Paleozoic aquifer (Osborne and Gallagher, 2001). Water quality data is available for the Zortman well via the SDWIS State database (Montana Department of Environmental Quality, 2008), although these data reflect the finished water provided to the public, not raw water at the source.

2.4 CLIMATE

Climate in the area is typical of mountains and plains in north-central Montana. Precipitation is most abundant in May and June. Annual average precipitation ranges from 13-21 inches. The mountains receive most of the moisture, and the amount received decreases with elevation, with the least falling at the confluence with the Missouri River. The precipitation data (**Appendix A, Figure A-9**) is mapped by Oregon State University's PRISM Group, using records from NOAA stations (Prism Group, 2004).

See **Table 2-2** below for a climate summary; **Appendix A, Figure A-9** shows the distribution of average annual precipitation.

2.4.1 Climate Stations

National Oceanographic and Atmospheric Administration's (NOAA) National Weather Service operates one weather station in the TPA (Zortman). There are no USDA Natural Resources Conservation Service (NRCS) SNOTEL snowpack monitoring stations within the TPA.

Three additional climate monitoring stations are present: BLM remote automatic weather stations (RAWS). RAWS stations are primarily used to assess conditions related to fire hazard, and provide telemetry to the National Interagency Fire Center in Boise, Idaho. The RAWS stations in the TPA include: Zortman Mine (ALDM8); Lewistown Port #2 (TS705); and Manning Corral Dogtown (MCDM8). Climate data in **Table 2-2** are provided by the MesoWest program, operated by the University of Utah Meteorology Department, and by the Western Regional Climate Center, operated by the Desert Research Institute at the University of Nevada-Reno.

Table 2-2. Monthly Climate Summary: Zortman

Zortman, Montana (NOAA Station 249900) Period of Record : 9/1/1965 to 12/31/2005

	Jan	Feb	Mar	Apr	May	Jun	Jul	Aug	Sep	Oct	Nov	Dec	Annual
Ave. Max. Temp (F)	31.8	35.2	42.0	52.6	63.0	71.1	79.4	79.4	68.3	55.8	42.2	33.8	54.5
Ave. Min. Temp. (F)	9.7	12.5	19.7	29.0	37.7	45.8	50.8	50.2	40.7	30.7	20.3	12.3	29.9
Ave Tot. Precip. (in.)	0.87	0.53	0.91	1.61	2.96	3.91	2.13	1.78	1.59	0.88	0.48	0.77	18.42
Ave.. Snowfall (in.)	4.7	5.3	6.3	1.3	0.6	0.0	0.0	0.0	0.0	0.3	3.2	5.3	27.0
Ave Snow Depth (in.)	4	4	2	0	0	0	0	0	0	0	1	2	1

2.5 ECOLOGICAL PARAMETERS

2.5.1 Vegetation

The majority of the land cover in the TPA (55%) is grassland/herbaceous. This area corresponds generally to the plains. The Little Rocky Mountains are mostly covered in evergreen forest (28.5% of the total area). Shrubland occupies 10.2% of the total, and deciduous forest 2.3%. Open mines account for 1.9% of the total area. Conifers are dominated by Lodgepole pine, giving way to Ponderosa pine at lower

elevations, with lesser amounts of Douglas fir, White pine, and juniper. Landcover is shown in **Appendix A, Figure A-10**. Data sources include the University of Montana’s Satellite Imagery Land Cover (SILC) project (University of Montana, 2002), and USGS National Land Cover Dataset (NLCD) mapping (Montana State Library, 1992).

2.5.2 Aquatic Life

Fish are reported in only four streams in the TPA: Beaver Creek, Lodge Pole Creek, Montana Gulch and Rock Creek. Fish in Rock Creek are limited to a one-mile section of the lower reach (Montana Department of Fish, Wildlife, and Parks 2011). Native fish species present in the TPA include: bigmouth buffalo, brassy minnow, brook stickleback, emerald shiner, fathead minnow, flathead chub, goldeye, Iowa darter, lake chub, longnose dace, mountain sucker, northern redbelly dace, river carpsucker, shorthead redhorse, smallmouth buffalo, western silvery/plains minnow, and white sucker.

Introduced species are also present, including: black bullhead, bluegill, brook trout, common carp, northern pike, pumpkinseed, smallmouth bass, walleye and yellow perch. Data on fish species distribution are collected, maintained and provided by FWP (2011). Fish species distribution data is shown simply in **Appendix A, Figure A-11** and tabulated in detail in **Appendix E**.

2.5.3 Fires

Fire has played significant economic and ecological roles in the mountainous portion of the planning area. There was a lull in mining activity when the Ruby Gulch Mill burned down in 1913. Fires swept through the mining town of Zortman in 1929 and again in 1944. A substantial area of the Little Rocky Mountains was burned in a 1936 forest fire. Smaller fires burned additional forest lands in 1984 and 1988.

2.6 CULTURAL PARAMETERS

2.6.1 Population

An estimated 98 persons lived within the TPA in 2000 (Montana Department of Natural Resources and Conservation, 2008). Population estimates are derived from census data (United States Census Bureau, 2000), based upon the populations reported from census blocks within and intersecting the TPA boundary. Populations from Landusky and Zortman are not reported in the 2000 census, either as towns or census designated places (CDPs). Census data are mapped in **Appendix A, Figure A-12**. Much of the TPA is unpopulated. The Landusky TPA does not include the area within the Fort Belknap Reservation.

Beaver Creek, King Creek, Lodge Pole Creek, and South Big Horn Creek flow from the crest of the Little Rocky Mountains, northward onto the Fort Belknap Indian Reservation. The reservation community of Hays is about six miles downstream of the Landusky planning area boundary on Little Peoples Creek; the community of Lodge Pole is four miles below the planning area boundary on Lodge Pole Creek. The resident population of the Fort Belknap Reservation is approximately 5,000. The effects of mine-related ARD occur in South Big Horn Creek below the reservation boundary. The influence of mining on Lodge Pole Creek water quality at the reservation boundary is less clear.

2.7 TRANSPORTATION NETWORKS

2.7.1 Roads

The TPA is bisected by US Route 191. The TPA contains a network of unpaved roads on public and private lands.

2.7.2 Railroads

No active or historic railways are present in the TPA.

2.8 LAND OWNERSHIP

Land ownership data (Table 2-3) are provided by the State of Montana CAMA database via the NRIS website (Montana Department of Natural Resources and Conservation, 2008). Slightly more than one-half of the TPA is administered by the US Bureau of Land Management, and 15% by the US Fish & Wildlife Service. Private lands comprise 23% of the TPA. Montana State Trust Lands occupy 4.5% of the TPA. Land ownership is shown in **Appendix A, Figure A-13**.

Table 2-3. Land Ownership

Owner	Acres	Square Miles	% of Total
US Bureau of Land Management	45,931	71.77	56%
Private	19,240	30.06	23%
US Fish & Wildlife Service	12,584	19.66	15%
Montana State Trust Land	3,701	5.78	4%
Bureau of Indian Affairs Trust Land	373	0.58	0.5%
Total	81,911*	127.99	—

*includes 83 acres of water

2.9 LAND USE & COVER

Land use within the TPA (Table 2-4) is dominated by forest and agriculture. Agricultural use in the lowlands is primarily livestock grazing. Information on land use is based on land use and land cover (LULC) mapping completed by the USGS in the 1980s. The data are at 1:250,000 scale, and are based upon manual interpretation of aerial photographs. Agricultural land use is illustrated in **Appendix A, Figure A-14**. Potential sources of human impacts (abandoned mines, timber harvest, livestock feeding areas) are illustrated in **Appendix A, Figure A-15**.

Table 2-4. Land Use and Cover

Land Use	Acres	Square Miles	% of Total
Grasslands/Herbaceous	44,819.6	70.0	54.73%
Evergreen Forest	23,323.1	36.4	28.48%
Shrubland	8,337.5	13.0	10.18%
Deciduous Forest	1,855.7	2.9	2.27%
Quarries/Strip Mines/Gravel Pits	1,578.3	2.5	1.93%
Bare Rock/Sand/Clay	1,064.3	1.7	1.30%
Small Grains	264.7	0.4	0.32%
Open Water	165.8	0.3	0.20%
Mixed Forest	147.5	0.2	0.18%
Pasture/Hay	125.1	0.2	0.15%
Commercial/Industrial/Transportation	103.3	0.2	0.13%

Table 2-4. Land Use and Cover

Land Use	Acres	Square Miles	% of Total
Fallow	101.7	0.2	0.12%
Row Crops	4.8	0.0	0.01%
Woody Wetlands	4.0	0.0	0.00%
Emergent Herbaceous Wetlands	3.3	0.0	0.00%

Additional information on agricultural land use can be obtained from Department of Revenue data. The Department of Revenue assigns a predominant agricultural use only if more than 50% of a given parcel is so used, and then the entire acreage is ascribed to that use. A total of 144 acres of irrigated land is reported in the TPA. The dominant designated agricultural use is grazing, corresponding to 17,685 acres (28 square miles) or 22% of the TPA area (Montana Department of Natural Resources and Conservation, 2008).

2.9.1 Mining

Until recently, mining was a major portion of the economy in the TPA. Waste rock and tailings are still present in many locations. Production began later than many other Montana districts. Gold-bearing placers were first widely discovered in 1884. Lode deposits were first worked in 1890 (Montana Department of Environmental Quality, 2011).

2.9.1.1 Historic Mining Activity

Like many mining districts, The Little Rockies district experienced several periods of intense activity separated by relative lulls. Lode mines were especially active in the early 1890s, 1903-1912, and during the 1930s.

DEQ Remediation Division data on abandoned mine locations are plotted in **Appendix A, Figure A-15**.
Modern Activity

Two large open pit gold mines operated from 1979 to 1998. The Zortman mine permit included 406 acres (**Figure A-16**), and the Landusky permit included 783 acres (**Figure A-17**) (Mitchell, 2004). Exposure of sulfide ores and associated tailings caused acid rock drainage (ARD) issues, and several leaks from the cyanide leach pits were documented.

2.9.2 Timber Harvests

No maps of timber harvests were identified. The ‘transitional’ classification in NLCD is commonly applied to harvested or burned areas, and this classification is not mapped in the TPA.

2.9.3 Livestock Operations

The Montana Pollution Discharge Elimination System (MPDES) does not report any regulated concentrated animal feeding operations (CAFOs) within the TPA.

2.10 WASTEWATER

Facilities treating ARD affected water with hydrated lime are located at the Landusky Mine, the Zortman Mine, and on Swift Gulch Creek. A separate biological treatment plant at the Landusky Mine removes cyanide, nitrates, and selenium from leach pad seepage.

The metals concentrations in untreated water reporting to the Zortman and Landusky treatment plants are generally several orders of magnitude higher than the applicable water quality standards. Although the reduction in metal concentrations with treatment is substantial at both plants, the treated effluent commonly exceeds standards for several parameters. **Figure 2-3** illustrates the metal concentrations in influent and effluent from the plants since 2003, compared to water quality standards.

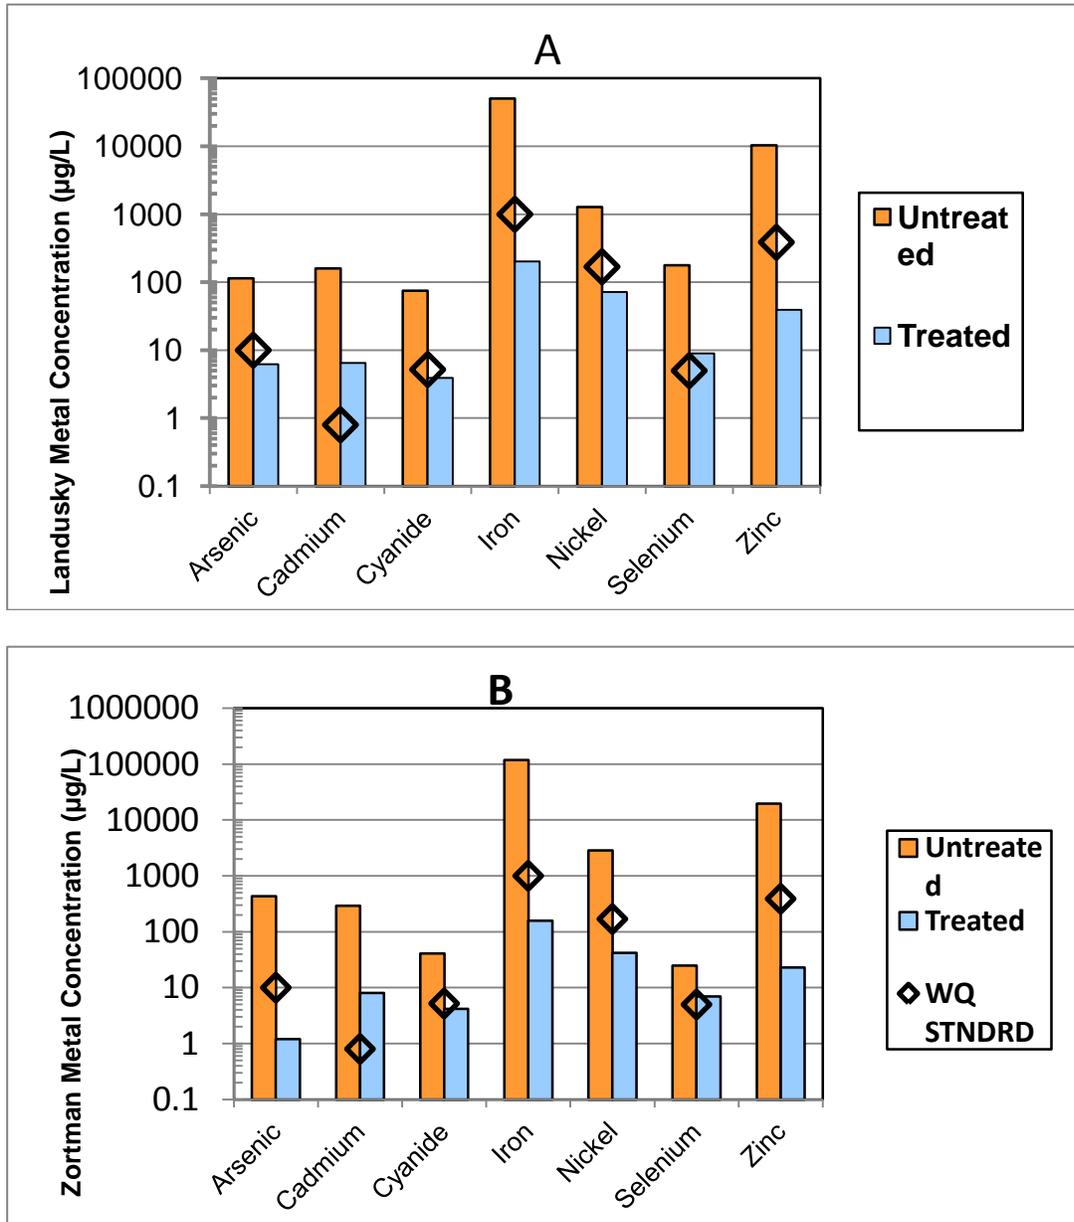


Figure 2-3. Metals and cyanide concentrations in untreated and treated wastewater at the Landusky (A) and Zortman (B) treatment plants

Average removal for the Landusky plant is 96 percent, compared to 94 percent at Zortman. Despite the high level of treatment, the treated effluent commonly exceeds water quality standards for cadmium and selenium. Considering the logarithmic scale of the **Figure 2-3** graphs, treatment interruptions or

bypasses caused by damaged or malfunctioning treatment system components causes extremely high metals loading to receiving waters.

The plant at Zortman treats an annual average of about 70 million gallons of wastewater collected from three drainage capture systems. The Landusky plant treats an annual average of about 225 million gallons from four drainage capture systems, a historic mine adit discharge, an artesian well, and leach pad drainage.

The Swift Gulch Creek plant operated from June through November of 2010, treating water from two upstream capture systems. The plant capacity ranges from 50 to 100 gallons per minute. **Figure 2-4** contains bar graphs of cadmium and zinc concentrations in Swift Gulch Creek at site L-19, located upstream of the capture systems, and site L-49, located downstream of the treatment plant discharge.

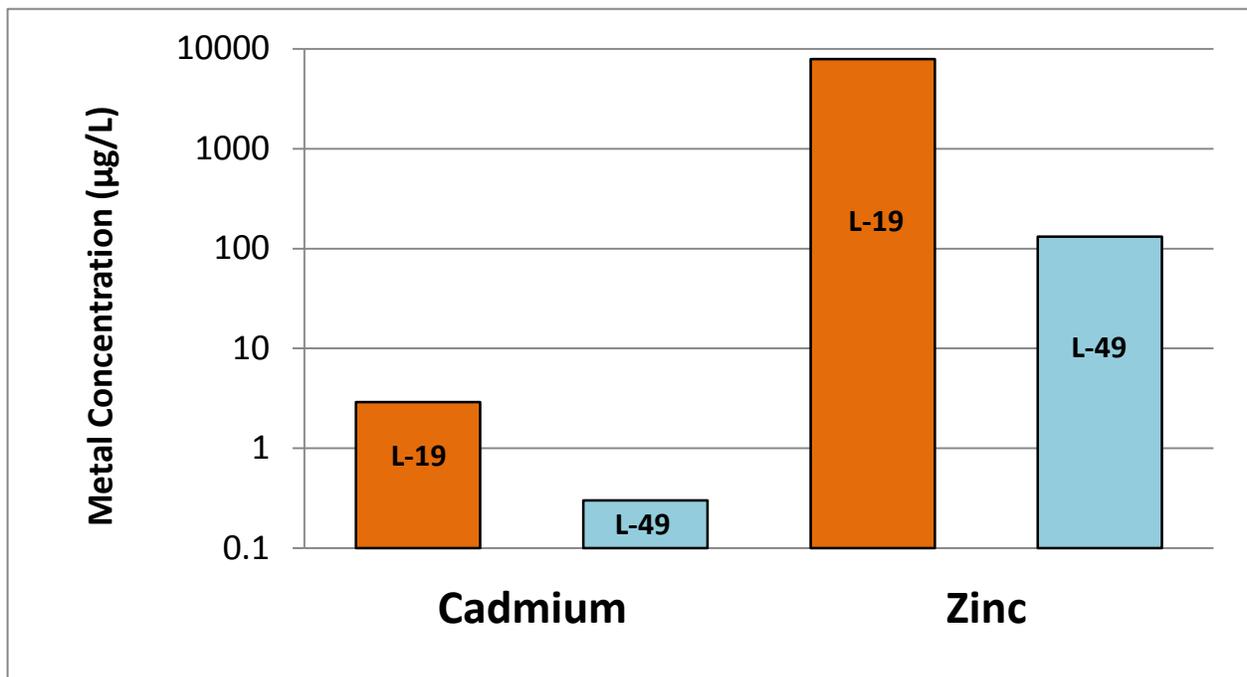


Figure 2-4. Median June through August cadmium and zinc concentrations in Swift Gulch Creek at sites upstream (L-19) and downstream (L-49) of the treatment plant during 2010.

The graphs depict a 90 percent reduction in cadmium and a 98 percent reduction in zinc concentration. Plant operation was shut down because of extreme Swift Gulch Creek flows during May of 2011 that destroyed both capture systems. Plant operation is planned to resume after capture system repairs.

There are no MPDES regulated discharges within the TPA. Since June of 2004, reclamation and water treatment have occurred under authority of the federal Comprehensive Environmental Response, Compensation and Liability Act (CERCLA). The current Engineering Evaluation and Cost Analysis (Spectrum Engineering, Inc., 2006) assumes that perpetual operation of the treatment plants is needed to minimize environmental damage and prevent exposure to toxic metal concentrations from untreated mine discharges.

Neither Zortman nor Landusky have centralized domestic sewage treatment. Domestic wastewater treatment is provided by on-site septic tanks and drainfields (Spectrum Engineering, Inc., 2006). Septic

system density is estimated from the 2000 census block data, based on the assumption of one septic tank and drainfield for each 2.5 persons (Montana Department of Natural Resources and Conservation, 2008), and that sewer systems correspond to incorporated communities. Septic system density is classified as low (<50 per square mile), moderate (51-300 per square mile) or high (>300 per square mile). Nearly all of the TPA is mapped as low septic system density, with very limited areas of moderate (35 acres) density. The moderate density locations are found in Zortman. Septic system density is illustrated in **Appendix A, Figure A-15**.

3.0 TMDL REGULATORY FRAMEWORK

3.1 TMDL DEVELOPMENT REQUIREMENTS

Section 303(d) of the Federal Clean Water Act (CWA) requires that states identify waterbodies within its boundaries that do not meet water quality standards. Montana tracks waterbodies that do not meet water quality standards within a biennial report, referred to as a Montana's Water Quality Integrated Report. Montana applies a consistent methodology for assessing whether or not a waterbody is meeting all applicable water quality standards. An updated assessment method for evaluating water quality standards for metals is identified in The Montana Department of Environmental Quality Metals Assessment Method (Montana Department of Environmental Quality, 2011).

Under Montana State Law, an "impaired waterbody" is defined as a waterbody or stream segment for which sufficient credible data (Montana Department of Environmental Quality, 2011) show that the waterbody or stream segment is failing to achieve compliance with applicable water quality standards (Montana Water Quality Act; Section 75-5-103(11)). A threatened waterbody is also defined within state law. There are 12 waterbodies identified as impaired in the Landusky TMDL planning area (TPA). No waterbodies are identified as threatened. To satisfy Montana State Law and the Federal Clean Water Act, TMDLs are developed for each waterbody-pollutant combination identified on the state's list of impaired or threatened waters. Montana State law also requires that DEQ periodically review TMD implementation as part of an adaptive management approach.

3.2 WATERBODIES AND POLLUTANTS OF CONCERN

Metals, pH, and cyanide causes of impairment in the Landusky TPA that appeared on the 2010 list are addressed in this document. TMDLs were not prepared where an updated assessment of available data suggests that the initial impairment determination was inaccurate, or where conditions have improved since the initial impairment determination to the extent that it is apparent that the pollutant no longer impairs a beneficial use. Where a pollutant cause of impairment is recommended for removal from the list of impaired waterbodies, justification is provided within this document.

DEQ describes impairment as either partially supporting or not supporting, based on assessment results. Not supporting is applied to all situations where a drinking water standard is not met, and is also applied to conditions where the assessment results indicate a severe level of impairment of aquatic life or fishery. All other impairment situations default to partially supporting. A non-supporting level of impairment does not equate to complete elimination of the use.

Table 3-1 provides a summary of waterbody beneficial use support status from the 2010 303(d) List for the Landusky TPA, along with updates that will be reflected on a future 303(d) list. Specific probable causes of impairment for each of the impaired waterbodies are found in **Table 1-1**, in **Section 1**.

Table 3-1. Landusky impaired waterbody segments and beneficial use support status

Waterbody & Stream Description	Waterbody #	Use Class	Aquatic Life	Fisheries - Cold	Fisheries - Warm	Drinking Water	Primary Contact (Recreation)	Agriculture	Industry
Alder Gulch , headwaters to mouth (Ruby Creek)	MT40E002_050	C-3	N	NA	N	N*	X	X	X
Beaver Creek , headwaters to Fort Belknap Reservation Boundary	MT40M001_011	B-3	N	NA	N	F	F	F	F
South Big Horn Creek , Zortman Mine to Fort Belknap Reservation Boundary	MT40I001_030	B-1	N	N	NA	N	X	F	F
King Creek , headwaters to Fort Belknap Reservation Boundary	MT40I001_040	B-1	N	N	NA	F	X	F	F
Lodge Pole Creek , headwaters to Fort Belknap Reservation Boundary	MT40I001_050	B-1	N	N	NA	N	X	F	F
Mill Gulch , headwaters to mouth (Rock Creek)	MT40E002_100	C-3	P	NA	P	N	P	P	P
Montana Gulch , headwaters to mouth (Rock Creek)	MT40E002_010	C-3	N	NA	N	N*	X	X	X
Rock Creek , headwaters to mouth (Missouri River)	MT40E002_090	C-3	P	NA	P	N*	P	X	X
Ruby Creek , un-named tributary T25N R25E S21 to mouth (CK Creek)	MT40E002_060	C-3	N	NA	N	N*	X	X	X
Ruby Gulch , headwaters to confluence of Alder Gulch	MT40E002_070	C-3	N	NA	N	N*	X	X	X
Sullivan Creek , headwaters to mouth (Rock Creek)	MT40E002_110	C-3	N	NA	N	N*	N	X	X
Swift Gulch Creek , headwaters to mouth (South Big Horn Creek)	MT40I002_010	B-1	N	N	NA	N	F	F	F

Legend: F= Full Support; P= Partial Support; N= Not Supported; T= Threatened; X= Not Assessed (Insufficient Credible Data)

* Newly identified use impairment based on Landusky TMDL development and related analyses

Impairment status and impairment list reviews are provided for each waterbody in **Section 5.0** of this document.

3.3 APPLICABLE WATER QUALITY STANDARDS

Water quality standards include: the uses designated for a waterbody, the legally enforceable standards that ensure that the uses are supported, and a nondegradation policy that protects the high quality of a waterbody. The ultimate goal of this water quality restoration plan, once implemented, is to ensure that all designated beneficial uses are fully supported and all standards are met. Water quality standards form the basis for the targets described in **Sections 5**. Pollutants addressed in this Water Quality Restoration Plan include: metals, cyanide, and pH. This section provides a summary of the applicable water quality standards for each of these pollutants.

3.3.1 Classification and Beneficial Uses

Classification is the assignment (designation) of a single or group of uses to a waterbody based on the potential of the waterbody to support those uses. Designated Uses or Beneficial Uses are simple

narrative descriptions of water quality expectations or water quality goals. The variety of “uses” of state waters includes: growth and propagation of fish and associated aquatic life; drinking water; agriculture; industrial supply; recreation, and wildlife. The Montana Water Quality Act (WQA) directs the Board of Environmental Review (BER, i.e., the state) to establish a classification system for all waters of the state that includes their present (when the Act was originally written) and future most beneficial uses (Administrative Rules of Montana (ARM) 17.30.607-616), and to adopt standards to protect those uses (ARM 17.30.620-670).

Montana, unlike many other states, uses a watershed based classification system with some specific exceptions. As a result, *all* waters of the state are classified and have designated uses and supporting standards. All classifications include multiple uses and in only one case (A-Closed) is a specific use (drinking water) given preference over the other designated uses. Some waters may not actually be used for a specific designated use, for example as a public drinking water supply; however, the quality of that waterbody must be maintained suitable for that designated use. When natural conditions limit or preclude a designated use, permitted point source discharges or nonpoint source discharges may not make the natural conditions worse.

Modification of classifications or standards that would lower a water’s classification or a standard (i.e., B-1 to a B-3), or removal of a designated use because of natural conditions can only occur if the water was originally mis-classified. All such modifications must be approved by the BER, and are undertaken via a Use Attainability Analysis (UAA) that must meet U.S. EPA requirements (40 CFR 131.10(g), (h) and (j)). The UAA and findings presented to the BER during rulemaking must prove that the modification is correct and all existing uses are supported. An existing use cannot be removed or made less stringent.

The streams or stream segments addressed in this document include designations as B-1, B-3 or C-3. A description of Montana’s applicable surface water classifications and designated beneficial uses for streams in the Landusky TPA are presented in **Table 3-2**.

Table 3-2. Montana Surface Water Classifications and Designated Beneficial Uses Applicable to the Landusky TPA

Classification	Designated Uses
B-1 CLASSIFICATION:	Waters classified B-1 are to be maintained suitable for drinking, culinary and food processing purposes after conventional treatment; bathing, swimming and recreation; growth and propagation of salmonid fishes and associated aquatic life, waterfowl and furbearers; and agricultural and industrial water supply.
B-3 CLASSIFICATION:	Waters classified B-3 are to be maintained suitable for drinking, culinary and food processing purposes after conventional treatment; bathing, swimming and recreation; growth and propagation of non-salmonid fishes and associated aquatic life, waterfowl and furbearers; and agricultural and industrial water supply.
C-3 CLASSIFICATION:	Waters classified C-3 are to be maintained suitable for bathing, swimming and recreation; growth and propagation of non-salmonid fishes and associated aquatic life, waterfowl and furbearers. The quality of these waters is naturally marginal for drinking, culinary, and food processing purposes, agriculture, and industrial water supply. Degradation which will impact established beneficial uses will not be allowed.

Several planning area streams are classified as C-3. The C-3 use support description in **Table 3-2** specifies that these waters “are to be maintained suitable” for bathing, swimming, recreation, growth and propagation of non-salmonid fishes and associated aquatic life, waterfowl, and furbearers. Although the C-3 classification states that these waters are naturally marginal for drinking, culinary, food processing,

agriculture, and industrial purposes, these uses remain as designated uses for C-3 waters. In spite of the naturally marginal condition for some uses, designated and established uses are to be protected. TMDLs are written to protect all designated and established uses for a waterbody and not just those identified as being non or partially supported. All metals TMDLs are calculated using the most stringent target value, which ensures that the TMDLs are protective of all designated and established beneficial uses.

3.3.2 Standards

In addition to the Use Classifications described above, Montana’s water quality standards include numeric and narrative criteria as well as a nondegradation policy.

Numeric surface water quality standards have been developed for many parameters to protect human health and aquatic life. These standards are in the Department Circular DEQ-7 (Montana Department of Environmental Quality, 2010a). The numeric human health standards have been developed for parameters determined to be toxic, carcinogenic, or harmful and have been established at levels to be protective of long-term (i.e., lifelong) exposure by water consumption, as well as through direct contact such as swimming.

The numeric aquatic life standards include chronic and acute values that are based on extensive laboratory studies that include a wide variety of potentially affected species, a variety of life stages and durations of exposure. Chronic aquatic life standards are protective of long-term exposure to a parameter. The protection afforded by the chronic standards includes detrimental effects to reproduction, early life stage survival and growth rates. In most cases the chronic standard is more stringent than the corresponding acute standard. Acute aquatic life standards are protective of short-term exposures to a parameter and are not to be exceeded.

High quality waters are afforded an additional level of protection by the nondegradation rules (ARM 17.30.701 et. seq.) and in statute (75-5-303 MCA). Changes in water quality must be “non-significant” or an authorization to degrade must be granted by the Department. However under no circumstance may standards be exceeded. It is important to note that, waters that meet or are of better quality than a standard are high quality for that parameter, and nondegradation policies apply to new or increased discharges to that the waterbody.

Narrative standards have been developed for substances or conditions for which sufficient information does not exist to develop specific numeric standards. The term “Narrative Standards” commonly refers to the General Prohibitions in ARM 17.30.637 and other descriptive portions of the surface water quality standards. The General Prohibitions are also called the “free from” standards; that is, the surface waters of the state must be free from substances attributable to discharges that impair the beneficial uses of a waterbody. Uses may be impaired by toxic or harmful conditions (from one or a combination of parameters) or conditions that produce undesirable aquatic life. Undesirable aquatic life includes bacteria, fungi and algae.

The standards applicable to the list of pollutants addressed in this document are summarized below.

Metals and Cyanide

Numeric standards for water column metals and cyanide in Montana include specific standards for the protection of both aquatic life and human health. Acute and chronic criteria have been established for the protection of aquatic life. The criteria for some metals vary according to the hardness of the water. Examples of the applicable numeric metals standards for aquatic life and human health used as targets

for the metals of concern in the Landusky TPA are presented in **Table 3-3**. Actual standards for aquatic life at any given hardness are calculated using **Equation 3-1** and the coefficients in **Table 3-4**. The actual standards based on measured hardness values, rather than the examples in **Table 3-4**, are used as targets in this document to determine standards exceedances for hardness dependent metals. Existing data indicates that metals other than those in **Table 3-3** are below water quality standards and thus do not cause impairment.

Recent studies have indicated that in some streams metals concentrations may vary through out the day because of diel pH and alkalinity changes. In some cases the variation can cross the standard threshold (both ways) for a metal. Montana water quality standards are not time of day dependent.

Table 3-3. Montana Numeric Surface Water Quality Standards Guide for Metals and Cyanide.

Parameter	Aquatic Life (acute) ($\mu\text{g/L}$) ^a	Aquatic Life (chronic) ($\mu\text{g/L}$) ^b	Human Health ($\mu\text{g/L}$) ^a
Aluminum (DIS)	750	87	---
Arsenic (TR)	340	150	10
Cadmium (TR) ^c	0.52 @ 25 mg/l hardness	0.097 @ 25 mg/l hardness	5
Chromium (TR) ^c	---	---	100
Copper (TR) ^c	3.79 @ 25 mg/l hardness	2.85 @ 25 mg/l hardness	1,300
Cyanide (TR)	22	5.2	140
Mercury (TR)	0.91	1.7	0.05
Iron (TR) ^d	---	1,000	300 ^d
Lead (TR) ^c	13.98 @ 25 mg/l hardness	0.545 @ 25 mg/l hardness	15
Manganese (TR) ^e	---	---	50
Nickle (TR)	145.21 @ 25 mg/l hardness	16.14 @ 25 mg/l hardness	100
Selenium (TR)	20	5	50
Thallium (TR)	---	---	0.24
Zinc (TR) ^c	37 @ 25 mg/l hardness	37 @ 25 mg/l hardness	2,000

^a Maximum allowable concentration.

^b No 4-day (96-hour) or longer period average concentration may exceed these values.

^c Standard is dependent on the hardness of the water, measured as the concentration of CaCO_3 (mg/L) (see **Table 3-5** for the coefficients to calculate the standard).

^d The concentration of iron must not reach values that interfere with the uses specified in the surface and groundwater standards (17.30.601 et seq. and 17.30.1001 et seq.) The Secondary Maximum Contaminant Level (listed) is based on aesthetic properties such as taste, odor, and staining may be considered as guidance to determine the levels that will interfere with the specified uses.

^e The concentration of manganese must not reach values that interfere with the uses specified in the surface and groundwater standards (17.30.601 et seq. and 17.30.1001 et seq.) The Secondary Maximum Contaminant Level (listed) is based on aesthetic properties such as taste, odor, and staining may be considered as guidance to determine the levels that will interfere with the specified uses.

Note: TR – total recoverable, DIS - Dissolved.

Hardness-based standards for aquatic criteria are calculated using the following equation and are used for determining impairment:

Equation 3-1.

Criteria = $\exp. \{mc[\ln(\text{hardness})]+bc\}$ where mc and bc are values from **Table 3-4**

Table 3-4. Coefficients for Calculating Metals Freshwater Aquatic Life Standards (Montana Department of Environmental Quality, 2010a).

Parameter	ma (acute)	ba (acute)	mc (chronic)	bc (chronic)
Cadmium	1.0166	-3.924	0.7409	-4.719
Copper	0.9422	-1.700	0.8545	-1.702
Lead	1.273	-1.46	1.273	-4.705
Nickel	0.846	2.255	0.846	0.0584
Zinc	0.8473	0.884	0.8473	0.884

Note: If hardness is <25 mg/L as CaCO₃, 25 must be used for the hardness value in the calculation. If hardness is equal or greater than 400 mg/L as CaCO₃, 400 mg/L must be used for the hardness value.

pH

Waterbodies impaired by metals are also sometimes impaired by pH as a result of acid mine drainage. For human health, changes in pH are addressed by the general narrative criteria in ARM 17.30.601 et seq. and ARM 17.30.1001 et seq. For aquatic life, which can be sensitive to small pH changes, criteria are specified for each waterbody use classification. For B-1 waters, ARM 17.30.623 (2)(c) states “Induced variation of hydrogen ion concentration (pH) within the range of 6.5 to 8.5 must be less than 0.5 pH unit.” Respectively for B-3 and C-3 waters, ARM 17.30.625 (2)(c) and ARM 17.30.629 (2)(c) state “Induced variation of hydrogen ion concentration (pH) within the range of 6.5 to 9.0 must be less than 0.5 pH unit.” “Natural pH outside these ranges must be maintained without change. Natural pH above 7.0 must be maintained above 7.0.”

4.0 DESCRIPTION OF TMDL COMPONENTS

A TMDL is the pollutant loading capacity for a particular waterbody and refers to the maximum amount of a pollutant a stream or lake can receive and still meet water quality standards. Therefore, when a TMDL is exceeded, the waterbody will be impaired.

More specifically, a TMDL is the sum of the allowable loading from all sources to the waterbody. These loads are applied to individual sources or categories of sources as a logical method to allocate water quality protection responsibilities and overall loading limits within the contributing watershed(s). The allocated loads are referred to as waste load allocations (WLAs) for point sources and load allocations (LAs) for nonpoint sources. Natural background loading is considered a type of nonpoint source and therefore represents a specific load allocation. In addition, the TMDL includes a Margin of Safety (MOS) that accounts for the uncertainty in the relationship between pollutant loads and the quality of the receiving stream. The inclusion of a MOS results in less load allocated to one or more WLAs or LAs to help ensure attainment of water quality standards.

TMDLs are expressed by the following equation which incorporates the above components:

$$\text{TMDL} = \Sigma\text{WLA} + \Sigma\text{LA} + \text{MOS}$$

The allowable pollutant load must ensure that the waterbody being addressed will be able to attain and maintain water quality standards for all locations, during all applicable seasonal variations in streamflow, and under all pollutant loading conditions. Although specific points of compliance may be designated as restoration plans are more explicitly developed, the TMDLs expressed in this document apply to all locations and flow conditions on the stream segment. **Figure 4-1** is a schematic diagram illustrating how numerous sources contribute to the existing load and how the TMDL is defined. The existing load can be compared to the allowable load to determine the amount of pollutant reduction needed.

The major components that go into TMDL development are target development, source quantification, establishing the total allowable load, and allocating the total allowable load to sources. Although the way a TMDL is expressed may vary by pollutant, these components are common to all TMDLs, regardless of pollutant. Each component is described in further detail below.

Section 5 is organized by waterbody and describes the metal pollutants of concern. The section includes a description of the waterbody segments, how the pollutants are impacting beneficial uses, the information sources and assessment methods to evaluate stream health and pollutant source contributions, water quality target development along with a comparison of existing conditions to targets, quantification of loading from identified sources, the determination of the allowable loading (TMDL) for each waterbody, and the allocations of the allowable loading to sources.

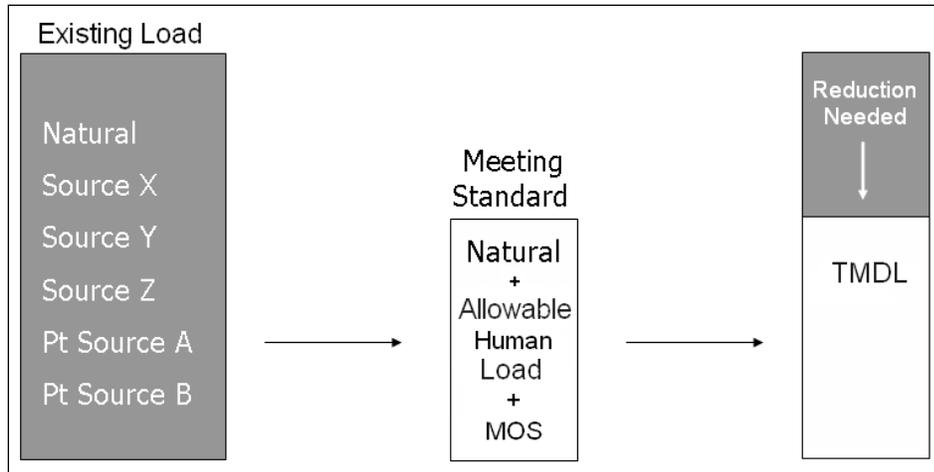


Figure 4-1. Schematic example of TMDL development

4.1 TARGET DEVELOPMENT

Because loading capacity is evaluated in terms of meeting water quality standards, quantitative water quality targets are developed to help assess the condition of the waterbody relative to the applicable standard(s) and to help determine successful TMDL implementation. This document outlines water quality targets for each pollutant of concern in the Landusky TPA. TMDL water quality targets help translate the applicable numeric or narrative water quality standards for the pollutant of concern. For pollutants with established numeric water quality standards, the numeric value(s) within the standard(s) are used as TMDL water quality targets. For pollutants with only narrative standards, the water quality targets provide a site-specific interpretation of the narrative standard(s), along with an improved understanding of impairment conditions. Water quality targets typically include a suite of in-stream measures that link directly to the impacted beneficial use(s) and applicable water quality standard(s). The water quality targets help define the desired stream conditions and are used to provide benchmarks to evaluate overall success of restoration activities. By comparing existing stream conditions to target values, there will be a better understanding of the extent and severity of the problem.

4.2 QUANTIFYING POLLUTANT SOURCES

All significant pollutant sources, including natural background loading, are quantified so that the relative pollutant contributions can be determined. Source assessments often have to evaluate the seasonal nature and ultimate fate of the pollutant loading since water quality impacts can vary throughout the year. The source assessment usually helps to further define the extent of the problem by putting human caused loading into context with natural background loading.

A pollutant load is usually quantified for each point source of the pollutant permitted under the Montana Pollutant Discharge Elimination System (MPDES) program. Most other pollutant sources, typically referred to as nonpoint sources, are quantified by source categories such as unpaved roads and/or by land uses such as crop production or forestry. These source categories or land uses can be further divided by ownership such as Federal, State, or private. Alternatively, a sub-watersheds or tributaries approach can be used, whereby most or all sources in a sub-watershed or tributary are combined for quantification purposes.

The source assessments are performed at a watershed scale because all potentially significant sources of the water quality problems must be evaluated. The source quantification approaches may range from reasonably accurate estimates to gross allotments, depending on the availability of data and appropriate techniques for predicting the loading (40CFR Section 130.2(l)). Montana TMDL development often includes a combination of approaches depending on the level of desired certainty for setting allocations and guiding implementation activities.

4.3 ESTABLISHING THE TOTAL ALLOWABLE LOAD

Identifying the TMDL requires a determination of the total allowable load over the appropriate and sensible time period necessary to comply with the applicable water quality standard(s). Although the concept of allowable daily load is incorporated into the TMDL term, a daily loading period may not be consistent with the applicable water quality standard(s) or may not be practical from a water quality management perspective. Therefore, the TMDL will ultimately be defined as the total allowable loading using a time period consistent with the application of the water quality standard(s) and consistent with established approaches to properly characterize, quantify, and manage pollutant sources in the watershed. For example, the TMDL to address acute metals toxicity criteria will include a near-instantaneous loading requirement calculated over a time period of one second (based on standard methods for evaluation flow in cubic feet per second). Chronic metals toxicity criteria will include a daily loading requirement calculated over a 24-hour period.

Where numeric water quality standards exist for a stream, the TMDL or allowable loading, represents the allowable concentration as represented by the established numeric standard, multiplied by the flow of water over the time period of interest. This same approach can be applied for situations where a numeric target is developed to interpret a narrative standard and the numeric value is based on an in-stream target concentration of the pollutant of concern.

For narrative standards, there is often a suite of targets based on the parameter causing impairment and related chemical or physical conditions. In many of these situations, it is difficult to link the desired target values to highly variable and often episodic instream loading conditions. In these situations, the TMDL is often expressed as a percent reduction in total loading based on source quantification results and an evaluation of load reduction potential (**Figure 4-1**). The degree by which existing conditions exceed desired target values can also be used to justify a percent reduction value for a TMDL.

Even if the TMDL is preferably expressed using a time period other than daily, an allowable daily loading rate will also be calculated to meet specific requirements of the Clean Water Act. Where this occurs, TMDL implementation and the development of allocations will still be based on the preferred time period as discussed above.

4.4 DETERMINING ALLOCATIONS

Once the loading capacity (i.e. TMDL) is determined, that total must be divided, or allocated, among the contributing sources. In addition to basic technical and environmental considerations, this step introduces economic, social, and political considerations. The allocations are often determined by quantifying feasible and achievable load reductions associated with the application of reasonable land, soil, and water conservation practices. Reasonable land, soil, and water conservation practices generally include Best Management Practices (BMPs), but additional conservation practices may be required to achieve compliance with water quality standards and restore beneficial uses. It is important to note that

implementation of the TMDL does not conflict with water rights or private property rights. **Figure 4-2** contains a schematic diagram of how TMDLs are allocated to different sources using WLAs for point sources and LAs for natural and nonpoint sources. Although some flexibility in allocations is possible, the sum of all allocations must meet the water quality standards in all segments of the waterbody.

Under the current regulatory framework for development of TMDLs, flexibility is allowed in the expression of allocations in that *“TMDLs can be expressed in terms of either mass per time, toxicity, or other appropriate measure.”* Allocations are typically expressed as a number, a percent reduction (from the current load), or as a surrogate measure, such as a percent increase in canopy density for temperature TMDLs.

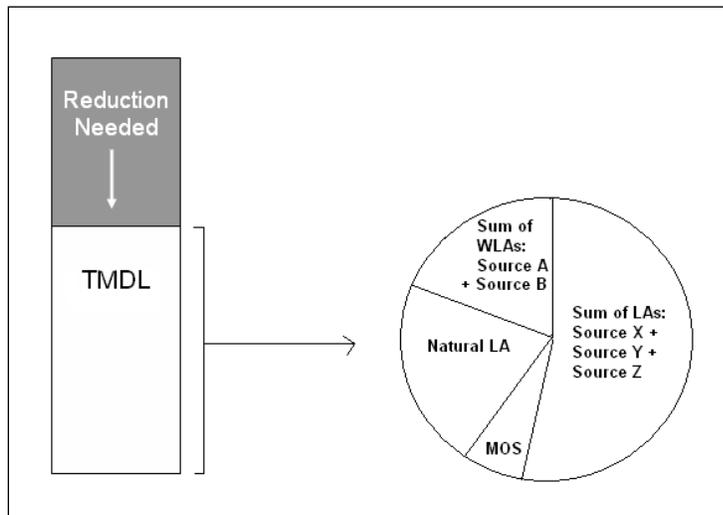


Figure 4-2. Schematic diagram of TMDL and allocations





Incorporating a margin of safety (MOS) is a required component of TMDL development. The MOS accounts for the uncertainty between pollutant loading and water quality and is intended to ensure that load reductions and allocations are sufficient to sustain conditions that will support beneficial uses. The MOS may be applied implicitly by using conservative assumptions in the TMDL development process or explicitly by setting aside a portion of the allowable loading (United States Environmental Protection Agency, 1999).

5.0 METALS TMDL COMPONENTS

This portion of the document focuses on metals impairment of water quality. It describes: 1) the mechanisms by which metals impair beneficial uses of those streams, 2) the specific stream segments of concern, 3) the presently available data pertaining to metals impairments in the watershed, 4) the various contributing sources of metals based on recent data and studies, and 5) the metals TMDLs and allocations.

5.1 EXCESS METALS EFFECTS ON BENEFICIAL USES

Elevated metals concentrations in the Landusky TPA are related to the weathering of rock types that contain metal sulfide minerals. Examples of these minerals include iron sulfides such as pyrite (FeS_2), lead sulfides such as galena (PbS), and copper sulfides such as chalcocite (Cu_2S). Exposure of metal sulfide minerals to oxygen (O_2) and water (H_2O) results in a series of chemical reactions that produce sulfuric acid and metal oxide precipitates. Mining in the Landusky TPA has been the principal means of exposure of metal sulfide minerals to weathering. The following series of equations describes the oxidation of pyrite, the most common sulfide mineral at the Zortman and Landusky mines:



The second and third equations are often accelerated by the activity of iron oxidizing bacteria such as *Thiobacillus ferrooxidans*, which commonly occurs in surface and groundwater. The fourth equation summarizes the first three and shows the formation of sulfuric acid (H_2SO_4) and iron oxide ($\text{Fe}(\text{OH})_3$). Iron oxide often causes turbidity in surface water and causes the reddish coating of stream bottom sediments often associated with pyrite oxidation.

The increased surface water acidity associated with sulfide oxidation increases the solubility of other metals such as copper, lead, and arsenic. The acid generation and metal contamination caused by metal sulfide oxidation are commonly referred to as “acid rock drainage” or ARD. **Figure 5-1** shows the effects of ARD on water quality in Swift Gulch Creek.



Figure 5-1. ARD-related iron oxide turbidity and substrate coating in Swift Gulch Creek

Waterbodies with metals concentrations exceeding the aquatic life and/or human health standards can impair support of numerous beneficial uses including aquatic life, both warm and cold water fisheries, drinking water, and agriculture. Elevated metals concentrations can have toxic, carcinogenic, or bioconcentrating effects on aquatic organisms. Humans and wildlife can suffer acute and chronic health effects from consuming metal contaminated drinking water or fish tissue. Because elevated metals can be toxic to plants and animals, metal contamination may damage agricultural irrigation or stock water uses.

5.2 STREAM SEGMENTS OF CONCERN

Table 5-1 lists the 11 waterbody segments in the Landusky TPA that are impaired due to metals-related causes on the 2010 Montana 303(d) List. In addition, **Table 5-1** includes Sullivan Creek that was listed as impaired by habitat alterations only in the 2010 Integrated Report. A review of the water chemistry data for Sullivan Creek indicates that standards are exceeded for the metal parameters given in the table. All 2010 303(d) Listings are included in **Table 1-1** and the beneficial use support status of listed segments is presented in **Table 3-1**. Metals-related listings include aluminum, arsenic, cadmium, chromium, copper, cyanide, iron, lead, mercury, nickel, selenium, thallium, sulfates, and zinc. Although pH and cyanide are not metals, they are address in this document because of their common association with metal contamination from mining sources.

Table 5-1. Waterbody segments in the Landusky TPA with metals-related impairments on the 2010 303(d) List

Waterbody ID	Stream Segment	Probable Causes of Impairment
MT40E002_050	ALDER GULCH , headwaters to mouth (Ruby Creek)	Cadmium, Copper, Lead, Mercury, Selenium, Zinc, pH
MT40M001_011	BEAVER CREEK , headwaters to Fort Belknap Reservation boundary	Cadmium, Lead, Iron
MT40I001_030	SOUTH BIG HORN CREEK , Zortman Mine to Fort Belknap Reservation boundary	Aluminum, Arsenic, Cadmium, Nickel, Zinc
MT40I001_040	KING CREEK , headwaters to Fort Belknap Reservation boundary	Selenium
MT40I001_050	LODGE POLE CREEK , headwaters to Fort Belknap Reservation boundary	Cadmium, Mercury
MT40E002_100	MILL GULCH , headwaters to mouth (Rock Creek)	Copper, Mercury, Selenium, pH
MT40E002_010	MONTANA GULCH , headwaters to mouth (Rock Creek)	Arsenic, Cadmium, Copper, pH
MT40E002_090	ROCK CREEK , headwaters to mouth (Missouri River)	Cadmium, Copper Lead, Mercury, Selenium, Zinc, pH
MT40E002_060	RUBY CREEK , un-named tributary T25N R25E S21 to mouth (CK Creek)	Aluminum, Cadmium, Copper Lead, Mercury, Selenium, Zinc, pH
MT40E002_070	RUBY GULCH , headwaters to confluence of Alder Gulch	Cadmium, Chromium, Copper, Lead, Mercury, Zinc, pH
MT40E002_110	SULLIVAN CREEK , headwaters to mouth (Rock Creek)	Cadmium, Iron, Lead, Selenium, Zinc
MT40I002_010	SWIFT GULCH CREEK , headwaters to mouth (South Big Horn Creek)	Aluminum, Arsenic, Cadmium, Copper, Cyanide, Iron, Lead, Nickel, Selenium, Thallium, Zinc, pH

5.3 INFORMATION SOURCES AND ASSESSMENT METHODS

The following information sources were used to assess pollutant sources and characterize pollutant loading in the planning area:

- The DEQ monitoring and assessment database for the Landusky TPA
- The Zortman-Landusky (Z-L) ACCESS relational database (Spectrum Engineering, Inc., 2005)
- Final Environmental Impact Statement (EIS), Zortman and Landusky Mines, 1996, and supporting documents (United State Department of the Interior, et al., 1996)
- Montana state agency (DEQ, MBMG) active and abandoned mine databases
- Federal agency databases of water chemistry, biology, and stream discharge
- Geographical Information System (GIS) data for geology, soil, landcover and land use layers
- 2009 National Agricultural Imagery Program (NAIP) Aerial photos
- Water balance and loading estimates reported by contract consultants.

The DEQ monitoring and assessment record (Montana Department of Environmental Quality, Water Quality Planning Bureau, 2010) is the basis for stream impairment listings. Most of the metals impairments are based on water column chemistry data collected from the late 1980s through the mid-1990s. Metals impairment listings for 10 of the 11 listed segments are based predominantly on records from the DEQ STOREASE database, dating from 1977 through 1994. For several streams, STOREASE data are supplemented by records from the Z-L ACCESS database for the period 2001 through 2003. The most recently updated assessment record is that for Swift Gulch Creek. It includes ZL ACCESS data for the

period 1985-2007. Sediment chemistry data is available for a single site on upper Beaver Creek collected during a DEQ field assessment in July, 2005.

The Microsoft Z-L ACCESS database is maintained by Spectrum Engineering, Inc. under contract with the DEQ. It is the largest source of water quality data for the planning area. Originally assembled in 2002, the ZL ACCESS database contains all baseline and mine permit compliance data collected by Zortman Mining, Inc. (ZMI), the mine operator from 1978 through 1998. The database also contains the results of all reclamation and water treatment monitoring since mining ended. It is regularly updated by Spectrum, Inc. as monitoring continues. Field and analytical protocols for the sample results and measurements in the ZL ACCESS database are described in **Section 3.5** of “Final Engineering/Cost Analysis for Water Management at the Zortman and Landusky Mines, Phillips County, Montana” (Spectrum Engineering, Inc., 2006).

The ZL ACCESS database contains nearly 193,000 analysis results and measurements from about 600 monitoring locations. Most of these records consist of surface and groundwater quality analyses, flow records and groundwater elevation measurements. Where data are available, water quality assessment and TMDL development are to be based on a subset of this data that has been collected during the past 10-year period (DEQ 2011a). However, for several of the 12 streams addressed in this section, the most recent data is that collected during the late 1990s. **Table 5-2** identifies the monitoring stations and data timeframes selected to describe the existing water quality condition for each of the 11 metals-listed streams, plus Sullivan Creek. Although not listed in 2010 as metals-impaired, Sullivan Creek water quality is also affected by mining. The locations of these monitoring sites are shown in **Figure 5-2**.

Table 5-2. Monitoring stations and data timeframes used to characterize existing water quality conditions of impaired stream segments

Waterbody ID	Stream Segment	Monitoring Station IDs	Monitoring Timeframe
MT40E002_050	Alder Gulch	Z-2, Z-8, Z-16,	1990-1998
MT40M001_011	Beaver Creek	Z-31, Z-39, M41BVR03	1990-2005
MT40I001_030	South Big Horn Creek	L-48, L-48A	2002-2010
MT40I001_040	King Creek	503, L-5, L-39	2000-2010
MT40I001_050	Lodge Pole Creek	Z-7, Z-29	1990-1998
MT40E002_100	Mill Gulch	506, L-7, L-22, L-36	1990-2010
MT40E002_010	Montana Gulch	L-16, L-47, L-2, 591	2000-2010
MT40E002_090	Rock Creek	L-1, L-4, L-23, L-29	1990-2008
MT40E002_060	Ruby Creek	Z-17, Z-32, R-22, Z-22C, Z-23	1990-2010
MT40E002_070	Ruby Gulch	667, Z-15, Z-100, Z-1B	1990-2010
MT40E002_110	Sullivan Creek	505, 595, D-4, L-37	2000-2010
MT40I002_010	Swift Gulch Creek	BKSS-2, BKSS-3, BKSS-9, L-19, L-49, M37SWFGC01,	2000-2010

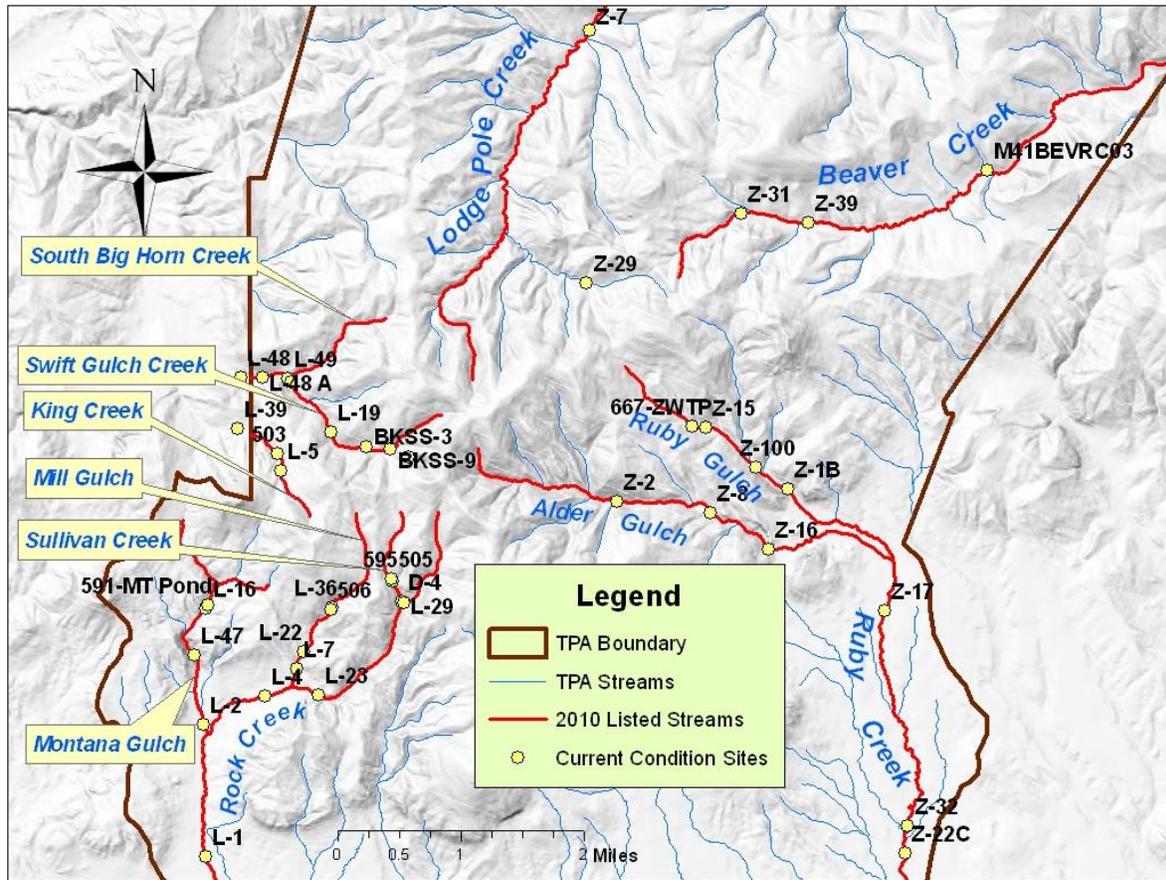


Figure 5-2. Monitoring sites selected as representing current water quality conditions

The criteria applied in selecting the **Table 5-2** sites include the following:

- Location to reflect water quality along as much of the main channel length of listed segments as possible
- Location bracketing significant mining sources
- The currency of the data record
- Number of analysis results and measurements

A second set of monitoring stations is selected to describe water quality in areas having minimal or no upstream mining disturbance. The purpose in separating these sites is to obtain an estimate of natural background water quality. Past assessments of water quality at the Zortman and Landusky mines document differences in metal concentrations caused by the degree of bedrock mineralization. The mineralization process alters bedrock chemistry through changes in the temperature, pressure, or pH of circulating hydrothermal fluids. Mineralization frequently occurs in fracture or shear zones or along contacts between differing rock types. The alteration increases local bedrock concentrations of metal elements that are the focus of mining activity. Mineralization in the Little Rock Mountains has mainly occurred parallel to shear zones within the bedrock core of the mountain range. The 16 surface water monitoring sites selected to estimate background surface water quality are listed in **Table 5-3**.

Table 5-3. Monitoring stations and data timeframes used to characterize natural background water quality conditions of impaired stream segments

Waterbody ID	Stream Segment	Monitoring Station IDs	Monitoring Timeframe
MT40E002_050	Alder Gulch	Z-60, Z-61, Z-62, AGSS-10	1996-1998
MT40M001_011	Beaver Creek	Z-27	1990-2005
MT40I001_030	South Big Horn Creek	L-21	1986-2008
MT40I001_040	King Creek	L-40	1994-1996
MT40I001_050	Lodge Pole Creek	Z-28, Z-30	1990-1998
MT40E002_100	Mill Gulch	L-40, RCSS-5	1994-1998
MT40E002_010	Montana Gulch	L-40	1994-1996
MT40E002_090	Rock Creek	Z-60, Z-61, Z-62, RCSS-5	1996-1998
MT40E002_060	Ruby Creek	Z-9, Z-52, Z-60, Z-61, Z-62, AGSS-10, RGSS-1, RGSP-1	1994-1998
MT40E002_070	Ruby Gulch	Z-9, Z-52, RGSS-1, RGSP 1	1994-1997
MT40E002_110	Sullivan Creek	L-40, Z-60, Z-61, Z-62, RCSS-5	1994-1998
MT40I002_010	Swift Gulch Creek	L-21, L-41, L-45	1986-2008

Figure 5-3 shows the location of the background sites in relation to the mineralized shear zones that were the focus of mining at Zortman and Landusky. The sites are generally in portions of the stream drainages more remote from mining disturbances. The **Table 5-3** sites which are included in the Zortman and Landusky mine water classification system developed by Osborne and Gallagher (2001), are classified as “Headwaters Background”, “Mineralized Syenite Background”, and “Non-Mineralized Syenite Background.” Although the shear zones shown in **Figure 5-3** are concentrated in headwater positions, other such zones occur throughout the core of the Little Rockies range. Thus, the metal sulfide mineralogy can potentially affect water quality at other locations and at lower elevations.

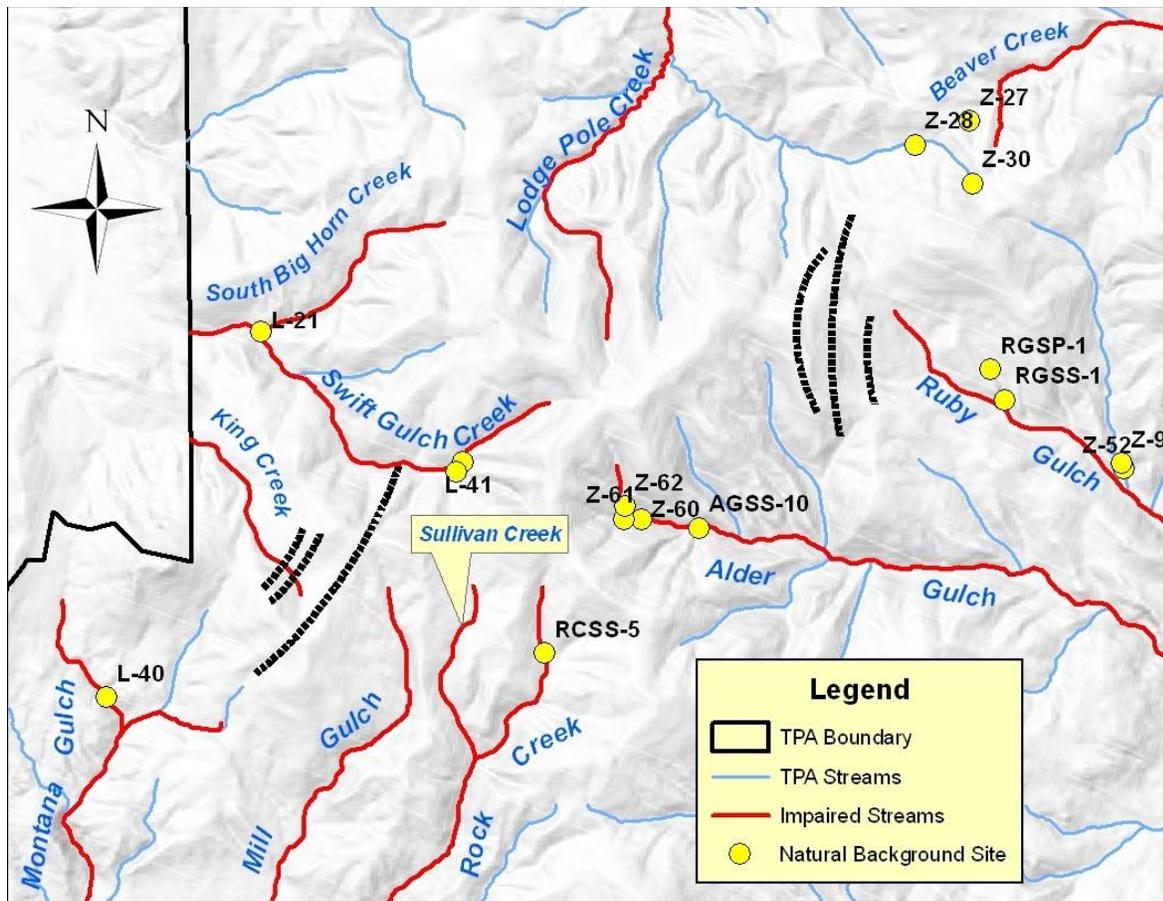


Figure 5-3. Locations of sites representing natural background water quality relative to bedrock shear zones in the Zortman (upper right) and Landusky (lower left) mine areas.

Older data are used in this document when data from the past decade are not available. The most recent surface water chemistry data for Alder Gulch, Beaver Creek, and Lodge Pole Creek are dated from 1990 through 1998. The most recent records for the remaining eight streams are dated from 2000 through 2010.

Recent data is generally of higher quality because of lower method detection limits, more consistent collection methods, and more accurate and standardized analysis procedures. The most recent data also reflects the effects of significant surface reclamation activities that occurred at the Zortman and Landusky mines from 1999 through 2005. STORET and NWIS data for the period 1985-1994 are also available for several streams and have been incorporated into the ZL ACCESS database

The number of water quality monitoring records used in TMDL analysis is further reduced by excluding results for hardness-dependent metals when the sample lacks a hardness value. Thus, the need for TMDLs is based only upon results for which the corresponding numeric criteria can be calculated from hardness.

In older water chemistry data, the detection limits of analytical methods are frequently higher than the numeric criteria used to determine impairment. Such records cannot be used for target comparisons and are omitted from use support and TMDL analyses. Despite these subtractions, the Z-L ACCESS database remains the most comprehensive source of water chemistry and flow data. **Appendix B**

contains the raw water quality data for metals and related parameters, by listed segment, used for TMDL development.

In addition to the ZL ACCESS database, Spectrum Engineering, Inc. supplied a number of digital and hard copy maps of the Zortman and Landusky mine areas. They identify monitoring point locations, hydrogeologic features, topography and the extent of underground mine workings. Other geographic information includes locations of above ground mine facilities, water capture and treatment systems, leach pads, dikes, pit areas, waste storage areas and roadways.

Abandoned mine databases maintained by DEQ and MBMG were used to better understand the locations and scales of historic mining, particularly in Alder and Ruby gulches. Geologic GIS data and recent aerial photography were used to locate potential metals sources and to understand the hydraulic connections between mine disturbances and the local stream system.

Since metals concentrations in surface waters often vary seasonally, data seasonality is also important for estimating loading. Springtime flows that typically have a large snowmelt or precipitation component commonly dilute metals concentrations during April, May and June. Summer, fall and winter flows have a larger groundwater component that provides less dilution. The operation of several subsurface capture systems demonstrate the substantial groundwater contributions to surface water metals loading. Examining water quality data under both high and low flow conditions is necessary to account for seasonal variability. The flow values used to estimate seasonal loading will vary by stream because of the large differences in drainage area among the listed streams.

Based on a combined assessment of source locations and water quality data, the potential sources of metals loading in the Landusky TPA include:

- Natural background loading
- Abandoned mines
- Surface and groundwater loading from areas disturbed by ZMI operations (1979 -1998).
- Point sources of wastewater from treatment plants

5.3.1 Natural Background Water Quality

Natural background water quality typically has neutral to slightly acidic pH, is low in dissolved solids, and has low sulfate and metals concentrations. Sites Z-60, Z-61, and Z-62, that are located in the relatively undisturbed headwater tributaries of Alder Gulch, represent natural background conditions for several nearby segments within the southern portion of the planning area. **Table 5-4** summarizes the 16 records for these sites for parameters that reflect ARD conditions. The records date from 1996 to 1998 and show minimal effects of ARD.

Table 5-4. Summary statistics for water quality data from sites Z-60, Z-61 and Z-62 showing minimal ARD effects in upper Alder Gulch

Summary Statistic	Total Hardness (mg/L)	Total Dissolved Solids (mg/L)	Sulfate (mg/L)	pH	Iron (µg/L)	Zinc (µg/L)
Minimum	11	40	9	6.6	380	< 5
Median	15	60	13	7.0	605	20
Maximum	18	74	65	7.8	780	30
Count	16	12	16	16	12	16

The median pH is neutral. All hardness values are less than 25 milligrams per liter (mg/L). The median sulfate concentration is less than 20 mg/L. All iron and zinc concentrations meet water quality standards.

Four sites in the upper reaches of Beaver (Z-27), Lodge Pole (Z-28 & Z-30) and South Big Horn creeks (L-21) are also remote from mining disturbances and represent background metals loading conditions within the northern portion of the planning area. **Table 5-5** summarizes the water quality of these sites.

Table 5-5. Summary statistics for water quality data from sites Z-21, Z-27, Z-28, and Z-30 showing minimal ARD effects in upper Beaver, Lodge Pole and South Big Horn creeks

Summary Statistic	Total Hardness (mg/L)	Total Dissolved Solids (mg/L)	Sulfate (mg/L)	pH	Iron (µg/L)	Zinc (µg/L)
Minimum	25	25	1.8	5.5	5	1
Median	95	83	14	7.5	175	5
Maximum	267	611	56	12.2	2680	80
Count	111	50	91	96	84	84

Although there are elevated values for the some parameters in **Table 5-5**, the median values represent surface water unaffected by sulfide oxidation from mining sources.

The remaining nine sites assumed to represent natural background conditions include the following:

- Sites L-41 and L-45 in upper Swift Gulch Creek
- Sites L-40 and RGSS-5 in the upper portions of Montana Gulch and Rock Creek, respectively
- Four sites (Z-9, Z-52, RGSP-1, RGSS-1) in unnamed tributaries draining undisturbed areas north of Ruby Gulch.

Table 5-6 summarizes the seasonal differences in water chemistry for the 16 background sites. High flow conditions are for sampling events from April through June; low flow conditions are for sampling events from July through December. Except for iron concentration, the median values are lower during high flows when dilution is provided by precipitation or snowmelt. The higher iron concentration during high flow may reflect a larger sediment contribution to loading of total recoverable iron.

Table 5-6. Comparison of high and low flow summary statistics for ARD-related parameters and flow from 18 monitoring sites representing natural background conditions

Summary Statistics	Flow (GPM)	Total Hardness (mg/L)	TDS (mg/L)	SO4 (mg/L)	pH (S.U.)	Fe (µg/L)	Zn (µg/L)
High Flow Statistics							
Minimum	1	9	25	2	5.5	10	5
Median	21	56	82	11	7.3	400	10
Maximum	1350	249	611	98	12.2	2680	80
Count	70	96	91	85	85	81	86
Low Flow Statistics							
Minimum	0.19	35	52	5	6.9	15	5
Median	1.4	198	235	42	7.6	160	10
Maximum	4039	297	351	134	8	1670	20
Count	8	22	21	17	22	9	9

A study by Gabelman and others (2005) of pre-mine water quality in Swift Gulch Creek concluded that pre-mining conditions were generally not affected by ARD. Ferricrete, an iron-cemented conglomerate

rock type, occurs adjacent to some stream courses in the Zortman-Landusky area. The presence of ferricrete is evidence of sulfide oxidation prior to mining. The age of the ferricrete deposits in the Zortman-Landusky area indicates formation during prehistoric weathering of metal sulfides exposed during glaciation, landslides, or other significant erosion events. Therefore, some degree of ARD occurred periodically in the area because of weathering caused by climate and rapid erosional episodes (Gabelman, et al., 2005).

All of the streams with metals impairments have been affected by mining to some extent. When possible, natural background metals loading will be accounted for separately from mining sources. However, for aluminum, cadmium, copper, and lead, the water quality records for sites representing natural background conditions contain values that occasionally exceed the water column criteria established in Circular DEQ-7. Therefore, natural background sources cannot always be assumed to meet metals target concentrations in the water column. In cases where there is no clear distinction between natural background and human-caused loading sources, composite allocations to natural background plus mining sources may be needed until monitoring can clarify the natural background loading contribution and allocations can be adjusted through adaptive management.

5.3.2 Abandoned Mines and Associated Wastes

Mining in the Little Rocky Mountains began with the discovery of placer gold in Alder Gulch in 1884. News of the find sent about 2000 miners into the area within a month (Burlingame and Toole, 1957). The boundary of an area set aside for Indian tribes was modified to accommodate mining and the southern boundary of the Fort Belknap Reservation was modified in 1896. Placer mining gave way to development of the first lode claims at the Julie, August and Gold Bug properties within the Landusky mine area. Ore was processed using a small stamp mill and mercury amalgamation until late in 1902.

The mining camp of Zortman was established in 1903 with operation of a cyanide mill in Alder Gulch that processed ore from the Alabama and Pole Gulch mines until 1908. The Ruby, Mint and Divide claims supplied ore for the Ruby Gulch Mill, a cyanide leaching plant that was constructed in 1905 and operated until destroyed by fire in 1913. It was rebuilt the following year and reached its peak production during 1917. Operations of the Ruby Gulch Mill were suspended in 1918 and the mill again burned in 1923. Charles Whitcomb, with a number of associates, consolidated the Landusky mining properties and formed the Little Ben Mining Company that operated a large cyanide mill in upper King Creek. Whitcomb and other investors opened another cyanide mill in Ruby Gulch in 1935 that operated until being shut down by the War Production Board in 1942. Later attempts to reopen the mine faltered after the war and serious mining efforts ceased in 1951 (Murray, 1978).

The Pegasus Gold Corporation operated the Zortman and Landusky mines from 1979 through 1998 through its wholly owned subsidiary, ZMI, Inc. Operating permits for two open pit mines with cyanide heap leaching operations were obtained from the former Montana Department of State Lands in 1979. Between 1979 and 1990 the Landusky Mine permit boundary expanded from 530 to 1,287 acres; the disturbed area expanded from 256 to 814 acres. During the same period at the Zortman Mine, the permit boundary expanded from 619 to 961 acres, with the disturbed area expanding from 273 to 401 acres. Pegasus began chapter 11 proceedings in 1998. Since then, the Bureau of Land Management (BLM) and DEQ have implemented mine closure, reclamation and wastewater treatment operations at both mine areas. Details of the timing and sequence of reclamation and waste treatment operations at the mines are described in Spectrum Engineering, Inc. (2006).

DEQ and MBMG databases identify about 45 abandoned mines within the Landusky TPA. None have been given a high priority ranking and many have been obscured or covered by more recent surface mining by ZMI, Inc. (**Appendix A, Figure 15**). Abandoned mine disturbances include both placer and lode operations that range from small hillslope disturbances to the more extensive alluvial workings such as those in Alder Gulch and lower Swift Gulch Creek. Abandoned mine effects on surface water quality are variable.

Environmental data describing individual abandoned mines is typically insufficient to guide specific load allocations. Where data is adequate, abandoned mine sites are considered as unpermitted point sources and assigned distinct wasteload allocations (WLA). Contributions from other abandoned mine sources are included in composite WLAs for mining sources. This approach assumes that metals loading reductions can be accomplished with remediation of these properties and surrounding mine disturbances.

5.3.3 Point Sources

Four wastewater treatment plants operate as point sources under authority of the Comprehensive Environmental Response, Compensation and Liability Act (CERCLA) through the BLM. Treatment of ARD affected wastewater by pH adjustment with hydrated lime is occurring at three plants located at the Landusky Mine, Zortman Mine and in the Swift Gulch Creek drainage. The Zortman plant began operation on June 10th, 1994. It discharges treated water to surface water in Ruby Gulch. The Landusky plant, that began operation on October 1st, 1997, discharges to surface water into Montana Gulch. The Swift Gulch Creek plant began a seasonal (June through November) operations during 2010. Treated wastewater discharges to Swift Gulch Creek downstream of the plant. Since 2005, a fourth plant provides biological removal of cyanide, selenium and nitrates from leach pad drainage piped from both the Zortman and Landusky mines. Treated water is discharged either to surface water in Montana Gulch or to a 204-acre land disposal area located between Goslin Gulch and Ruby Creek about one mile south of the town of Zortman. **Figure 5-4** illustrates the locations of the treatment plant point sources and the Goslin Flats land disposal area.

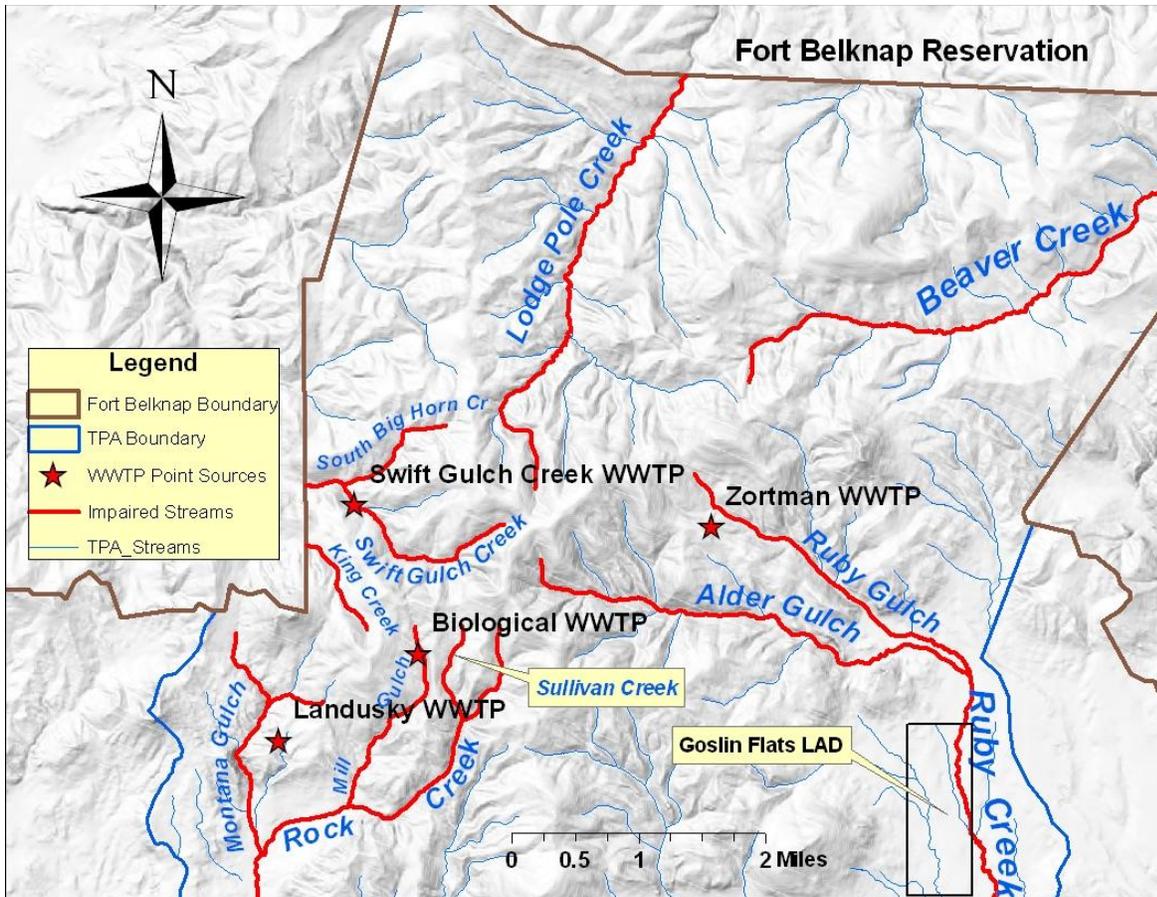


Figure 5-4. Wastewater treatment plant and Goslin LAD point source locations.

After use of CERCLA authority for reclamation and treatment plant operations, the two Montana Pollutant Discharge Elimination System (MPDES) permits, for the Landusky Mine (MT0024864) and Zortman mine (MT0024856) were terminated on July 1, 2004.

5.4 WATER QUALITY TARGETS

The established Montana numeric water quality criteria are adopted as the water quality targets for metal and cyanide pollutants. These values are published in Circular DEQ-7 (Montana Department of Environmental Quality, 2010a). Circular DEQ-7 contains acute and chronic aquatic life criteria, designed to protect aquatic life uses, and the human health criteria, designed to protect drinking water uses. TMDLs are calculated using the most stringent target value, which ensures that the TMDLs are protective of all designated beneficial uses.

Attainment of *chronic* aquatic life water quality criteria is based on an average water quality metals concentration over a 96 hour period. The one-hour average concentration in surface water may not exceed the *acute* aquatic life water quality criteria more than once in any three year period.

DEQ has established an assessment method for determining water quality impairment caused by elevated metals concentrations (Montana Department of Environmental Quality, 2011). When assessing the metals data, the stream classification is considered when evaluating support for aquatic life versus drinking water beneficial uses. Numeric standards to protect aquatic life and human health are different

and therefore the methods on how they are applied differ (Montana Department of Environmental Quality, 2010b). In general, some standard exceedances are allowed to assess the aquatic life/fishes beneficial use, whereas, no exceedances are allowed when assessing compliance with the human health standards. Thus, a waterbody can be listed for drinking water but not for aquatic life/fishes. Some of the aquatic life standards are dependent on hardness and adjust with changes in hardness. The recommended minimum sample size is eight samples within the same assessment reach. Fewer samples may be considered for specific use attainment decisions. In general, data from the last ten years should be considered when making attainment decisions for aquatic life and drinking water uses. Data that is older than ten years may be used for a historical reference or for TMDL development when more recent data is unavailable. Although samples can be taken any time of the year, 33 percent of the data set should be from samples collected during high flow conditions, with the remaining samples collected during base flow conditions. At a minimum, a metals sampling suite should include analysis for total recoverable metals and dissolved aluminum. Although not required for making use attainment decisions, other dissolved and sediment metal sample fractions may be valuable for identifying potential sources.

The metals assessment method assumes that the allowable exceedance rate for the chronic criteria is equivalent to 10 percent of samples collected using a typical monitoring design that includes representative and independent samples under both high and low flow conditions. No exceedances are allowed at twice the acute aquatic life criteria. Where the numeric criteria apply to protection of both aquatic life and human health, the most restrictive value is adopted as the water quality target.

Metals and Cyanide

Water quality targets include the acute aquatic life (AAL), chronic aquatic life (CAL) and human health (HH) criteria for dissolved aluminum, and total recoverable concentration of arsenic, cadmium, chromium, copper, iron, lead, mercury, nickel, selenium, thallium, and zinc (Montana Department of Environmental Quality, 2010a). The aquatic life criteria for several metals are dependent upon water hardness. The acute and chronic aquatic life criteria for cadmium, copper, lead, nickel, and zinc increase with increasing hardness. **Table 3-3** contains the aquatic life and human health criteria for these metals at a hardness value of 25 mg/L. **Table 3-3** also contains the aquatic life and human health criteria for cyanide and those metals not affected by water hardness including aluminum, arsenic, chromium (total), mercury, iron, manganese, selenium and thallium. **Table 3-4** contains the coefficients for calculating hardness dependent metals standards that are the targets applied to determine the need for TMDLs.

The human health criterion given in Circular DEQ-7 for iron (300 µg/L) and manganese (50 µg/L) are based on secondary maximum contaminant levels (MCL) established by EPA to prevent aesthetic issues with taste, odor, or staining. These values are considered as guidance to determine interference with the specified uses after conventional water treatment. It is assumed that the concentrations of iron and manganese present in listed waterbodies after conventional treatment would not consistently exceed the guidelines. Therefore, the chronic aquatic life criterion of 1,000 µg/L is the water quality target for iron. Since there are no aquatic life criteria for manganese and no manganese listings in the Landusky TPA, no targets or TMDLs are developed in this document for manganese.

5.4.1 Supplemental Indicators

Supplemental indicators have an inherently higher level of uncertainty in the level that indicates use impairment, compared to established numeric standards. Therefore, exceedance of supplemental indicators does not automatically equate to beneficial use impairment. The number and magnitude of

supplemental indicator exceedances are considered together with those for numeric standards when evaluating beneficial use support. In most cases, a combination of target departure analysis, meaningful qualitative observations, and sound professional judgment is applied in each assessment of TMDL development needs.

Sulfate

Montana currently has no numeric water quality criteria for sulfate. Sulfate criteria development has focused on use classification categories that include drinking water. In the Landusky TPA, these are the streams in categories B-1 and B-3 (see **Table 3-1**). Use classifications are broadly applied in the Landusky TPA. All streams draining north into the Milk River are classified as either B-1 or B-3; streams draining south to the Missouri River are classified as C-3. A DEQ review of sulfate effects on aquatic life recommended a concentration range of 200-250 mg/L for western Montana streams, based on toxicity testing of salmonid fishes in British Columbia (Denisger, 1998). The sulfate range recommended for protection of aquatic vegetation is 50-100 mg/L. Regardless of the current classification, all stream reaches in the mountainous portion of the planning area probably supported salmonid fish and associated aquatic life prior to mining. Water temperature and dissolved solids (including sulfate) concentrations naturally increase with the transition from a mountain to a prairie setting. Thus, sulfate concentrations in low elevation reaches are inherently higher than those of upland headwater reaches.

Natural background concentrations of sulfate are low in planning area surface waters compared with waters affected by mining. The median values for high and low flow condition sulfate concentration are 11 and 42 mg/L respectively (**Table 5-6**). Mining activity and associated sulfide oxidation have caused wide sulfate ranges in affected surface waters. The typical range is from the median values in **Table 5-6** to several thousand mg/L. **Figure 5-5** illustrates this range for water quality in Swift Gulch Creek that began to deteriorate during the early 1990s as local groundwater contaminated beneath the Landusky Mine pit entered the stream through a series of springs. The wide fluctuation in sulfate concentration after 2000 is the dilution effect of spring snowmelt and precipitation.

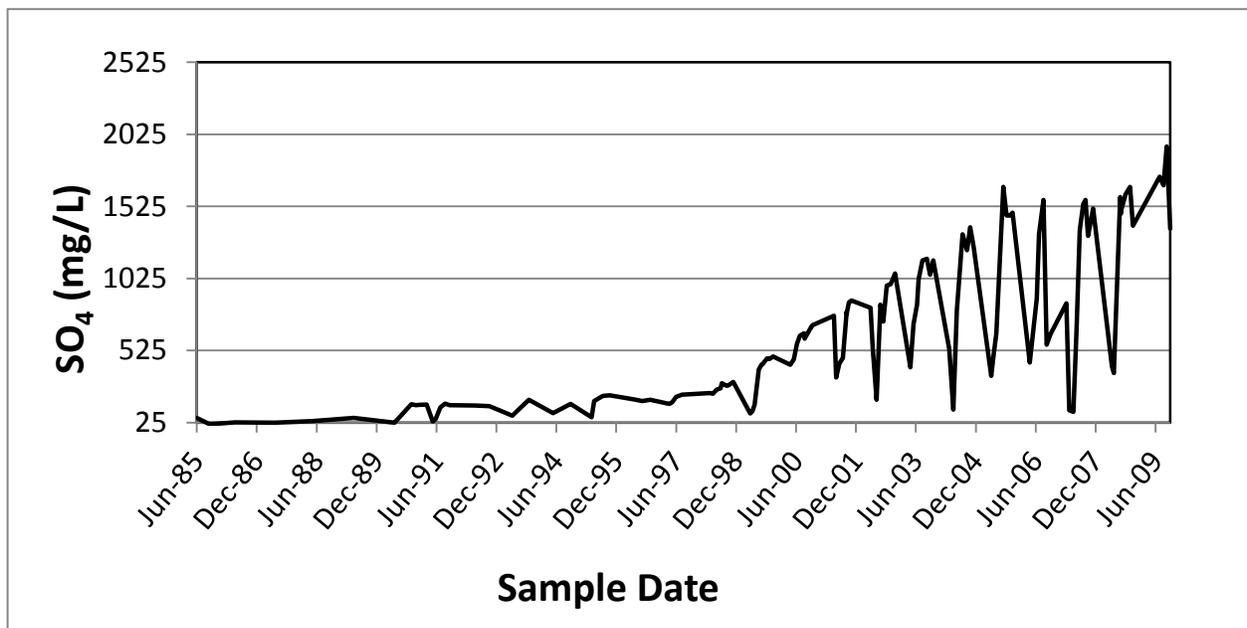


Figure 5-5. Surface water sulfate monitoring record for site L-19 in Swift Gulch Creek.

The natural background sulfate levels in the mountainous portion of the planning area are commonly an order of magnitude less than the 200-250 mg/L range recommended for protection of trout in B-classified streams in western Montana. Considering the inherently low sulfate concentrations for mountain stream reaches, and the expected higher background sulfate concentrations within prairie reaches, a sulfate concentration of 200mg/L is selected as a maximum value for aquatic life protection in the Landusky TPA.

Metals in Sediment

The general prohibitions in Montana’s water quality standards (ARM 17.30.637) apply to additions of pollutants in sediment at harmful or toxic concentrations. Although sediment chemistry data is sparse, sediment concentration guidelines are used here as supplemental indicators of water quality problems. The National Oceanic and Atmospheric Administration (NOAA) has developed Screening Quick Reference Tables that contain metals concentration guidelines for freshwater and marine sediments (Buchman, 2008). The screening criteria, developed from a variety of toxicity studies, are expressed as Probable Effects Levels (PELs) in **Table 5-7**.

Table 5-7. Screening criteria for sediment metals concentrations used as supplemental indicators.

Metal Parameter	PEL (µg/g dry weight)
Arsenic	17
Cadmium	3.53
Chromium	90.0
Copper	197
Lead	91.3
Nickel	36
Zinc	315

PELs represent the sediment concentrations above which toxic effects frequently occur. PELs are used here as a screening tool to identify potential impacts to aquatic life.

Macroinvertebrate Metrics

Macroinvertebrate metrics have been developed as general indicators to document the relationship between water quality and the health of this aquatic life form. Macroinvertebrate assessment models in use by the DEQ Water Quality Planning Bureau are the Multimetric Indices (MMI) for mountain, low valley, and prairie landscapes, and the River Invertebrate Prediction and Classification System (RIVPACS) that is applied to all streams regardless of physical setting. Both metrics were developed from Montana reference site data.

Macroinvertebrate assessment sites in the Landusky TPA fit into the “Low Valley” index category that applies to locations having elevations less than 1,700 meters (5,577 feet). The minimum use support threshold score for this site category is 48; the RIVPACS model specifies a minimum use support score of 0.80 that applies to all Montana streams. These values are used as supplemental indicators of aquatic life use support.

5.4.2 Target Summary

The metals targets and supplemental indicators are summarized below in **Table 5-8**.

Table 5-8. Targets and Supplemental Indicators for the Landusky TPA

Target Parameter	Criterion
Water Column Pollutant Concentration	Montana Water Quality Standards, Circular DEQ 7 (Montana Department of Environmental Quality, 2010a)
Supplemental Indicators	Criterion
Water Column Sulfate Concentration (mg/L)	200
NOAA Quick Reference Table for Inorganics in Freshwater Sediment	Probable Effects Limits (PELs) (Buchman, 2008)
Macroinvertebrate Multi Metric Index (MMI), Low Valley Index Score	48
River Invertebrate Prediction and Classification System (RIVPACS) Score	0.8

5.4.3 Targets, Supplemental Indicators, and the Need for TMDLs

The decisions to complete metals and cyanide TMDLs are based on the combined influence of the following factors:

- Degree of compliance with numeric water column criteria and supplemental indicators
- The presence of human-caused loading sources
- The current pollutant listing status of the segment
- Availability of pollutant concentration and flow data for high and low flow conditions
- The temporal distribution of exceedances within the monitoring record
- The age of the dataset

Compliance with targets and supplemental indicators, the presence of sources, and the current listing status for a parameter are the primary factors influencing TMDL development decisions. The seasonality requirement for TMDLs makes high and low flow data availability another primary decision factor. Though not essential for TMDLs, information about the trend of target exceedances in the monitoring record helps to identify additional impairment causes, recognize developing or remediated sources, and refine monitoring plans. On a case-by-case basis, a valid impairment listing for a pollutant with a sparse, outdated, or inconclusive data record frequently supports TMDL development. The following scenarios are examples where combined consideration of the decision factors indicates the need for metals TMDLs.

1. The most restrictive water quality criterion is exceeded in greater than 10 percent of analysis results for samples from a listed segment with known sources
2. One or more analysis results is more than double the acute aquatic life criteria, the human health criterion is exceeded during the most recent 10-year period (Applies to streams with drinking water as a beneficial use.)
3. The aquatic life criteria are exceeded in less than 10 percent of samples, exceedances are concentrated among the most recent data, and known sources are present in a listed segment
4. Water column concentration targets are met, supplemental indicators are commonly exceeded, and known human-caused sources occur in the drainage of a listed segment.

Additional monitoring may be recommended in lieu of TMDLs where only supplemental indicators are exceeded, causes are unlisted, and the effects of sources on water quality are unknown or unclear. The

following examples are scenarios in which additional monitoring and source assessment would preclude TMDL development.

1. All analysis results for a listed pollutant consist of non-detections, and method detection limits exceed the water quality criteria
2. Recent data indicate no target exceedances for a listed segment, sources are present, data is not sufficient to evaluate seasonal loading.
3. Natural background concentrations of either listed or unlisted metals consistently exceed aquatic life criteria, supplemental indicators are below suspect levels, and sources are absent or remote from surface waters.

5.4.4 Achievability of Water Quality Targets

With the bankruptcy of ZMI in 1998, the BLM and DEQ essentially became operators responsible for reclamation and water treatment at the Zortman and Landusky mines. Because these operations control releases of hazardous substances onto and from BLM administered lands, the reclamation and water treatment operations are classified as removal actions under CERCLA, with the BLM as lead federal agency. The BLM and DEQ are jointly conducting the removal actions according to a 2006 Action Memorandum that specifies attainment of Applicable or Relevant and Appropriate Requirements (ARARs) of federal and state laws. The applicable ARARs are listed in Appendix 4 of the Engineering Evaluation/Cost Analysis for Water Management at the Zortman and Landusky Mines (Spectrum Engineering, Inc., 2006). The applicable ARARs include the Montana Water Quality Act and Montana regulations establishing ambient water quality standards, including those specified in Circular DEQ-7. The Action Memorandum states that the removal actions will attain ARARs “to the extent practicable considering the exigencies of the situation.” The most significant obstacles to meeting water quality ARARs are funding limitations, the wide variability in the volume and quality of water needing treatment, and access limitations preventing year round treatment plant operation.

From 1994 through 2010 the annual precipitation measured at the Zortman and Landusky weather stations has varied from 15 to 30 inches. Water balance calculations by Osborne (2003) estimated that an average of 44 percent of precipitation at the mine sites infiltrates the land surface. The leach pad liners capture about 26 million gallons per year at Zortman and about 70 million gallons per year at Landusky. Periodic large spring rainstorms, or rainstorms combined with spring snowmelt periodically exceed the capacities of both leach pad liners and drainage capture systems. Such conditions have required decisions allowing temporarily bypasses of drainage capture systems. Systems with better water quality have been allowed to bypass treatment in favor of routing more polluted waters to the treatment plants. Storage capacity overflows and resulting bypass strategies have caused applicable ARARs to be exceeded. Variable precipitation and storm intensity combine with an annual funding shortfall to force compromises in ARAR compliance (See Section .

The annual operating and maintenance costs for the capture and treatment of mine-impacted water are about \$1.5 million. The surety companies reached an agreement with the DEQ to fund reclamation and water treatment to the limits of the surety bonds. The bonds supply \$731,321, leaving an annual shortfall of about \$770,000. The BLM has often provided sufficient funding to cover the difference, but operation and maintenance cost continue to cause frequent annual shortfalls (Spectrum Engineering, Inc., 2006). Several funding sources will combine to provide a project trust fund of \$33.9 million beginning in 2018. The trust can provide perpetual funding if assumed annual return and inflation

assumptions are correct. If the annual return is less and inflation greater than assumed, an eventual long-term funding shortfall could result.

Seasonal access limitations to Swift Gulch Creek prevent year round treatment plant operations. Bypasses accompany flows that exceed the plant's or 800 gpm treatment capacity or when sludge volumes exceed available storage. Despite efforts to provide for timely sludge removal, future seasonal discharges of ARD-affected water that exceeds water quality ARARs are anticipated in Swift Gulch Creek.

Under the current Memorandum of Understanding between the BLM, DEQ, and its contractors will continue to operate, maintain, and monitor the treatment plants and the leach pad treatment system under CERCLA authority, using surety company funds. The BLM will continue with reclamation actions and consult with DEQ on the need for any new removal actions necessary to protect BLM lands. The BLM will provide funding to supplement surety payments as allowed by the BLM budgeting process. Cooperation between the two agencies will continue with the goal of meeting water quality ARARs as consistently as possible, considering available funding and physical site limitations.

5.5 EXISTING CONDITIONS AND DEPARTURES FROM WATER QUALITY TARGETS

The water quality record for each stream impaired by metals or cyanide is assessed in terms of the targets and supplemental indicators listed above in **Table 5-8**.

The first step in the evaluation process is to identify a subset of the monitoring sites contained in the Z-L ACCESS database for each stream segment. These are the sites identified above in **Section 5.3**. The objectives of the selection process are to:

1. Identify sites that reflect a broad sampling time frame that captures the effects of tributary inflows and changing downstream sources
2. Identify sites that reflect the effects of increasing downstream flow on pollutant concentrations
3. Identify sites that reflect minimal human caused loading to gain perspective on the degree of impairment in the segment.

Monitoring results from sites representing current conditions are compared to targets and supplemental indicators to determine the need for TMDLs. Data for listed metals are evaluated first, followed by a review of data for other metals with notable target departures.

The stream by stream review of metals loading sources and comparison of water quality data to targets and supplemental indicators is contained in **Appendix F** for the 12 listed streams. The target departure analyses and TMDL conclusions are summarized below for each segment in **Tables 5-9 through 5-20**.

Table 5-9. Metals decision factors and TMDL conclusions for Alder Gulch

Pollutant Parameter	CAL/AAL Exceedance Rate > 10%	Results Twice the AAL Criterion	Supplemental Indicators Suggest Impairment	Human-Caused Sources Present	Variable Flow Data Available	Notable Water Quality Trend	Parameter Listing in 2010	TMDL Decision	Qualifying Notes
Cadmium	Y/Y	Y	Y	Y	Y	N	Y	Cd TMDL	Most recent data is 1998
Copper	Y/Y	Y	Y	Y	Y	N	Y	Cu TMDL	Most recent data is 1998
Lead	Y/N	N	Y	Y	Y	N	Y	Pb TMDL	One exceedance 1995-1998
Mercury	N/N	N	Y	Y	Y	N	Y	Hg TMDL	Most TMDLs Exceed WQ Criteria
Selenium	N/N	Y	Y	Y	Y	Y	Y	Se TMDL	Single Exceedance in 1992; None since in 75 results
Zinc	Y/Y	Y	Y	Y	Y	N	Y	Zn TMDL	Most recent data-1998

Table 5-10. Metals decision factors and TMDL conclusions for Beaver Creek

Pollutant Parameter	CAL/AAL Exceedance Rate > 10%	Results Twice the AAL Criterion	HH Criterion Exceeded	Supplemental Indicators Suggest Impairment	Human-Caused Sources Present	Variable Flow Data Available	Notable Water Quality Trend	Parameter Listing in 2010	TMDL Decision	Qualifying Notes
Cadmium	Y/Y	N	N	N	Y	Y	Y	Y	No Cd TMDL	No exceedance since 1990
Iron	N/NA	NA	NA	N	Y	Y	Y	Y	No Fe TMDL	No exceedance at selected sites
Lead	Y/N	N	Y	N	Y	Y	Y	Y	Pb TMDL	No exceedance since 1994

Table 5-11. Metals decision factors and TMDL conclusions for South Big Horn Creek

Pollutant Parameter	CAL/AAL Exceedance Rate > 10%	Results Twice the AAL Criterion	HH Criterion Exceeded	Supplemental Indicators Suggest Impairment	Human-Caused Sources Present	Variable Flow Data Available	Notable Water Quality Trend	Parameter Listing in 2010	TMDL Decision	Qualifying Notes
Aluminum	Y/N	N	N	Y	Y	N	N	Y	Al TMDL	Limited dataset
Arsenic	N/N	N	Y	Y	Y	N	Y	Y	As TMDL	Single HH Exceedance
Cadmium	Y/N	N	Y	Y	Y	N	Y	Y	Cd TMDL	Increasing Cd trend
Iron	Y/NA	NA	NA	Y	Y	N	N	N	Fe TMDL	Background high flow exceedance
Nickel	Y/N	N	Y	Y	Y	N	Y	Y	Ni TMDL	Increasing Ni trend
Zinc	Y/Y	Y	Y	Y	Y	N	Y	Y	Zn TMDL	Increasing Zn trend

Table 5-12. Metals decision factors and TMDL conclusions for King Creek

Pollutant Parameter	CAL/AAL Exceedance Rate > 10%	Results Twice the AAL Criterion	HH Criterion Exceeded	Supplemental Indicators Suggest Impairment	Human-Caused Sources Present	Variable Flow Data Available	Notable Water Quality Trend	Parameter Listing in 2010	TMDL Decision	Qualifying Notes
Arsenic	N/N	N	Y	Y	Y	N	N	N	As TMDL	High flow HH exceedance
Cadmium	Y/N	N	Y	Y	Y	N	Y	N	Cd TMDL	Increasing Cd trend
Selenium	Y/Y	Y	Y	Y	Y	N	N	Y	Se TMDL	Decreasing trend at L-39

Table 5-13. Metals decision factors and TMDL conclusions for Lodge Pole Creek

Pollutant Parameter	CAL/AAL Exceedance Rate > 10%	Results Twice the AAL Criterion	HH Criterion Exceeded	Supplemental Indicators Suggest Impairment	Human-Caused Sources Present	Variable Flow Data Available	Notable Water Quality Trend	Parameter Listing in 2010	TMDL Decision	Qualifying Notes
Cadmium	N	N	N	N	Y	Y	N	Y	Cd TMDL	Aging dataset
Mercury	N	N	N	Y	Unknown	Y	N	Y	Hg TMDL	High MDLs

Table 5-14. Metals decision factors and TMDL conclusions for Mill Gulch

Pollutant Parameter	CAL/AAL Exceedance Rate > 10%	Results Twice the AAL Criterion	HH Criterion Exceeded	Supplemental Indicators Suggest Impairment	Human-Caused Sources Present	Variable Flow Data Available	Notable Water Quality Trend	Parameter Listing in 2010	TMDL Decision	Qualifying Notes
Copper	Y/Y	Y	Y	Y	Y	Y	N	Y	Cu TMDL	High flow background CAL exceedance
Lead	N/N	N	N	Y	Y	Y	N	Y	No Pb TMDL	Aging dataset at L-7
Mercury	N/N	N	Unknown	Y	Y	Y	N	Y	Hg TMDL	Aging dataset High MDLs
Selenium	Y/Y	Y	Y	Y	Y	Y	N	Y	Se TMDL	Aging dataset at L-7

Table 5-15. Metals decision factors and TMDL conclusions for Montana Gulch

Pollutant Parameter	CAL/AAL Exceedance Rate > 10%	Results Twice the AAL Criterion	Supplemental Indicators Suggest Impairment	Human-Caused Sources Present	Variable Flow Data Available	Notable Water Quality Trend	Parameter Listing in 2010	TMDL Decision	Qualifying Notes
Aluminum	N	Y	Y	Y	Y	N	N	Al TMDL	Single result greater than twice AAL
Arsenic	N/N	N	Y	Y	N	Y	Y	As TMDL	HH exceedances
Cadmium	Y/N	Y	Y	Y	N	Y	Y	Cd TMDL	Increasing trend at MT Pond outfall
Copper	N/N	N	Y	Y	N	Y	Y	No Cu TMDL	Increasing trend at MT Pond since late 2005
Cyanide	Y/N	Y	Y	Y	N	Y	N	CN TMDL	Increasing trend at MT Pond since mid-2004
Nickel	Y/N	N	Y	Y	N	Y	N	Ni TMDL	Increasing trend at MT Pond since late 2005
Selenium	Y/Y	Y	Y	Y	N	Y	N	Se TMDL	Increasing trend at MT Pond since mid-2004
Zinc	N/N	Y	Y	Y	N	Y	N	Zn TMDL	Increasing trend at MT Pond since March, 2005

Table 5-16. Metals decision factors and TMDL conclusions for Rock Creek

Pollutant Parameter	CAL/AAL Exceedance Rate > 10%	Results Twice the AAL Criterion	HH Criterion Exceeded	Supplemental Indicators Suggest Impairment	Human-Caused Sources Present	Variable Flow Data Available	Notable Water Quality Trend	Parameter Listing in 2010	TMDL Decision	Qualifying Notes
Cadmium	Y/N	N	Y	Y	Y	Y	N	Y	Cd TMDL	Aging dataset
Copper	Y/Y	Y	N	Y	Y	Y	N	Y	Cu TMDL	Aging dataset
Lead	Y/N	N	Y	Y	Y	Y	N	Y	Pb TMDL	High MDLs
Mercury	N/N	N	Unknown	Y	Y	Y	N	Y	Hg TMDL	High MDLs
Selenium	N/N	N	N	Y	Y	Y	N	Y	Se TMDL	Old data, previous listing, sources
Zinc	N/N	Y	N	Y	Y	Y	N	Y	Zn TMDL	Single result > 2(AAL)

Table 5-17. Metals decision factors and TMDL conclusions for Ruby Gulch

Pollutant Parameter	CAL/AAL Exceedance Rate > 10%	Results Twice the AAL Criterion	Supplemental Indicators Suggest Impairment	Human-Caused Sources Present	Variable Flow Data Available	Notable Water Quality Trend	Parameter Listing in 2010	TMDL Decision	Qualifying Notes
Aluminum	Y/Y	Y	Y	Y	N	N	N	Al TMDL	Small sample size, High MDLs
Cadmium	Y/Y	Y	Y	Y	N	N	Y	Cd TMDL	
Chromium	N/N	N	Y	Y	N	N	Y	Cr TMDL	Listing from old data with one HH exceedance in groundwater
Copper	N/N	Y	Y	Y	N	N	Y	No Cu TMDL	Results > 2(AAL) are 1995-1997 data
Cyanide	Y/N	Y	Y	Y	N	Y	N	CN TMDL	Pulses of CN in Zortman WWTP outfall 2003-2005
Lead	N/N	N	Y	Y	N	N	Y	Pb TMDL	HH exceedances
Mercury	N/N	N	Y	Y	N	N	Y	Hg TMDL	High MDLs prevent drinking water assessment
Selenium	Y/N	N	Y	Y	N	Y	Y	Se TMDL	Long-term decrease in Zortman WWTP loading
Zinc	N/N	Y	Y	Y	N	N	Y	Zn TMDL	HH exceedance

Table 5-18. Metals decision factors and TMDL conclusions for Ruby Creek

Pollutant Parameter	CAL/AAL Exceedance Rate > 10%	Results Twice the AAL Criterion	Supplemental Indicators Suggest Impairment	Human-Caused Sources Present	Variable Flow Data Available	Notable Water Quality Trend	Parameter Listing in 2010	TMDL Decision	Qualifying Notes
Aluminum	Unknown	N	Y	Y	N	N	Y	Al TMDL	High MDL
Cadmium	Y/Y	Y	Y	Y	N	N	Y	Cd TMDL	Small dataset pre-2000
Copper	Y/Y	Y	Y	Y	N	N	Y	Cu TMDL	Small dataset pre-2000
Lead	Y/N	N	Y	Y	N	N	Y	Pb TMDL	High MDLs
Mercury	Y	N	Y	Y	N	N	Y	Hg TMDL	High MDLs
Selenium	Y/Y	N	Y	Y	N	N	Y	Se TMDL	8 of 9 results pre-2000
Zinc	Y/Y	Y	Y	Y	N	N	Y	Zn TMDL	3 of 7 results pre-2000

Table 5-19. Metals decision factors and TMDL conclusions for Sullivan Creek

Pollutant Parameter	CAL/AAL Exceedance Rate > 10%	Results Twice the AAL Criterion	HH Criterion Exceeded	Supplemental Indicators Suggest Impairment	Human-Caused Sources Present	Variable Flow Data Available	Notable Water Quality Trend	Parameter Listing in 2010	TMDL Decision	Qualifying Notes
Cadmium	Y/N	N	Y	Y	Y	N	N	N	Cd TMDL	
Iron	Y/NA	NA	NA	Y	Y	N	N	N	Fe TMDL	
Lead	Y/N	N	Y	Y	Y	N	N	N	Pb TMDL	
Selenium	N/N	N	N	Y	Y	N	Y	N	Se TMDL	Recent trend of CAL exceedance in old dataset
Zinc	Y/Y	Y	N	Y	Y	N	N	N	Zn TMDL	

Table 5-20. Metals decision factors and TMDL conclusions for Swift Gulch Creek

Pollutant Parameter	CAL/AAL Exceedance Rate > 10%	Results Twice the AAL Criterion	HH Criterion Exceeded	Supplemental Indicators Suggest Impairment	Human-Caused Sources Present	Variable Flow Data Available	Notable Water Quality Trend	Parameter Listing in 2010	TMDL Decision	Qualifying Notes
Aluminum	Y/N	Y	NA	Y	Y	Y	N	Y	Al TMDL	Aging Dataset, High MDLs
Arsenic	N/N	N	Y	Y	Y	Y	Y	Y	As TMDL	Increasing As Trend
Cadmium	Y/Y	Y	Y	Y	Y	Y	Y	Y	Cd TMDL	Increasing Cd Trend, High MDLs
Copper	Y/Y	Y	Y	Y	Y	Y	Y	Y	Cu TMDL	Increasing Cu Trend, High MDLs
Cyanide	N/N	Y	N	Y	Y	Y	Y	Y	CN TMDL	Decreasing trend
Iron	Y/NA	NA	NA	Y	Y	Y	Y	Y	Fe TMDL	Increasing trend
Lead	N/N	N	N	Y	Y	Y	Y	Y	No Pb TMDL	Decreasing trend
Nickel	Y/N	N	Y	Y	Y	Y	Y	Y	Ni TMDL	Increasing trend
Selenium	N/N	N	N	Y	Y	Y	N	Y	No Se TMDL	
Thallium	NA/NA	NA/NA	Unknown	Y	Unknown	Y	N	Y	TI TMDL	High MDLs
Zinc	Y/Y	Y	Y	Y	Y	Y	Y	Y	Zn TMDL	Increasing trend

5.5.1 TMDL Development Summary

Twelve stream segments in the Landusky TPA require the development of 63 TMDLs for metals and cyanide (**Table 5-21**). The metals of concern include aluminum, arsenic, cadmium, chromium, copper, iron, lead, mercury, nickel, selenium, thallium and zinc. Cyanide TMDLs will be developed for Montana Gulch, Ruby Gulch and Swift Gulch Creek. As indicated in **Table 5-21**, 7 of the 12 streams are listed in 2010 for pH. They include Alder Gulch, Mill Gulch, Montana Gulch, Rock Creek, Ruby Gulch, Ruby Creek, and Swift Gulch Creek. Surrogate metal parameters have been selected to address the impairments caused by pH. Cadmium will serve as the pH surrogate in Alder Gulch, Montana Gulch, Rock Creek, Ruby Gulch, Ruby Creek and Swift Gulch Creek; copper will serve as the pH surrogate in Mill Gulch.

Several parameters that were not listed as impairment causes in the 2010 Integrated Report were added to the list of needed TMDLs based on data reviews. All five metal causes for Sullivan Creek are new listings. Iron is a new cause listing for South Big Horn Creek. Arsenic and cadmium are new listings for King Creek. Aluminum, cyanide, nickel, selenium, and zinc are new listings in Montana Gulch. Aluminum and cyanide are new listings for Ruby Gulch. Conversely, the data review identified several pollutants included in the 2010 Integrated Report that are no longer causing impairment. These include cadmium and iron in Beaver Creek, lead in Mill Gulch, copper in Montana Gulch, copper-in Ruby Gulch, and selenium and lead in Swift Gulch Creek.

Table 5-21. Streams requiring TMDLs for metal and cyanide pollutants.

Waterbody Segment ID	Waterbody Segment	2010 Integrated Report Listings (metals-related)	Verified Target Exceedances and TMDL Developed
MT40E002_051	Alder Gulch	Cd, Cu, Hg, Pb, Se, Zn, pH	Cd, Cu, Hg, Pb, Se, Zn
MT40M001_011	Beaver Creek	Cd, Fe, Pb	Pb
MT40I001_030	South Big Horn Creek	Al, As, Cd, Ni, Zn	Al, As, Cd, Fe, Ni, Zn
MT40I001_040	King Creek	Se	As, Cd, Se
MT40I001_050	Lodge Pole Creek	Cd, Hg	Cd, Hg
MT40E002_100	Mill Gulch	Cu, Hg, Pb, Se, pH	Cu, Hg, Se
MT40E002_010	Montana Gulch	As, Cd, Cu pH	Al, As, Cd, CN, Ni, Se, Zn
MT40E002_090	Rock Creek	Cd, Cu, Hg, Pb, Se, Zn, pH	Cd, Cu, Hg, Pb, Se, Zn
MT40E002_060	Ruby Creek	Al, Cd, Cu, Hg, Pb, Se, Zn, pH	Al, Cd, Cu, Hg, Pb, Se, Zn
MT40E002_070	Ruby Gulch	Cd, Cr, Cu, Hg, Pb, Se, Zn, pH	Al, Cd, CN, Cr, Hg, Pb, Se, Zn
MT40E002_110	Sullivan Creek	Not metals listed	Cd, Fe, Pb, Se, Zn
MT40I002_010	Swift Gulch Creek	Al, As, Cd, Cu, CN, Fe, Pb, Ni, Se, Ti, Zn, pH	Al, As, Cd, Cu, CN, Fe, Ni, Tl, Zn

5.6 TMDLs

As explained in **Section 4.0**, TMDLs are the maximum amount of each pollutant parameter that a stream can assimilate without exceeding water quality standards. A stream's ability to assimilate metal pollutants is based on its hardness (for hardness-dependent metals) and its capacity to dilute metal concentrations with increased flow. Stream discharge and water hardness both vary seasonally. Therefore, established TMDLs must provide seasonal protection of beneficial uses.

TMDLs are calculated according to *Equation 1*:

Equation 1: $TMDL = (X)*(Y)*(0.0054)$,
where:

TMDL = Total Maximum Daily Load in lbs/day for pollutants of concern

X = the most restrictive water quality target (typically either the CAL or HH criterion in $\mu\text{g/L}$)

Y = streamflow in cubic feet per second (cfs)

0.0054 = a conversion factor to obtain loading in units of pounds per day.

As discussed in **Section 5.4**, where the numeric criteria apply to protection of both aquatic life and human health, the most restrictive value is adopted as the water quality target and inserted as the value for "X" in the above equation. Using a CAL criterion that is based on a 96-average value to calculate a daily load provides an implicit margin of safety in the calculated TMDL.

Although the TMDLs are based on HH or CAL criteria, the AAL criteria are also water quality targets applied as an instantaneous instream concentration that shall not be exceeded (see **Section 4.3**). For example, an instantaneous spike in a pollutant concentration during a capture system bypass may exceed the acute criterion while remaining in compliance with the chronic standard. The TMDL will ultimately be defined as the total allowable loading using a time period consistent with the application of the most appropriate numeric water quality criterion. Remediation required to eliminate pollutant loading that exceeds the chronic standards will often mitigate more extreme short duration exceedances of acute criteria.

5.6.1 TMDLS for Non-Hardness Dependent Metals and Cyanide

The toxicity of several metal elements and the cyanide are independent of water hardness. The TMDLS for these substances can be illustrated graphically using Equation 1 above with the most restrictive water quality criterion substituted for the value of "X", and stream discharge in cubic feet per second (cfs) substituted for the value of "Y". **Figure 5-6** shows the graphs of the TMDLs for Fe, As, Se, CN, Tl, and Hg based on the most restrictive water quality criterion for each parameter over a range of stream discharge common in the Landusky TPA. For C-3 classified waters where drinking water is not an established use, the loading graphs for arsenic and mercury would be based on the less restrictive aquatic life criteria, and appear higher on the vertical loading axis.

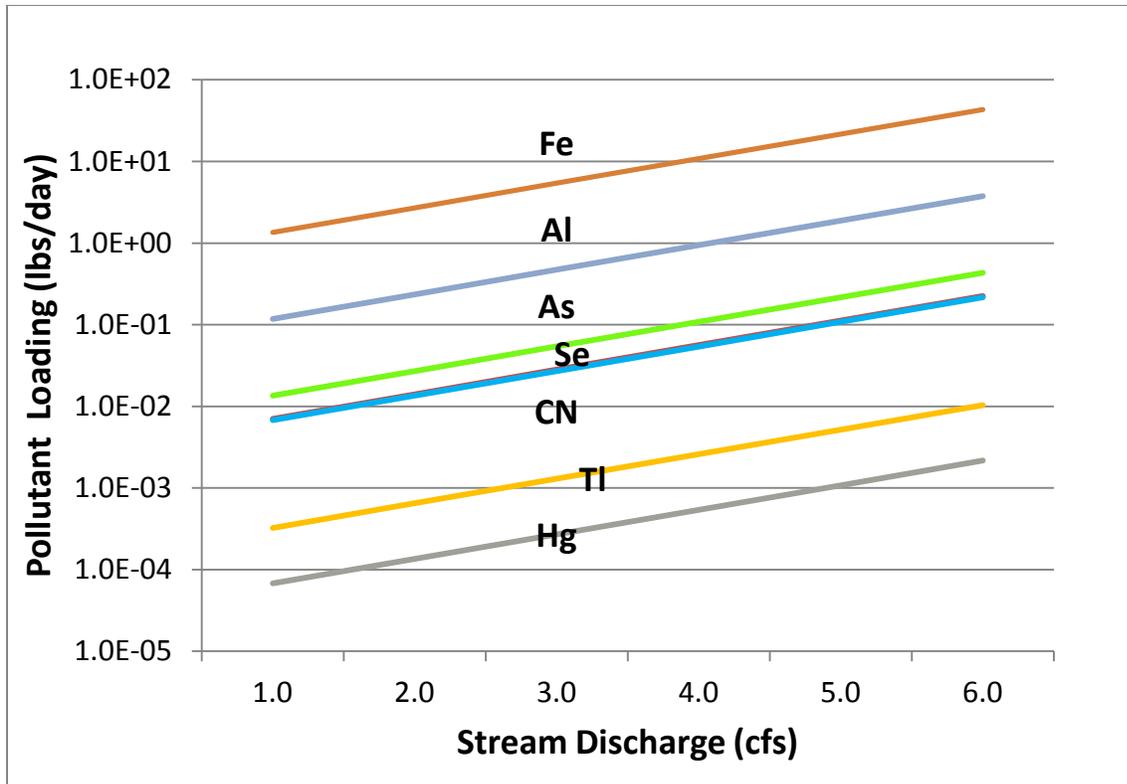


Figure 5-6. Graphs of TMDLs (lbs/day) for iron (Fe), aluminum (Al), arsenic (As), selenium (Se), cyanide (CN), thallium (TI), and Mercury (Hg) with increasing stream discharge

The **Figure 5-6** graphs are based on the CAL criterion for iron (1,000 µg/L), the CAL for aluminum (87 µg/L), the HH criterion for arsenic (10 µg/L), the CAL criterion for selenium (5 µg/L), the CAL criterion for cyanide (5.2 µg/L), the HH criterion for thallium (0.24 µg/L), and the HH criterion for mercury (0.05 µg/L). The TMDL graphs in **Figure 5-6** apply to all aluminum, arsenic, cyanide, iron, mercury, selenium, and thallium TMDLs within this document. Where drinking water is not an established use for waters classified as C-3, the arsenic and mercury TMDL targets are the CAL criteria for these two metals. Therefore, the TMDLs for arsenic and mercury in C-3 streams reflect these less restrictive targets.

5.6.2 Example TMDLS for Metals and Cyanide for Listed Streams

Table 5-22 contains example TMDLs, also calculated using *Equation 1*, for the 12 waterbody segments requiring one or more metals or cyanide TMDLs. The example high- and low-flow TMDLs apply at a selected monitoring station on each stream. High flow values in the table are medians of flow measurements greater than the 50th percentile flow for the site. Low flows are medians of flow measurements less than the 50th percentile. The hardness values, used to calculate the hardness-dependent metals targets, are mean values for each flow condition. The water quality targets are the most restrictive among the CAL, AAL, and HH criteria. Example TMDLs in the table are in units of pounds per day. Monitoring station selection is guided by availability of flow and hardness data and a station location that reflects loading from significant sources. The calculated example TMDLs represent the maximum load (lbs/day) of each pollutant that each waterbody can receive without exceeding applicable water quality standards for the specified flow and hardness. The raw data for the metals of concern are included in **Appendix B**. **Table 5-22** also contains calculated percent reductions in loading needed for each stream to meet metals and cyanide TMDLs under high and low flow conditions.

Pollutant loading in the planning area occurs in pulses caused by periodic high precipitation events or by capture system bypasses. Pulses of high loading are often separated by extended periods of minimal loading due to low flows, proper capture and treatment system function, or a combination of these. It is common for datasets to consist of a series of elevated metals values followed by a longer series of low values or values less than analytical MDLs. Although the dataset contains a sufficient number or magnitude of exceedances to be impaired, the mean or median values for the datasets are commonly less than water quality targets. The reductions for each stream and flow condition in **Table 5-22** are calculated from a subset of the data for the entire stream segment that exceeds the most restrictive water quality target for that parameter. The reductions are those needed to bring both the number and degree of target exceedances below the impairment thresholds described above in **Section 5.4.3**. Load reductions are not required for datasets that contain no target exceedances, and a value of "0" is entered in the table in these instances.

Table 5-22. Example metals TMDLs for waterbodies in the Landusky TPA

Stream Segment (Segment ID)	Station	Discharge (cfs)		Hardness		Metal	Target Concentration (µg/L)		TMDL (lbs/day)		Percent Load Reduction Based on Sampled Target Exceedance	
		High flow	Low flow	High flow	Low flow		High flow	Low flow	High flow	Low flow	High flow	Low flow
Alder Gulch (MT40E002_050)	Z-8	1.5	0.05	140	300	Cadmium	0.35	0.61	0.003	0.0002	96	24
						Copper	12.44	23.85	0.10	0.006	89	96
						Lead	4.88	12.88	0.040	0.003	90	7
						Zinc	159.34	303.94	1.290	0.082	45	80
				NA		Mercury	0.05	0.05	0.0004	0.000014	95	90
				NA		Selenium	5	5	0.041	0.00135	73	0
Beaver Creek (MT40M001_011)	Z-31	0.42	0.05	83	109	Lead	2.51	3.55	0.0057	0.00096	88	0
South Big Horn Creek (MT40I001_030)	L-48	0.49	0.03	227	400	Cadmium	0.50	0.76	0.001	0.0001	80	85
						Nickel	104.37	168.54	0.280	0.027	29	60
						Zinc	239.98	387.83	0.635	0.063	75	90
				NA		Aluminum	87	87	0.230	0.014	0	71
				NA		Arsenic	10	10	0.026	0.002	70	0
				NA		Iron	1,000	1,000	2.650	0.162	82	0
King Creek (MT40I001_040)	L-5	0.02	0.002	364	397	Cadmium	0.70	0.75	0.0001	0.00001	79	83
				NA		Arsenic	10	10	0.0011	0.0001	30	24
				NA		Selenium	5	5	0.0005	0.00005	88	89
Lodge Pole Creek (MT40I001_050)	Z-7	4.58	0.35	149	200	Cadmium	0.36	0.45	0.009	0.001	50	57
				NA		Mercury	0.05	0.05	0.001	0.0001	90	90
Mill Gulch (MT40E002_100)	L-7	0.056	0.015	387	391	Copper	29.65	29.91	0.009	0.002	98	94
				NA		Mercury	0.05	0.05	0.00002	0.000004	90	90
				NA		Selenium	5	5	0.002	0.0004	96	82
Montana Gulch (MT40E002_010)	L-2	1.14	0.44	383	397	Cadmium	0.73	0.75	0.004	0.002	88	91
						Nickel	162.46	167.47	1.0	0.40	0	35
						Zinc	373.82	385.36	2.30	0.92	0	64
				NA		Arsenic	10	10	0.062	0.024	78	85
				NA		Aluminum	87	87	0.536	0.021	0	90
				NA		Cyanide	5.2	5.2	0.032	0.012	0	93
				NA		Selenium	5	5	0.031	0.012	88	82

Table 5-22. Example metals TMDLs for waterbodies in the Landusky TPA

Stream Segment (Segment ID)	Station	Discharge (cfs)		Hardness		Metal	Target Concentration (µg/L)		TMDL (lbs/day)		Percent Load Reduction Based on Sampled Target Exceedance	
		High flow	Low flow	High flow	Low flow		High flow	Low flow	High flow	Low flow	High flow	Low flow
Rock Creek (MT40E002_090)	L-23	0.446	0.021	142	283	Cadmium	0.35	0.58	0.0008	0.00007	80	80
						Copper	12.59	22.69	0.030	0.0026	80	0
						Lead	4.97	11.96	0.012	0.0014	85	10
						Zinc	161.27	289.28	0.388	0.033	26	0
				NA		Mercury	0.05	0.05	0.0001	0.000006	90	90
				NA		Selenium	5	5	0.012	0.0006	0	45
Ruby Creek (MT40E002_060)	Z-32	0.37	0.03	400	369	Cadmium	0.76	0.71	0.0015	0.0001	99	0
						Copper	30.5	28.47	0.061	0.005	99	8
						Lead	15	15	0.03	0.0024	93	96
						Zinc	387.83	362.21	0.77	0.059	95	90
				NA		Aluminum	87	87	0.174	0.014	13	0
				NA		Mercury	0.91	0.91	0.0018	0.00015	78	93
NA		Selenium	5	5	0.01	0.0008	98	98				
Ruby Gulch (MT40E002_070)	Z-15	0.40	0.12	387	393	Cadmium	0.74	0.75	0.0016	0.0005	94	96
						Chromium	261.06	264.37	0.564	0.171	0	0
						Lead	15	15	0.0324	0.01	98	0
						Zinc	377.12	377.12	0.815	0.244	57	74
				NA		Aluminum	87	87	0.19	0.056	55	99
				NA		Cyanide	5.2	5.2	0.011	0.003	85	45
				NA		Mercury	0.91	0.91	0.002	0.0006	98	90
NA		Selenium	5	5	0.011	0.003	50	50				
Sullivan Creek (MT40E002_110)	D-4	0.083	0.007	191	269	Cadmium	0.44	0.56	0.0002	0.00002	94	50
						Lead	7.25	11.21	0.003	0.0004	85	90
						Zinc	207.32	277.11	0.093	0.010	73	5
				NA		Iron	1,000	1,000	0.45	0.038	1	48
				NA		Selenium	5	5	0.00019	0.0002	55	0

Table 5-22. Example metals TMDLs for waterbodies in the Landusky TPA

Stream Segment (Segment ID)	Station	Discharge (cfs)		Hardness		Metal	Target Concentration (µg/L)		TMDL (lbs/day)		Percent Load Reduction Based on Sampled Target Exceedance	
		High flow	Low flow	High flow	Low flow		High flow	Low flow	High flow	Low flow	High flow	Low flow
Swift Gulch Creek (MT40I002_010)	L-19	0.43	0.065	242	347	Cadmium	0.56	0.68	0.0013	0.0002	97	92
						Copper	21.73	27.01	0.050	0.009	87	86
						Nickel	120.49	149.45	0.279	0.052	30	73
						Zinc	277.11	343.83	0.643	0.121	80	95
				NA		Aluminum	87	87	0.202	0.031	86	13
				NA		Arsenic	10	10	0.023	0.0035	77	88
				NA		Cyanide	5.2	5.2	0.012	0.002	0	71
				NA		Iron	1,000	1,000	2.32	0.351	97	99
NA		Thallium	0.24	0.24	0.0006	0.0001	84	84				

5.7 LOADING SUMMARIES AND ALLOCATIONS

The following sections provide a loading summary and source allocation for each pollutant-waterbody combination with a TMDL. Loading summaries are based on the sample data contained in **Appendix B** and summarized in **Appendix F**. The aim of the loading summaries is to illustrate loading trends and discuss seasonal and significant loading sources and pathways. Loads are expressed in units of pounds per day. While units of pounds per day are appropriate for expressing TMDLs, the most appropriate means of measuring compliance with metals TMDLs would be a measurement of the contaminant concentration in surface water samples.

As discussed in **Section 4.0**, a TMDL is the sum of all of the load allocations (LAs), wasteload allocations (WLAs), and a margin of safety (MOS). LAs are allowable pollutant loads assigned to nonpoint sources and may include the cumulative pollutant load from naturally occurring and human caused sources. When possible, LAs are provided separately to naturally occurring sources. WLAs are allowable pollutant loads that are assigned to permitted and non-permitted point sources. Mining related waste sources such as treatment plant discharges, leach pads, and waste rock repositories are non-permitted point sources subject to WLAs. TMDLs are expressed by the following general equation:

$$\text{TMDL} = \text{LA}_{\text{NB}} + \text{WLA}_{\text{MS}} + \text{MOS}$$

The prevailing human-caused source of metals loading in the Landusky TPA is from ZMI mining at the Zortman and Landusky mines between 1979 and 1998. Where adequate data are available to evaluate loading from individual mining sources, these non-permitted point sources will be given separate WLAs. Where data from discrete mining sources is not available, loading contributions from mining are grouped into composite WLAs. The adaptive management process discussed in **Section 5.9** is recommended where more detail is needed for future refinement and adjustment of composite WLAs to mining sources.

TMDLs are required to incorporate a MOS. All metals and cyanide TMDLs in this document apply an implicit MOS through the adoption of a variety of conservative assumptions in calculating TMDLs and estimating pollutant loads. These assumptions are described in more detail in **Section 5.8.2**. Therefore, the implicit MOS is implied in the TMDL equations developed below and not repeated in each developed equation.

5.7.1 Alder Gulch (MT40E002_051)

Loading Summary

Metals target exceedances in Alder Gulch result from mine related ARD entering its northern tributaries of Carter Gulch and Alder Spur from Zortman Mine facilities. These include seepage from beneath the Alabama Pit complex, seepage through 3.7 million tons of waste rock in the Alder Waste Rock Repository, and seepage from beneath three leach pads used between 1979 and 1984 that occupy the ridge separating Alder and Ruby gulches (**Figure A-16**).

The bulk of water quality data for Alder Gulch dates from 1990 to 1998. Elevated concentrations of cadmium, copper, lead, selenium, and zinc in Alder Gulch coincide with completion of the Alder Waste Rock Repository in 1990. Large spikes in metals concentrations occur during low flows from 1990-1992. The metals listings for Alder Gulch largely result from data collected during this period. The ARD conditions causing elevated metals concentrations also affect water

column SO_4 concentration. **Figure 5-7** shows the SO_4 monitoring record for site Z-8 in Alder Gulch and the corresponding concentration spike from 1990 to 1992.

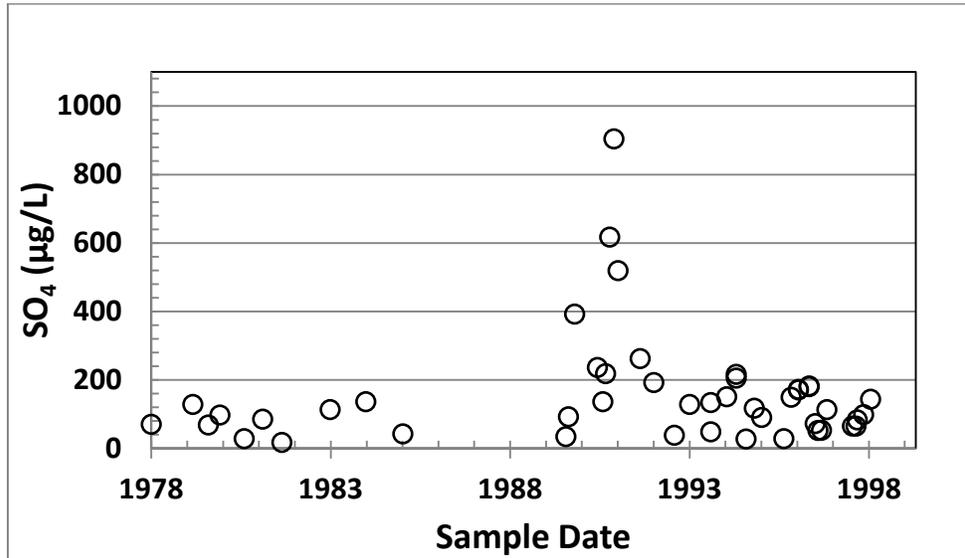


Figure 5-7. Sulfate concentration record at site Z-8 in Alder Gulch.

Surface reclamation of the Alder Waste Rock Repository was complete in 1992. Seepage capture systems were installed during 1994 in Carter Gulch below the Alder Waste Rock Repository and in Alder Spur below the 83 and 84 leach pad dikes. A decrease in surface water metals concentrations occurred after reclamation and continued until monitoring ended in 1998.

An extended period of heavy rainfall during May of 2011 caused a slope failure at the base of the Alder Gulch Waste Rock Repository. The failure removed the Carter Gulch seepage capture system. The data used to develop Alder Gulch TMDLs and allocations does not include that collected after the storm damage. Future monitoring of Alder Gulch water quality will require lower MDLs that allows a comparison of results to aquatic life criteria.

TMDLs and Allocations

The metals TMDLs and allocations for high and low flow conditions in Alder Gulch are summarized below and **Table 5-23**. The allocations for cadmium, lead, selenium, and zinc include load allocations to natural background concentrations ($\text{LA}_{\text{ALDR GUL NB}}$) and a wasteload allocation to mining sources of these four metals ($\text{WLA}_{\text{ALDR GUL MS}}$). Natural background loading is calculated using the median metal concentrations of cadmium, lead, selenium, and zinc from the four Alder Gulch background sites Z-60, Z-61, Z-62, and AGSS-10 located in headwaters tributaries. The Alder Gulch TMDL is summarized by the following equation:

$$\text{TMDL}_{\text{ALDR GUL}} = \text{LA}_{\text{ALDR GUL NB}} + \text{WLA}_{\text{ALDR GUL MS}}$$

Where background sample analysis results are less than MDLs, one half of the MDL is the assumed background concentration. The wasteload allocation to mining sources is obtained by subtracting the calculated background load from the TMDL. The allocation scheme for cadmium, lead, selenium, and zinc assumes that natural background loading rates do not exceed water

quality standards. The allocations also assume that further application of BMPs to mining sources will reduce loading so that TMDLs and water quality standards are met.

A separate allocation scheme is proposed for copper and mercury TMDLs. A composite WLA allocation to the sum of natural background and mining sources is proposed for copper and mercury and is reflected in the following equation

$$\text{TMDL}_{\text{ALDR GUL}} = (\text{WLA}_{\text{ALDR GUL NB}} + \text{WLA}_{\text{ALDR GUL MS}})$$

Using a composite allocation, the sum of allowable copper loading from natural background, plus mining sources, is equal to the TMDLs of 0.010 lbs/day under high flow and 0.006 lbs/day under low flow conditions. The TMDL equations for copper are inserted into **Table 5-23** for high and low flow conditions.

Copper concentrations measured at the four background sites from 1996 to 1998 exceeded the hardness-based CAL criteria by a factor of three. All samples were collected under high flow conditions. During the same period, a similar high flow exceedance magnitude was measured at site Z-2, the site farthest upstream among the three current condition sites in Alder Gulch. The composite allocation serves as a limit on copper loading until targeted monitoring in headwaters reaches of Alder Gulch can better describe natural background copper loading under a range of flow conditions.

A composite allocation similar to that for copper is proposed for mercury in Alder Gulch. Natural background mercury loading to Alder Gulch is obscured by the use of MDLs that exceed the CAL criterion of 0.91 µg/L. Of the 52 Hg results for Alder Gulch, 51 are reported as less than the MDL. The composite allocation to natural background and mining sources of mercury will equal 0.0074 lbs/day under high flow and 0.00025 lbs/day under low flow conditions. The TMDL equations for high and low flow Hg loading are inserted into **Table 5-23**. Additional monitoring at background and current condition sites, with sufficiently low MDLs applied during both high and low flow conditions is recommended to better refine the mercury allocation.

Table 5-23. Cadmium, copper, lead, mercury, selenium and zinc TMDLs and load- and wasteload allocation examples for Alder Gulch at site Z-8.

Metal	Flow Conditions	TMDL (lbs/day)	Percent Reduction Needed	LA _{NB} (lbs/day)	WLA _{MS} (lbs/day)
Cadmium	High flow	0.003	96	0.0008	0.0022
	Low flow	0.0002	24	0.00003	0.00017
Copper	High flow	0.10	89	TMDL = (LA_{ALDR GUL NB} + WLA_{ALDR GUL MS}) = 0.10 lbs/day	
	Low flow	0.006	96	TMDL (LA_{ALDR GUL NB} + WLA_{ALDR GUL MS}) = 0.006 lbs/day	
Lead	High flow	0.04	90	0.012	0.028
	Low flow	0.003	7	0.0004	0.0026
Mercury	High flow	0.0074	90	TMDL = (LA_{ALDR GUL NB} + WLA_{ALDR GUL MS}) = 0.0074 lbs/day	
	Low flow	0.00025	90	TMDL = (LA_{ALDR GUL NB} + WLA_{ALDR GUL MS}) = 0.00025 lbs/day	
Selenium	High flow	0.041	73	0.0041	0.037
	Low flow	0.00135	0	0.000135	0.00121
Zinc	High flow	1.29	45	0.162	1.128
	Low flow	0.082	80	0.0054	0.0766

5.7.2 Beaver Creek, (MT40M001_011)

Loading Summary

Only high flow target exceedances for lead occurred in Beaver Creek at sites Z-31 and Z-39. High flow exceedances also occurred at background site Z-27. Despite its remoteness from obvious sources, exceedances at site Z-27 are similar in magnitude to those farther downstream at sites with more conceivable sources from road sediment and mine tailings at the Beaver Mine near site Z-39. A high flow sample collected in 2005 about 1.5 miles below site Z-39 from DEQ assessment site M31BEVRC03 contained less than 0.5 µg/L. The sediment sample collected at site M31BEVRC03 did not exceed the sediment lead target of 91.3 µg/g.

The exceedances occurred in samples collected from 1990 to 2001 and were about 10 times the CAL criteria. The data suggest a similar level of loading at both the background site and at the upper two current conditions sites prior to 2001. The similar exceedance pattern for both the background and current condition sites suggests either naturally high background lead loading at high flows with little downstream effects or some level of human-caused loading affecting site Z-27 in a headwaters tributary.

TMDLs and Allocations

The similarity among the upper three sites in number, degree, and timing of exceedances prevents a specific load allocation to background sources of lead in Beaver Creek. Therefore, a composite waste load allocation is proposed to the sum of natural background (BVR CR NB) and Beaver Creek mining sources (BVR CR MS) during high flow conditions. The composite wasteload allocation is calculated based on Beaver Creek flow at site Z-31 and is calculated by making the sum of the composite allocation equal to the TMDL as summarized in the following equation:

$$\text{TMDL} = \text{WLA}(\text{BVR CR NB} + \text{BVR CR MS}) = 0.0057 \text{ lbs/day.}$$

In this case, the sum of natural background and mining sources is equal to the high flow TMDL of 0.0057 pounds of lead per day. The following equation expresses the low flow TMDL for lead in Beaver Creek:

$$\text{TMDL} = \text{WLA}(\text{BVR CR NB} + \text{BVR CR MS}) = 0.00096 \text{ lbs/day.}$$

5.7.3 South Big Horn Creek, (MT40I001_030)

Loading Summary

Loading sources to South Big Horn Creek include natural background sources and mining sources in Swift Gulch Creek affecting South Big Horn Creek water quality below the Swift Gulch Creek confluence. Swift Gulch Creek TMDLs and allocations are described below in **Section 5.7.12**. Swift Gulch Creek water quality is affected by a series of streambank springs hydrologically connected to the August-Surprise-Queen Rose pit complex at the Landusky Mine. The location of the metal contaminated springs is approximately one half mile above the Swift Gulch Creek confluence with South Big Horn Creek. The oxidation of iron sulfides in the bottom of the pit complex creates acidic groundwater within a bedrock shear zone that serves as a flow conduit between the pits and surface water in Swift Gulch Creek.

Water quality data collection for most metals in South Big Horn Creek at site L-48 began in the spring of 1997 and continued through the following year. Sampling was resumed in 2003 and

has continued to the present on a seasonal basis. Monitoring at site L-48A began in 2003 has continued to the present on a near monthly basis.

Deteriorating water quality in Swift Gulch Creek prompted construction of a seasonally operated lime addition treatment plant in the Swift Gulch Creek drainage below the contaminated springs in 2010. The plant is designed to operate under base flow conditions in Swift Gulch Creek that routinely range from 50 to 100 gallon per minute (Spectrum Engineering, 2010). The annual median peak flow in Swift Gulch Creek is 3,000 gallons per minute. Construction of a plant capable of treating high flows was not considered feasible given the confined nature of drainage channel, lack of a reliable access route, and extreme flow fluctuations that are common for the stream (Spectrum Engineering, 2010). Although the plant is designed for base flow operations, the discharge of ARD affected springs into Swift Gulch Creek is a year round phenomenon.

The Swift Gulch Creek treatment plant receives wastewater from two upstream capture systems and treated water is discharged to two settling ponds downstream of the plant. The treated effluent returns to the Swift Gulch Creek channel below the ponds. Extremely high flows in Swift Gulch Creek during May of 2011 severely damaged the capture systems causing a shutdown of the treatment plant pending repairs to the capture system plumbing.

TMDLs and Allocations

Example metals TMDLs and allocations for high and low flow conditions in South Big Horn Creek at site L-48 are summarized below in **Table 5-24**. The allocations consist of load allocations to natural background sources ($LA_{SBH\ CR\ NB}$) of the six metal parameters in the table and wasteload allocations to mining sources ($WLA_{SBH\ CR\ MS}$) at the Landusky Mine. The TMDL is stated in the following equation:

$$TMDL_{SBH\ CR} = LA_{SBH\ CR\ NB} + WLA_{SBH\ CR\ MS}$$

Natural background loading is represented by median high and low flow metal concentrations of aluminum, arsenic, cadmium, iron, nickel, and zinc calculated for site L-21, located just upstream of the confluence with Swift Gulch Creek. It is assumed that the WLA for South Big Horn Creek includes those developed below in **Table 5-35** for Swift Gulch Creek for the metal pollutants affecting downstream water quality in South Big Horn Creek at site L-48. The South Big Horn Creek allocations below in **Table 5-24** are not the sum of those for both Swift Gulch Creek and South Big Horn Creek because the WLAs for the two stream segments are based on samples collected on different dates with different flow and hardness conditions. The loading in **Table 5-24** is intended to represent that contributed from upstream sources in Swift Gulch Creek.

Table 5-24. Aluminum, arsenic, cadmium, iron, nickel, and zinc TMDLs and allocation examples for South Big Horn Creek at site L-48

Metal	Flow Conditions	TMDL (lbs/day)	Percent Reduction Needed	LA_{NB} (lbs/day)	WLA_{MS} (lbs/day)
Aluminum	High flow	0.230	0	0.132	0.098
	Low flow	0.014	71	0.008	0.006
Arsenic	High flow	0.026	70	0.004	0.022
	Low flow	0.002	0	0.0002	0.0018
Cadmium	High flow	0.001	80	0.00026	0.00074
	Low flow	0.0001	85	0.00001	0.00009

Table 5-24. Aluminum, arsenic, cadmium, iron, nickel, and zinc TMDLs and allocation examples for South Big Horn Creek at site L-48

Metal	Flow Conditions	TMDL (lbs/day)	Percent Reduction Needed	LA _{NB} (lbs/day)	WLA _{MS} (lbs/day)
Iron	High flow	2.650	82	0.340	2.31
	Low flow	0.162	0	0.002	0.160
Nickel	High flow	0.280	29	0.0265	0.254
	Low flow	0.027	60	0.00012	0.0269
Zinc	High flow	0.635	75	0.013	0.622
	Low flow	0.063	90	0.0008	0.0622

Cadmium, nickel, and zinc exceedances are common under both high and low flow conditions. Iron and arsenic exceedances are almost exclusively high flow phenomena and low flow reductions are not required. Data for dissolved aluminum are sparse and restricted to low flow conditions. Therefore, reductions to high flow aluminum are not specified. The allocations assume that applying BMPs to mining sources will meet the TMDLs and water quality standards.

5.7.4 King Creek (MT40I001_040)

Loading Summary

King Creek sources of arsenic, cadmium, and selenium are residual tailings from historic cyanide mills near the top of the drainage and oxide waste rock from the nearby August-Little Ben and Gold Bug pits. The tailings were largely removed during restoration in 2000. Waste rock surfaces received coversoil and were revegetated. Stormwater and seepage through the waste rock collects behind a downstream interception trench, is routed through a passive treatment system for nutrient removal and surfaces as a seep at site L-5. The upper extent of the drainage is truncated by the August-Surprise-Queen Rose pit complex at the Landusky Mine. A broad groundwater divide exists beneath the pit complex and local ARD-affected groundwater may be a periodic source of metals in King Creek. Water quality data are available for sites L-5 in the upper drainage, the inlet to the Cumberland retention pond (site 503), and monitoring site L-39 located about one half mile downstream.

TMDLs and Allocations

The extent of mining disturbance in King Creek prevents locating a background water quality site within the drainage. Site L-40, located in a headwaters tributary of Montana Gulch is similar to upper King Creek in that both drain undisturbed portions of Mission Peak. The water quality record from site L-40 is used here to develop an allocation to natural background sources of metals loading.

Mining sources in upper King Creek receive a wasteload allocation ($WLA_{KG\ CR\ MS}$). A load allocation to naturally background sources ($LA_{KG\ CR\ NB}$) is calculated based on flow at L-5 and metals concentrations from site L-40 in a headwater tributary of Montana Gulch that is assumed to represent the background condition. Where metals concentrations at L-40 are less than MDLs, one half of the MDLs is used as the concentration value. The $WLA_{KG\ CR\ MS}$ is calculated by subtracting the $LA_{KG\ CR\ NB}$ from the TMDL. The King Creek TMDL is stated in the following equation:

$$TMDL_{KG\ CR} = LA_{KG\ CR\ NB} + WLA_{KG\ CR\ MS}$$

The TMDL components are summarized below and **Table 5-25** shows example TMDLs and allocations for measured high and low flow conditions in King Creek at site L-5.

Table 5-25. Arsenic, cadmium, and selenium TMDLs and allocation examples for arsenic, cadmium, and selenium in King Creek at site L-5.

TMDLs				Allocations	
Metal	Flow Condition	TMDL (lbs/day)	Needed Percent Reduction	LA _{KG CR NB} (lbs/day)	WLA _{KG CR MS} (lbs/day)
Arsenic	High flow	0.0011	30	0.0003	0.0008
	Low flow	0.0001	24	0.00003	0.00007
Cadmium	High flow	0.0001	79	0.00004	0.00006
	Low flow	0.00001	83	0.000004	0.000006
Selenium	High flow	0.0005	88	0.0003	0.0002
	Low flow	0.00005	89	0.00003	0.00002

This allocation scheme assumes that natural loading rates do not cause water quality standards to be exceeded and applying BMPs to mining sources will result in the loading reductions necessary to meet the TMDLs and water quality standards.

5.7.5 Lodge Pole Creek (MT40I001_050)

Loading Summary

Potential mining sources of cadmium are associated with the Ross Pit area that is the northernmost extent of the Zortman Mine (**Figure A-16**). Although mercury has not been detected in Lodge Pole Creek at sites Z-2 and Z-29 upstream of the Fort Belknap Reservation boundary, historic placer mining within the planning area, using mercury amalgamation for gold separation, could be a potential source of the positive mercury detection downstream at USGS station 06154430 near the town of Lodge Pole. This detection was extrapolated to the segment of Lodge Pole Creek south of the reservation boundary. There were two positive mercury detections among 24 mercury results for background sites Z-28 and Z-30, both occurred on the same date (5/15/91) under high flow conditions. Mercury has not been detected in 22 subsequent samples from these sites through 1996.

TMDLs and Allocations

Example TMDLs and allocations for cadmium and mercury in Lodge Pole Creek at site Z-7 are summarized in **Table 5-26**. The load allocation to natural background sources of cadmium ($LA_{LP CR NB}$) is calculated by multiplying high and low discharge values by the average metal concentrations at sites Z-28 and Z-30. Where results at these sites are less than MDLs, one half of the MDL is used as the concentration value in the calculations. The wasteload allocations to mining sources ($WLA_{LP CR MS}$) of cadmium are calculated by subtracting the $LA_{LP CR NB}$ from the cadmium TMDLs. The TMDL is stated in the following equation:

$$TMDL_{LP CR} = LA_{LP CR NB} + WLA_{LP CR MS}$$

The allocations for mercury in Lodge Pole Creek are formulated as a composite wasteload allocation to natural background plus mining sources ($WLA_{(LP CR NB + LP CR MS)}$) that is set equal to the high and low flow mercury TMDLs. The Lodge Pole Creek mercury TMDL is stated in the following equation that is inserted into **Table 5-26**:

$$\text{TMDL}_{\text{LP CR}} = \text{WLA}_{(\text{LP CR NB} + \text{LP CR MS})}$$

This approach is used because the MDLs for mercury used in monitoring are as much as an order of magnitude higher than the most restrictive water quality criteria. The high MDLs, combined with the large number of non-detections in both the natural background and current condition datasets equate to equal reduction requirements (90%) for the two datasets in order to meet the HH criterion of 0.05 µg/L. In other words, the high MDLs and large number of non-detections do not allow a clear, separate definition of the natural background and mining contributions to the TMDLs.

The composite allocation scheme assumes that natural background concentrations are less than the HH criterion and that actual mercury loading from mining sources both exceeds this criterion and can be reduced by further application of BMPs to mining sources. Further monitoring of both background and current condition sites using appropriate MDLs will be needed to fine tune the composite allocation and more accurately define loading from both source categories.

Table 5-26. Cadmium and mercury TMDLs and allocation examples for cadmium and mercury in Lodge Pole Creek at site Z-7

TMDLs				Allocations	
Metal	Flow Condition	TMDL (lbs/day)	Needed Percent Reduction	LA _{NB} (lbs/day)	WLA _{MS} (lbs/day)
Cadmium	High flow	0.009	50	0.00124	0.0078
	Low flow	0.001	57	0.000095	0.00091
Mercury	High flow	0.001	90	TMDL _{LP CR} = WLA _(LP CR NB + LP CR MS) = 0.001 lbs/day	
	Low flow	0.0001	90	TMDL _{LP CR} = WLA _(LP CR NB + LP CR MS) = 0.0001 lbs/day	

5.7.6 Mill Gulch (MT40E002_100)

Loading Summary

Metals loading to Mill Gulch is from a combination of surface stormwater and subsurface drainage from the 1987 leach pad, its supporting dike, and the Mill Gulch Waste Rock Dump occupying the upper reach of the drainage. Subsurface seepage from the more distant Gold Bug pit complex is also a potential source of ARD-affected groundwater discharging to Mill Gulch surface water. The Gold Bug pit was used as a repository for waste rock removed from the sulfidic August-Little Ben/Queen Rose pit complex. The Mill Gulch capture system was installed at the toe of the Mill Gulch Waste Rock Dump in 1997. Water is piped from the capture system to the Landusky wastewater treatment plant.

The metal exceedances resulting in the impairment listings for copper and selenium are concentrated at sites 506 and L-36, both located below the capture pond constructed near the base of the waste rock dump that occupies the upper portion of the drainage. Site 506 is a stormwater monitoring site below the pond and L-36 is the bypass of the seepage capture system.

TMDLs and Allocations

The potential metals sources are mining sources that receive a wasteload allocation (WLA_{MIL GUL MS}). The WLA_{MIL GUL MS} is calculated by subtracting the load allocation to natural background

sources ($LA_{MIL\ GUL\ NB}$) from the TMDL. The allocations for allowable copper and selenium loading are stated in the following equation:

$$TMDL = LA_{MIL\ GUL\ NB} + WLA_{MIL\ GUL\ MS}$$

The $LA_{MIL\ GUL\ NB}$ is calculated using the mean concentrations from sites L-40 and RCSS-5. Where background copper and selenium concentrations at sites L-40 and RCSS-5 are less than the MDLs, one half the detection limit is used to calculate the LA. Use of one half the detection limit incorporates an implicit MOS by increasing the needed reduction above what would be calculated using the MDL.

The mercury dataset for Mill Gulch contains only results reporting less than detectable levels. The MDLs (1, 0.2, and 0.6 µg/L), all exceed the 0.05 µg/L HH criterion for mercury. Therefore, separate loading contributions from natural background and mining sources of mercury cannot be determined from the available monitoring results.

A mercury TMDL is developed to address the previous mercury listing and mercury allocations are to a composite WLA to natural background and mining sources ($WLA_{(MIL\ GUL\ NB + MIL\ GUL\ MS)}$). This TMDL is reflected in the following equation:

$$TMDL_{MIL\ GUL} = WLA_{MIL\ GUL\ NB + MIL\ GUL\ MS}$$

Additional monitoring using adequate MDLs is needed to verify the mercury listing, source contributions, and reductions if needed.

Table 5-27 shows example Cu, Hg, and Se TMDLs and allocations for measured high and low flow conditions at site L-7 in Mill Gulch. Because of the loading uncertainty resulting from high MDLs, the mercury allocation is a composite of natural background and mining sources at this time.

Table 5-27. Copper, mercury, and selenium TMDLs and load allocation examples for Mill Gulch at L-7

Metal	Flow Conditions	TMDL (lbs/day)	Percent Reduction Needed	LA_{NB} (lbs/day)	WLA_{MS} (lbs/day)
Copper	High flow	0.009	98	0.0015	0.0075
	Low flow	0.002	94	0.0004	0.0016
Mercury	High flow	0.000015	90	$TMDL_{MIL\ GUL} = 0.000015 = WLA_{MIL\ GUL\ NB + MIL\ GUL\ MS}$	
	Low flow	0.000004	90	$TMDL_{MIL\ GUL} = 0.000004 = WLA_{MIL\ GUL\ NB + MIL\ GUL\ MS}$	
Selenium	High flow	0.002	96	0.0008	0.0012
	Low flow	0.0004	82	0.0002	0.0002

This allocation scheme assumes that background loading rates do not cause water quality standards to be exceeded and applying BMPs to the mining sources will result in the loading reductions necessary to meet the TMDLs and water quality standards.

5.7.7 Montana Gulch (MT40E002_010)

Loading Summary

Montana Gulch drains the western third of the Landusky Mine (see **Figure A-17**). Its headwaters consist of three tributaries. The western branch drains an undisturbed watershed to the south and west of Mission Peak. Site L-40, selected as representing natural background water quality, is near the base of this tributary. The middle tributary begins at the south end of the August-Little Ben mine pit and its upper reach contains the Montana Gulch Waste Rock Dump. At the base of the waste rock valley fill is the upper Montana Gulch seepage capture system. It intercepts seepage through the waste rock valley fill and the discharge from a buried portal to the former August Mine. The capture system flow is piped to the Landusky wastewater treatment plant. The upper reach of the eastern headwaters branch drains the reclaimed surface near the Gold Bug and South Gold Bug mine pits and contains the 84 leach pad and dike farther downstream. The area where the three branches converge once contained the 85/86 leach pad until its removal from 2002 to 2005. The ridge separating Montana Gulch from Mill Gulch is occupied by the 79, 80-82, and 83 leach pads. Below the headwaters confluence, Montana Gulch contains a wastewater retention pond.

The Montana Gulch pond receives the discharge from the Landusky wastewater treatment plant (Landusky WWTP) that operates around the clock at an average annual discharge of 225.4 million gallons (0.96 cfs). The pond discharges at a rate of about 1.3 cfs to Montana Gulch (Spectrum Engineering 2006). Thus, the average daily flow from surface flow and seepage sources above the pond, that are not routed to the Landusky WWTP, is about 0.34 cfs or 153 gallons per minute. Below the pond, Montana Gulch flows south for about a mile to its confluence with Rock Creek.

Montana Gulch is listed for arsenic, cadmium, copper, and pH in the 2010 Integrated Report (Montana Department of Environmental Quality, Water Quality Planning Bureau, 2010). The water quality data indicates that copper is not currently impairing aquatic life uses and additional listings are warranted for aluminum, cyanide, nickel, selenium, and zinc. Among the four monitoring sites selected to represent current conditions (L-16, L-47, L-2, 591), the Montana Gulch pond overflow discharge (site 591) accounts for 97 percent of the records for the most recent 10 years. **Figure 5-8** is a graph of the sulfate concentration at site 591 in Montana Gulch during the past 10 years. The general water quality trend of the retention pond discharge is toward increasing effects of ARD at the Landusky Mine. The graph reflects a trend of increasing acidity generated by sulfide oxidation in the sources of wastewater that are routed to the pond from the Landusky WWTP.

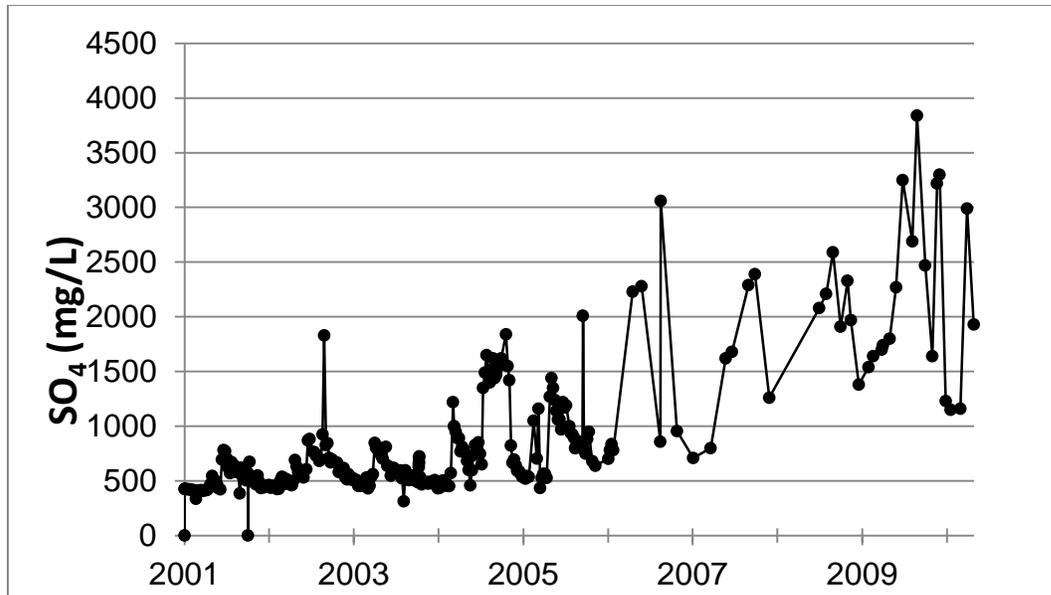


Figure 5-8. Graph of the sulfate concentration in the Montana Gulch pond discharge during the past 10 years.

The increasing trend in **Figure 5-8** for sulfate is similar to those for cadmium, cyanide, nickel, selenium, and zinc. Although the datasets for the three current condition sites downstream of site 591 are much smaller, they exhibit a similar trend of deteriorating water quality. **Figure 5-9** shows the sulfate data points for sites L-16, L-47 and L-2 from 2001 through 2009.

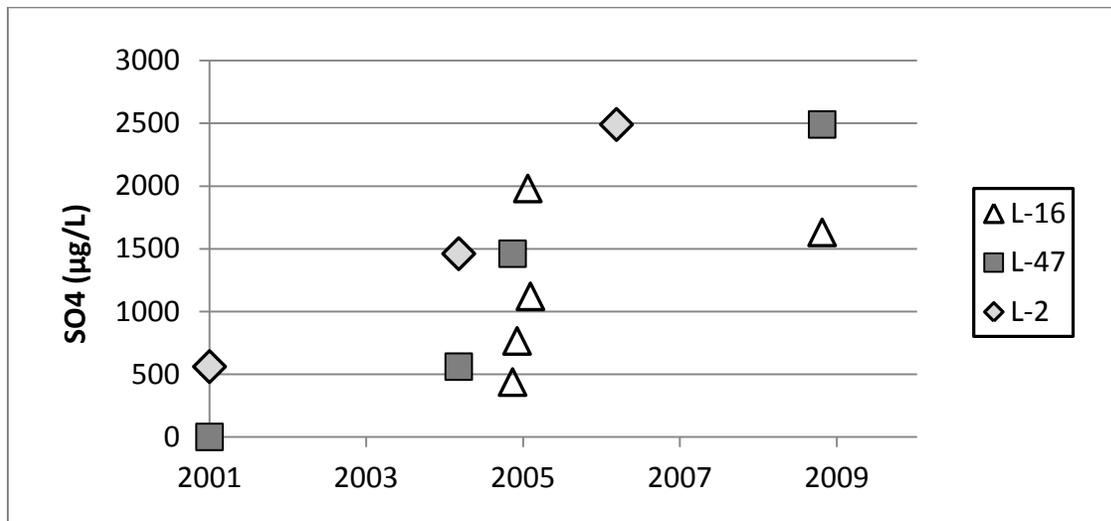


Figure 5-9. Graphs of surface water sulfate concentration at sites L-16, L-47, and L-2 during the past 10 years

Although the arsenic record contains 51 human health exceedances, arsenic has been on a decreasing trend since 2001. Arsenic concentrations have generally been an order of magnitude less than the CAL and AAL targets. **Figure 5-10** shows the trend in arsenic concentration at site 591 over the past decade. Although clearly on a decreasing trend, persistent arsenic exceedances during the most recent decade require development of an arsenic TMDL.

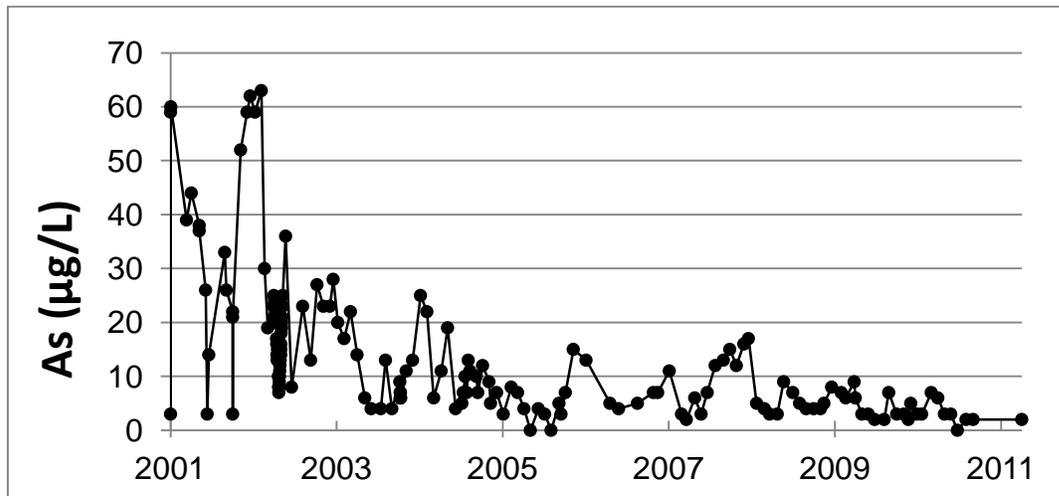


Figure 5-10. Graph of the arsenic concentration in the Montana Gulch pond discharge during the past 10 years.

Although copper concentrations in Montana Gulch are increasing slightly, (Figure 5-11) the CAL and AAL exceedance rates over all flow conditions are about one percent. No TMDLs or allocations are proposed for copper in Montana Gulch.

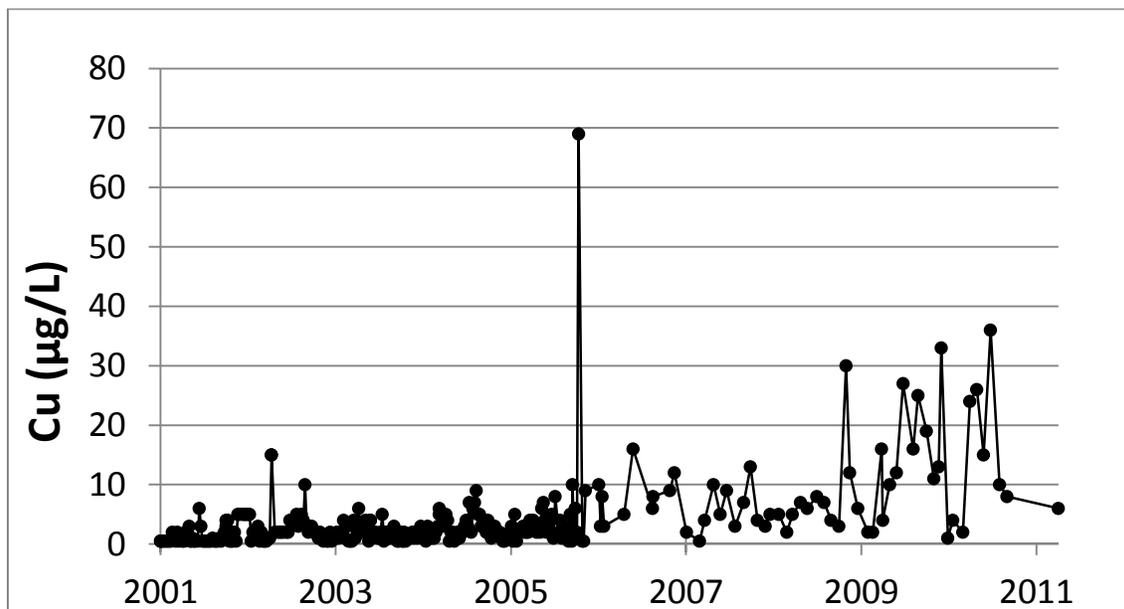


Figure 5-11. Graph of copper concentration in the Montana Gulch pond discharge during the past 10 years.

TMDLs and Allocations

The flow in Montana Gulch can be divided into two broad categories:

1. Surface and groundwater that is intercepted, treated, and discharged from the Landusky WWTP, and

2. Surface and groundwater that enter Montana Gulch from sources other than the Landusky WWTP.

The second category comprises waters that have been affected by mining activity and waters of natural background quality. Waters entering Montana Gulch from the watershed upstream of site L-40 are assumed to be of natural background quality because the drainage has not been mined. This is also the case in two downstream tributaries that enter Montana Gulch from the west. Tributaries entering Montana Gulch from the east are likely to be affected by the Landusky Mine. Some of the mine-affected water is intercepted and treated prior to its discharge to Montana Gulch. It is unlikely that all drainage to Montana Gulch from the Landusky mine enters a capture system and receives treatment. Therefore, category 2 above is necessarily a mixture of naturally occurring waters and untreated waters affected by the Landusky Mine. The metals loading allocations for Montana Gulch include a WLA to the Landusky WWTP (WLA_{LWWTP}) and a second WLA to a composite of natural background sources (**NB**) from both mined and un-mined areas of the watershed and untreated mining sources (**UTMS**) from mined areas. The TMDL allocations are expressed by the following equation:

$$TMDL = WLA_{LWWTP} + WLA_{(MT\ GUL\ NB + MT\ GUL\ UTMS)}$$

Until additional water quality and streamflow monitoring can better define the actual proportion of each WLA to the TMDL, the proportions at site L-2 near the mouth of Montana Gulch are assumed equal to the proportions of these sources entering the Montana Gulch retention pond. Long-term monitoring of the pond discharge to Montana Gulch and the discharge entering the pond from the Landusky WWTP indicates that approximately 74 percent (430 gpm) of the 580 gpm pond discharge is from the treatment plant. The remaining 26 percent of the pond discharge (150 gpm) is from combined natural background and untreated mining sources. **Table 5-28** shows example aluminum, arsenic, cadmium, cyanide, nickel, selenium, and zinc TMDLs and allocations for measured high and low flow conditions at site L-2 in Montana Gulch.

Table 5-28. Aluminum, arsenic, cadmium, cyanide, nickel, selenium, and zinc TMDLs and allocation examples for Montana Gulch at site L-2

Metal	Flow Conditions	TMDL (lbs/day)	Percent Reduction Needed	WLA_{LWWTP} (lbs/day)	$WLA_{(NB + UTMS)}$ (lbs/day)
Aluminum	High flow	0.536	0	0.402	0.134
	Low flow	0.021	90	0.016	0.005
Arsenic	High flow	0.062	78	0.046	0.016
	Low flow	0.024	85	0.018	0.006
Cadmium	High flow	0.004	88	0.003	0.001
	Low flow	0.002	91	0.0015	0.0005
Cyanide	High flow	0.032	0	0.024	0.008
	Low flow	0.012	93	0.009	0.003
Nickel	High flow	1.0	0	0.74	0.26
	Low flow	0.40	35	0.30	0.01
Selenium	High flow	0.031	88	0.023	0.008
	Low flow	0.012	82	0.009	0.003
Zinc	High flow	2.30	0	1.70	0.60
	Low flow	0.92	64	0.68	0.24

The data for cyanide, nickel, and zinc indicate that reductions are not needed under high flow conditions. High flow data for dissolved aluminum are not available and additional monitoring is needed to determine high flow reductions.

5.7.8 Rock Creek (MT40E002_090)

Loading Summary

Rock Creek drains nearly the entire Landusky mine because of its northern Sullivan Creek, Mill Gulch and Montana Gulch tributaries. Flows in Rock Creek are ephemeral and intermittent above the town of Landusky. Despite its C-3 classification, the Rock Creek water quality record is assessed using HH criteria because of the assumed close connection between surface water and shallow groundwater and the established use of shallow groundwater as a drinking water source for Landusky residents.

The metals loading is from runoff and seepage from waste rock, leach pad, and pad dike sources at the Landusky Mine. Below the confluence with Montana Gulch, Rock Creek loading includes that from the Landusky WWTP. Natural background loading to Rock Creek is represented by the water quality records for sites RCSS-5 in the reach above the Sullivan Creek confluence and sites Z-60, Z-61, and Z-62 in headwaters tributaries of Alder Gulch to the east.

TMDLs and Allocations

TMDLs and allocations are described for the reach above monitoring site L-23 located below the confluence with Sullivan Creek (**Figure F-11**). Cadmium, selenium, and zinc allocations at site 23 include a LA to natural background sources of ($LA_{RK\ CR\ NB}$), and WLA to mining sources of these metals ($WLA_{RK\ CR\ MS}$). The Rock Creek TMDLs for cadmium, selenium, and zinc site L-23 ($TMDL_{ROCK}$), and allocations are expressed in the following equation:

$$TMDL_{ROCK} = LA_{RK\ CR\ NB} + WLA_{RK\ CR\ MS}$$

The load allocation for natural background sources of cadmium, selenium and zinc is calculated from the data from sites RCSS-5, Z-60, Z-61, and Z-62. Where concentrations are less than MDLs, one half the MDL value is used in the calculation. The WLA to mining sources is obtained by subtracting the LA_{NB} from the TMDL. This allocation scheme assumes that natural loading rates do not cause water quality standards to be exceeded and applying BMPs to the mining sources will result in the loading reductions necessary to meet the TMDLs and water quality standards.

Table 5-29 contains example TMDLs and allocations for measured high and low flow conditions in the Rock Creek watershed above site L-23.

Table 5-29. Cadmium, selenium and zinc TMDLs and allocation examples for Rock Creek at site L-23

Metal	Flow Conditions	TMDL (lbs/day)	Percent Reduction Needed	LA_{NB} (lbs/day)	$WLA_{(MS)}$ (lbs/day)
Cadmium	High flow	0.0008	80	0.00005	0.00075
	Low flow	0.00007	80	0.0000057	0.000065
Selenium	High flow	0.012	0	0.002	0.01
	Low flow	0.0006	45	0.000057	0.000543
Zinc	High flow	0.388	26	0.048	0.34
	Low flow	0.033	0	0.002	0.031

A separate allocation scheme is developed for the metals copper, mercury, and lead in Rock Creek because the data prevent development of separate allocations to natural versus human-caused loading sources. The copper concentrations at sites RCSS-5, Z-60, Z-61, and Z-62 were all obtained during high flows in June of 1996 and May of 1997. All copper values exceed both the CAL and AAL criteria that apply to flow and hardness conditions on the sample dates. The MDLs reported with the lead (3 µg/L) and mercury (0.6 µg/L) results for these four sites exceed the CAL criteria. Therefore, the data do not allow development of separate allocations to natural background and human-caused sources of these metals. Until additional copper, mercury, and lead data can be collected for a range of flow and hardness conditions, the TMDLs are allocated to a composite WLA that is the sum of natural background and mining sources ($WLA_{RK\ CR\ NB + UPR\ RK\ CR\ MS}$). The TMDLs and allocation for copper, mercury, and lead in Rock Creek at site L-23 can be summarized by the following equation:

$$TMDL = WLA_{RK\ CR\ NB + UPR\ RK\ CR\ MS}$$

Table 5-30 contains example TMDLs and composite allocations for copper, mercury, and lead in upper Rock Creek under high and low flow conditions at site L-23. Percent reductions of lead and mercury assume existing concentrations are one half the reported method detection limits for these pollutants.

Table 5-30 Copper, lead and mercury TMDLs and example composite allocations for Rock Creek at site L-23.

Metal	Flow Conditions	TMDL (lbs/day)	Percent Reduction Needed	$WLA_{(NB + MS)}$ (lbs/day)
Copper	High flow	0.030	80	0.030
	Low flow	0.0026	0	0.0026
Lead	High flow	0.012	85	0.012
	Low flow	0.0014	10	0.0014
Mercury	High flow	0.0001	90	0.0001
	Low flow	0.000006	90	0.000006

5.7.9 Ruby Gulch (MT40E002_070)

Loading Summary

Mining sources at the Zortman Mine affect water quality in Ruby Gulch. Historic cyanide mill tailings in Ruby Gulch extended downstream for over three 3.0 miles from the mines at the head of the drainage to the confluence with Alder Gulch south of the town of Zortman. ZMI removed ore from six open pits and processed it in five leach pads located at the head of Ruby Gulch and along the divide between Ruby and Alder gulches. Deteriorating surface water quality at the Zortman mine prompted construction of the Zortman WWTP in 1994. The average annual discharge of treated water to from the plant to Ruby Gulch is 90 million gallons (170 gpm). The effluent discharges into the stream channel at site number 667 (**Figure F-1**). Flows to the treatment plant are from three capture systems in Ruby Gulch, Carter Gulch, and Alder Spur.

The Ruby Gulch capture system pumps approximately 48 million gallons per year to the treatment plant. The system consists of a collection sump and pump station, an 8.9 million gallon collection pond, a drain beneath the pond, and a pipe manifold that combines flows for routing to the treatment plant. Sources include seep discharges buried beneath the 85-86 leach pad, historic adit discharges covered by the O.K Waste Rock Dump, and a combination of

surface runoff and subsurface seepage from background and mining sources in upper Ruby Gulch. The retention pond, pump station, and manifold are in upper Ruby Gulch 1.5 miles upstream of Zortman.

The Carter Gulch capture system intercepts approximately nine million gallons of runoff and seepage from the Carter Gulch tributary that contains the Alder Gulch Waste Rock Repository (**Appendix F, Section F 2.1.1**). The valley fill waste rock structure contains a large proportion of sulfide waste. Spring rainfall in 2011, approximating the 500-year event, caused a slope failure at the base of the repository that destroyed the Carter Gulch capture system. Until it is repaired, ARD-affected runoff and seepage from the repository enters Alder Gulch.

The Alder Spur capture system is located in the Alder Spur tributary of Alder Gulch. It annually intercepts seven million gallons of runoff and seepage from the leach pad and dike complex that occupies the divide between Ruby and Alder gulches.

TMDLs and Allocations

Ruby Gulch TMDLs are developed for aluminum, cadmium, cyanide, chromium, lead, mercury, selenium, and zinc. The sources of metals loading to Ruby Gulch are, the Zortman WWTP, and a combination of natural background sources and mining sources not routed to the treatment plant. Therefore, the metals loading allocations for Ruby Gulch include a WLA to the Zortman WWTP (WLA_{ZWWTP}), a LA to natural background sources in Ruby Gulch ($LA_{RBY\ GUL\ NB}$), and a WLA to untreated mining sources in Ruby Gulch ($WLA_{RBY\ GUL\ UTMS}$). The TMDL and allocations are expressed by the following equation:

$$TMDL = WLA_{ZWWTP} + LA_{RBY\ GUL\ NB} + WLA_{RBY\ GUL\ UTMS}$$

This allocation scheme applies to cadmium, chromium, cyanide, lead, selenium, and zinc. The natural background concentrations of these pollutants are calculated from the dataset for the designated background sites in Alder Gulch and Ruby Gulch. Where results were less than MDLs, the sample is assumed to contain one half of the detection limit. Because of the high MDLs for aluminum and mercury analysis, one half of the MDL exceeded the CAL criterion for aluminum (87 µg/L) and the CAL criterion for mercury (0.91 µg/L). Therefore, the aluminum and mercury TMDLs were allocated to a composite wasteload from natural background and untreated Ruby Gulch mining sources ($WLA_{RBY\ GUL\ NB + RBY\ GUL\ UTMS}$). The aluminum and mercury TMDLs are expressed according to the following Equation:

$$TMDL_{RBY\ GUL} = WLA_{ZWWTP} + WLA_{RBY\ GUL\ NB + RBY\ GUL\ UTMS}$$

Table 5-31 contains example metals and cyanide TMDLs and allocations for site Z-15 in Ruby Gulch. A median high flow value of 0.4 cfs was calculated from the available flow records for site Z-15. The mean annual discharge from the Zortman WWTP is estimated at 170 gpm or about 0.38 cfs. Thus, the treatment plant discharge is about 94 percent of the flow in Ruby Gulch at site Z-15. The remaining 6 percent comes from other Ruby Gulch runoff and seepage sources. The treatment plant discharge is assumed to equal 0.38 cfs, and the remaining 0.02 cfs is equally divided between natural background and untreated mining sources. The allocations for cadmium, chromium, cyanide, lead, selenium, and zinc TMDLs in **Table 5-31** reflect this partitioning of flow at Z-15. The allocations for aluminum and mercury TMDLs reflect the

composite scheme for natural background and mining sources not routed to the Zortman WWTP.

Table 5-31. Aluminum, cadmium, cyanide, chromium, mercury, and selenium TMDL and allocation examples for Ruby Gulch at L-15

Metal	Flow Conditions	TMDL (lbs/day)	Percent Reduction Needed	WLA _{ZWWTP} (lbs/day)	LA _{NB} (lbs/day)	WLA _{UTMS} (lbs/day)
Aluminum	High flow	0.19	55	0.179	0.011	
	Low flow	0.056	99	0.053	0.003	
Cadmium	High flow	0.0016	94	0.0015	0.0000015	0.000095
	Low flow	0.00047	96	0.00046	0.0000021	0.000008
Cyanide	High flow	0.0112	85	0.0105	0.00016	0.00054
	Low flow	0.0034	45	0.0032	0.000049	0.00015
Chromium	High flow	0.564	--	0.53	0.000045	.034
	Low flow	0.171	--	0.161	0.0000146	0.01
Lead	High flow	0.0324	98	0.031	0.000081	0.00132
	Low flow	0.01	0	0.00914	0.00003	0.00083
Mercury	High flow	0.002	98	0.0018	0.0002	
	Low flow	0.0006	90	0.00056	0.00004	
Selenium	High flow	0.011	50	0.0103	0.000032	0.00067
	Low flow	0.003	50	0.0028	0.0000092	0.0002
Zinc	High flow	0.815	57	0.774	0.00162	0.0394
	Low flow	0.244	74	0.23	0.00003	0.014

The reduction column is blank for chromium because data on which to base a reduction are not available. Needed mercury reductions in Ruby Gulch assume existing levels are one half the reported method detection limit. These allocation schemes assume that natural loading rates do not cause water quality standards to be exceeded and applying BMPs to mining sources will result in the loading reductions needed to meet the TMDLs and water quality standards.

5.7.10 Ruby Creek (MT40E002_060)

Loading Summary

Ruby Creek is an intermittent stream that begins at the confluence of Alder and Ruby gulches. Flow in Ruby Creek results from large precipitation or snowmelt events. Metals loading to Ruby Creek are from upstream sources in Alder Gulch and Ruby Gulch described in **Appendix F, F 2.1.1 and F 2.9.1**. The stream receives drainage from all but the extreme northern portion of the Zortman Mine. A portion of the 410-acre Goslin Flats land application area (LAD) is located on bench land to the west of Ruby Creek. Wastewater from the biological treatment plant at the Landusky Mine is currently sprinkler applied to 204 acres of the Goslin Flats LAD. The application rates are set to prevent runoff (Spectrum Engineering, Inc., 2006).

TMDLs and Allocations

Ruby Creek is downstream of the watershed area disturbed by the Zortman Mine. Therefore, Ruby Creek metals loading from mining sources are from upstream sources in Alder and Ruby gulches. Alder and Ruby gulches are also sources of natural background metals loading. Therefore, allocations to allowable metals loading to Ruby Creek are to the following sources:

1. Natural background sources in Alder Gulch, Ruby Gulch, and Ruby Creek
2. Mining sources in Alder Gulch

3. Untreated mining sources in Ruby Gulch
4. The Zortman WWTP.

The TMDL equation reflecting allocations to the above sources is given below for the metals cadmium, lead, selenium, and zinc. **Table 5-32** contains example metals TMDLs and allocations for site Z-32 in Ruby Creek.

$$\text{TMDL}_{\text{RBY CR}} = \text{LA}_{\text{RBY CR NB}} + \text{WLA}_{\text{ALDR GUL MS}} + \text{WLA}_{\text{RBY GUL UTMS}} + \text{WLA}_{\text{ZWWTP}}$$

Natural background concentrations in Ruby Creek are assumed equal to those in Alder and Ruby gulches. Natural background concentrations of cadmium, lead, selenium, and zinc are calculated from the analytical results from the monitoring sites representing natural background conditions. These sites are located in headwater tributaries of Alder Gulch (sites Z-60, Z-61, Z-62, and AGSS-10) and in Ruby Gulch tributaries draining the undisturbed eastern extent of the Ruby Gulch watershed (sites Z-52, Z-9, AGSS-1, and RGSP-1).

The loading in **Table 5-32** is based on median high and low flow rates calculated from the flow record available for site Z-32. The high flow value is 0.37 cfs; the median low flow is 0.03 cfs. The watershed area upstream of site Z-32 is larger than that upstream of site Z-15 in Ruby Gulch. Therefore, the percentage of Z-32 flow that discharges from the Zortman WWTP is much smaller than the 94 percent that the treatment plant contributes to site Z-15. The drainage area contributing flow to site Z-15 is approximately 130 acres. Most of the flow from the watershed above site Z-15 is intercepted by the Ruby Gulch capture system and pumped to the Zortman WWTP. This volume, plus that from the Carter Gulch and Alder Spur capture systems, makes the treatment plant discharge large relative to flow at Z-15. The area of the Ruby Creek watershed above site Z-32, that is not pumped to the Zortman WWTP from the three capture systems, is approximately 3,700 acres. Extrapolating the per acre water yield of 0.08 gpm/acre to the 3,700-acre watershed above Z-32 gives a water yield at Z-32 of 296 gpm. The discharge of the Zortman WWTP (170 gpm), plus the water yield at Z-32 (296 gpm) gives a theoretical total flow at Z-32 of 466 gpm. The fraction of this total flow attributable to the Zortman WWTP is 0.365 (170/466 = 0.365). Multiplying the median high flow at Z-32 (0.37 cfs or 166 gpm) times the fraction calculated for the Zortman WWTP (0.365) gives a high flow treatment plant discharge of 61 gpm (166 X 0.365 = 61), or 0.136 cfs. Applying the same 0.365 fraction to the median low flow at Z-32 of 0.03 cfs (13.5 gpm), gives a low flow treatment plant flow at Z-32 of five gpm (13.5 X 0.365 = 4.9), or 0.11 cfs..

Table 5-32 contains example TMDLs and allocations for the metals cadmium, lead, selenium, and zinc at site Z-32. These are the pollutants for which natural background concentrations can be calculated from the sites selected as representing background conditions for Ruby Creek. The respective natural background concentrations ($\mu\text{g/L}$) calculated for cadmium, lead, selenium, and zinc are 0.08, 1.5, 0.5, and 15.

Table 5-32. Cadmium, lead, selenium and zinc TMDLs and allocation examples for Ruby Creek at Z-32

Metal	Flow Condition	TMDL (lbs/day)	Percent Reduction Needed	LA _{RBV CR NB} (lbs/day)	WLA _{ALDR MS} (lbs/day)	WLA _{RBV UTMS} (lbs/day)	WLA _{ZWWTP} (lbs/day)
Cadmium	High	0.00151	99	0.00016	0.0004	0.0004	0.00055
	Low	0.0001	0	0.000013	0.000023	0.000023	0.000042
Lead	High	0.03	93	0.003	0.008	0.008	0.011
	Low	0.0024	96	0.00024	0.0006	0.0006	0.001
Selenium	High	0.01	98	0.001	0.0027	0.0027	0.004
	Low	0.0008	98	0.00008	.000345	0.000345	0.00003
Zinc	High	0.77	95	0.03	0.23	0.23	0.28
	Low	0.0594	90	0.0024	0.018	0.018	0.021

The allocations in the table are derived by calculating natural background and WWTP contributions and subtracting the sum of these sources from the TMDL. The remaining allocation is evenly divided between the allocations to Alder Gulch mining sources and untreated mining source in Ruby Gulch. The allocation scheme in **Table 5-32** assumes that natural loading rates do not cause water quality standards to be exceeded and applying BMPs to mining sources will result in the loading reductions needed to meet the TMDLs and water quality standards.

The high MDLs reported with aluminum and mercury results, and the exclusive high flow sampling of the natural background sites for copper prevent a clear allocation to natural background sources of these metals. Therefore, a composite allocation to the sum of Ruby Creek natural background sources (**RBV CR NB**), Alder Gulch mining sources (**ALDR GUL MS**), and untreated Ruby Gulch mining sources (**RBV GUL UTMS**) is proposed for aluminum, copper, and mercury. The TMDL equation reflecting allocations to the above sources is given below.

$$\text{TMDL}_{\text{RBV CR}} = \text{WLA}_{\text{RBV CR NB}} + \text{ALDR GUL MS} + \text{RBV GUL UTMS} + \text{WLA}_{\text{ZWWTP}}$$

Table 5-33 contains example TMDLs and allocations for aluminum, copper, and mercury in Ruby Creek at site Z-32 using this composite allocation scheme. The high and low flow reductions given in the **Table 5-33** for copper reflect those required to bring the high and low flow values measured at current condition sites into compliance with the CAL criteria. The needed reductions to aluminum and mercury assume existing conditions are one half the reported method detection limits.

Table 5-33. Aluminum, copper, and mercury TMDLs and allocation examples for Ruby Creek at Z-32

Metal	Flow Condition	TMDL (lbs/day)	% Reduction Needed	WLA _{RBV CR NB + ALDR GUL MS + RBV GUL UTMS} (lbs/day)	WLA _{ZWWTP} (lbs/day)
Aluminum	High	0.174	13	0.111	0.063
	Low	0.0141	0	0.009	0.0051
Copper	High	0.061	99	0.039	0.022
	Low	0.005	8	0.0033	0.0017
Mercury	High	0.0018	99	0.00114	0.00067
	Low	0.00015	100	0.000095	0.000055

The allocation scheme in **Table 5-33** assumes that natural loading rates do not cause water quality standards to be exceeded and applying BMPs to mining sources will result in the loading reductions needed to meet the TMDLs and water quality standards.

5.7.11 Sullivan Creek (MT40E002_110)

Loading Summary

Metals loading to Sullivan Creek, referred to as Sullivan Creek in the DEQ assessment database, is from the L91 leach pad and supporting dike that were constructed from approximately 69 million tons of largely sulfide ore and waste rock from the Landusky pit complex. The Sullivan Creek capture system, consisting of an interception sump, pump house, and holding pond, was constructed at the base of the L91 leach pad dike in 1997. Captured wastewater is pumped to the Landusky WWTP. Other potential sources are storm runoff from the dike and pad face and the county roadway connecting the Zortman and Landusky mines.

Water quality data are available for a capture system overflow, two sites just below the capture system and a fourth site near the confluence with Rock Creek. Metal exceedances are more common and of higher magnitude at the upper sites than at site D-7 near the mouth. Most exceedances occur under high flow conditions.

TMDLs and Allocations

TMDLs for cadmium, iron, lead, selenium, and zinc in Sullivan Creek are allocated to natural background (**SLVN GUL NB**) and mining sources (**SULVN GUL MS**) of these pollutants. The following equation states the Sullivan Creek TMDL:

$$\text{TMDL}_{\text{SULVN GUL}} = \text{LA}_{\text{SLVN GUL NB}} + \text{WLA}_{\text{SULVN GUL MS}}$$

Loading from natural background sources is calculated from median concentrations of pollutants measured at sites RCSS-5, Z-60, Z-61, Z-62, and L-40. Where concentrations are less than the detection limit, one half of the MDL is used in the calculation. **Table 5-34** contains TMDL and allocation examples for high and low flow conditions at site D-7 near the mouth of Sullivan Creek. The allocations in **Table 5-34** to Sullivan Creek mining sources are calculated as the difference between the TMDL and the LA to natural background sources.

Table 5-34. Cadmium, iron, lead, selenium, and zinc TMDLs and allocation examples for Sullivan Creek at D-7

Metal	Flow Condition	TMDL (lbs/day)	Percent Reduction Needed	LA _{SULVN GUL NB} (lbs/day)	WLA _{SULVN GUL MS} (lbs/day)
Cadmium	High	0.0002	94	0.000045	0.00016
	Low	0.00002	50	0.0000038	0.0000162
Iron	High	0.45	1	0.17	0.28
	Low	0.038	48	0.014	0.024
Lead	High	0.003	85	0.00224	0.00076
	Low	0.0004	90	0.00019	0.00021
Selenium	High	0.002	55	0.0002	0.0018
	Low	0.0002	0	0.000019	0.000181
Zinc	High	0.093	73	0.0045	0.0885
	Low	0.01	5	0.00038	0.00962

The allocation scheme in **Table 5-34** assumes that natural loading rates do not exceed water quality standards and that further application of BMPs to mining sources will result in the loading reductions needed to meet the TMDLs and water quality standards.

5.7.12 Swift Gulch Creek (MT40I002_010)

Loading Summary

Swift Gulch Creek is a southern tributary to South Big Horn Creek. Approximately 540 acres of the reclaimed surface of the Landusky Mine drain north to Swift Gulch Creek. The main source of metals loading to Swift Gulch Creek from the mine is ARD from beneath the August-Little Ben-Surprise-Queen Rose pit complex at the Landusky mine. The pit complex is approximately parallel to subsurface bedrock shear zones where local mineralization has increased concentrations of sulfides, particularly pyrite (FeS_2). The shear zones control the volume and direction of local groundwater flow. The shear zone extends from beneath the pit complex, northeastward into the Swift Gulch Creek watershed (Spectrum Engineering, 2008). The intersection of the shears and the Swift Gulch Creek channel are expressed in a series of streambank springs. Mining within the shear zones at the Landusky Mine has lowered the local water table and exposed an increased volume of sulfide bedrock to weathering. Accelerated sulfide oxidation in the mined portion of the shear zones has acidified local groundwater that enters Swift Gulch Creek at the springs. Groundwater quality in Swift Gulch Creek has been deteriorating due to metals loading since the early 1990s; with a marked increased rate of metals loading beginning in 1998. This effect is illustrated in **Figure F-22**, a graph of the sulfate concentration in Swift Gulch Creek at site L-19. Sulfate is a product of sulfide mineral oxidation. **Figure 5-12** contains graphs of arsenic, copper, and iron concentrations in Swift Gulch Creek during the past two decades.

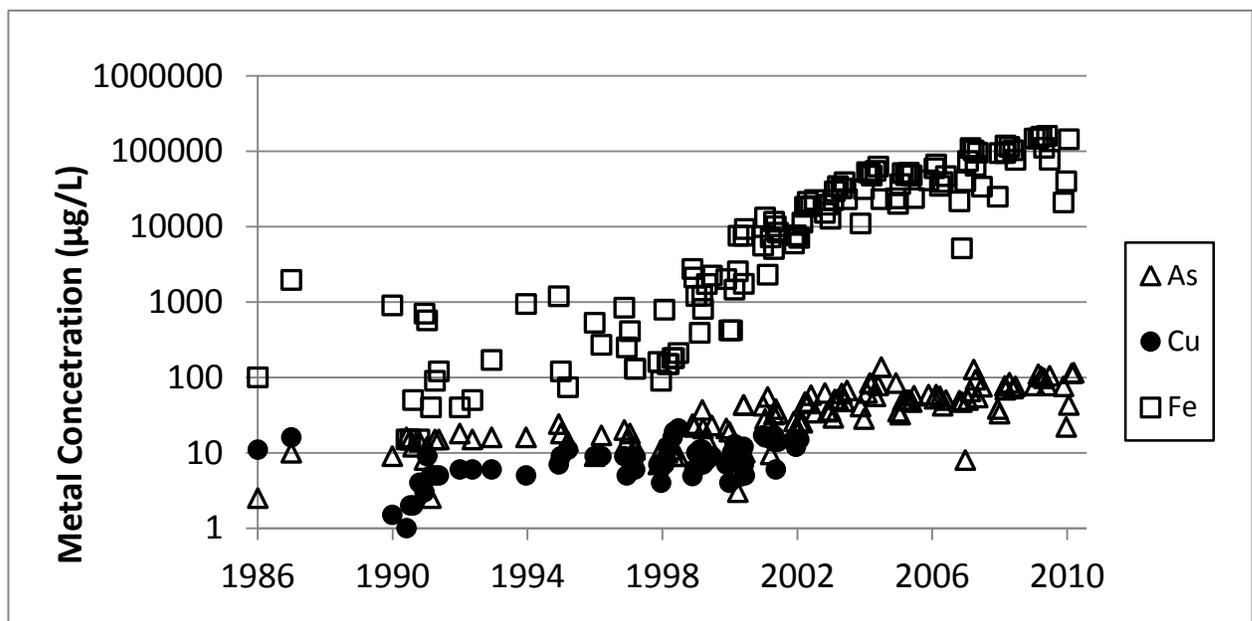


Figure 5-12. Graphs of arsenic, copper, and iron concentration at site L-19 in Swift Gulch Creek through 2010.

Although the metals target exceedances are generally more numerous during low flows, high flow runoff sediment pulses often cause the largest individual exceedances. Large flow events usually provide dilution with higher quality precipitation of snowmelt runoff. The wide fluctuation in sulfate concentration (**Figure F-22**) illustrates the effects of clean runoff diluting higher base flow metals concentrations. Of the seven widely spaced cyanide exceedances, five occurred during high flows.

TMDLs and Allocations

Swift Gulch Creek TMDLs are allocated to natural background concentrations ($LA_{SGC\ NB}$) and mining sources ($WLA_{SGC\ MS}$) for all pollutants, except thallium. The following equation expresses the allocation scheme for aluminum, arsenic, cadmium, copper, cyanide, iron, nickel, and zinc:

$$TMDL_{SGC} = LA_{SGC\ NB} + WLA_{SGC\ MS}$$

Table 5-35 contains TMDL and allocation examples for Swift Gulch Creek at site L-19.

Table 5-35. Metals and cyanide TMDLs and allocation examples for Swift Gulch Creek at L-19

Metal	Flow Condition	TMDL (lbs/day)	Percent Reduction Needed	$LA_{SULVN\ GUL\ NB}$ (lbs/day)	$WLA_{SULVN\ GUL\ MS}$ (lbs/day)
Aluminum	High	0.202	86	0.116	0.086
	Low	0.031	13	0.0175	0.0135
Arsenic	High	0.023	77	0.0035	0.0195
	Low	0.0035	78	0.0005	0.003
Cadmium	High	0.0013	97	0.0001	0.0012
	Low	0.0002	92	0.000018	0.000182
Copper	High	0.05	87	0.0035	0.0465
	Low	0.009	86	0.00053	0.0085
Cyanide	High	0.012	0	0.0058	0.0062
	Low	0.002	71	0.0009	0.0011
Iron	High	2.32	97	0.09	2.23
	Low	0.351	99	0.014	0.337
Nickel	High	0.279	30	0.023	0.256
	Low	0.052	73	0.0035	0.0485
Zinc	High	0.643	80	0.012	0.631
	Low	0.121	95	.002	0.119

The 3 µg/L MDL reported with thallium results exceeds the 0.24 µg/L HH criterion and precludes a separate allocation to natural background sources in Swift Gulch Creek. As a result, the TMDL allocation for thallium is a composite wasteload allocation that is the sum of natural background and mining sources ($WLA_{SGC\ NB + SGC\ MS}$) until additional monitoring with lower detection limits can distinguish concentration differences between these two sources. The thallium TMDL in Swift Gulch Creek is expressed in the following equation:

$$TMDL_{SGC} = WLA_{SGC\ NB + SGC\ MS}$$

An example TMDL and allocation for high and low flow conditions at site L-19 in Swift Gulch Creek is contained in **Table 5-36**.

Table 5-36. Thallium TMDLs and allocation examples for Swift Gulch Creek at L-19

Metal	Flow Condition	TMDL (lbs/day)	Percent Reduction Needed	WLA _{SGC NB + SGC MS}
Thallium	High	0.0006	84	0.0006
	Low	0.0001	84	0.0001

The allocation schemes in **Tables 5-35 and 5-36** assume that natural loading rates do not exceed water quality standards and that further application of BMPs to mining sources will result in the loading reductions needed to meet the TMDLs and water quality standards.

5.8 SEASONALITY AND MARGIN OF SAFETY

TMDLs must consider the effects of seasonal variability on water quality conditions and provide for a margin of safety to account for uncertainties in calculating contributions from pollutant sources. The margin of safety is intended to provide reasonable assurance that developed TMDLs are protective of water quality and beneficial uses. The following sections describe the considerations given to seasonality and a margin of safety for TMDLs in the Landusky planning area.

5.8.1 Seasonality

Seasonality was considered in assessing loading conditions and developing targets, TMDLs, and allocation schemes. Seasonality is important for metals due to varying metals loading pathways and varying water hardness during high flow and base flow conditions. Runoff delivery of metal contaminated sediment is the major cause of target exceedance during high flows. The amount of streamflow contributed from surface runoff also affects water hardness and the inherent toxicity of metals in surface water. Base flow exceedances are most often caused by loading from groundwater discharge from the shallow aquifer system and from perennial mining-related sources such as historic adits and seeps from extensive underground workings that predate ZMI surface mining operations. Seasonal variability in pollutant loading is addressed in this document in the following ways:

- Targets for hardness-dependent metal pollutants are developed based on the prevailing hardness conditions that vary with seasonal changes in streamflow contributions from runoff versus groundwater sources
- Flow data distributions were analyzed to derive characteristic high and low flows that are used in loading equations to develop corresponding high and low flow TMDLs and allocations
- Where data quality allows, needed load reductions are identified for both high and low flow conditions.

5.8.2 Margin of Safety

A margin of safety ensures that TMDLs and allocations adequately protect beneficial uses. The margin of safety is implicit in all TMDLs described above. The implicit margin of safety is applied through the following conservative assumptions applied in TMDL development:

- The Spectrum Z-L ACCESS database contains the results of monitoring that, in many cases, does not describe water quality conditions throughout the entire reach of each stream segment. A large proportion of the results are reported with method detection limits that do not allow comparison with the most restrictive aquatic life or human health criteria. The timing of past sampling may not allow an adequate evaluation of

seasonal variability in water quality. Therefore, target attainment, refinement of load allocations, impairment validations and TMDL-development decisions are all based on an adaptive management approach that relies on future monitoring and assessment for updating water treatment and other reclamation implementation efforts.

- Water quality data from instantaneous results used to quantify target departures and loading are in many cases more restrictive than data based on mean values over a 96-hour period
- The most restrictive water quality criteria are used to calculate daily load limits

5.9 UNCERTAINTY AND ADAPTIVE MANAGEMENT

Uncertainty is inherent in the TMDL development process. Uncertainty exists in the accuracy of chemical analysis results, flow conditions at the time of sampling, and representativeness of sampling locations and timing to current instream conditions. These uncertainties are carried forward in target values and loading assessments. The adaptive management process is an important check against perpetuating error in future assessments of loading misdirecting future remediation efforts. Therefore, the need to conduct further monitoring is imperative to an improved understanding of loading sources, impairment conditions and the processes that affect impairment. Adoption of the adaptive management approach is a realistic admission that targets, TMDLs, allocations, and the analyses supporting them are iterative processes that welcome new information.

In the atmosphere of chronic funding limitations, adaptive management provides critical feedback to help identify those restoration activities that best result in water quality improvement. It provides the flexibility to refine targets as necessary to ensure protection of the resource or to adapt to new information concerning target achievability. Additional monitoring and source refinement recommended in **Section 6.0** are necessary to determine the current extent of impairment, better describe the effects of treatment plant discharges, and refine remediation strategies in area of limited seasonal access. Restoration and monitoring plans linked to the adaptive management process are described in **Sections 6.0** and **7.0**.

Future efforts toward water quality improvement in the Landusky TPA have a number of potential outcomes. Restoration could achieve full attainment of applicable standards. Restoration could fail to attain standards and the waterbodies remain impaired and require further restoration to reduce loading. Restoration could fail to meet standard and standards are deemed unachievable after restoration activities have been completed. In this case, site-specific water quality standards and/or the reclassification of the waterbody may be needed. This would prompt new target and TMDL development reflecting existing conditions or the best anticipated future conditions.

The TMDLs developed for the Landusky TPA are based on attainment of water quality standards and achieving support for established beneficial uses. In spite of all reasonable efforts, attainment of restoration targets may not be possible due to the potential presence of pervasive mining sources and, in some cases, natural background loading sources. The DEQ Permitting and Compliance Division, Bureau of Land Management personnel, the Fort Belknap Tribal Community, and DEQ's water quality standards program will, with the help of other stakeholders, cooperate to identify appropriate remediation strategies to address mining impacts.

6.0 FRAMEWORK WATER QUALITY RESTORATION STRATEGY

6.1 SUMMARY OF RESTORATION STRATEGY

This section provides a framework restoration strategy toward water quality improvement in the Landusky planning area. The framework strategy is focused on progress in achieving the TMDLs presented in this document. This section identifies activities with potential to reduce metals and cyanide loading to listed segments. The discussion includes information on what improvements to water management systems are needed and where they would occur. This section seeks to inform stakeholders about the administrative as well as technical path to developing an adaptive Watershed Restoration Plan (WRP) in light of significant physical and financial obstacles to meeting water quality goals. A cooperatively developed WRP will provide more specifics about project priorities and spatial application of treatments for each stream.

The intent of a cooperatively developed restoration plan is to provide a locally supported list of priorities, schedule of activities, and funding opportunities for addressing problems in a headwater setting. Because of the technical obstacles and large infrastructure requirements, development of an effective restoration plan will require a unified effort among local, state, tribal, and federal entities. The watershed restoration process will initially proceed with a thorough technical evaluation of restoration alternatives and an analysis that identifies water quality improvement options that deliver the most benefit for each financial commitment. As restoration progresses and setbacks occur, the restoration strategy benefits from an adaptive approach that is informed by environmental monitoring and revised by stakeholders based on new information and advancements in treatment technology.

6.2 ROLE OF DEQ, OTHER AGENCIES, AND STAKEHOLDERS

Because of DEQ's established role in past restoration plan development, funding, and implementation, the agency will provide cooperative oversight for future pollutant reduction projects for both point source and nonpoint source activities. DEQ will also be providing continued technical and financial assistance for local, tribal and federal stakeholders with interests in improving water quality. The DEQ will work with participants to develop and fund restoration approaches that are locally supported, take full advantage of existing treatment infrastructure, and apply proven technical solutions to pollutant load reductions.

While recognizing the past leadership role of DEQ in development and implementation of mine reclamation at the Zortman and Landusky properties, it is important for local landowners and , watershed organizations to increase their involvement and collaboration with tribal, state, and federal agencies to progress toward meeting water TMDL targets and load reductions. In addition to DEQ, specific stakeholder agencies that will continue to promote restoration efforts include the Fort Belknap Tribal Environmental Department, Aaniiih Nakoda College, the U.S. Department of Interior BLM and Bureau of Indian Affairs, and the U.S. Environmental Protection Agency. Other agencies and organizations capable of providing technical expertise, educational outreach, and possible funding include the Milk River Watershed Alliance, Phillips County Conservation District, Montana Department of Natural Resources and Conservation, and the Natural Resource Conservation Service.

6.3 WATERSHED RESTORATION GOALS

The following are general water quality goals provided in this TMDL document:

Provide technical guidance for full recovery of aquatic life and human health related beneficial uses to all impaired streams within the Landusky TPA by reducing water- and sediment-bound metal loading.

This technical guidance is provided by the TMDL components in the document which include:

- water quality targets,
- pollutant source assessments, and
- general restoration guidance which should meet the TMDL allocations.
- Assess watershed restoration activities to address significant pollutant sources.

A cooperatively developed restoration plan is more prescriptive and dynamic than the TMDL document. It can be refined as activities progress and address broader goals than those included in this document.

The following elements are likely to be included in a future restoration plan for mined lands:

- A comprehensive update of the 2006 Engineering Evaluation and Cost Analysis for Water Management at the Zortman and Landusky Mines, Phillips County, Montana
- Interim replacement and repair of capture system components damaged during extreme precipitation in the planning area during May of 2011
- An assessment and implementation of new treatment options for leach pad effluent at the Landusky Mine.
- Water treatment infrastructure improvements capable of providing increased treatment capacity at the Zortman and Landusky treatment plants, the biological treatment system at the L87 and L91 leach pads, and the wastewater treatment system in Swift Gulch Creek
- Rehabilitation of water capture and interception systems feeding the Zortman and Landusky WWTPs
- Evaluation of additional source control options that reduce metal concentrations in water delivered to the Zortman, Landusky, and Swift Gulch Creek treatment plants.
- Reevaluation of the water quality monitoring program to reduce duplicative analyses, better characterize entire extents of affected streams, and update water quality information at selected sites lacking recent data

The water quality targets for each metal pollutant (and supplemental indicators) are described above for each metal pollutant and cyanide (**Section 5.4**). These targets serve as the basis for long-term effectiveness monitoring for achieving beneficial use support. **Section 7** identifies a general monitoring strategy and recommendations designed to track water quality conditions and restoration successes.

6.4 OVERVIEW OF WATER MANAGEMENT RECOMMENDATIONS

TMDLs were completed for a variety of metals on 12 streams. Other streams in the watershed may be in need of TMDLs, but insufficient information about them precludes TMDL formation at this time. In general, metal loading can be reduced by focusing restoration efforts on repair and rehabilitation of existing water treatment infrastructure and by focused evaluation of additional source control options. Stream channel restoration may provide additional metals source controls in areas severely scoured by recent flooding. Other restoration options for suppressing sediment metals loading include roadway inspection and follow-up drainage control improvements, decommissioning and reclamation of abandoned mine access and exploration roads, and surface stabilization of erodible abandoned mine tailings and waste rock deposits.

6.4.1 Water Treatment System Repairs

The paragraphs below summarize damage to water treatment infrastructure resulting from high precipitation during May of 2011. Damage descriptions and repair cost estimates are from Spectrum Engineering (2011).

Carter Gulch Capture System

The Carter Gulch capture system was located at the base of the Alder Gulch Waste Rock Repository located in the eastern headwater branch of Carter Gulch (**Appendix A, Figure A-16**). The capture trench had a 50,000 gallon capacity and the pumping rate from the capture system to the Zortman WWTP averaged 20 gpm.

High rainfall during May of 2011 caused a slope failure at the base of the waste rock repository that destroyed the entire capture system. Remnants of the capture system and channel erosion damage were observed for 1,600 feet downstream in Carter Gulch and extending into Alder Gulch. The damage will require the complete rebuilding of the system at a cost of approximately \$500,000. Options for stabilizing the waste rock repository are being reviewed. Cost range from \$300,000 for buttressing of the waste rock base, \$14,500,000 for complete removal of the repository.

Ruby Capture System

High precipitation caused a landslide into the Ruby Gulch pond. The sediment influx damaged the pump system delivering wastewater to the Zortman WWTP and caused a loss of pond storage volume. Bypass flows resulting from the damage are estimated at 21 million gallons. The cost of pump repair and sediment removal from the pond is estimated at \$30,000.

Zortman Z85/86 Leach Pad

Infiltration into the Z85/86 pad is usually pumped at about 150 gpm into the Z89 pad for pH adjustment prior to discharge onto the Goslin Flats LAD area. Increased precipitation caused the pad storage capacity to be exceeded, requiring construction of a larger diameter pipeline to the Z89 pad and purchase of additional sodium hydroxide for pH adjustment. The increase cost to handle the extra flow and caustic requirements was \$80,500.

Swift Gulch Wastewater Treatment Plant

The Swift Gulch plant was constructed in the bottom of the Swift Gulch Creek drainage in 2011. The plant is supplied by two upstream infiltration trenches. The treatment plant capacity is from 50 to 100 gpm. High streamflows caused channel scouring to a depth of about eight feet that removed both capture systems and destroyed the access road to the treatment plant. Needed repairs include rebuilding of the capture systems, rebuilding of the access road, land armoring of the plant building against future high flows. Repair costs are estimated at \$250,000.

Incidental Erosion Damage

Erosion caused by high precipitation in the spring of 2011 also damaged roadways and diversion structures at both mines. Repairs are estimated to cost \$20,000.

6.4.2 Water Treatment Improvement Options

The following paragraphs describe options being considered to increase metals precipitation in treated wastewater and to improve the capacity of capture systems at both mine properties.

Lime Neutralization of Landusky Leach Pad Effluent

The high acidity of drainage through the Landusky leach pads requires pretreatment using sodium hydroxide before this waste stream can be routed to the biological treatment plant for removal of cyanide, selenium, and nitrate. An option for increasing metals removal and reducing treatment costs is to replace the hydroxide treatment with neutralization by calcium oxide addition. Lime is a less expensive neutralizing agent and is capable of settling out more metal precipitates that could potentially damage the bio-treatment system. Increased metal removal of leach pad water would allow more of this wastewater to be routed to the Goslin Flats LAD area rather than to the Landusky WWTP. This would increase the capacity of the Landusky plant to treat flows from the Sullivan and Mill Gulch capture systems. This option would also reduce maintenance costs of removing sediment from the pH adjustment pond now used to pre-treat leach pad drainage prior to biological treatment.

Capture System Improvements

Seven capture systems deliver wastewater to the Landusky and Zortman WWTPs. Six systems remain with the loss of the Carter Gulch system in May, 2011. Each system generally consists of a capture trench excavated perpendicular to the channel flow direction. The downstream side of the trench is sealed with a low permeability slurry wall, fabric barrier, or a combination of these. A perforated pipe is installed in the trench bottom and covered with coarse gravel. A submersible pump is used to remove water from the buried pipe and route it to either the Zortman or Landusky plants for treatment by lime precipitation.

As the capture system age, the permeability of the gravels at each trench bottom is reduced by infiltration of fine sediments from the surrounding fill. The lower permeability of the gravels reduces the flow capacity of each system. The reduced flow capacity causes more untreated wastewater to bypass the capture trench and enter downstream surface waters. Metal concentrations in capture system bypass flows are some of the highest in the planning area. Rehabilitation or expansion of the infiltration trenches has not occurred since they were installed in the late 1990s. These options have the potential to improve water quality below the capture trenches and increase the flow of untreated water to both treatment plants.

An additional strategy is available to improve the performance of the upper Montana Gulch capture system. The upper Montana Gulch system is located below the base of the Montana Gulch waste rock dump. It delivers about 10 million gallon of wastewater per year to the Landusky WWTP. Because of a connection between local groundwater and flow to the capture system, the amount of water from a nearby artesian well (WS-3) that is routed to the Landusky Waste Water Treatment Plant (WWTP) affects water quality in the upper Montana Gulch capture. When flows from the artesian well are reduced (the well is partially shut in) surface water seeps form in Montana Gulch below the capture system. This water contains high aluminum concentrations that enter Montana Gulch untreated. If flows from WS-3 to the treatment plant are increased the seeps disappear. Although the quality of water from well WS-3 is affected by mining, it is less contaminated than other Landusky wastewaters. An option under consideration is to use WS-3 water to dilute other Landusky waste streams, thus, maintaining high flows from WS-3 and eliminating the aluminum laden seeps below the upper Montana Gulch capture system.

6.4.3 Source Control Evaluation

The feasibility of several source reduction options requires further evaluation before the commitment of limited funding. These include the installation of infiltration barriers in areas with large volumes of sulfide rich ore or waste rock. Such efforts would be similar to the regarding, capping, and construction of runoff controls on the surface of the Alder Gulch Waste Rock Repository completed in 2007. Potential target areas include the area overlying the Gold Bug Pit at the Landusky Mine, selected areas of the L87/91 leach pads, or portions of the August-Little Ben-Surprise-Queen Rose pit complex.

A well drilling and pump test program was initiated along the steep upper slope between the Landusky pits and Swift Gulch Creek in 2009. The purpose of the program was to determine the volume of groundwater recharge from the bottom of the pits to the shear zone transporting contaminated groundwater to Swift Gulch Creek. Further evaluation of this metals loading source would determine the feasibility of installing a low permeability grout curtain to reduce, capture, or divert metals loading to Swift Gulch Creek.

6.5 GENERAL MINE RECLAMATION APPROACHES

Rather than restoration practices specifically considered for the Zortman and Landusky mines, this section is a brief discussion of general restoration programs and funding mechanisms applicable to the metals sources. The need for further characterization of impairment conditions and loading sources is addressed through the framework monitoring plan in **Section 7.0**. A number of state and federal regulatory programs have been developed over the years to address water quality problems stemming from historic mines and associated disturbances. Regulatory programs and approaches considered most applicable to the Landusky watershed include:

- The Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA),
- The State of Montana Mine Waste Cleanup Bureau's Abandoned Mine Lands (AML) Reclamation Program.

6.5.1 Pollution Restoration Approach

"Pollution" causes of impairment are distinguished from those resulting from the loading of specific chemical pollutants, such as cadmium, nitrate nitrogen, or sediment. Although TMDLs are not developed for pollution impairments, they are often linked to pollutants, such as channel substrate alterations caused by excess sediment. Addressing pollution sources is an important part of watershed restoration. Six streams in the Landusky TPA have impairments caused by pollution. The streams and corresponding pollution impairments are contained in **Table 6-1**.

Table 6-1. Pollution Impairments in the Landusky TPA.

Stream Name	Pollution Impairment Cause
Alder Gulch	Alteration in stream-side or littoral vegetative covers
King Creek	Alteration in stream-side or littoral vegetative covers
	Physical substrate habitat alterations
Lodge Pole Creek	Alteration in stream-side or littoral vegetative covers
Mill Gulch	Alteration in stream-side or littoral vegetative covers
Rock Creek	Alteration in stream-side or littoral vegetative covers
Sullivan Creek	Alteration in stream-side or littoral vegetative covers
	Physical substrate habitat alterations
	Fish-Passage Barrier
	Other flow regime alterations

Habitat impairments are typically addressed during implementation of sediment, nutrient, or temperature TMDLs. Although flow alterations have the most direct link with temperature, and temperature TMDLs are the only TMDLs that explicitly discusses flow, adequate flow is also critical for transporting sediment and diluting metals inputs. Therefore, if restoration goals within the Landusky TPA are not also addressing pollution impairments, additional pollution-related BMP implementation should be considered. Habitat and flow BMPs are discussed below in **Section 9.5**.

Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA)

CERCLA (a.k.a. Superfund) is a Federal law that addresses cleanup on sites, such as historic mining areas, where there has been a hazardous substance release or threat of release. Sites are prioritized on the National Priority List (NPL) using a hazard ranking system with significant focus on human health. Under CERCLA, the potentially responsible party or parties must pay for all remediation efforts based upon the application of a strict, joint and several liability approach whereby any existing or historical land owner can be held liable for restoration costs. Where viable landowners are not available to fund cleanup, funding can be provided under Superfund authority. Federal agencies can be delegated Superfund authority, but cannot access funding from Superfund.

Cleanup actions under CERCLA must be based on professionally developed plans and can be categorized as either Removal or Remedial. Removal actions can be used to address the immediate need to stabilize or remove a threat where an emergency exists. Removal actions can also be non-time critical.

Once removal activities are completed, a site can then undergo Remedial Actions or may end up being scored low enough from a risk perspective that it no longer qualifies for remedial action. Under these conditions the site is released back to the state for a "no further action" determination. At this point there may still be a need for additional cleanup since there may still be significant environmental threats or impacts, although the threats or impacts are not significant enough to justify Remedial Action under CERCLA. Any remaining threats or impacts would tend to be associated with wildlife, aquatic life, or aesthetic impacts to the environment or aesthetic impacts to drinking water supplies versus threats or impacts to human health. A site could, therefore, still be a concern from a water quality restoration perspective, even after CERCLA removal activities have been completed.

Remedial actions may or may not be associated with or subsequent to removal activities. A remedial action involves cleanup efforts whereby Applicable or Relevant and Appropriate Requirements and Standards (ARARS), which include state water quality standards, are satisfied. Once ARARS are satisfied, then a site can receive a "no further action" determination.

The use of CERCLA authority for reclamation at the Zortman and Landusky began in 2004 with a BLM Action Memorandum for Time-Critical removal actions so that reclamation and water treatment could continue in the absence of a mine operator. Federal funding for water treatment at the mines continues under CERCLA authority through the BLM.

Other Programs

In addition to the programs discussed above, other funding may be available for water quality restoration activities. These sources include the following:

Resource Indemnity Trust/Reclamation and Development Grants Program (RIT/RDGP)
EPA Section 319 Nonpoint Source Grant Program

RIT/RDGP

The RIT/RDG is an annual program that can provide up to \$300,000 to address environmental related issues. This money can be applied to sites included on the Mine Waste Cleanup Bureau's Abandoned Mine Lands (AML) priority list, but of low enough priority where cleanup under AML is uncertain. RIT/RDG program funds can also be used for conducting site assessment/ characterization activities such as identifying specific sources of water quality impairment.

Section 319 funding

Section 319 grant funds are typically used to help identify, prioritize, and implement water quality protection projects with focus on TMDL development and implementation of nonpoint source projects. Individual contracts under the yearly grant typically range from \$20,000 to \$150,000, with a 25 percent or more match requirement. RIT/RDG and 319 projects typically need to be administered through a non-profit or local government such as a conservation district, a watershed planning group, or a county.

Program Overlap and Coordination

Within the Landusky TPA, metals-related restoration work and project oversight is occurring by state, federal and tribal government agencies. The major agencies involved are the DEQ, BLM, and Fort Belknap Tribal Community. These organizations and their principal contractor, Spectrum Engineering, Inc., contribute members to a formal working group that cooperates to review monitoring results and consult on how best to allocate funding for continued facility maintenance, repair, and reclamation at the mines. This TMDL document is focused on metals impairment and restoration in 303(d) listed streams. Future reclamation and water management will be guided by a revised Engineering Evaluation and Cost Analysis to be prepared by the BLM in the coming months.

All of the agencies are actively collaborating to promote the exchange of information and prevent duplicative efforts. The atmosphere of cooperation among the agencies allows for a fully concerted restoration effort that encourages participation by additional stakeholders.

7.0 MONITORING STRATEGY AND ADAPTIVE MANAGEMENT

7.1 INTRODUCTION

The monitoring strategies discussed in this section are an important component of watershed restoration, a requirement of TMDL development under Montana's TMDL law, and the foundation of the adaptive management approach. Water quality targets and allocations presented in this document are based on available data at the time of analysis, however the scale of the watershed coupled with constraints on time and resources often result in compromises that must be made that include estimations, extrapolation, and a level of uncertainty. The margin of safety (MOS) is put in place to reflect some of this uncertainty, but other issues only become apparent when restoration strategies are underway. Having a monitoring strategy in place allows for feedback on the effectiveness of restoration activities (whether TMDL targets are being met), if all significant sources have been identified, and whether attainment of TMDL targets is feasible. Data from long-term monitoring programs also provide technical justifications to modify restoration strategies, targets, or allocations where appropriate.

The monitoring strategy proposed in this section is a contribution toward modification of the program initiated with the Engineering Evaluation and Cost Analysis document prepared by the BLM in 2006. A more detailed monitoring effort will be guided by recommendations contained in a revision of this document currently in progress. Monitoring recommendations provided are intended to assist cooperating agencies and interested stakeholders in developing an appropriate monitoring plan to meet water quality goals. Funding for future monitoring is uncertain and may vary with economic and political changes. Prioritizing monitoring activities depends on stakeholder priorities for restoration and funding opportunities.

7.2 ADAPTIVE MANAGEMENT APPROACH

An adaptive management approach is recommended to control costs and meet the water quality standards to support all beneficial uses. This approach works in cooperation with the monitoring strategy, and as new information is collected, it allows for adjustments to restoration goals or pollutant targets, TMDLs, and/or allocations, as necessary.

7.3 FUTURE MONITORING GUIDANCE

The objectives for future monitoring in the Landusky watershed include:

- Improve the understanding of water quality conditions in stream segments with aging monitoring records in order to identify the need for additional restoration work and refine the source assessment analysis
- Gather data needed to improve the understanding of natural background and current condition loading so that TMDL development assumptions can be refined.
- Consistently gather data among agencies and other cooperators that is comparable to that needed to assess compliance with the most restrictive water quality targets
- Expand the understanding of downstream water quality beyond the boundaries where TMDLs have been developed and address issues as necessary.
- Further assess the effectiveness of reclamation efforts and adjustments to water treatment infrastructure.

7.3.1 Strengthening the Source Assessment

Identification of sources in the Landusky TPA was conducted largely through a review of the timing, location, and extent of mining and reclamation activities from 1979 to the present and review of water quality data in the Spectrum Z-L ACCESS database for corresponding water quality responses. The mining and reclamation narratives and data review are supplemented by assessment of 2009 aerial imagery and GIS information on local geology, hydrography, and location of monitoring points.

The available data and review of the current engineering evaluation and cost analysis document (Spectrum Engineering, Inc., 2006) is supplemented by personal communications with DEQ Permitting and compliance Division staff, Fort Belknap Environmental Department staff, Spectrum Engineering personnel, and limited field verification during tours of the Zortman and Landusky mines. Although the level of detail provided a basic understanding of mine operations, reclamation practices and monitoring results, the large physical extent and overlap of mine disturbances allowed only for allocation of loading from broad source categories in each stream segment. Strategies for strengthening the metals source assessment includes follow up monitoring to focus on better defining the contribution from background sources, un-mineralized versus mineralized portions of the mined area, and, in some cases, sources from abandoned mines and areas disturbed by past exploration drilling. Although the mines in the DEQ and/or MBMG databases have some information, the loading contributions from the abandoned Hawkeye (Alder Gulch) and Beaver (Beaver Creek) mines need further evaluation. Further information on the loading contribution from the near-channel road in the Beaver Creek drainage would also improve the understanding of its effect on local water quality. Traffic density in Beaver Creek may have changed since the last observations in 2005. The contribution from past, and perhaps ongoing, placer-mining in Alder Gulch and the South Big Horn Creek drainages is not well defined and some degree of field verification would be helpful in improving the source assessment for mercury in these locations. As additional information becomes available regarding contributions from these features, TMDLs may be modified via adaptive management to split composite WLAs into separate LAs and WLAs.

7.3.2 Increase and Update Available Data

While the Landusky TPA has been the focus of significant remediation and restoration activities, recent data is still often limited depending on the stream and pollutant of interest. The TMDL development process has identified the need for regularly scheduled sampling for metal parameters, under a variety of flow conditions, at the current conditions sites listed in **Table 5-2**. The most recent data in Alder Gulch, Beaver Creek, Lodge Pole Creek, and lower Ruby Gulch is commonly from 1998. Regular water chemistry and flow data collection at source-bracketing locations, over the full extent of stream length, is needed for these streams. A revised monitoring plan should strongly consider updating these water quality and flow records.

Monitoring should also include a focused effort to quantify natural background metals loading at high and low flows. Much of the existing background data in and around the Zortman and Landusky mines covers a limited time period (1994-1998) and includes too few sampling events for an accurate description of loading during runoff and base flow periods.

Little is known about the concentrations and distribution of metals in sediment within the planning area. The environmental monitoring program should be modified to allow development of a sediment metals profile for each affected stream. This effort should be linked to an updated biological assessment of periphyton, macroinvertebrate, fish, and aquatic and riparian plant communities. Paired water chemistry and biological assessments would be useful for applying existing biological indices of metal

pollution, and perhaps modifying existing measures of metals tolerance to conditions specific to the Landusky TPA.

7.3.3 Consistent Data Collection and Methodologies

Data record for the Landusky TPA has been collected over several decades during which analysis methods and detection limits have significantly changed. The Montana DEQ is the lead agency for developing and conducting impairment status monitoring of surface waters. The DEQ process of stream assessment and monitoring could produce a more accurate evaluation of impairment conditions if all entities collecting water quality and stream condition data employed the same sample collection and handling protocols, analytical methods, and method detection limits. Monitoring and assessment costs could be reduced if data collected by other programs within DEQ and other agencies and organizations from the same page of data collection protocols. These monitoring recommendations are based on experience with TMDL related efforts to meet water quality targets and protect beneficial uses. The efficiency of water monitoring efforts by DEQ and other natural resource programs could improve if data from all entities would allow for comparison to TMDL program goals, as well as fulfill the water quality protection responsibilities of other programs.

7.3.4 Specific Recommendations for Metals Monitoring

Monitoring to assess water quality standards compliance for trace metals needs to include analysis for a parameter suite that, for the Landusky TPA, includes aluminum, arsenic, cadmium, copper, iron, lead, selenium, and zinc). Several companion parameters are also important for identifying conditions related to metals toxicity and oxidation of sulfide minerals. These include water hardness, pH, and sulfate concentration. A second, shorter parameter list should be considered depending on the local geology and mining method. This list includes cyanide, chromium, mercury, nickel, and Thallium. Total recoverable concentrations are needed for standards comparisons except for aluminum, where the standard is for dissolved concentrations. A regular subset of dissolve metal concentrations for all parameters is helpful for distinguishing between runoff sources and contributions from groundwater, where dissolved concentrations predominate.

Based on the data evaluations in this document, metals included in **Table 7-1** are identified as priorities for future metals monitoring in the Landusky TPA. Many of the recommendation are made to update older datasets, incorporate current MDLs, and confirm impairments for Hg and CN that are based on older data, small datasets, and high MDLs.

Table 7-1. Metals Monitoring Recommendations for Landusky TPA by stream segment.

Waterbody Segment ID	Waterbody Segment Name	Recommended Monitoring	Rationale
MT40E002_050	Alder Gulch	Cd, Cu, Hg, Pb, Se, Zn All flows	Update from 1998 Confirm existing impairments Document NB conditions
MT40M001_011	Beaver Creek	Cd, Fe, Pb All flows	Update from 1998 Confirm Cd & Fe delistings Confirm Pb impairment Document NB conditions
MT40I001_030	South Big Horn Creek,	Al All flows Lower Al MDL	Confirm Al impairment

Table 7-1. Metals Monitoring Recommendations for Landusky TPA by stream segment.

Waterbody Segment ID	Waterbody Segment Name	Recommended Monitoring	Rationale
MT40I001_040	King Creek	As, Cd, Sediment All flows	Confirm new As & Cd listings Assess sediment transport status
MT40I001_050	Lodge Pole Creek	Cd & Hg All flows Low level Hg method	Update from 1998; Confirm Cd & Hg listings; Establish western headwater trib. Conditions
MT40E002_100	Mill Gulch	Cu, Hg, Pb, Se All flows Low level Hg method Update L-7 conditions	Confirm Cu, Hg, Se listings; Confirm Pb delisting
MT40E002_010	Montana Gulch	Al, As, Cd, CN, Ni, Se, Zn All flows	Confirm CN & Ni impairments; Update since 2007
MT40E002_090	Rock Creek	Cd, Cu, Hg, Pb, Se, Zn All flows Include site below MT Gulch	Update since 1998 Confirm Hg impairment
MT40E002_060	Ruby Creek	Al, Cd, Cu, Hg, Pb, Se, Zn Lower Al, Cd MDLs Low level Hg Low flows	Confirm all impairments; Update from 1998; Establish low flow conditions for entire segment
MT40E002_070	Ruby Gulch	Al, Cd, CN, Cr, Hg, Pb, Se, Zn Lower MDLs All flows Include sites Z-100 & Z-1B	Confirm all impairments; Document conditions synoptically below Zortman WWTP discharge
MT40E002_110	Sullivan Creek	Cd, Fe, Pb, Se, Zn All flows	Confirm all pollutant listings
MT40I002_010	Swift Gulch Creek	Al, As, Cd, Cu, CN, Fe, Pb, Ni, Tl, Zn Low Al & Cd MDLs Low flows Document conditions above seep discharges Document WWTP discharge effect at low flow	Determine background and low flow conditions; Confirm CN and Tl impairments

Sediment chemistry data is lacking for the planning area. Future monitoring should include an effort to build a sediment chemistry database over a number of years to avoid high initial costs. Analytical detection limits for water column pollutant concentrations should allow assessment of use support based on the most restrictive criteria, especially for cadmium and mercury.

7.3.5 Effectiveness Monitoring for Reclamation Activities

As restoration activities are implemented, watershed-scale monitoring may be valuable in determining if restoration activities are improving water quality, instream flow, and aquatic habitat and communities. It is important to remember that degradation of aquatic resources happens over many decades and that restoration is also a long-term process. An efficiently executed long-term monitoring effort is an essential component to any restoration effort.

Due to the natural high variability in water quality conditions, trends in water quality are difficult to define and even more difficult to relate directly to restoration or other changes in management. Improvements in water quality or aquatic habitat from restoration activities will most likely be evident in fine sediment deposition and channel substrate embeddedness, changes in channel cumulative width/depths, improvements in bank stability and riparian habitat, and changes in communities and distribution of bio-indicator species. Specific monitoring methods, priorities, and locations will depend heavily on the type of restoration projects implemented, landscape or other natural setting, the land use influences specific to potential monitoring sites, and budget and time constraints.

As restoration activities continue throughout the watershed, pre and post monitoring so as to understand the changes that follow will be necessary to track the effectiveness of specific given practices or implementation projects. The following section describes recommendations applied to mined lands.

7.3.6 Reclamation in Areas Affected by Mining

Each reclamation site will have site-specific needs but general recommendations for mine site remediation effectiveness monitoring are outlined in **Table 7-2**.

Table 7-2. Effectiveness monitoring recommendations for mine site reclamation.

Parameter	Monitoring Recommendations
Water quality	Sample for heavy metals, pH, flow and TSS in water column at high and low flow above and below specific sources. Collect sediment samples at low flow. Monitoring should occur prior to remediation efforts and continue for at least 10 years after site restoration. If possible, monitoring should include biomonitoring (i.e. periphyton and macroinvertebrates) at low flow every 3 years.
Vegetation re-establishment	Greenline survey every 3 years, including bank stability, shrub regeneration, and bare ground. Vegetation transects across floodplain for vegetation community structure and regeneration.

7.3.7 Watershed Wide Analyses

The BMPs listed above are only a sample of the potential management practices that could be used in the Landusky TPA to improve water quality and habitat. Recommendations for monitoring in the planning area should not be confined to only those streams addressed within this document. The water quality targets presented here are applicable to most streams draining the Little Rocky Mountains, and the absence of a stream from the State's 303(d) List does not necessarily imply full support for all beneficial uses. Furthermore, as conditions change over time and land management evolves, the consistent application of data collection methods and information collected throughout the planning area will best allow resource professionals to identify problems as they occur, and to track improvements over time. The recommendations and TMDLs developed in this document also relate to, and will ultimately help achieve the eventual TMDLs to be developed for downstream segments that appear on the 303(d) List for metals.

8.0 PUBLIC INVOLVEMENT & COMMENTS

Stakeholder and public involvement is a component of TMDL planning by EPA guidelines and required by Montana state law (MCA 75-5-703, 75-5-704) which directs DEQ to consult with watershed advisory groups and local conservation districts during the TMDL development process. Technical advisors, stakeholders and interested parties, state, tribal and federal agencies, interest groups, and the public were solicited to participate in differing capacities throughout the TMDL development process in the Landusky TMDL Planning Area (TPA).

8.1 PARTICIPANTS AND ROLES

Throughout completion of the Landusky planning area metals TMDLs, DEQ worked with stakeholders to keep them apprised of project status and solicited input from a TMDL advisory group. A description of the participants in the development of the metal TMDLs in the Landusky TPA and their roles is contained below.

Montana Department of Environmental Quality

Montana state law (MCA 75-5-703) directs DEQ to develop all necessary TMDLs. DEQ has provided resources toward completion of these TMDLs in terms of staff, funding, internal planning, technical assessments, document development, and stakeholder communication and coordination. DEQ has worked with other state and federal agencies to gather data and conduct technical assessments. DEQ has also partnered with the local watershed organization to coordinate local outreach activities for this project.

Stakeholders

Stakeholders were informed of the TMDL process through periodic meetings of the Phillips County CD, Milk River Watershed Alliance (MRWA), and Fort Belknap Tribal Environmental Department. In addition, Technical Advisory Group communications, and on-site tours of the Zortman and Landusky mine areas provided opportunities to discuss mining effects on water quality and mine reclamation issues. Drafts of document sections were provided to tribal representatives and other local stakeholders. Comments, both verbal and written, were accepted and addressed in the redrafted document.

Area stakeholders included:

- Phillips County Conservation District (CD)
- Milk River Watershed Alliance (MRWA)
- Fort Belknap Tribal Community
- Montana Department of Natural Resources and Conservation
- Montana Department of Fish, Wildlife & Parks
- USDA – Natural Resource Conservation Service
- United States Department of Interior, Bureau of Land Management
- Bureau of Indian Affairs
- US Environmental Protection Agency
- Interested local land owners and watershed residents

Landusky TMDL Advisory Group

The Landusky TMDL Advisory Group consisted of selected resource professionals who possess a familiarity with water quality issues and processes in the Landusky TPA, and also representatives of

applicable interest groups. All members were solicited to participate and work with DEQ and the Phillips County conservation districts in an advisory capacity per Montana state law (75-5-703 and 704). DEQ requested participation and information from the interest groups defined in MCA 75-5-704 and included local city and county representatives, livestock-oriented and farming-oriented agriculture representatives, conservation groups, watershed groups, state and federal land management agencies, and representatives of recreation and tourism interests. The advisory group also included additional stakeholders and landowners with an interest in maintaining and improving water quality and riparian resources.

Advisory group involvement was voluntary and the level of involvement was at the discretion of the individual members. Members had the opportunity to provide comment and review of technical TMDL assessments and to attend meetings organized by DEQ for the purpose of soliciting information and feedback on the project. Typically, draft documents were released to the advisory group for review under a limited timeframe, and their comments were then compiled and evaluated. Final technical decisions regarding document modifications resided with DEQ.

Communications with the group members was typically conducted through email and draft documents were made available. Opportunities for review and comment were provided for participants at varying stages of TMDL development, including opportunity for review of the draft TMDL document prior to the public comment period.

8.2 RESPONSE TO PUBLIC COMMENTS

Upon completion of the draft TMDL document, and prior to submittal to EPA, DEQ issues a press release and enters into a public comment period. During this timeframe, the draft TMDL document is made available for general public comment, and DEQ addresses and responds to all formal public comments.

The formal public comment period for the “Landusky Metals TMDLs and Framework Water Quality Restoration Plan” was initiated on August 17, 2011 and closed on October 12, 2011. Electronic copies of the draft document were made available at the Fort Belknap College of Technology Center and Library, Fort Belknap Agency, Phillips County Public Library, Malta, MT and at the State Library in Helena, MT.

A public informational meeting and open house was held in Malta, MT on September 1, 2011. DEQ provided an overview of the document, answered questions, and solicited public input and comment on the TMDLs. Meetings were held with representatives of the Environmental Department of the Fort Belknap Tribal Community at Fort Belknap Agency on May 10 and September 1, 2011.

Notice of the meeting and public comment period was posted on the DEQ webpage and also advertised in the following newspapers: Phillips County News and the Billings Gazette. The comments received during the public comment period and DEQ responses to these comments are presented in **Section 8.3**.

This section includes DEQ’s response to all official public comments received during the public comment period. This final document was updated, based on public input and comment.

8.3 PUBLIC COMMENTS AND RESPONSES

Nine individual comments letters were submitted to DEQ during the public comment period. Excerpts from comment letters are provided below. Responses prepared by DEQ follow each of the individual comments. Original comment letters are held on file at the DEQ and may be viewed upon request.

Comment #1: A significant amount of work in terms of data collection, and in developing monitoring changes and remediation proposals, went into developing this document. Significant planning is required to address final closure and water contamination issues at the Zortman and Landusky mines. Issues remain regarding coliform impairments and contamination from the Goslin Flats LAD. The Landusky Metals TMDLs and Framework Water Quality Restoration Plan is a significant step in a work-in-progress. The CSP2 appreciates the effort and open lines of communication MDEQ has fostered for some time with the Zortman-Landusky cleanup effort. Active participation by all stakeholders will be an essential for the long-term and costly cleanup effort.

DEQ Response: Thank you for your acknowledgement. We appreciate your understanding of the water quality obstacles ahead.

Comment #2: Section 2.10 of the document states that “There are no MPDES regulated discharges within the TPA. Reclamation of mine features and operation of four wastewater treatment facilities have been occurring under authority of the Comprehensive Environmental Response, Compensation and Liability Act (CERCLA) since June of 2004.”

The output from both the Zortman and Landusky water treatment plants does not meet Montana water quality standards. In each case the discharge from the water treatment plant forms the source of a stream considered in the TMDL.

Although CERCLA status currently exempts the treatment plants from meeting MPDES/Montana water quality standards, these plants will not remain in CERCLA status indefinitely, and will eventually be required to meet Montana water quality standards. Because the discharge from the water treatment plants forms the source of streams, it should be explicitly stated in the Water Quality Restoration Plan that one of the goals of the Plan should be for the water treatment plants to meet Montana water quality standards.

DEQ Response: The first paragraph of **Section 3.3** explicitly states that “The ultimate goal of this water quality restoration plan, once implemented, is to ensure that all designated beneficial uses are fully supported and all standards are met.” The paragraph further states that “Water quality standards form the basis for the targets described in **Sections 5, 6 and 7.**” While standards attainment is a stated goal of TMDL implementation, the TMDL document is not intended as the final prescription of exactly how standards will ultimately be met. Nevertheless, as currently written, meeting the TMDL and associated water quality targets will ultimately require that the discharges from the water treatment plants either meet the target concentrations at the end of the pipe or the end of a mixing zone if one exists.

Section 5.9 describes several potential outcomes of a thorough engineering evaluation and cost analysis of reclamation and water management options. Although full attainment of water quality standards is the stated optimum outcome, the costs of building and maintaining the treatment infrastructure needed to address both the magnitude and duration of metals loading may force consideration of less stringent remediation endpoints (See **Section 5.4.4**).

Comment #3: Section 5.2, Stream Segments of Concern, contains Table 5-2 that lists the monitoring stations that were used to determine water quality in the impaired stream segments under consideration.

For Ruby Creek the sites used to determine water quality in the impaired stream segment were Z-17 and Z-32. These sites do not reflect water quality changes to lower Ruby Creek related to operation of the Goslin Flats Land Application Disposal Area (LAD). There is significant selenium groundwater contamination at the LAD site, as evidenced by monitoring location R-22, that should be taken into account in the TMDL. The selenium contamination due to LAD operation not only affects groundwater below the LAD area, but also seeps into surface water of lower Ruby Creek. The level of contamination is high enough to potentially affect wildlife and livestock that might drink this water. Vegetative uptake of selenium from groundwater has also been known to cause fatalities to grazing wildlife and livestock.

MDEQ should incorporate sites that reflect the contamination from the Goslin Flats LAD Area. The most appropriate site to measure these effects would be the "Robinson Hayfield" site, site Z-22C, or site Z-23 at the junction of CK and Ruby Creeks. MDEQ should select monitoring stations that reflect the surface and groundwater contamination coming from the LAD area, and should add the lower segment of Ruby Creek, which is impacted by selenium-contaminated groundwater from the Goslin Flats LAD area, to the TMDL list.

DEQ Response: Table 5-2 has been edited to include sites, R-22, Z-22C, and Z-23. The target departure discussion of Ruby Creek in **Appendix F** has been edited to include target departures occurring at the three additional sites and include a discussion of the effect of the Goslin Flats LAD on water quality in Ruby Creek. Data from the three additional sites has been added to **Appendix B**.

The Ruby Creek segment currently listed as impaired by metal pollutants extends from the confluence of Alder and Ruby gulches to the mouth of Ruby Creek on CK Creek. This segment comprises the entire length of Ruby Creek. Thus the entire length of Ruby Creek, including the reach downstream of the Goslin Gulch confluence, is listed as impaired due to several metal parameters, including selenium.

Comment #4: The Center for Science in Public Participation endorses the approach of adopting the numeric water quality standard as the water quality target for remediation of both surface and groundwater at Zortman-Landusky.

DEQ Response: The State of Montana has both surface and groundwater quality standards published in Circular DEQ-7. The appropriate approach for surface water target development where numeric standards have been established is to apply the numeric standard as the TMDL target. Surface water standards are not applied to groundwater through TMDL development, although the need to ultimately meet TMDL surface water quality targets often forces the need to reduce pollutant/contaminant loading levels within groundwater.

Comment #5: As noted in the introduction to **Section 5.7:** "... a TMDL is the sum of all of the load allocations (LAs), wasteload allocations (WLAs), and a margin of safety (MOS). LAs are allowable pollutant loads assigned to nonpoint sources and may include the cumulative pollutant load from naturally occurring and human caused sources."

The TMDLs developed for the affected stream segments are all expressed in “lbs/day.” While this is the appropriate measurement for developing a TMDL for an impacted stream segment, measuring this load in the field is not very practical. The most appropriate measurement for determining compliance with a TMDL would be a measurement of the concentration of the contaminant, as is currently the practice with the water quality sampling program.

DEQ Response: As discussed in **Section 4.1**, determining whether or not the TMDL is ultimately satisfied is whether or not the water quality targets are being met. The first paragraph of **Section 5.7** has been edited to state that measurement of the pollutant concentration in water quality samples is the appropriate means of determining TMDL attainment.

Comment #6: The document states in **Section 5.9** that “In spite of all reasonable efforts, attainment of restoration targets may not be possible due to the potential presence of pervasive mining sources and, in some cases, natural background loading sources.”

In developing a cooperative strategy for implementing the restoration of each affected water, selection of a “point-of-compliance” will also be very important in designing and implementing the remediation strategy. For each affected water, selecting the point-of-compliance should be a part of the consultation process.

DEQ Response: Selecting specific points of compliance may indeed be necessary for future restoration efforts. However, in the TMDL development stage, daily maximum loads are intended to apply throughout the entire extent of the listed segment. The third paragraph of **Section 4.0** has been edited to state this degree of TMDL application, while recognizing the possibility of establishing specific compliance points in the future as restoration efforts progress.

Comment #7: What benefits toward meeting water quality standards are currently being provided by the wastewater treatment plants? A concise summary that discusses progress associated with current treatment and what is needed to achieve the TMDL targets would be very helpful for the reader.

DEQ Response: **Section 2.10** of the document describing the wastewater sources at the Zortman and Landusky mines has been edited to include descriptions and graphs of treatment system performance during the past decade.

Comment #8: It would be helpful to clarify that the WTPs will be operating indefinitely since there is no indication that the water being treated is improving, or if the TMDL targets can ever be achieved without treatment.

DEQ Response: **Section 2.10** of the document has been edited to include a statement that perpetual treatment of mine discharges is assume necessary to minimize environmental damage and prevent exposure to toxic metal concentrations from untreated discharges.

Comment #9: More maps, graphs and figures in place of text and tables would make this document more digestible.

DEQ Response: **Section 5.0** and **Appendix F** of the document have been edited to clarify locations of waterbodies, monitoring sites, and treatment plant locations. Although graphic elements are helpful in clarifying technical details of plant operations and pollutant loading, graphics increase the size of

the document beyond the downloading capabilities of many members of the public. Thus, the documents tend to rely more on text explanations and tables to present information.

Comment #10: Chapter 7 outlines the tasks that need to take place prior to establishing reclamation strategy(ies). It seems logical to swap Chapters 6 and 7, saving the Framework discussion for last since it is generalized and dependent on what the outcome of monitoring and a more comprehensive site characterization.

DEQ Response: The sequence of document sections follows a template pattern developed from staff experience and suggestions from technical reviewers. Although monitoring results are often needed to guide implementation options, implementation approaches can also help define future monitoring goals and requirements. The significant monitoring needs in the Landusky TPA warranted the emphasis given to issues presented last in the document.

Comment #11: When working at the Lodge Pole School, I didn't realize the water quality was so bad. I support anything the State of Montana can do to clean the water on the Reservation.

DEQ Response: Although most Lodge Pole Creek water quality records are from 1998 or earlier, the data indicate that water in Lodge Pole Creek is of a higher quality than streams more directly affected by ZMI mining at Zortman and Landusky.

Comment #12: The draft TMDL doesn't adequately reflect the extent of impairment of waterbodies in the region, given the May 2011 spring flood event, which damaged the Swift Gulch water treatment system, and caused the failure of the Alder Gulch waste rock repository and the Carter Gulch seepage collection system. The draft TMDL is based on data that pre-dates the May 2011 storm events, which have dramatically altered conditions within the various watersheds. It's clear that this will take additional sampling efforts, and a recalculation of TMDLs to accurately reflect the extent of waste load reductions that will need to occur to meet water quality standards. We ask the Department to specify the next steps for incorporating these changed circumstances.

DEQ Response: **Section 6.4.1** specifically describes repairs to the water treatment infrastructure that are needed to address damage caused by high precipitation during May, 2011. These include replacement of the destroyed Carter Gulch capture system, restoration of reduced storage capacity of the Ruby Gulch pond, and replacement of the Swift Gulch Creek capture systems. In addition, **Section 7.3** specifies the need to update the monitoring records for a number of streams affected by May, 2011. These include Alder Gulch and lower Ruby Gulch. **Table 7-1** contains specific recommendations to update the water quality records for each of the twelve metals-impaired stream segments using a parameter list and analytical methods that allow the direct comparison of analytical results to numeric surface water quality standards.

There is no need to recalculate any TMDLs since the TMDL equals the water quality standard times the flow (with hardness corrections where necessary). The calculated departure from the target or TMDL values could conceivably change over time. Data collected during the most recent 10 years from the selected current condition sites is used to quantify target departures. High flow events during these periods have commonly caused spikes in water column metals concentrations. These high values in the pre-2011 data, combined with large sample sizes for most stream segments, do not necessarily translate to larger high flow target departures. In many cases, the large runoff volume from precipitation this past May resulted in lower surface water metals concentrations than during more normal years. The load reductions presented in this document are not necessarily final.

Additional sampling is required to update older analysis results and quantify metals concentrations throughout the entire length of each stream segment.

Comment #13: Because the discharge from the Zortman and Landusky water treatment plants forms the source of Ruby and Montana gulches, it should be explicitly stated in the Water Quality Restoration Plan that one of the immediate goals of the Plan should be for the water treatment plants to meet Montana water quality standards.

DEQ Response: See responses to comments 2 and 5 above.

Comment #14: The TMDL document should specifically incorporate the water quality criteria as the measurement for compliance with the TMDL.

DEQ Response: See response to Comment #5 above.

Comment #15: For each affected water, MDEQ should use the appropriate metals Montana water quality criterion for measuring whether the TMDL is being met. These limits are listed as "Target Concentrations." We ask MDEQ to add Montana WQ Standards as TMDL compliance limits to **Tables 5-23 through 5-36**. This would make it clear how the TMDL is to be implemented/enforced. Lacking a measurable enforcement standard (like the standard water quality measurement currently being done), there is no way to measure whether the TMDL is being implemented.

DEQ Response: See the response to Comment #5 above. The first paragraph of **Section 5.7** has been edited to state that "the most appropriate means of measuring compliance with metals TMDLs would be a measurement of the contaminant concentration in surface water samples." The TMDLs given in **Tables 5-23 through 5-36** are calculated from the target concentrations in **Table 5-22** that, in turn, are derived from established water quality standards for metals. Thus, the metals standards are multiplied by stream flow to directly to calculate TMDLs. Inserting the numeric standards into each TMDL and allocation table would unnecessarily duplicate the contents of **Table 5-22**.

Comment #16: The sites used to determine water quality in the impaired stream segment of Ruby Creek were Z- 17 and Z-32. These sites do not reflect water quality changes to lower portion of the segment that are related to operation of the Goslin Flats Land Application Disposal Area (LAD). There is significant selenium groundwater contamination at the LAD site, as evidenced by monitoring location R-22, that should be taken into account in the TMDL. The selenium contamination due to LAD operation over a number of years not only affects groundwater below the LAD area, but also seeps into surface water of lower Ruby Creek. The level of contamination is high enough to potentially affect wildlife and livestock that might be exposed. MDEQ should incorporate sites that reflect the contamination from the Goslin Flats LAD Area.

DEQ Response: See the response to Comment #3 above.

Comment #17: It is impossible for all water uses currently affected by metals and cyanide to be restored when water quality goals are met. For example, the water quality in Swift Gulch Creek has deteriorated for the past 10 years with increased concentrations of toxic metals.

DEQ Response: The water quality goals or TMDL targets are set such that all uses will be supported when targets are met. The deteriorating water quality in Swift Gulch Creek is caused by a lack of effective controls on mining sources. Should a system of controls be developed and effectively

applied to all Swift Gulch Creek mining sources, the logical result should be a return of metals loading to natural background levels that, with few exceptions, will support the beneficial uses designated for B-1 streams. It is unreasonable to expect a short-term restoration of beneficial uses, considering the degree and extent of water quality damage within the planning area.

Comment #18: Chronic and acute toxicity of metal and cyanide pollutants are presented in the document as individual pollutants. How does the application of individual water quality standards address synergistic effects on aquatic life?

DEQ Response: Meeting each individual water quality criterion will protect designated beneficial uses as well as address any potential synergistic effects.

Comment #19: The recommended framework strategies for achieving the pollutant reduction goals should include biological research on the effects of fine textured, sulfide wastes on periphyton, macroinvertebrates, fish, and higher plants.

DEQ Response: Section 7.3.2 of the document that addresses monitoring needs has been edited to include the recommendation in the comment for metals sediment and biological monitoring.

Comment #20: The recommended framework strategies for achieving the pollution reduction goals are inadequate and should include restoration of soil, development of wet lands, and re-establishment of native plants for sequestering heavy metals and cyanide before they impact the drainages. Much of the water quality improvements through the years have not proven effective and have just generated more water sampling data and addition of more lime.

DEQ Response: Support for a broad approach to water quality restoration including long-term solutions as proposed in the comment, makes sense in most ARD-affected watersheds. However, the recommendations in the comment would not be sufficient to offset the degree of metals loading at these mines. Lime addition has removed significant quantities of metal pollutants from collected waters. This degree of initial removal is not likely to be matched by low gradient wet land treatment or native plant sequestration in an area with steep terrain and a continental climate.

A concern with metal sequestration by plants is the fate of the sequestered metal concentrations when plants decay. Unless the vegetation is harvested or otherwise removed, metals concentrations would persist in the soil. In addition, the vast volume of acid generating waste materials at the mines is located beneath the root zone of growing plants. Without some means of interception and treatment, infiltrating precipitation would continue to deliver metal pollutants to surface waters.

Comment #21: An aluminum listing is needed for Montana Gulch and the selenium listing for Swift Gulch Creek should continue.

DEQ Response: An aluminum listing in Montana Gulch is required due to the single result of 7,450 µg/L that is more than twice the acute aquatic life criterion of 750 µg/L. The appropriate sections of the document have been edited to reflect a TMDL for aluminum in Montana Gulch.

The selenium record for the current condition sites on Swift Gulch Creek contains 117 results since 2000. There are no water quality criteria exceedances among these results. Therefore, a TMDL has not been developed for selenium in Swift Gulch Creek.

Comment #22: Appendix E, Table E-1 contains fish distribution data extrapolated from a single survey, observation or professional judgment. If this information is to be used for the TMDL's in any way it would need verification of actual field monitoring. The **Section 2.5.2** reference to the **Appendix A** figure illustrating fish distribution is incorrect.

DEQ Response: **Section 2.0** of the document, that references **Appendix E**, contains a general description of the planning area. Available data as reported is used in this description. This includes the current MFISH database. Additional fish data is not needed for metals TMDL development given the application of numeric metals standards and the ability to apply these for protection of aquatic life, including fish. The reference to **Figure A-11** has been corrected.

Comment #23: Section 2.10 mistakenly refers to the Landusky biological plant as removing only nitrogen from leach pad seepage.

DEQ Response: The section has been edited to state that the plant operates to remove nitrate, cyanide and selenium.

Comment #24: Section 2.6.1 contains no mention of cultural usage by American Indians or mention of adverse mining influences.

DEQ Response: The section refers to the current population within the planning area, which is beyond Fort Belknap boundaries. **Section 2.6.1** of the document has been edited to describe the reservation communities downstream of the planning area boundary give the approximate reservation population. The influences of mining area described in **Section 2.9.1**.

Comment #25: Section 3.1 contains the term "sufficient credible data" that is not defined. Metal and cyanide TMDL's are being developed in an atmosphere lacking oversight of mine operations. Standards compliance is needed to justify the costs of TMDL development to tax payers. The draft TMDL document is a work in progress and will hopefully consider more stakeholder input before more tax payer monies are spent.

DEQ Response: The definition of "sufficient credible data" is contained in the Montana Water Quality Act, Section 75-5-103(30), and is applied in the Water Quality Assessment Method (DEQ 2011c). The reference has been added to the **Section 3.1** discussion and list of document citations. A detailed description of all assessment methods and details that apply to making "sufficient and credible data" determinations is beyond the scope of TMDL development documents. Nevertheless, **Appendix F** TMDL development determinations are based on DEQ's approach to application of sufficient and credible data for metals impairment determinations.

Water quality compliance oversight for hard rock mining is with DEQ's Hard Rock Mining Section that issues mine operating permits. This section also has oversight responsibility for reclamation and water management at the Zortman and Landusky mines. Hard Rock Mine Section staff has assisted the TMDL program in understanding the water quality conditions, treatment system configuration, and funding framework for operations in the Landusky TPA. Once maximum allowable loads are established, stakeholder involvement in developing remediation strategies can potentially improve the level of local participation in water quality management decisions, many of which will be under the leadership of DEQ's Hardrock Mine Section.

Comment #26: The B-1 classification for Swift Gulch Creek is totally inappropriate for this extremely polluted stream.

DEQ Response: The B-1 classification refers to the potential to support a specific set of beneficial uses, independent of human pollution (See **Table 3.2.**) Swift Gulch Creek is currently classified as B-1, which means that the water is to be maintained suitable for drinking, cold water fish, associated aquatic life, and other uses. This is a high level of water quality protection consistent with both polluted and non-polluted water bodies in mountain regions across the state. The classification makes sense given the fact water flows through populated downstream communities and stream should provide protection of aquatic life. The ability to remove pollutants through time, along with natural background pollutant levels, will define through time the ability to achieve these B-1 classification goals.

Comment #27: The numeric and narrative standards described in **Section 3.3.2** are misleading in terms of concentrations that would affect aquatic life. The metals listed for the tables act in concert for any living organism and are synergistic in effect. Synergism, rather than the disparate effects of each metal is the true reality.

DEQ Response: See response to Comment #18.

Comment #28: The units in **Table 3-3** needed to be corrected to microgram rather than microliter quantities for both the acute and chronic amounts.

DEQ Response: The table has been edited to correct the column heading concentration units.

Comment #29: The numeric standards values in **Table 3-3** can be misleading as the concentrations of heavy metals we have found in Swift Gulch vary with environmental conditions and location relative to the mines. The pH of Swift Gulch Creek is an example of varying pH with gradient from the mines. Close to the mines the pH is commonly between 2 and 3 and increases down-gradient. During the past 10 years pH has decreased as the water has gone down stream. To say that Swift Gulch Creek is a B-1 water is a misnomer as the pH range should be 6.5 to 8.5.

DEQ Response: See response to Comment #25. Also note that the applicable pH criteria, defined in **Section 3.3.2** for a B-1 stream implies a range of 6.5 to 8.5 while acknowledging the possibility of naturally higher pH.

Comment #30: **Section 4.0**, Description of TMDL Components, states that “TMDLs can be expressed in terms of either mass per time, toxicity, or other appropriate measure”. This flexibility allows for “acceptable” variations in metals loads that remain deleterious to the health of the stream ecosystem.

DEQ Response: The language regarding loading units reflects the definition of a TMDL in the Federal regulations. Federal regulations also require that TMDLs reflect conditions where water quality standards are satisfied and all applicable uses are protected for the pollutants in question. The flexibility is geared toward those situations where other loading approaches may work well, such as for temperature where a mass per unit time approach is not feasible. It is correct to assume that the flexibility allows for “acceptable” variations in metals loads that remain deleterious to the health of the stream ecosystem. For metals and cyanide loading in the Landusky document, DEQ has applied units of mass per unit time (pounds per day). This works best for situations where numeric water

quality criteria exist. The loads are based on flow volume multiplied by the applicable numeric criterion that is intended to support all designated beneficial uses.

Comment #31: Please explain how the **Section 4.1** statement “By comparing existing stream conditions to target values, there will be a better understanding of the extent and severity of the problem” applies to Swift Gulch Creek.

DEQ Response: A comparison of water quality targets to actual water column concentrations measured in samples from Swift Gulch Creek illustrates the degree to which the standards are exceeded in Swift Gulch Creek, or any other stream.

Comment #32: **Figure 5.1** shows an example of ARD-related iron oxide turbidity and substrate coating in Swift Gulch Creek- and the explanation of the elevated metals in the Landusky TPA are related to the weathering of rock types that contain metal sulfide minerals. The missing part of the explanation is that the effects of the huge cyanide heap leach process accelerated this underlying geology-i.e. even though Swift Gulch does have seeps of this nature up and until the advent of large scale heap leach process it was a healthy stream ecosystem! It is therefore hoped that the causal relationship of **Figure 5.1** and the explanation of chemical events described above the figure do not give the impression the situation that exists currently in Swift Gulch is due only to the weathering of rock types!

DEQ Response: The first mention of ARD in the document occurs in **Section 2.9**, Land Use and Cover. **Section 2.9.1**, entitled “Mining” describes the role of mining in altering water quality. Therefore, mining is identified early in the document as the principal source of metals loading to surface water. The first paragraph of **Section 5.1** has been edited to restate that mining is the principal means of sulfide mineral oxidation in the planning area.

Comment #33: The draft document needs to include information from the following sources:

- 1) Fort Belknap College Aquatic Study Final Report
- 2) Fort Belknap College USDA Mines Restoration research final report
- 3) Water Quality data from the EPO office for the Fort Belknap Tribes.

DEQ Response: In the efforts to form an advisory group for the Landusky TMDL effort, a broad spectrum of stakeholders, including the Fort Belknap tribal Environmental Department, received correspondence from DEQ asking for participation in the TMDL process and information on the planning area that would be helpful in developing TMDLs. A representative of the Fort Belknap Environmental Department responded with suggestions for tribal advisory group membership, but provided no environmental monitoring information. Written and verbal requests to the tribal Environmental Department for water quality data for updating the Z-L ACCESS database have been unproductive. DEQ is not aware of the documents entitled “Fort Belknap College Aquatic Study Final Report” or “Fort Belknap College USDA Mines Restoration Research Final Report.” If these documents contain information that would change the recommendations for load reductions, future adjustments can be made through the adaptive management process described in **Section 7.2**.

If the Fort Belknap tribes had water quality information useful for TMDL development, it is assumed that such data would have been made available to both DEQ and Spectrum Engineering. Lacking such data, the metals TMDLs were developed using the data available. Fortunately, the Z-L ACCESS database is large and clearly documents that the streams addressed are in need of metals TMDLs. Although additional data could further a substantiate the degraded stream conditions, is unlikely that

additional data and analysis from the studies mentioned in the comment would markedly revise impairment conclusions.

Comment #34: The data timeframes in **Table 5-3** do not record changes that could have taken place in this very fluid system of pollution.

DEQ Response: The timeframes given in **Table 5-3** to estimate natural background water quality conditions reflect those available in the Z-L ACCESS database. The water quality record for many of these sites needs to be updated to better indicate current conditions. Recommendations for improving the estimation of background conditions are contained in **Section 7.3** of the document.

Comment #35: The location of BKSS-2 cannot be found on the **Figure 5.2** map.

DEQ Response: The location of site BKSS-2 is obscured in **Figure 5.2** by the label for site BKSS-9. The small scale of the map prevents printing of all labels. Site BKSS-2 is located between the letters “B” and “K” in the label for site BKSS-9.

Comment #36: The text of **Section 5.3** states that “The most recent data also reflects the effects of significant surface reclamation activities that occurred at the Zortman and Landusky mines from 1999 through 2005.” If that is so it is assumed that water quality conditions would improve and in the case of Swift Gulch Creek they are deteriorating.

DEQ Response: The general statement does not specifically address the effects of mine reclamation on the monitoring record for each site. In the short-term, surface reclamation is unlikely to have a uniform effect of improving water quality at all sites, including those in Swift Gulch Creek.

Comment #37: Is it true that the detection limits of analytical methods for older analysis results are frequently higher than the numeric criteria used to determine impairment? Older chemistry data would have lower values due to not being as precise as the new equipment in detection limits!

DEQ Response: The reported method detection limits for older analytical results in the Z-L ACCESS database are commonly higher than the current most restrictive numeric water quality criterion. An example is a method detection limit for lead of 10 µg/L prior to 1996 that was reduced to 3 µg/L after 1996. The chronic aquatic life criteria for lead are often less than 10 µg/L at hardness values typical during runoff.

Comment #38: The use of median values in **Table 5.5** is misleading when some values do show the effects of mining. This data misses the point of what living organisms are exposed to!

DEQ Response: Median values are used where data are suspected of not being normally distributed. The median values in **Table 5-5** are intended to generally describe water chemistry having minimal ARD effects, rather than to represent a spectrum of conditions to which organisms may be exposed.

Comment #39: Are sites L-41 and L-45 truly natural background sites as the text says they are “assumed” to be? They could easily be influenced by the 87-91 leach underground water drainage as the shear zone might not be where it is represented on the map!

DEQ Response: The current water quality record in the planning area is inadequate to establish truly natural background conditions. The existing records for sites L-41 and L-45 appear to indicate a lack of ARD effects due to low sulfate and low or non-detectable metal concentrations.

Comment #40: Separate accounting for natural background metals loading versus loading from mining sources is almost impossible to do due to the influence of mining and the unknown hydrology. The historical use of the Little Rocky Mountains (Fur Cap Mts., Islands Mts) as sacred areas by American Indians for 1,000's of years attests to the excellent water health of the creeks and springs.

DEQ Response: An accurate accounting of pollutant loading from natural background and mining sources presents many challenges that sometimes are beyond the scope of TMDL development, particularly in locations where there is a long mining history of mineralized ores. This is acknowledged in the **Section 5.3.1** discussion of composite loading allocations for combined natural background and mining sources where separate allocations to these sources cannot be made.

Comment #41: References in the document to the treatment provided by the biological treatment plant are not consistent.

DEQ Response: See response to Comment # 23.

Comment #42: Sediment metals data is available in the Fort Belknap College Aquatic Study Final Report.

DEQ Response: See response to Comment #33.

Comment #43: Toxicity testing (see toxicity test results for Swift Gulch in the Fort Belknap College Aquatic Study Final Report) would be a viable option to DEQ use of the Multimetric Indices and the River Invertebrate Prediction and Classification System (RIVPACS) scores as supplemental indicators.

DEQ Response: Toxicity testing is a common research tool for establishing numeric water quality standards. Therefore, the metals targets in this document are influenced, to some degree, by toxicity testing. Although local toxicity testing may better identify local aquatic life limitations, the MMI and RIVPACS scores are adequate general indicators of aquatic life support.

Comment #44: The use of targets and supplemental indicators introduces undue variability into standards compliance. Data age is an inappropriate factor for making TMDL decisions.

DEQ Response: The numeric water quality criteria are the targets used to determine the need for TMDLs. Thus, the metals targets are directly linked to legally established use support criteria. Modifying established criteria is a formal rule-making process that protects against water quality degradation. Some flexibility is required as criteria (and targets) are adjusted to reflect relevant toxicity or exposure research.

More recent water chemistry data is of higher quality because of improved consistency in sample collection and analysis methods, and generally lower method detection limits. These improvements over time increase the importance of data age when concluding the need for TMDLs.

Comment #45: The target achievability discussion in **Section 5.4.4** indicates that water quality targets will not be met. But the state of Montana passed a bill so the water treatment will have to go on for perpetuity –but what of the water quality?

DEQ Response: The **Section 5.4.4** target achievability discussion describes the annual standards exceedances that occur under current treatment system funding. The bill referenced in the comment may be the one passed by the Montana legislature to establish the project trust fund. Seasonal large flows will continue to cause in-stream standards exceedances. The cost of building the treatment plant capacity that would prevent all bypasses may exceed available funding, even with the income from the additional trust.

The nature and extent of the mining sources of metals loading will require water treatment into the distant future. The quality of water routed to the treatment systems may deteriorate for some parameters and improve for others. Despite anticipated funding limits, establishing TMDLs and monitoring the reclaimed areas and treatment systems provides a framework for finding future opportunities to incrementally improve water quality. Water quality improvement until all standards are met and all beneficial uses are supported is a stated objective of this document.

Comment #46: **Table 5-20**, containing TMDL conclusion for Swift Gulch Creek, should specify TMDLs for selenium and pH.

DEQ Response: See response to Comment #21 regarding the need for a selenium TMDL in Swift Gulch Creek. TMDLs are not developed for pH because of the impracticality of converting standard pH units into meaningful loading units. It is assumed that treatment to reduce total recoverable metals loading will also bring pH values into compliance with standards.

Comment #47: The TMDL graphs for non hardness dependent metals in **Figure 5-6** and the loading values in **Table 5-20** are misleading.

DEQ Response: The vertical axis in **Figure 5-6** was mistakenly labeled as a concentration rather than a load. The axis label has been edited to reflect the loading units of pounds per day. The loading values in **Table 5-20** are example TMDLs for specific flow and hardness conditions and should not be interpreted as fixed or absolute values.

Comment #48: The seasonal pathways of metal loading are not known since no sediment data is included in the explanation. This part of the draft document and the TMDL's and allocations for Swift Gulch are just examples and could be very misleading as the data is not there to support the information as given. Until sediment data is included **Table 5-35** is also misleading as how can you tell the natural background loading from the effect of the mining activity?

DEQ Response: A common characteristic of seasonal metals loading in watersheds with a snowmelt runoff component is higher turbidity and sediment transport during runoff than during base flow periods. This difference is reflected in results for total recoverable metal concentration because some of the sediment bound metals are dissolved by the weak acid extraction of the total recoverable analysis procedure. Regardless of the bio-availability of sediment-adsorbed metals, the water quality data shows this seasonal trend for metals such as iron and aluminum that are common in sediment.

The values in the loading and allocations tables are examples based on summary statistics for metal concentrations during high and low flow conditions. The table titles clearly specify that the values are examples, and summary statistics are appropriate for use in summary tables. Sediment chemistry would have value as a supplemental indicator of impairment, but target departures are more accurately assessed in the same concentration units as the targets themselves. Natural background

concentrations are estimated from sites remote from mining disturbances compared to those used to estimate current loading from mining.

Comment #49: Where is the role of the Fort Belknap College (now named Aaniiih Nakoda College) in the framework restoration plan? We have a water quality program which was developed partly because of the tremendous effect that the mines have had on the Fort Belknap Indian Reservation. We have had Environmental Justice Grants, Packard Foundation grants, USDA grants, and will apply to NIH for environmental health grants in the coming year.

DEQ Response: The second paragraph of **Section 6.2** has been edited to add Aaniiih Nakoda College as providing technical expertise, educational outreach, and possible funding for the restoration effort.

Comment #50: A better approach to the source control evaluation described in **Section 6.4.3** would be a restoration ecology approach not a low permeability grout curtain and let the Fort Belknap Indian Reservation personnel be in charge of the project

DEQ Response: Participation by Fort Belknap Reservation personnel in implementing restoration using any scientifically sound and cost conscious approach is encouraged by DEQ's Watershed Protection Section and other stakeholders. The Tribe's membership among the project working group should also provide a forum for proposing tribal reclamation recommendations.

Comment #51: The pollution events reflected in the 12 drainages in the draft document might have been averted if there had been stricter control, oversight and Tribal consultation.

DEQ Response: The comment is acknowledged. DEQ's current program for hardrock mine permitting would more closely match bond requirements to anticipated reclamation and water treatment needs, compared to the procedures in place in 1979. Legal restrictions on heap leach mining and improvements in data collection, organization and processing are likely to improve future compliance oversight. The scoping process in place for permitting large surface mines would provide opportunities for consultation with the Fort Belknap Tribes.

Comment #52: The whole monitoring strategy and adaptive management approach needs to be changed and a new direction and emphasis needs to be taken.

DEQ Response: The basic premise of adaptive management is to allow development and consideration of new, workable, and effective monitoring approaches and proposals by interested stakeholders.

Comment #53: The TMDL process and water quality restoration framework described in the draft document should:

- Provide more education to tribal and surrounding communities concerning water quality issues
- Insure that the water quality test results are accurate
- Involve Fort Belknap tribal members and AANIIH/NAKODA College in water quality monitoring of the drainages impacting the Fort Belknap Indian Reservation
- Put more emphases on restoration of the mine site itself
- Hire more tribal employees to run the water treatment plants, to do the monitoring and reclamation
- Make sure other tribes with similar problems are consulted

- Ultimately return the Sacred Mountains to the tribe.

DEQ Response: An approved TMDL document opens opportunities for tribal stakeholders to apply for and procure funding for community education, voluntary participation in environmental monitoring, consideration of effective and workable reclamation alternatives, and consultation with others facing similar reclamation challenges. Procedures for preferential selection of tribal members for reclamation and water treatment positions and ultimate transfer of land ownership are beyond the scope of the TMDL process.

Comment #54: Was the Fort Belknap Community aware of the TMDL development process in the Landusky planning area and were they provided an opportunity to participate?

DEQ Response: The process for stakeholder participation in the Landusky TMDL process, including tribal participation, is described above in the first two paragraphs of **Section 8.0**

Comment #55: Has the Fort Belknap Tribal Community developed a water code that was considered in TMDL development?

DEQ Response: According to staff of the Fort Belknap Environmental Department, the tribes are currently working to develop water quality criteria, but such criteria are not available for incorporation in the draft Landusky TMDL document.

Comment #56: Has the Fort Belknap Tribal Community been working with the EPA in reviewing the document?

DEQ Response: EPA staff has reviewed the draft TMDL and will have final approval. To assure that Assiniboine/Gros Ventre interests have been addressed, EPA requested a copy of the public comments on the document and so are aware of those submitted from the Fort Belknap Tribes.

Comment #57: Has the periodic sampling conducted by the Fort Belknap Tribes been incorporated into the document?

DEQ Response: See response to Comment #33 above.

Comment #58: Please include the Bureau of Indian Affairs as a potential cooperator in assisting with water quality monitoring and reclamation plan development.

DEQ Response: **Section 6.2** of the document, “Role of DEQ, Other Agencies, and Stakeholders”, has been edited to include the Bureau of Indian Affairs as a stakeholder in TMDL planning and implementation in the Landusky planning area.

Comment #59: Several streams evaluated by DEQ’s TMDL Program in the Little Rocky Mountains mining district cannot meet either of Montana’s Chapter 30; narrative or numeric standards for human health or aquatic life:

- Swift Gulch Creek has selenium, arsenic, iron, cadmium, lead, nickel, and aluminum exceedances
- South Big Horn Creek has elevated arsenic, aluminum, nickel, iron, and zinc with related staining from ARD precipitation

- Movement of mine tailing sediment in King Creek has been recorded since 2007. The King Creek catchment pond, Shambo Lake, is nearing its sediment retention capacity and will spill into reclaimed areas. King Creek metals of concern include cadmium and selenium
- The loss of historic high flows from King Creek, Montana Gulch, and Swift Gulch Creek needs to be addressed as a water rights issue and Fort Belknap needs to be compensated for flow losses.

The present B-1 water-use classification needs to be maintained for these streams.

DEQ Response: DEQ evaluation of TMDL needs differs from those in the comment. The differences by stream are the following:

- Swift Gulch Creek – The data records do not support the need for selenium or lead TMDLs.
- South Big Horn Creek – As indicated in the comment, the data records support TMDL development for aluminum, arsenic, cadmium, iron, nickel, and zinc.
- King Creek - The data record supports TMDL development for arsenic, cadmium, and selenium. Determination of the need for a sediment TMDL in King Creek will require a field assessment. Sediment and the need for this assessment have been added to the entries in **Table 7-1** of the document as a monitoring recommendation for King Creek.
- Flow Reductions – Consideration and settlement of water rights issues are beyond the scope of this TMDL document.

Comment #60: Section 5.4.4 discusses periodic large spring rainstorms, snow melt and excess amounts of water that cannot be captured in the drainage capture systems, and how required decisions will allow temporary bypasses of the drainage system. Can the capture systems be enlarged or constructed to capture excess runoff or can something be done to prevent having to bypass pollutants into the waters/streams? The increase of volume of water caused by storm events should be retained and treated on site. There should be a more effective control plan put in place to address capture system bypasses.

DEQ Response: Treatment system bypasses are common during high flows. Expanding the capacity of the treatment system to capture all flows may be theoretically possible, but at the current level of treatment, the Zortman-Landusky project is chronically underfunded. Water quality tradeoffs remain as a response to large flows.

Comment #61: Section 6.4 discusses the water system treatment repairs and improvement options. The discussion mentions the need to restore the capture systems and describes the associated costs. However, the discussion does not mention expanding the current capture systems to treat waters from storm events. Options should be broadened to ensure the public and health is protected from pollutants that exceed the TMDL during such events.

DEQ Response: The “Capture System Improvements” discussion in **Section 6.4.2** has been edited to include the option of expanding the existing capture trenches to intercept more ARD-affected water.

Comment #62: Although use of risk assessment processes is common among state and federal agencies to help manage risks associated with exposure to pollutants (heavy metals), these tools are inadequate and do not serve the needs of Native peoples. The traditional knowledge of native peoples needs to be incorporated into the decision making process. It is important to not only ensure that human health is protected but to also ensure that traditional cultural practices are protected. Traditional practices are directly related to individual and community health. There is a need to restore and maintain the traditional and cultural practices in the decision making process. Did this document/Plan take into

consideration the cultural uses, traditional knowledge and include Native American Leaders in the risk assessment process?

DEQ Response: The document contains a reference to risk management in the **Section 6.5** description of the CERCLA decision-making process for undertaking removal actions. On a more project-specific level, the Fort Belknap Environmental Department is represented on the interagency technical working group that has responsibility for considering and proposing the reclamation options contained in the 2006 Engineering Evaluation and Cost Analysis (Spectrum Engineering 2006). Section VIII of the 2006 Action Memorandum that recommended continued removal actions at the Zortman and Landusky mines, specifically describes the extent of consultations with the Fort Belknap Government. The section describes phone, e-mail, written, and face-to-face communications with tribal government representatives and tribal consultants for the purpose of reviewing and selecting reclamation and water management options at the mine sites. Assuming a similar level of tribal government involvement in decision making during the next scheduled update of the 2006 Engineering Evaluation and Cost Analysis, there will be ample opportunities for tribal representatives to stress the importance of protecting traditional cultural practices.

Comment #63: The document language is too technical for the common lay person to understand.

DEQ Response: Surface water quality assessment and TMDL development are technical processes that warrant some use of technical language in the document. The TMDL program staff is aware that technical language may be difficult to interpret and has made a concerted effort to strike a balance between required technical completeness and readability.

Comment #64: When will the TMDLs for nitrate and fecal coliforms be developed?

DEQ Response: TMDL development for nitrate and fecal coliforms in the Landusky TPA has not been included in work scheduled through 2014. These impairment conditions will remain on Montana's 303(d) List of water body-pollutant combinations that require TMDLs.

Comment #65: Do the developed TMDLs apply on the Fort Belknap Reservation?

DEQ Response: The Fort Belknap Reservation boundary defines the northern boundary of The Landusky TMDL planning area. The TMDLs in this document apply within the planning area boundaries only. Waters within the Fort Belknap Reservation boundary are outside of State of Montana jurisdiction.

Comment #66: Why were TMDLs not developed prior to or during mine permitting.

DEQ Response: Provisions requiring water quality assessment and TMDLs were enacted into the Montana Water Quality Act in 1997; the mines received operating permits in 1979. Stream acidity and metals loading problems came to light in 1991 from water monitoring required by two wastewater discharge permits. The need for TMDL development in the Landusky area, based on metals concentrations elevated above water quality standards, was identified in the mid-1990s. Because of limited resources, TMDL efforts have focused on other planning areas since 1997, mostly in western Montana. Nevertheless, Landusky area TMDL development was identified as a priority area in the mid-2000s, ahead of many areas located throughout the state.

Comment #67: How will pre-mine conditions be determined if the assessment method is based on data collected during the most recent 10 years?

DEQ Response: Current loading conditions are area based on the most recent data. Natural background conditions are estimated from data for sites remote from mined areas. Data from these sites was commonly collected prior to 2000, so pre-mine conditions are generally estimated from older data. The assessment method does not preclude the use of older data to infer natural background conditions if newer data from potential background condition sites is no longer representative or feasible to collect. Note that the assessment method is for determining impairment from human sources, not from natural background or pre-mining sources.

Comment #68: What was the basis for selection of Swift Gulch Creek current condition sites?

DEQ Response: The criteria applied in selecting current condition sites are:

- Location reflecting water quality along as much of the main channel length of listed segments as possible
- Location bracketing significant mining sources
- The age of the data record
- The sample size for analysis results and measurements.

Comment #69: Why were leach pad water quality problems and pad stability issues not addressed during permitting?

DEQ Response: The ores were initially represented as being mostly oxidized materials with minimal acid generating potential. As mining progressed, a larger portion of processed ore contained increasing amounts of sulfide minerals with high acid generating potential. Pad stability was probably assessed during the permitting process and not perceived as a problem.

Comment #70: Why does **Table 5-5** not contain values for all metals, indicate the sample sizes associated with each median value, and include pre-1996 data.

DEQ Response: The selected parameters in **Table 5-5** are those with easily recognized signatures for ARD. Including results and sample size figures for all metal parameters would have made the table unnecessarily large for its intended purpose of illustrating water quality conditions unaffected by ARD. The median values in the table were calculated, in part, from pre-1996 analytical results.

Comment #71: Why are there no January-March data in **Table 5-6**?

DEQ Response: The data record for the **Table 5-6** sites contains a single March reading. The lack of January to March data is probably due to no water in the channels during this period or due to lack of mid-winter access to the sites

Comment #72: Explain composite allocation per **Section 5.3.1** discussion.

DEQ Response: Composite allocations to the sum of natural background plus mining sources are used where the two sources cannot currently be distinguished. The word “plus” is inserted into the explanatory sentence to clarify this point.

Comment #73: Are waters applied to Goslin Flats LAD considered state waters?

DEQ Response: Land application disposal waters are excluded from the definition of state waters (75-5-103(34)(b)(ii), MAC).

Comment #74: Are standards applied to the Goslin Flats discharge?

DEQ Response: Water quality criteria are typically applied to receiving waters. Standards may be applied to end-of-pipe discharges if all assimilative capacity of the receiving water has been consumed.

Comment #75: Why has no sediment metals study been completed to address this source?

DEQ Response: Montana has no numeric standards that apply to sediment. Considering the large volumes of wastewater generated at the mines, funding that may be available for a study of sediment metals loading is likely to be committed to additional water treatment and treatment system maintenance.

Comment #76: Why is a selenium TMDL required for Alder Gulch with only a single exceedance (**Table 5-9**)?

DEQ Response: The single exceedance is more than twice the acute aquatic life criterion for selenium. A selenium listing based on this single exceedance is consistent with Montana's updated assessment methodology.

Comment #77: What is the data source for **Table 5-22**?

DEQ Response: The example high flow and low flow TMDLs in **Table 5-22** are derived from data recorded in the Z-L ACCESS database constructed and maintained by Spectrum Engineering, Inc.

Comment #78: There is a site up stream of L-19 on Swift Gulch Creek that is more impacted than L-19.

DEQ Response: Regardless of the level of water quality degradation, TMDLs apply to all points on an impaired stream and are calculated by multiplying flow by the applicable water quality criterion.

Comment #79: Does the seasonality discussion (**Section 5.8.1**) address sediment or water sampling?

DEQ Response: Seasonality is a required consideration for TMDL development. Therefore, the discussion more directly addresses total recoverable concentrations of metal pollutants in surface water. Regardless of sample timing, numeric water quality standards and water quality targets apply during all seasons.

Comment #80: How will the adaptive management process prevent perpetuating error?

DEQ Response: In the TMDL context, the adaptive management process is a feedback approach to improving water quality that is based on interpretation of validly collected environmental data to make meaningful adjustments to a remediation strategy. Although the approach is subject to some degree of human error, it provides a framework for iterative review and adjustment of water management and treatment decisions in order to minimize perpetual error.

Comment #81: What role will the Fort Belknap Indian Community/Fort Belknap College play in the restoration strategy?

DEQ Response: See the response to Comment # 62 above.

Comment #82: How would the proposed grout curtain work to prevent pollution of Swift Gulch Creek?

DEQ Response: The grout curtain, if determined to be feasible, would work in conjunction with a pumping system that would intercept ARD-affected water prior to its discharge to Swift Gulch Creek and deliver that water for treatment in the Landusky treatment plant.

Comment #83: The current restoration plan needs to be reevaluated and should include plant sequestration of metals.

DEQ Response: See response to Comment # 20

Comment #84: Restoration within the Landusky TPA needs to begin at the top of the mountain. Leach pads continue to be large sources of metal contamination. The pad liners will eventually fail and contribute to pollution indefinitely. Degraded soil structure and limited soil microbial activity in reclaimed surface cover soils is a continuing problem.

DEQ Response: Maintaining a stable and functioning soil cover on mined lands is a proven means of protecting water quality. Unfortunately, this is a long-term goal at Zortman and Landusky because of the limited cover soil resources, high acid generating potential of the wastes, and harsh physical setting. Although the lime amendment and biological plants address more immediate problems, the plants routinely prevent large, frequent metals loading at toxic levels. Reclamation that addresses both short- and long-term problems is probably possible if actively promoted by the technical working group.

9.0 REFERENCES

- Buchman, M. F. 2008. NOAA Screening Quick Reference Tables. NOAA HAZMAT Report 08-1. Seattle, WA: NOAA. http://response.restoration.noaa.gov/book_shelf/122_NEW-SQuiRTs.pdf.
- Burlingame, Merrill G. and K. Ross Toole. 1957. A History of Montana: Lewis Historical Publishing Company.
- Denisger, J. 1998. In Situ Bioanalysis on Coho Eggs and Daphnia Done in Response to Increasing Trends in Sulfate Levels for Ouinsam Coal Exposure. Nanaimo, BC: BC Environment, Pollution prevention and Pesticides.
- Gabelman, Joan, George Furniss, Joel Adams, Tom Osborne, and Shannon Shaw. 2005. Pre-Mining Water Quality Evaluation of Swift Gulch. Phillips County, Montana.
- Mitchell, Larry D. 2004. Zortman & Landusky Mines: HJR 43 Water Quality Impacts. S.I.: s.n.
- Montana Department of Environmental Quality. 2011. Water Quality Assessment Method. Helena, MT: Montana Department of Environmental Quality.
- Montana Department of Environmental Quality. 2008. Safe Drinking Water Information System (SDWIS). Helena.
- . 2010a. Circular DEQ-7: Montana Numeric Water Quality Standards. Helena, MT: Montana Department of Environmental Quality. <http://deq.mt.gov/wqinfo/Standards/PDF/DEQ-7.pdf>. Accessed 6/9/11a.
- . 2010b. Circular DEQ-7: Montana Numeric Water Quality Standards. Helena, MT: Montana Department of Environmental Quality. <http://deq.mt.gov/wqinfo/Standards/PDF/DEQ-7.pdf>. Accessed 6/9/11b.
- . 2011. Abandoned Mine Lands: Historical Narrative of Little Rockies Mining District. <http://deq.mt.gov/abandonedmines/linkdocs/155tech.mcp>. Accessed 11/30/11 A.D.
- . 2011. The Montana Department of Environmental Quality Metals Assessment Method. Helena, MT: Montana Department of Environmental Quality.
- Montana Department of Environmental Quality, Water Quality Planning Bureau. 2010. Montana 2010 Final Water Quality Integrated Report. Helena, MT: Montana Department of Environmental Quality, Planning, Prevention and Assistance Division, Water Quality Planning Bureau. Report WQPBDMSRPT-03 Rev.

- Montana Department of Fish, Wildlife, and Parks. 2011. Fish Distribution Spatial Data. Helena, MT: Montana Department of Fish, Wildlife and Parks.
<http://fwp.mt.gov/fishing/mFish/default.html>.
- Montana Department of Natural Resources and Conservation. 2008. Montana Natural Resources Information Interactive Map Website. Helena, MT: Montana Department of Natural Resources and Conservation. <http://nris.state.mt.us/interactive.html>. Accessed 7/25/11 A.D.
- Montana State Library. 1992. Natural Resources Information System (NRIS): National Landcover Dataset, Montana. Montana State Library Natural Resource Information Service Website.
<http://nris.state.mt.us/nsdi/nris/nlcd/nlcdvector.html>.
- Murray, Robert A. 1978. Gold Mining Near Landusky and Zortman, Montana With Special Emphasis on the EIS Study Area for the Ruby Gulch, August, Little Ben, Gold Bug, and Related Mines. Sheridan, WY: Western Interpretive Services, Inc.
- Osborne, T. 2003. The Water Balance and Chemical Mass Loads at the Zortman and Landusky Mines, Montana. Lexington, KY: American Society for Mining and Reclamation.
- Osborne, T. and Kathy Gallagher. 2001. Hydrology Support Document for the Supplemental Environmental Impact Statement - Reclamation of the Zortman and Landusky Mines, Phillips County, MT.
- Porter, K. W. and E. M. Wilde. 2001. Geologic Map of the Zortman 30' x 60' Quadrangle, Eastern Montana. Montana Bureau of Mines and Geology. 1:100,000.
- Prism Group. 2004. PRISM Precipitation Data. <http://www.ocs.orst.edu/prism/index.phtml>.
- Schwarz, Gregory E. and R. B. Alexander. 1995. Soils Data for the Conterminous United States Derived From the NRCS State Soil Geographic (STATSGO) Data Base. [Original Title: State Soil Geographic (STATSGO) Data Base for the Conterminous United States.]. Reston, VA: U.S. Geological Survey. Report USGS Open-File Report 95-449.
<http://water.usgs.gov/GIS/metadata/usgswrd/XML/ussoils.xml>.
- Spectrum Engineering. 2008. Swift Gulch Mitigation Options. Short and Long Term Treatment, Analysis of the Options Considered to Capture and Treat the Acid Water in Swift Gulch and Ways to Capture and Manage the Resulting Sludge. Billings, MT: Spectrum Engineering.
- . 2010. Interim Report on Water Treatment in Swift Gulch Creek. Billings, MT: Spectrum Engineering.
- . 2011. Zortman and Landusky Mine Work Plan Resulting From May 2011 Rain Damage. Billings, MT: Spectrum Engineering.

- Spectrum Engineering, Inc. 2005. Microsoft ACCESS Database of Environmental Monitoring, Zortman-Landusky Mining and Reclamation Project. Billings, MT: Spectrum Engineering, Inc. Accessed 10/19/10.
- . 2006. Final Engineering Evaluation/Cost Analysis for Water Management at the Zortman and Landusky Mines, Phillips County, Montana.
- U.S. Geological Survey. 1999. National Hydrography Dataset (NHD) - Medium Resolution. United States Geological Survey. <http://nhd.usgs.gov>. Accessed 7/25/11 A.D.
- United State Department of the Interior, Bureau of Land Management, and Hard Rock Bureau Montana Department of Environmental Quality. 1996. Final Environmental Impact Statement, Zortman and Landusky Mines, Reclamation Plan Modifications and Mine Life Expansions.
- United States Census Bureau. 2000. 2000 Census Data.
http://factfinder.census.gov/home/saff/main.html?_lang=en.
- United States Department of the Interior. 2008. USGS Station 06115350 Rock Creek Near Landusky, MT. Geological Survey Database.
- United States Department of the Interior, Bureau of Land Management, and Montana Department of Environmental Quality. 2001. Final Supplemental Environmental Impact Statement for Reclamation of the Zortman and Landusky Mines, Phillips County, MT.
- United States Environmental Protection Agency. 1999. Draft Guidance for Water Quality Based Decisions: The TMDL Process (Second Edition). Washington, DC: United States Environmental Protection Agency. Report EPA 841-D-99-001.
http://water.epa.gov/lawsregs/lawsguidance/cwa/tmdl/decisions_index.cfm. Accessed 8/17/11 A.D.
- University of Montana. 2002. Wildlife Spatial Analysis Lab, SILC – Satellite Imagery Land Cover Classification Projects for Idaho, Montana, and the Dakotas.
<http://www.wru.umt.edu/reports/gap>.
- Wischmeier, W. H. and D. Smith. 1978. Predicting Rainfall Erosion Losses: A Guide to Conservation Planning. Washington, D.C.: United States Department of Agriculture. Report Agriculture Handbook No. 537. http://topsoil.nserl.purdue.edu/usle/AH_537.pdf.
- Woods, Alan J., James M. Omernik, John A. Nesser, Jennifer Shelden, Jeffrey A. Comstock, and Sandra J. Azevedo. 2002. Ecoregions of Montana, 2nd ed., Reston, VA: United States Geographical Survey.

APPENDIX A – TMDL STATUS SUMMARY TABLE AND MAPS

Table A-1. 2010 Impaired Waterbodies, Impairment Causes, Impaired Uses, and Impairment Cause Status in the Landusky TPA A-3

Figure A-1. Landusky TMDL Planning Area A-9

Figure A-2. Ecoregions A-10

Figure A-3. Topography..... A-11

Figure A-4. Geology..... A-12

Figure A-5. Erodibility..... A-13

Figure A-6. Slope A-14

Figure A-7. Hydrography A-15

Figure A-8. Selected Ground Water Quality Well Sites..... A-16

Figure A-9. Annual Precipitation A-17

Figure A-10. Land Cover A-18

Figure A-11. Fish Distribution A-19

Figure A-12. Population Density A-20

Figure A-13. Ownership A-21

Figure A-14. Agricultural Use A-22

Figure A-15. Discharges..... A-23

Figure A-16. Zortman Mine Facilities Map (Haight 2004)..... A-24

Figure A-17. Landusky Mine Facilities Map (Haight 2004)..... A-25

Table A-1. 2010 Impaired Waterbodies, Impairment Causes, Impaired Uses, and Impairment Cause Status in the Landusky TPA

Waterbody & Location Description	Waterbody ID	Impairment Cause	TMDL Pollutant Category	Impaired Use(s)	Impairment Cause Status
ALDER GULCH, headwaters to mouth (Ruby Creek)	MT40E002_050	Cadmium	Metals	Aquatic Life Warm Water Fishes	Addressed by Cadmium TMDL
		Copper	Metals	Aquatic Life Warm Water Fishes	Addressed by Copper TMDL
		Lead	Metals	Aquatic Life Warm Water Fishes	Addressed by Lead TMDL
		Mercury	Metals	Aquatic Life Warm Water Fishes	Addressed by Mercury TMDL
		Selenium	Metals	Aquatic Life Warm Water Fishes	Addressed by Selenium TMDL
		Zinc	Metals	Aquatic Life Warm Water Fishes	Addressed by Zinc TMDL
		pH	pH/Acidity/Caustic Conditions	Aquatic Life Warm Water Fishes	Addressed by cadmium TMDL
		Alteration in stream-side or littoral vegetative covers	Non-pollutant	Aquatic Life Warm Water Fishes	Not yet addressed by a TMDL or restoration plan
BEAVER CREEK, headwaters to Fort Belknap Reservation boundary	MT40M001_011	Cadmium	Metals	Aquatic Life Warm Water Fishes	Not impaired based on updated assessment
		Iron	Metals	Aquatic Life Warm Water Fishes	Not impaired based on updated assessment
		Lead	Metals	Aquatic Life Warm Water Fishes	Addressed by Lead TMDL

Table A-1. 2010 Impaired Waterbodies, Impairment Causes, Impaired Uses, and Impairment Cause Status in the Landusky TPA

Waterbody & Location Description	Waterbody ID	Impairment Cause	TMDL Pollutant Category	Impaired Use(s)	Impairment Cause Status
BIG HORN CREEK, SOUTH FORK, Zortman Mine to Fort Belknap Reservation boundary	MT40I001_030	Aluminum	Metals	Aquatic Life, Cold Water Fishes	Addressed by Aluminum TMDL
		Arsenic	Metals	Aquatic Life Cold Water Fishes Drinking Water	Addressed by Arsenic TMDL
		Cadmium	Metals	Aquatic Life, Cold Water Fishery	Not impaired based on updated assessment
		Nickel	Metals	Aquatic Life Cold Water Fishes Drinking Water	Addressed by Nickel TMDL
		Zinc	Metals	Aquatic Life Cold Water Fishes	Addressed by Zinc TMDL
KING CREEK, headwaters to Fort Belknap Reservation boundary	MT40I001_040	Selenium	Metals	Aquatic Life, Cold Water Fishery	Not impaired based on updated assessment
		Alteration in stream-side or littoral vegetative covers	Non-pollutant	Aquatic Life, Cold Water Fishery	Not yet addressed by a TMDL or restoration plan
		Physical substrate habitat alterations	Non-pollutant	Aquatic Life, Cold Water Fishery	Not yet addressed by a TMDL or restoration plan
LODGE POLE CREEK, headwaters to Fort Belknap Reservation boundary	MT40I001_050	Cadmium	Metals	Aquatic Life, Cold Water Fishery	Addressed by TMDL
		Mercury	Metals	Aquatic Life, Cold Water Fishery Drinking Water	Addressed by Mercury TMDL
		Cause Unknown	Non-pollutant	Aquatic Life, Cold Water Fishery	Addressed by Cadmium TMDL

Table A-1. 2010 Impaired Waterbodies, Impairment Causes, Impaired Uses, and Impairment Cause Status in the Landusky TPA

Waterbody & Location Description	Waterbody ID	Impairment Cause	TMDL Pollutant Category	Impaired Use(s)	Impairment Cause Status
MILL GULCH, headwaters to mouth (Rock Creek)	MT40E002_100	Copper	Metals	Aquatic Life Drinking Water Warm Water Fishes	Addressed by Copper TMDL
		Mercury	Metals	Aquatic Life Drinking Water Warm Water Fishes	Addressed by Mercury TMDL
		Lead	Metals	Aquatic Life Drinking Water Warm Water Fishes	Not impaired based on updated assessment
		Selenium	Metals	Aquatic Life Warm Water Fishes	Addressed by Selenium TMDL
		pH	pH/Acidity/Caustic Conditions	Agriculture Aquatic Life Industrial Primary Contact Recreation	Addressed by Copper TMDL
		Alteration in stream-side or littoral vegetative covers	Non-pollutant	Aquatic Life Warm Water Fishes	Not yet addressed by a TMDL or restoration plan
MONTANA GULCH, headwaters to mouth (Rock Creek)	MT40E002_010	Arsenic	Metals	Aquatic Life Warm Water Fishes	Addressed by Arsenic TMDL
		Cadmium	Metals	Aquatic Life Warm Water Fishes	Addressed by Cadmium TMDL
		Copper	Metals	Aquatic Life Warm Water Fishes	Not impaired based on updated assessment
		pH	pH/Acidity/Caustic Conditions	Aquatic Life Warm Water Fishes	Addressed by Cadmium TMDL

Table A-1. 2010 Impaired Waterbodies, Impairment Causes, Impaired Uses, and Impairment Cause Status in the Landusky TPA

Waterbody & Location Description	Waterbody ID	Impairment Cause	TMDL Pollutant Category	Impaired Use(s)	Impairment Cause Status
ROCK CREEK , headwaters to mouth (Missouri River)	MT40E002_090	Cadmium	Metals	Aquatic Life Warm Water Fishes	Addressed by Cadmium TMDL
		Copper	Metals	Aquatic Life Warm Water Fishes	Addressed by Copper TMDL
		Mercury	Metals	Aquatic Life Warm Water Fishes	Addressed by Mercury TMDL
		Lead	Metals	Aquatic Life Warm Water Fishes	Addressed by Lead TMDL
		Selenium	Metals	Aquatic Life Warm Water Fishes	Addressed by Selenium TMDL
		Zinc	Metals	Aquatic Life Warm Water Fishes	Addressed by TMDL
		pH	pH/Acidity/Caustic Conditions	Aquatic Life Warm Water Fishes	Addressed by Cadmium TMDL
		Alteration in stream-side or littoral vegetative covers	Non-pollutant	Aquatic Life Warm Water Fishes	Not yet addressed by a TMDL or restoration plan
RUBY CREEK , unnamed tributary T25N R25E S21 to mouth (CK Creek)	MT40E002_060	Aluminum	Metals	Aquatic Life Warm Water Fishes	Addressed by Aluminum TMDL
		Cadmium	Metals	Aquatic Life Warm Water Fishes	Addressed by Cadmium TMDL
		Copper	Metals	Aquatic Life Warm Water Fishes	Addressed by Copper TMDL
		Mercury	Metals	Aquatic Life Warm Water Fishes	Addressed by Mercury TMDL
		Lead	Metals	Aquatic Life Warm Water Fishes	Addressed by Lead TMDL
		Selenium	Metals	Aquatic Life Warm Water Fishes	Addressed by Selenium TMDL
		Zinc	Metals	Aquatic Life Warm Water Fishes	Addressed by Zinc TMDL
		pH	pH/Acidity/Caustic Conditions	Aquatic Life Warm Water Fishes	Addressed by Cadmium TMDL

Table A-1. 2010 Impaired Waterbodies, Impairment Causes, Impaired Uses, and Impairment Cause Status in the Landusky TPA

Waterbody & Location Description	Waterbody ID	Impairment Cause	TMDL Pollutant Category	Impaired Use(s)	Impairment Cause Status
RUBY GULCH, headwaters to confluence of Alder Gulch	MT40E002_070	Cadmium	Metals	Aquatic Life Warm Water Fishes	Addressed by Cadmium TMDL
		Chromium	Metals	Aquatic Life Warm Water Fishes	Addressed by Chromium TMDL
		Copper	Metals	Aquatic Life Warm Water Fishes	Not impaired based on updated assessment
		Mercury	Metals	Aquatic Life Warm Water Fishes	Addressed by Mercury TMDL
		Lead	Metals	Aquatic Life Warm Water Fishes	Addressed by Lead TMDL
		Selenium	Metals	Aquatic Life Warm Water Fishes	Addressed by selenium TMDL
		Zinc	Metals	Aquatic Life Warm Water Fishes	Addressed by Zinc TMDL
		pH	pH/Acidity/Caus- tic Conditions	Aquatic Life Warm Water Fishes	Addressed by Cadmium TMDL
SULLIVAN CREEK, headwaters to mouth (Rock Creek)	MT40E002_110	Alteration in stream-side or littoral vegetative covers		Aquatic Life Primary Contact Recreation Warm Water Fishes	Not yet addressed by a TMDL or restoration plan
		Fish-Passage Barrier	Non-pollutant	Aquatic Life Primary Contact Recreation Warm Water Fishes	Not yet addressed by a TMDL or restoration plan
		Other flow regime alterations	Non-pollutant	Aquatic Life Primary Contact Recreation Warm Water Fishes	Not yet addressed by a TMDL or restoration plan
		Physical substrate habitat alterations	Non-pollutant	Aquatic Life Primary Contact Recreation Warm Water Fishes	Not yet addressed by a TMDL or restoration plan

Table A-1. 2010 Impaired Waterbodies, Impairment Causes, Impaired Uses, and Impairment Cause Status in the Landusky TPA

Waterbody & Location Description	Waterbody ID	Impairment Cause	TMDL Pollutant Category	Impaired Use(s)	Impairment Cause Status
SWIFT GULCH CREEK, headwaters to mouth (South Big Horn Creek)	MT40I002_010	Aluminum	Metals	Aquatic Life, Cold Water Fishes	Addressed by Aluminum TMDL
		Arsenic	Metals	Drinking Water	Addressed by Arsenic TMDL
		Cadmium	Metals	Aquatic Life, Cold Water Fishes Drinking Water	Addressed by Cadmium TMDL
		Copper	Metals	Aquatic Life, Cold Water Fishes	Addressed by Copper TMDL
		Cyanide	Metals	Aquatic Life, Cold Water Fishes	Addressed by Cyanide TMDL
		Iron	Metals	Aquatic Life, Cold Water Fishes	Addressed by Iron TMDL
		Lead	Metals	Aquatic Life, Cold Water Fishes	Not impaired based on updated assessment
		Nickel	Metals	Aquatic Life, Cold Water Fishes Drinking Water	Addressed by Nickel TMDL
		Selenium	Metals	Aquatic Life, Cold Water Fishes	Not impaired based on updated assessment
		Thallium	Metals	Drinking Water	Addressed by Thallium TMDL
		Zinc	Metals	Aquatic Life, Cold Water Fishes Drinking Water	Addressed by TMDL
pH	pH/Acidity/Caustic Conditions	Aquatic Life, Cold Water Fishes	Addressed by Cadmium TMDL		

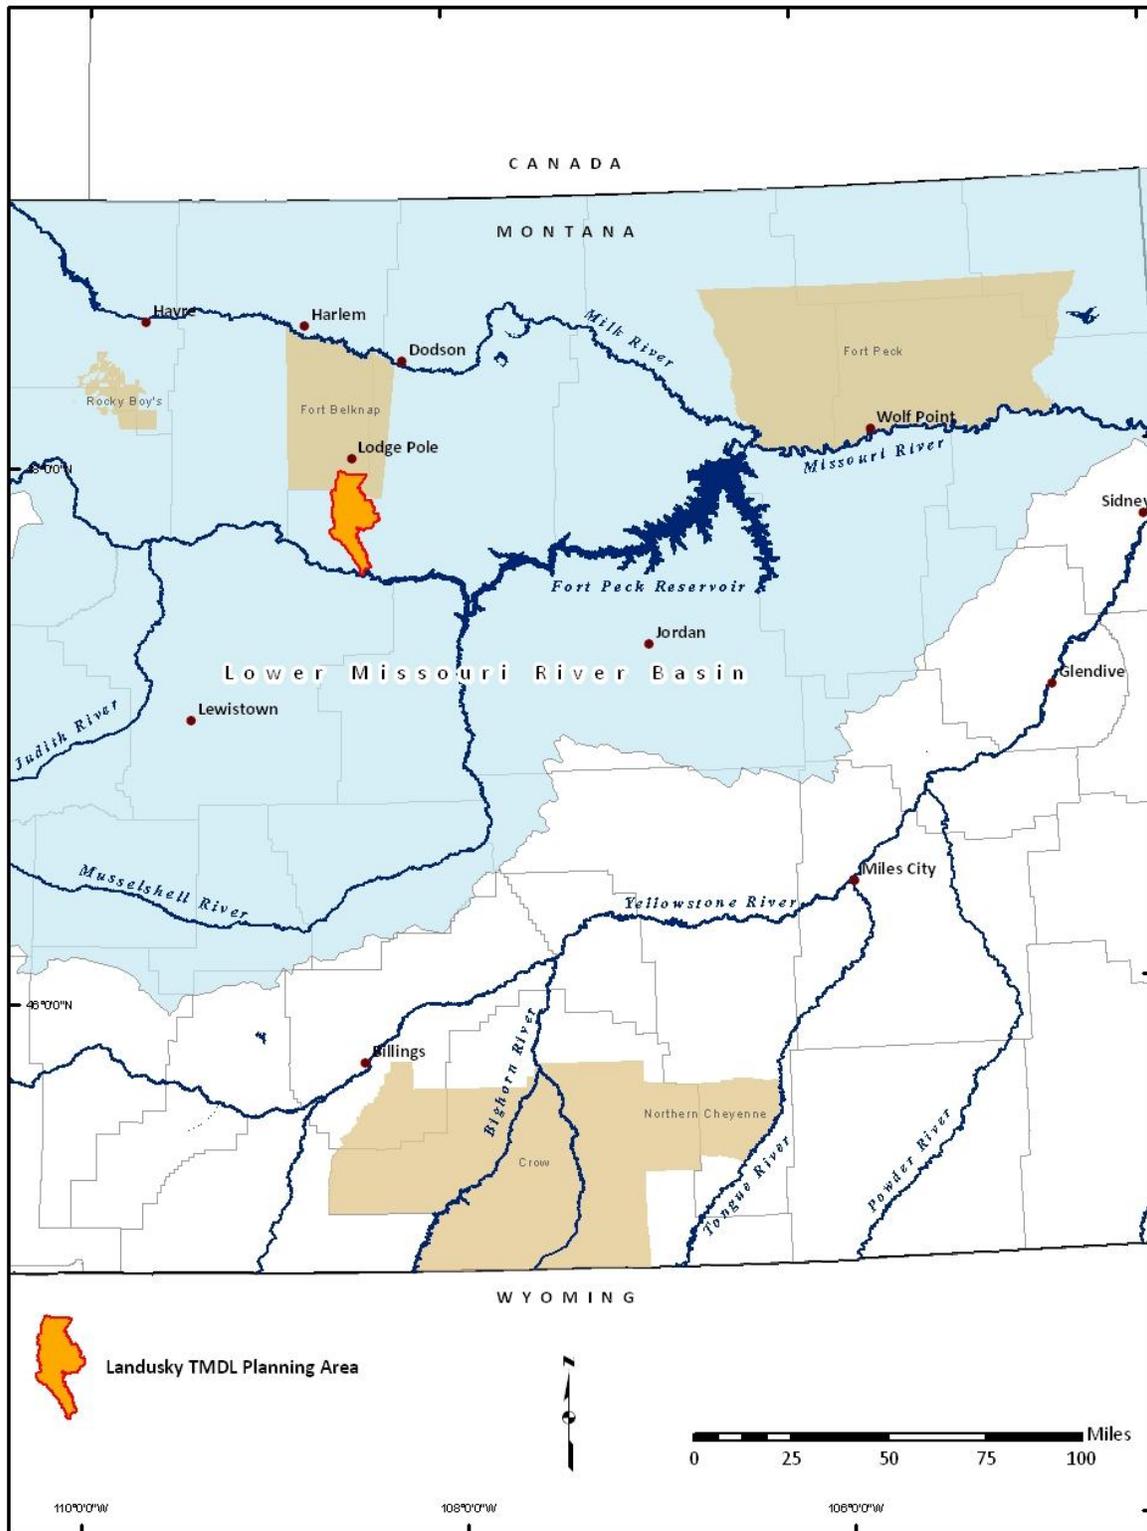


Figure A-1. Landusky TMDL Planning Area

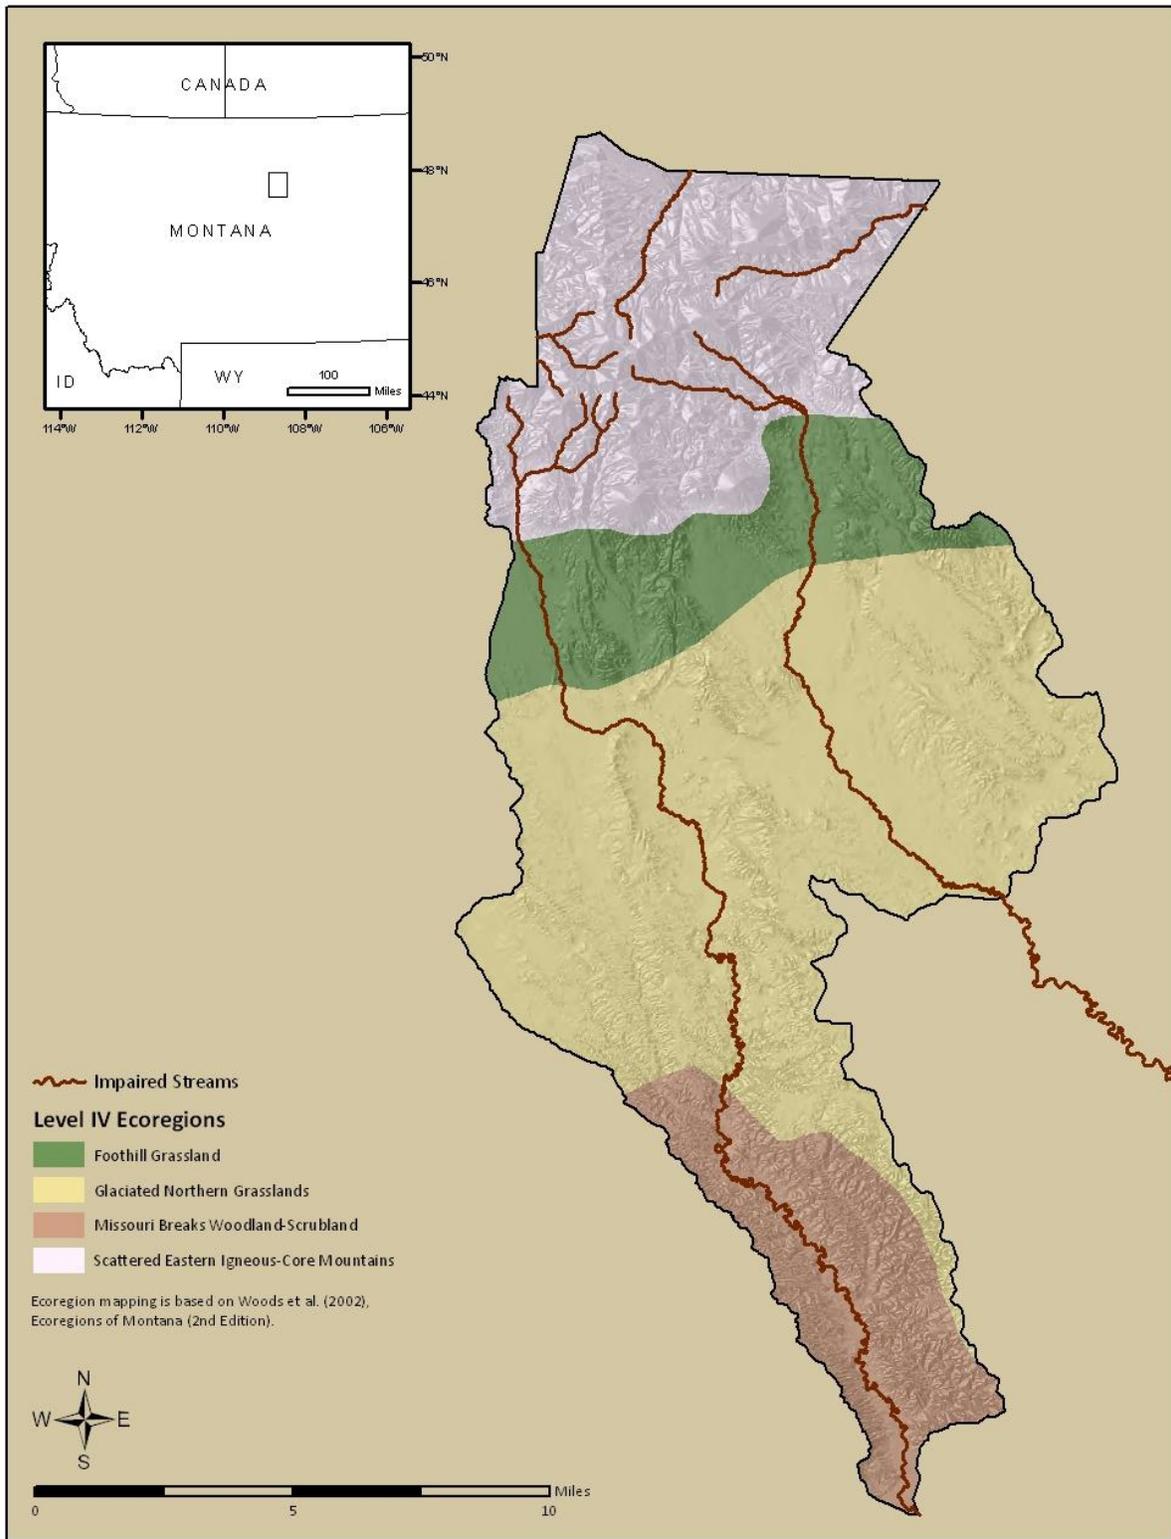


Figure A-2. Ecoregions

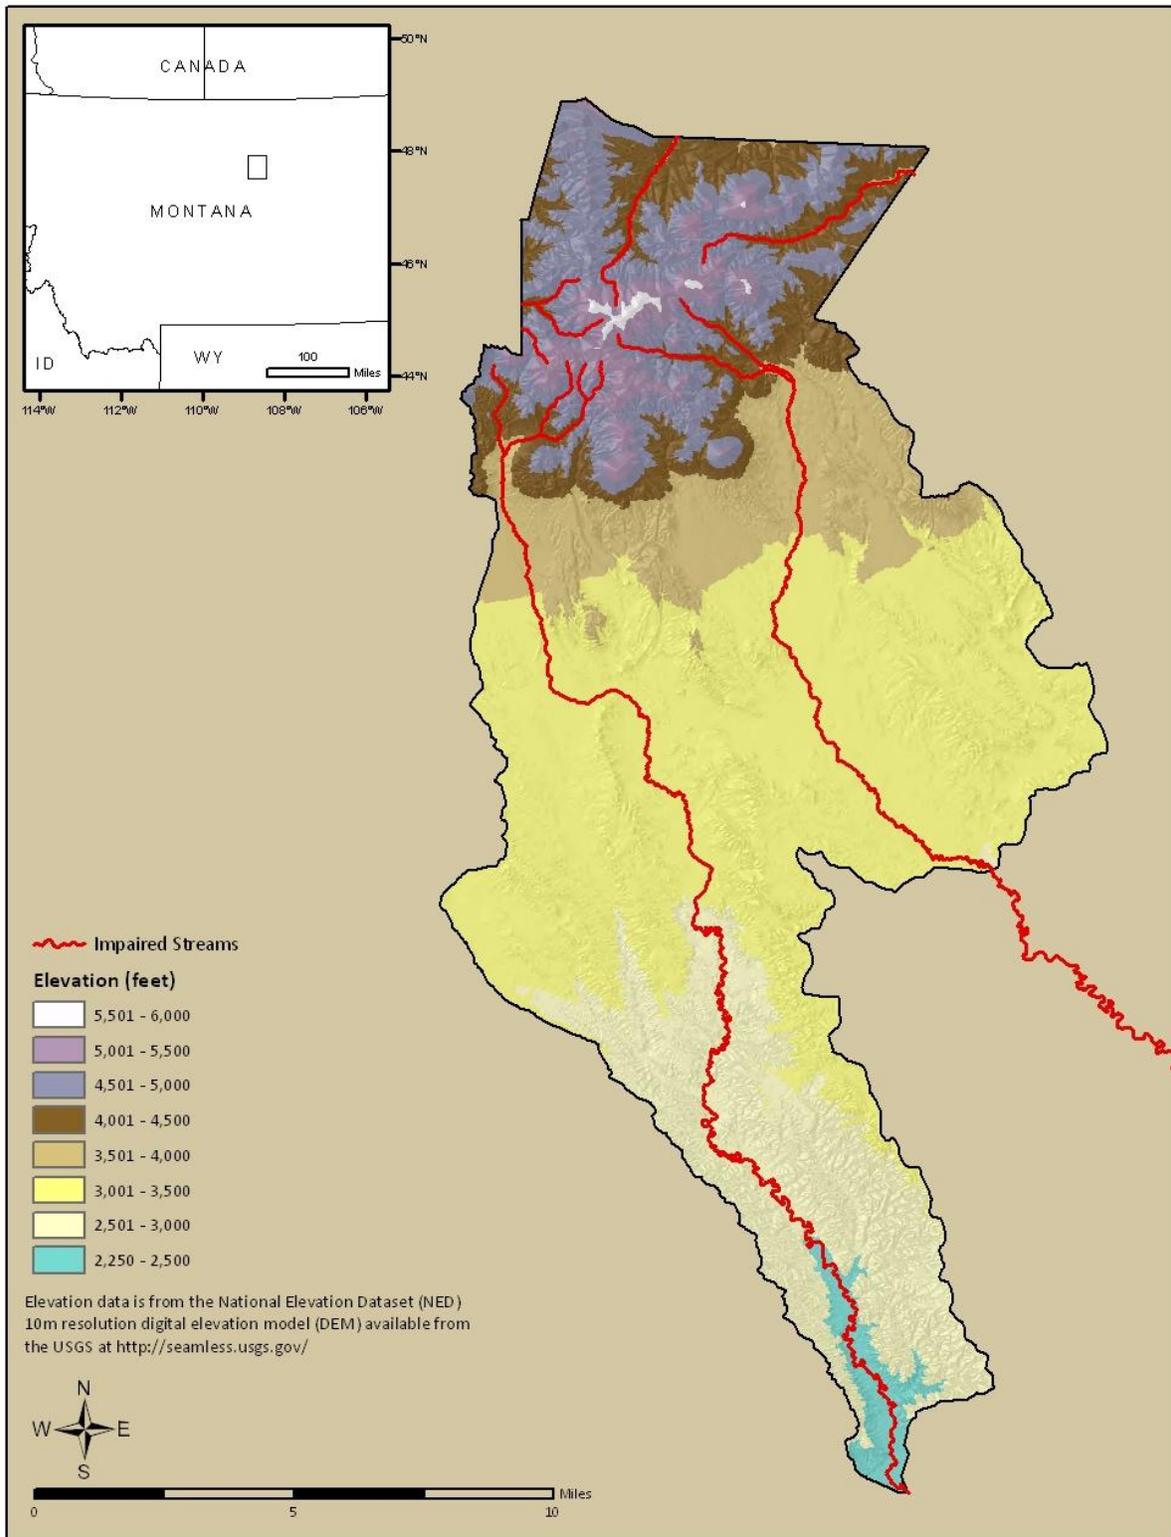


Figure A-3. Topography

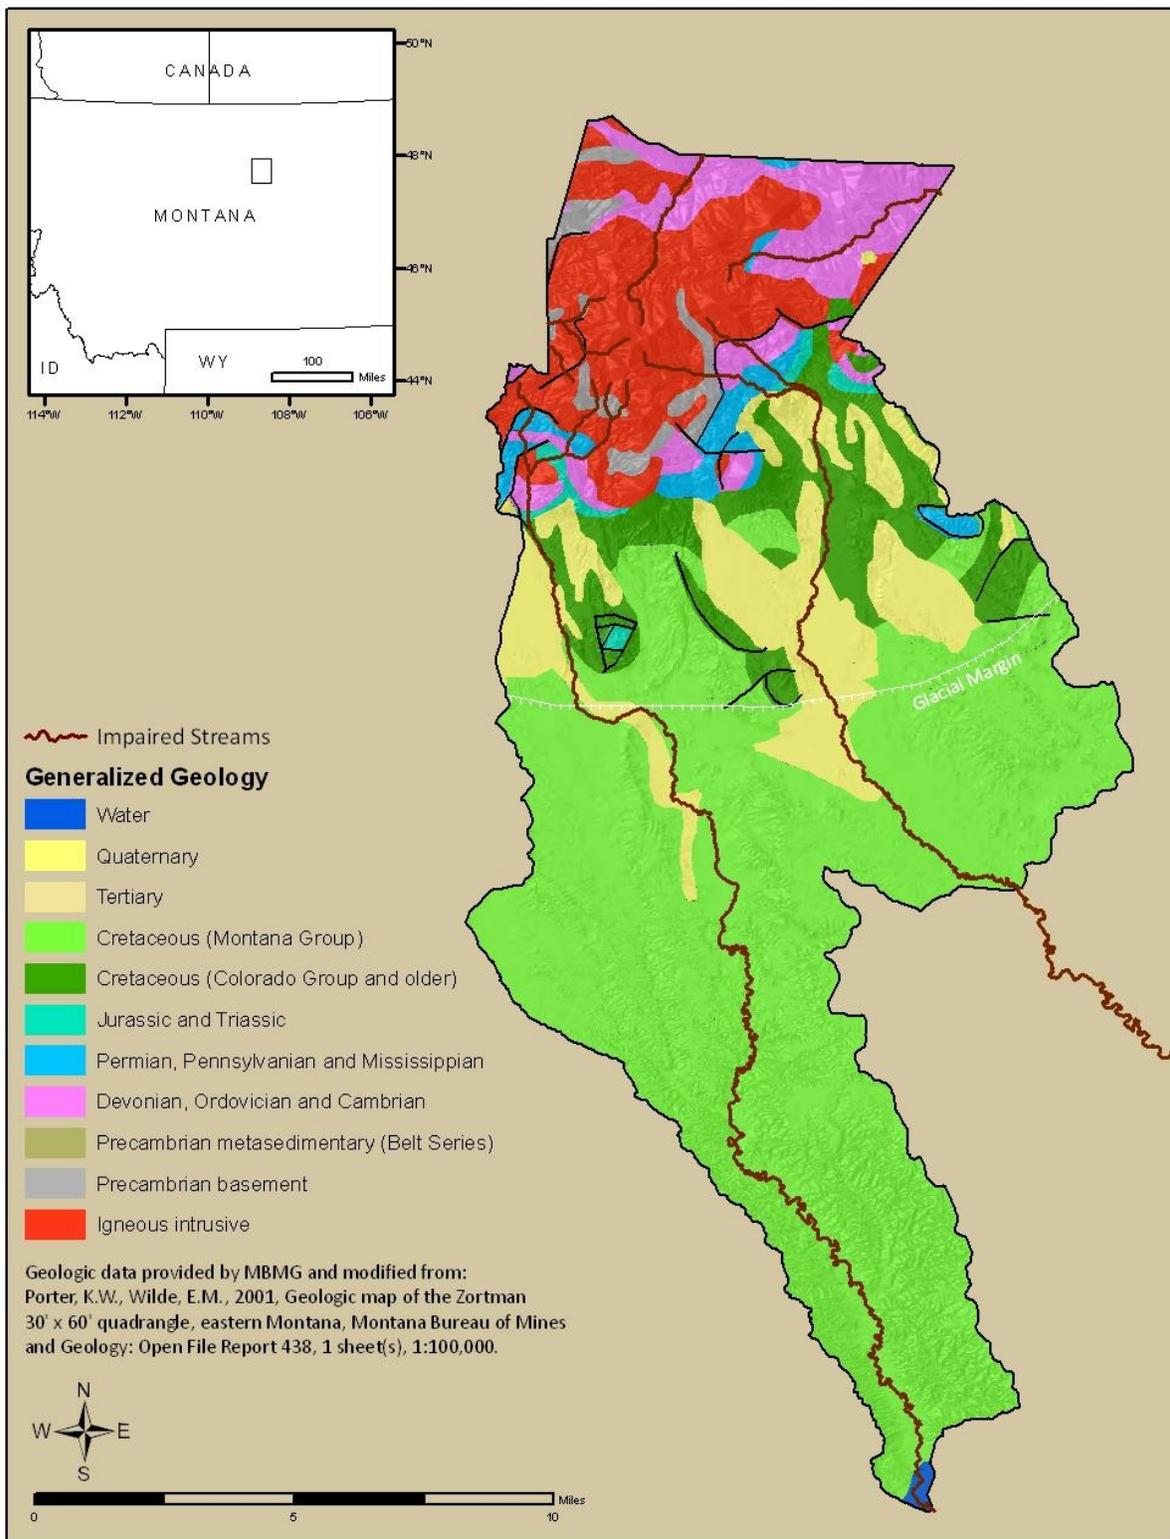


Figure A-4. Geology

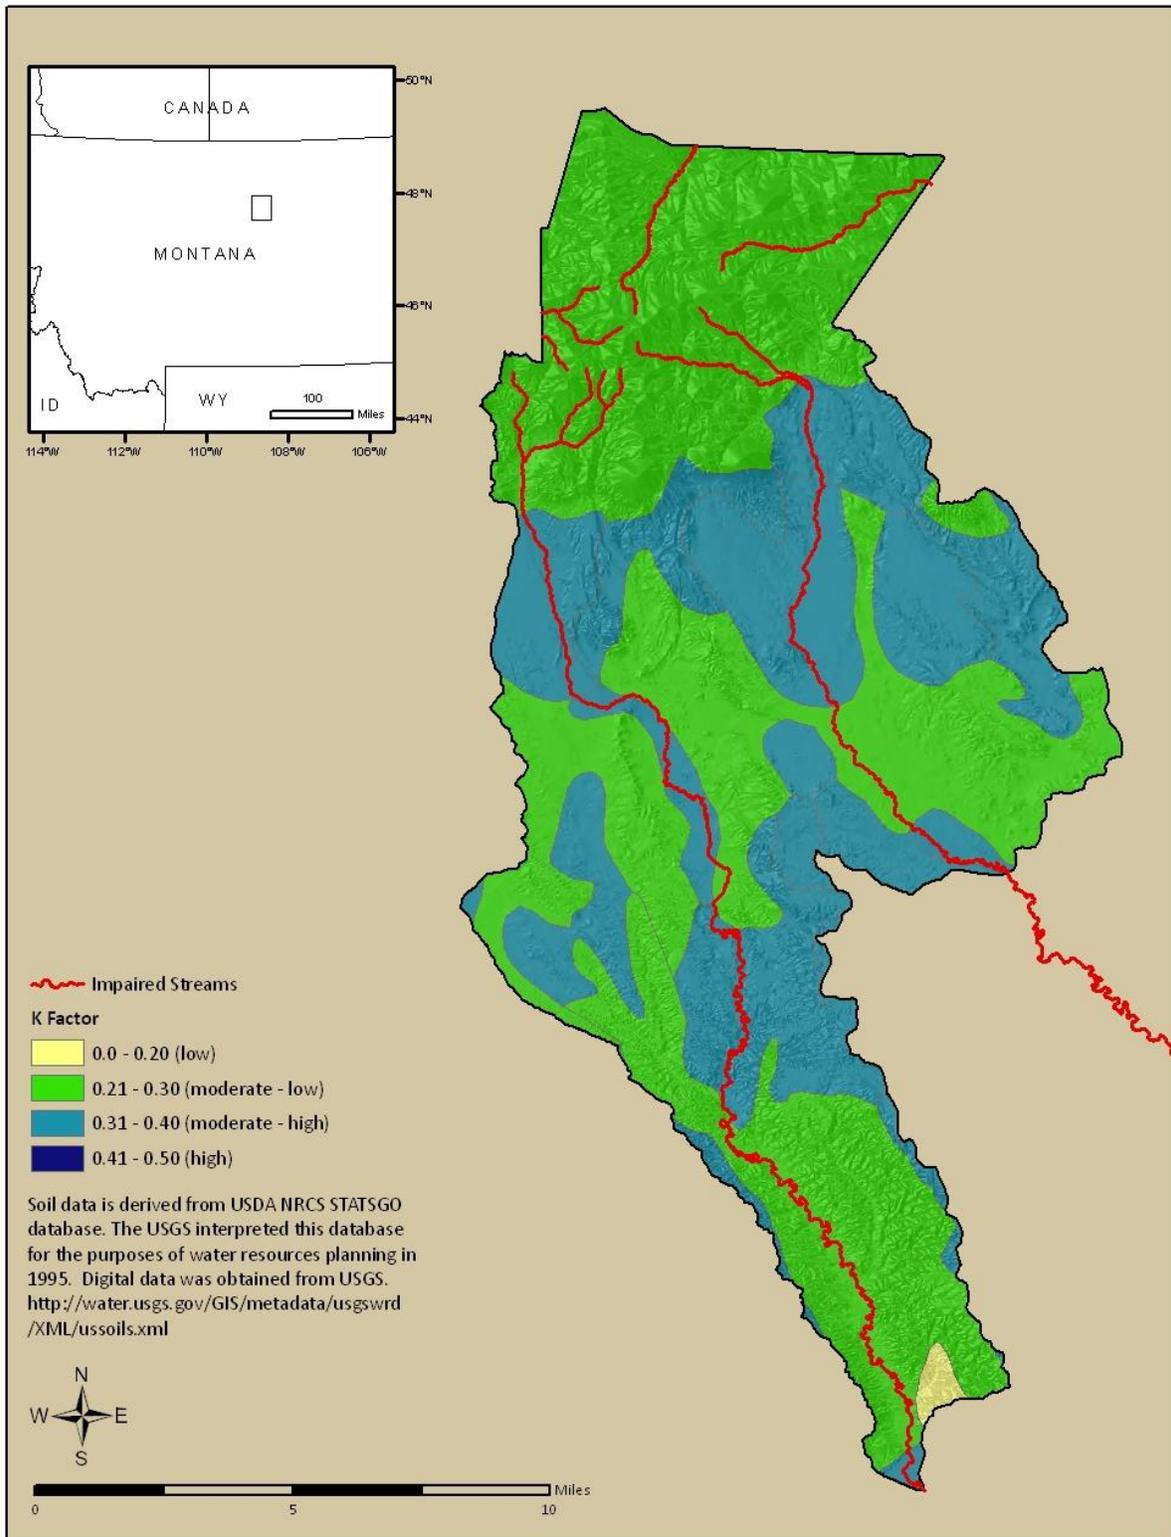


Figure A-5. Erodibility

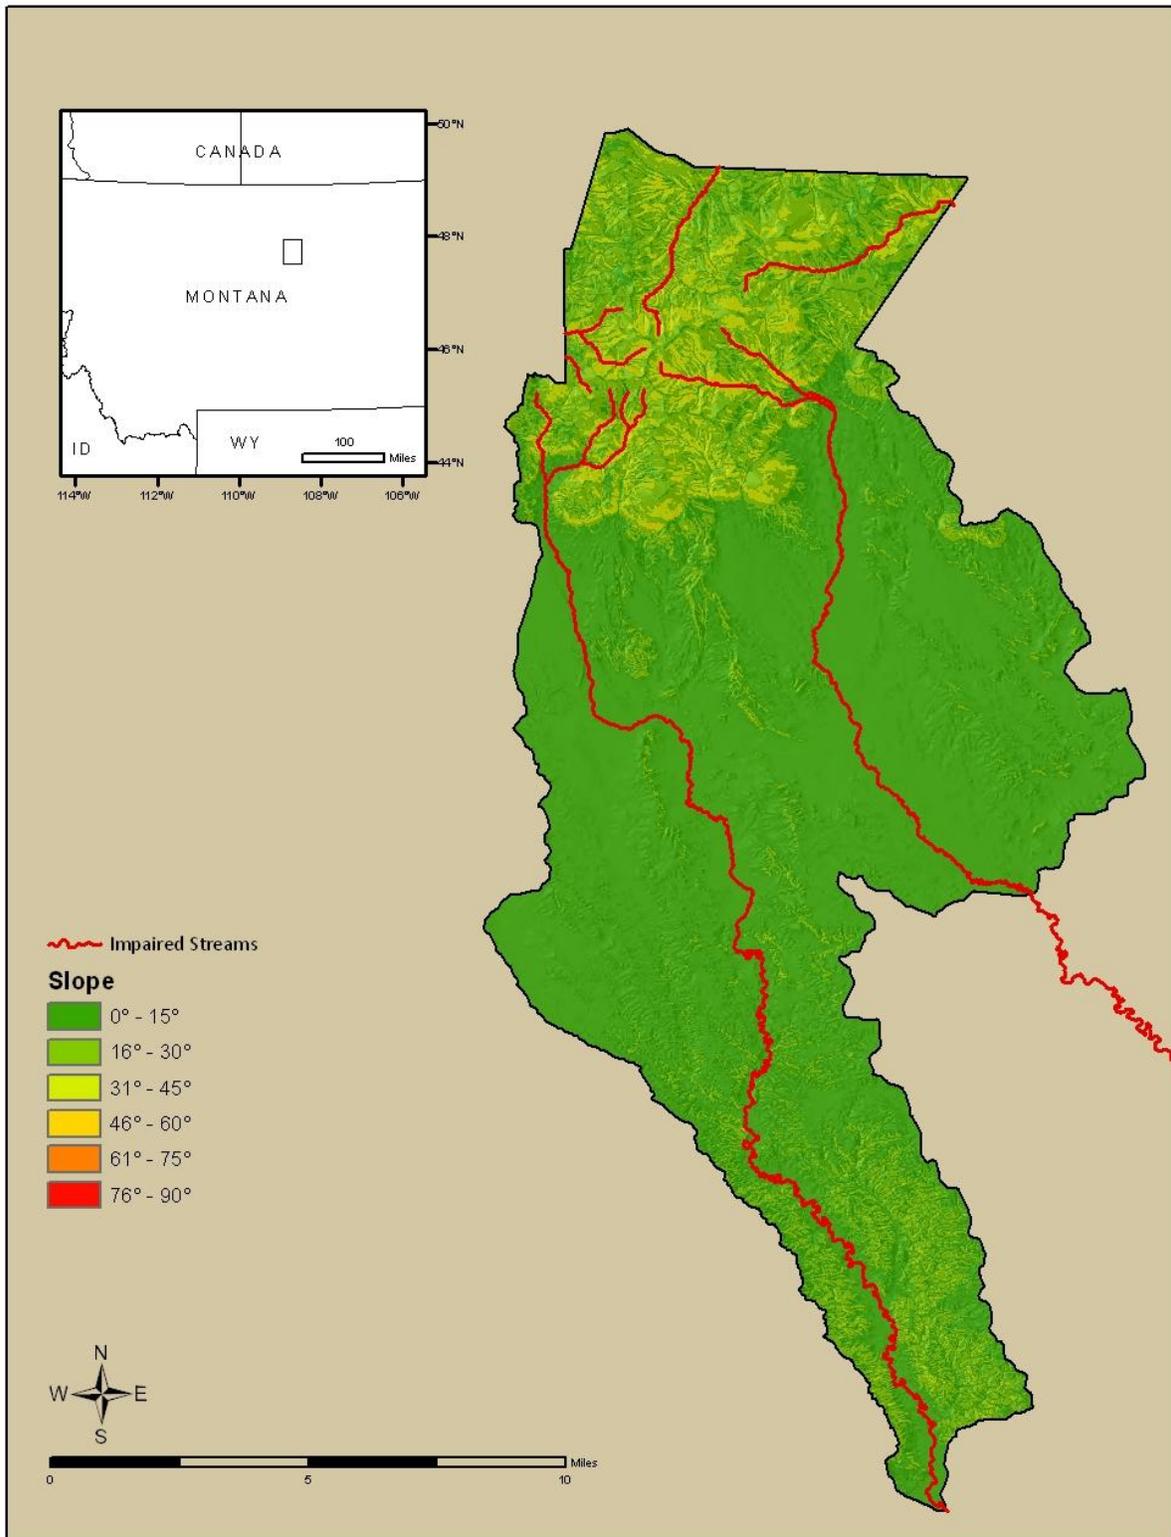


Figure A-6. Slope

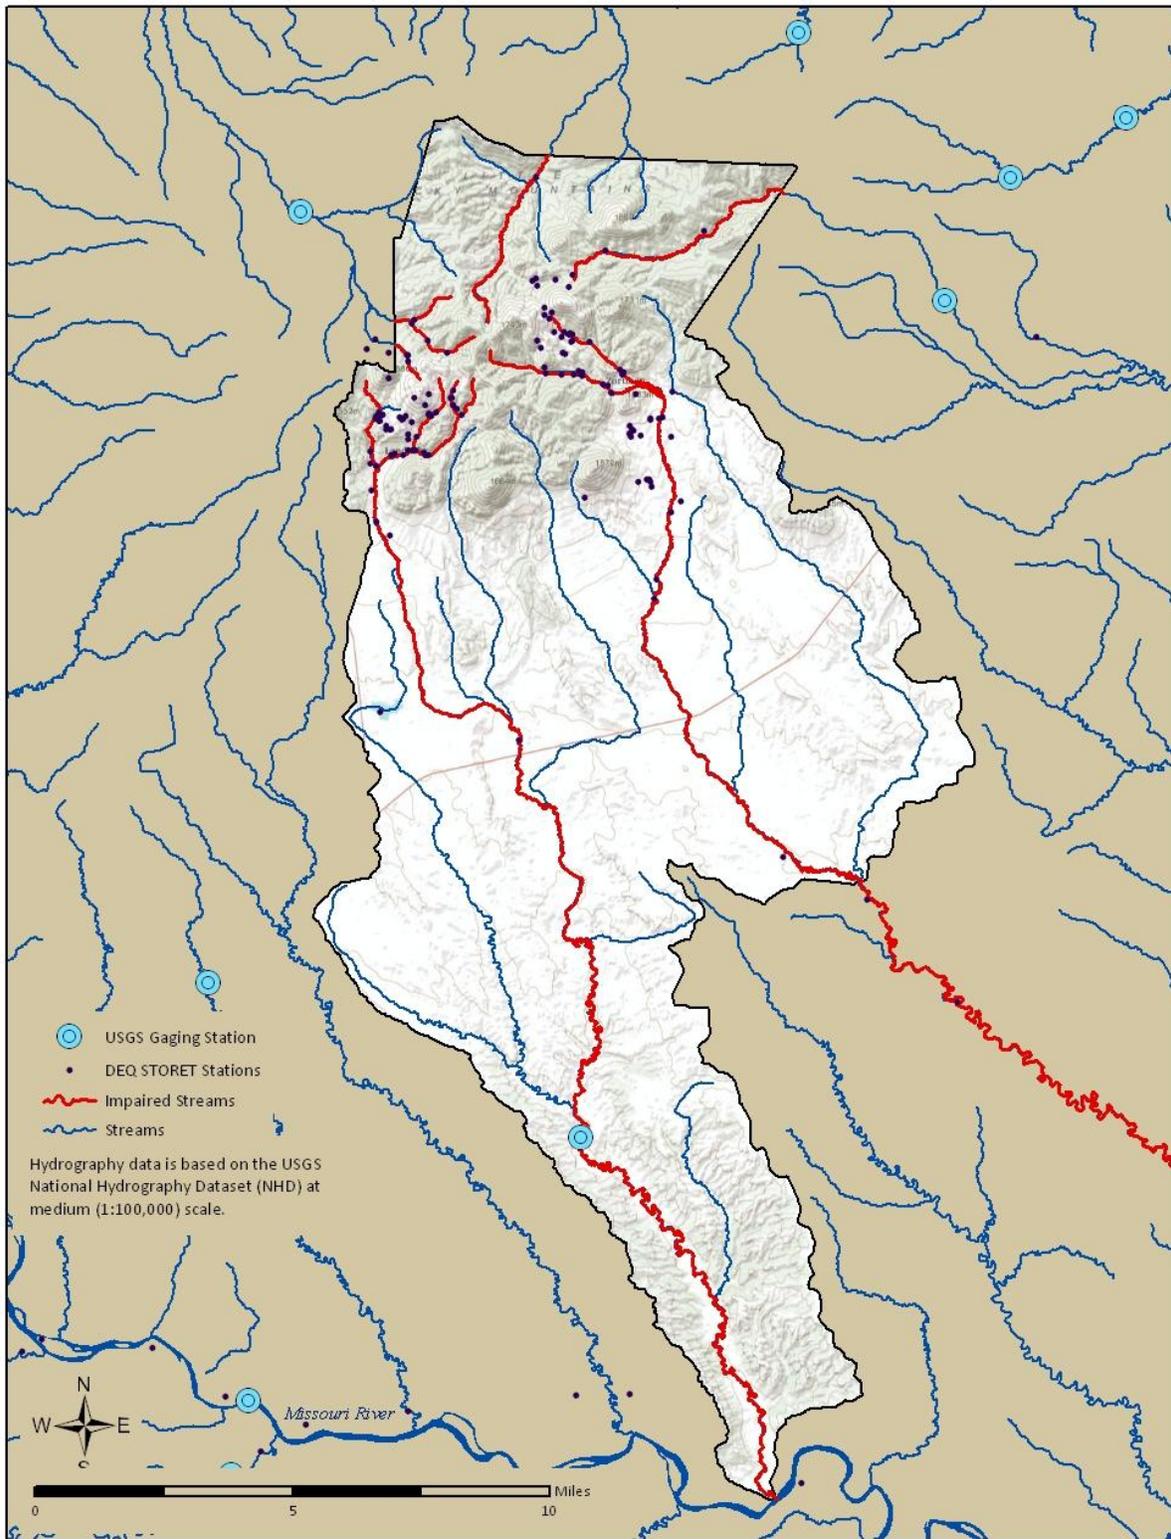


Figure A-7. Hydrography

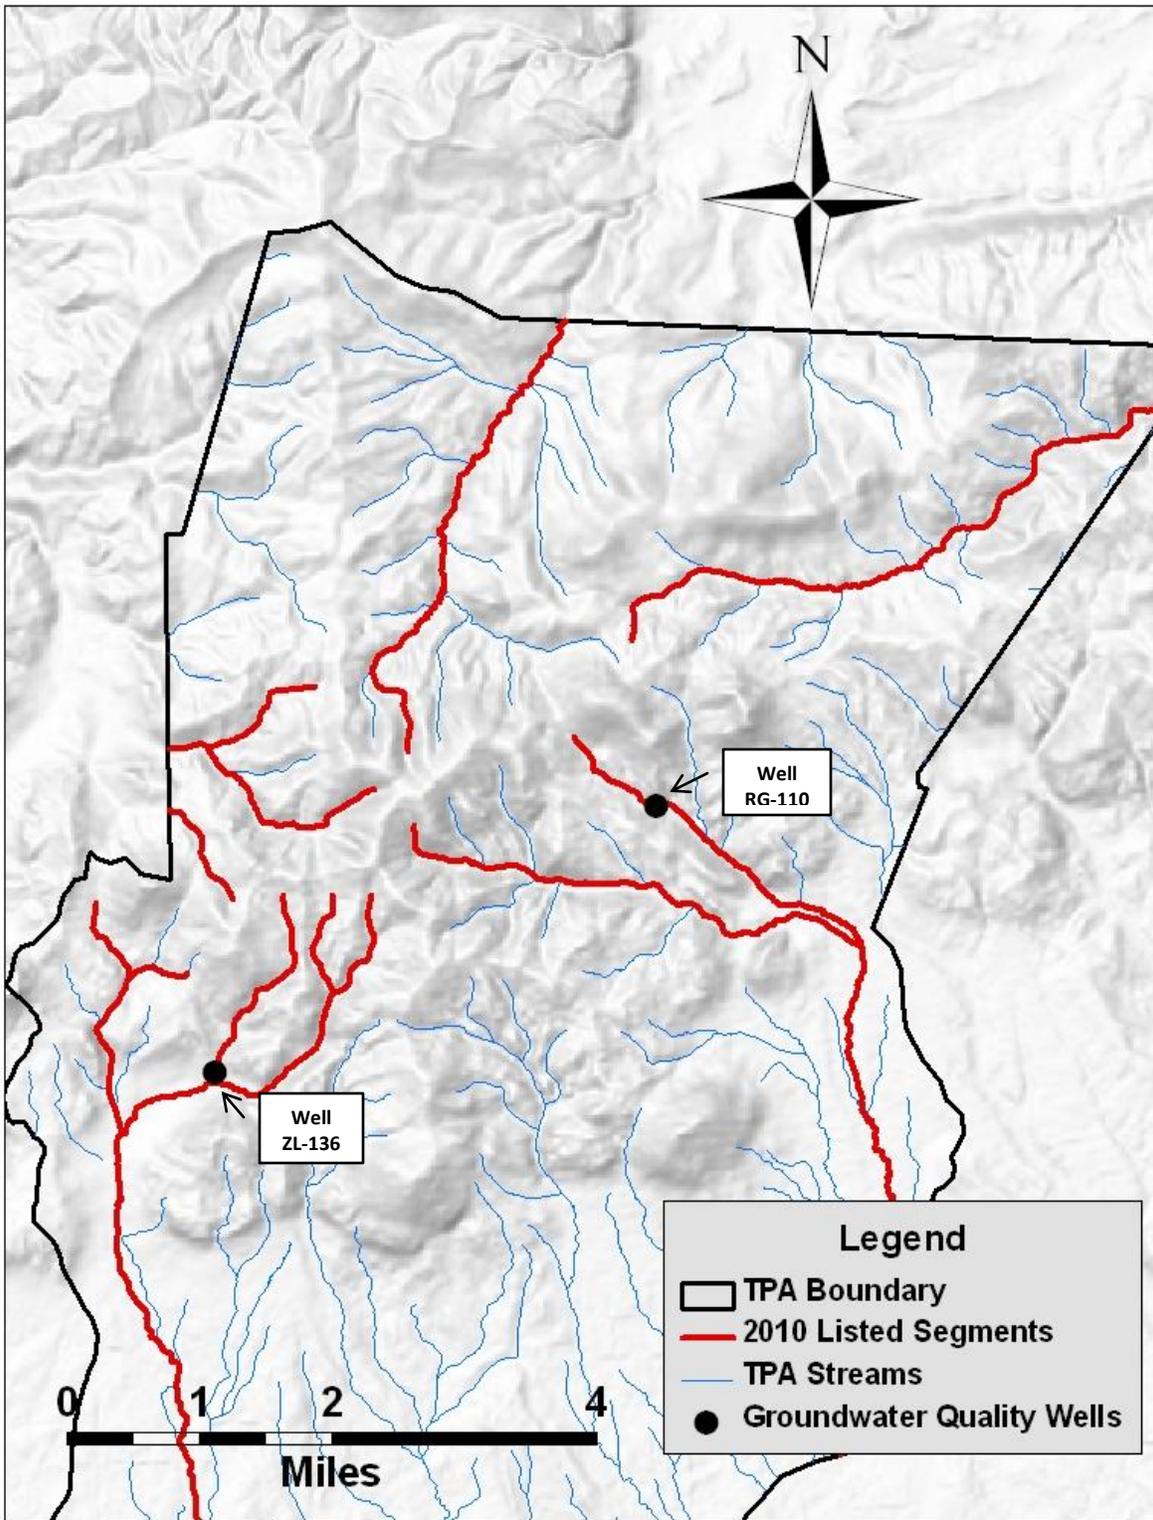


Figure A-8. Selected Ground Water Quality Well Sites

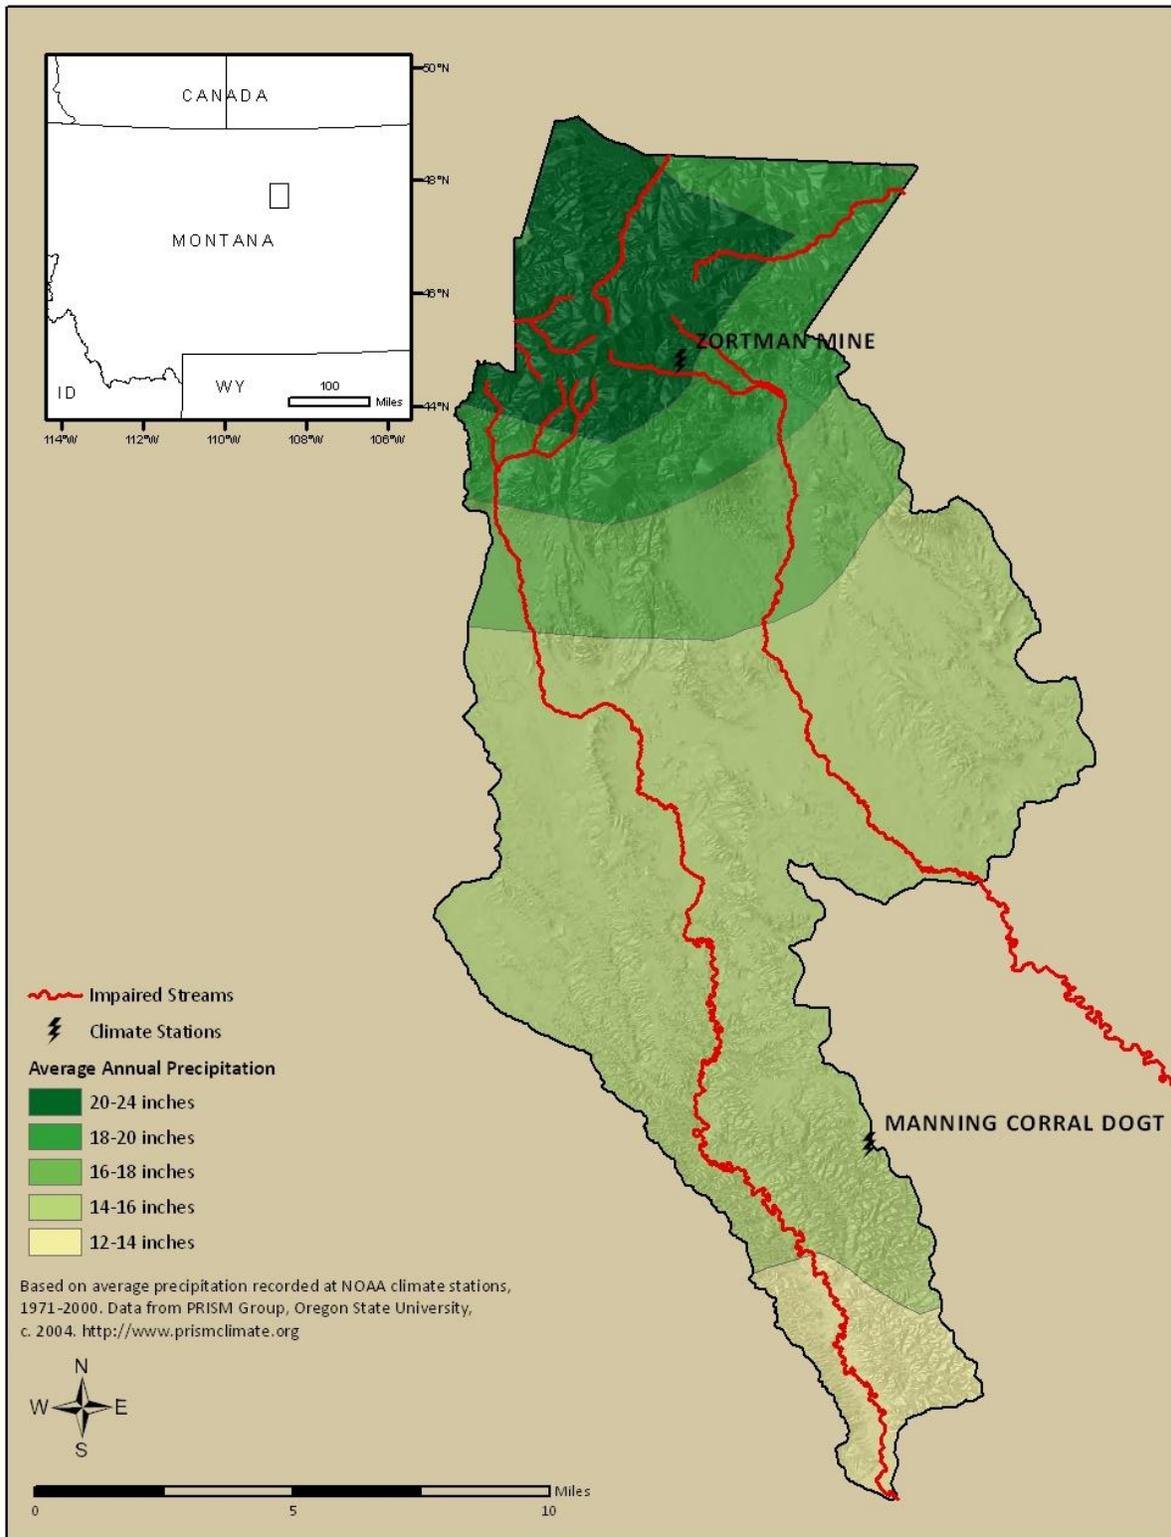


Figure A-9. Annual Precipitation

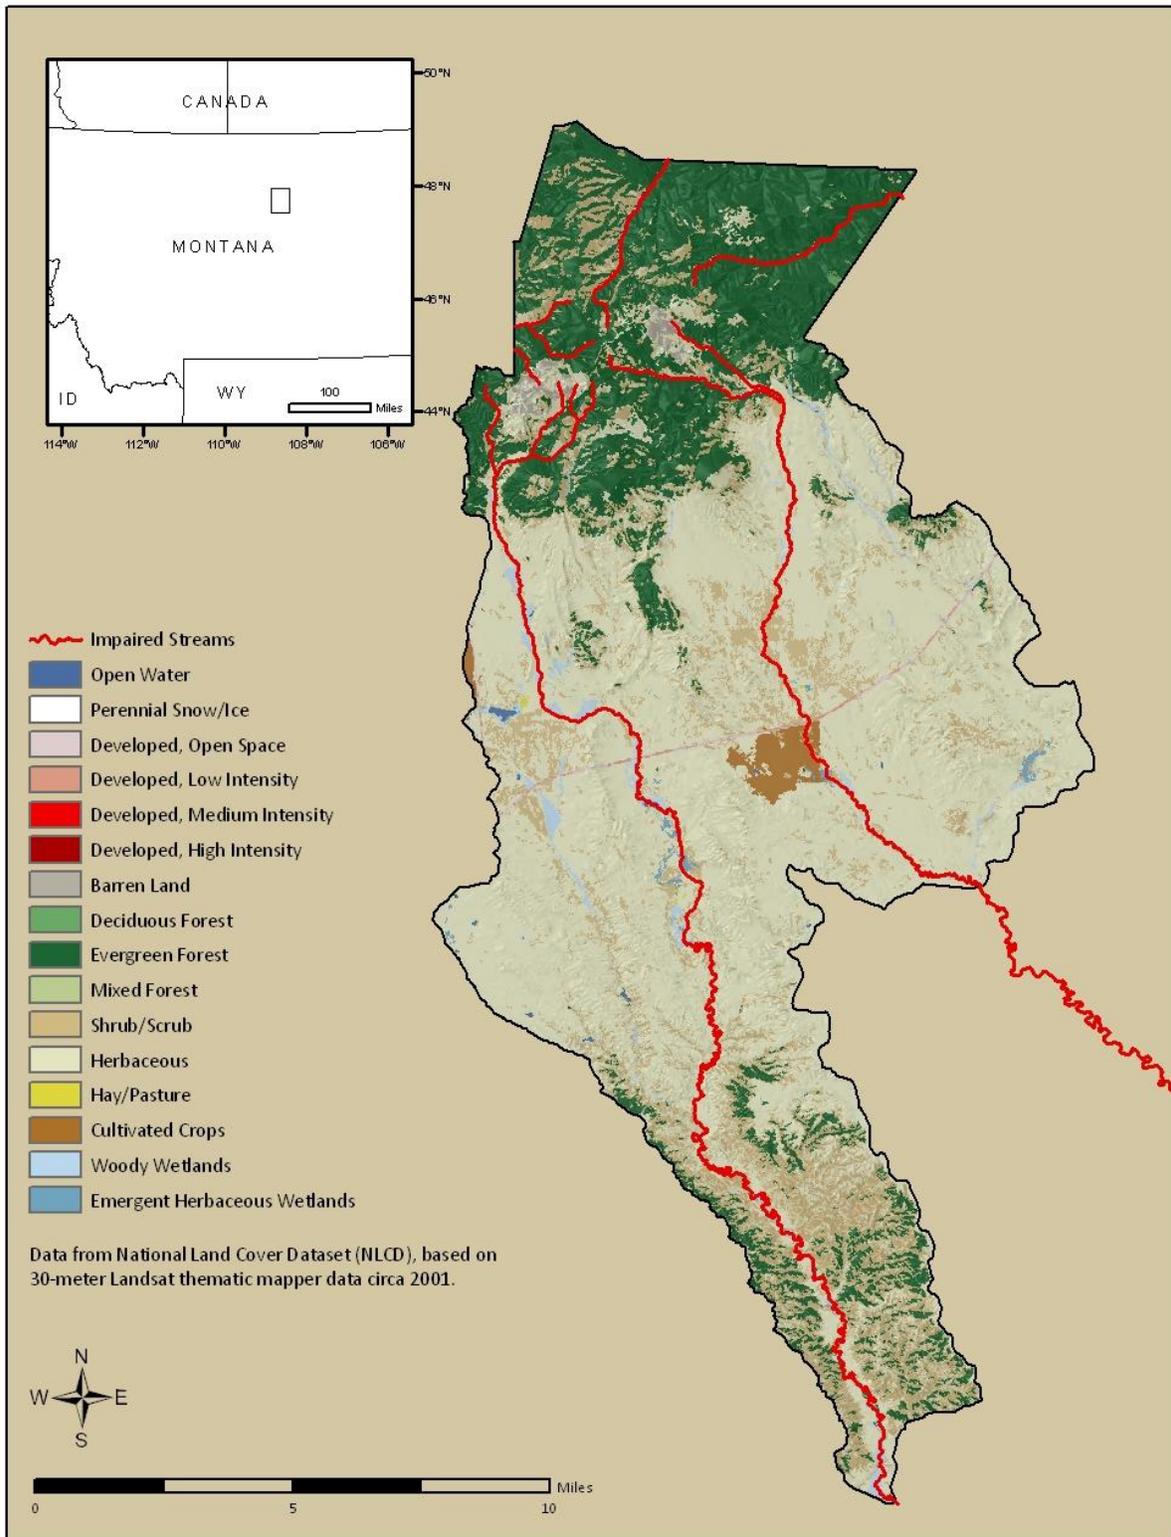


Figure A-10. Land Cover

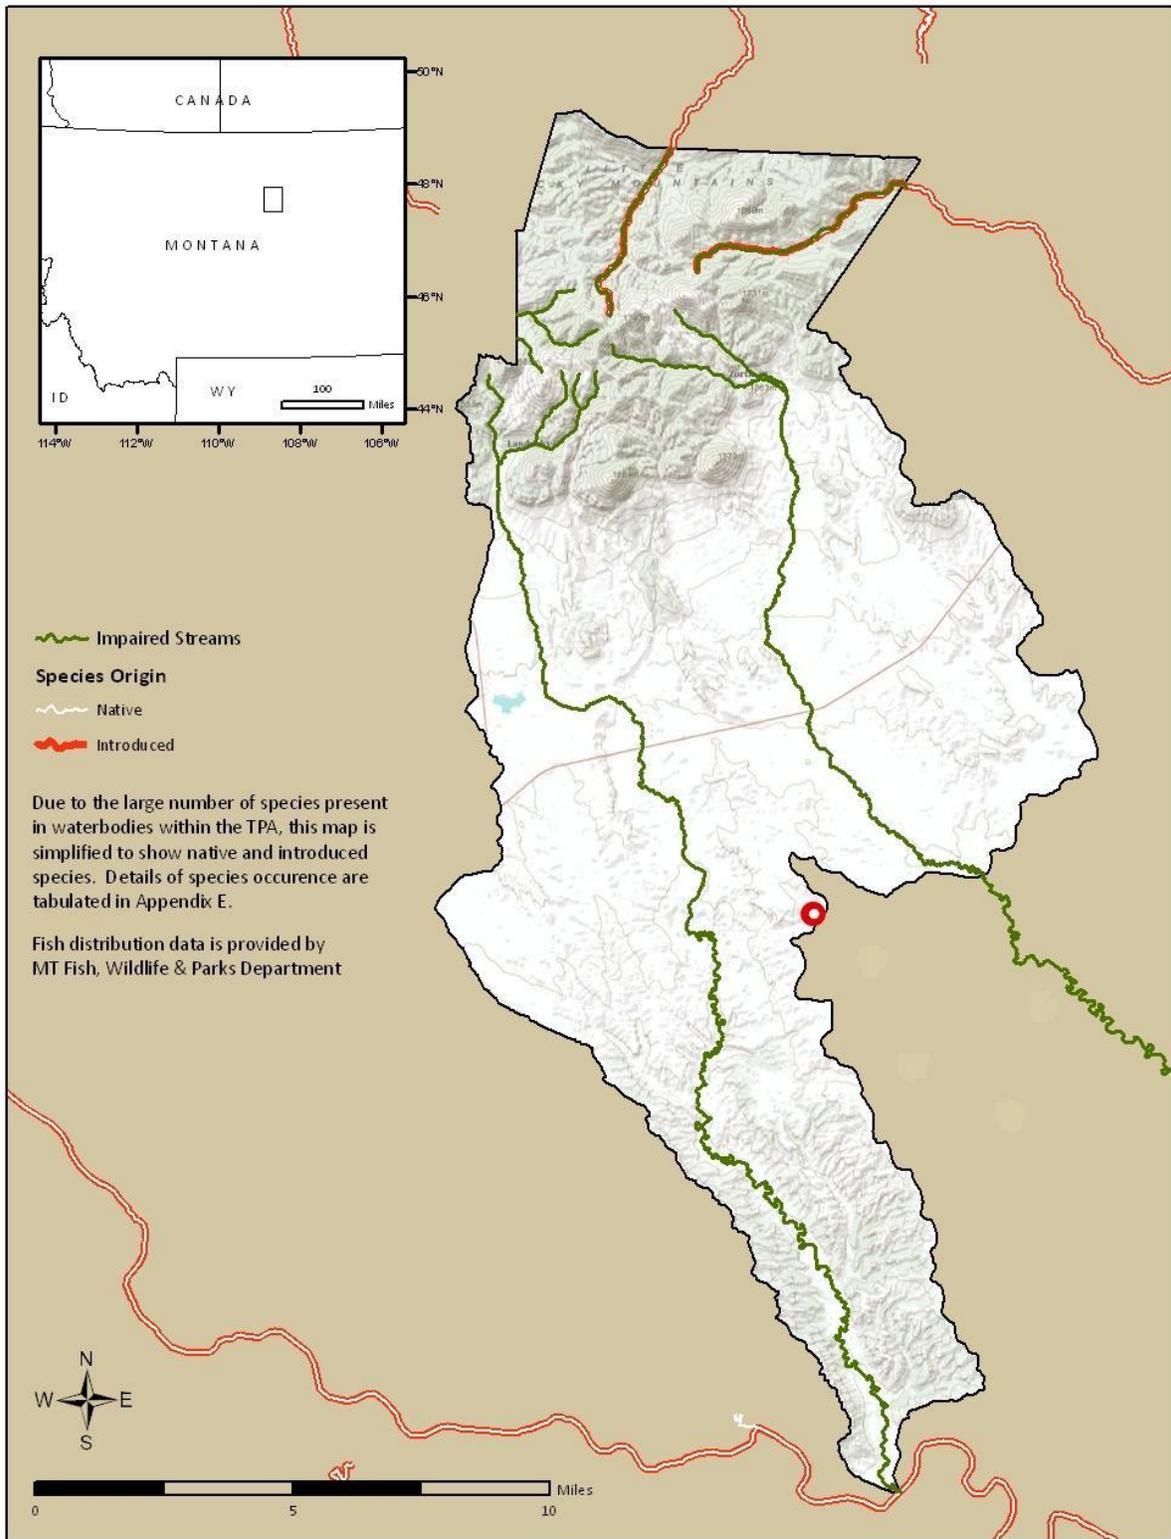


Figure A-11. Fish Distribution

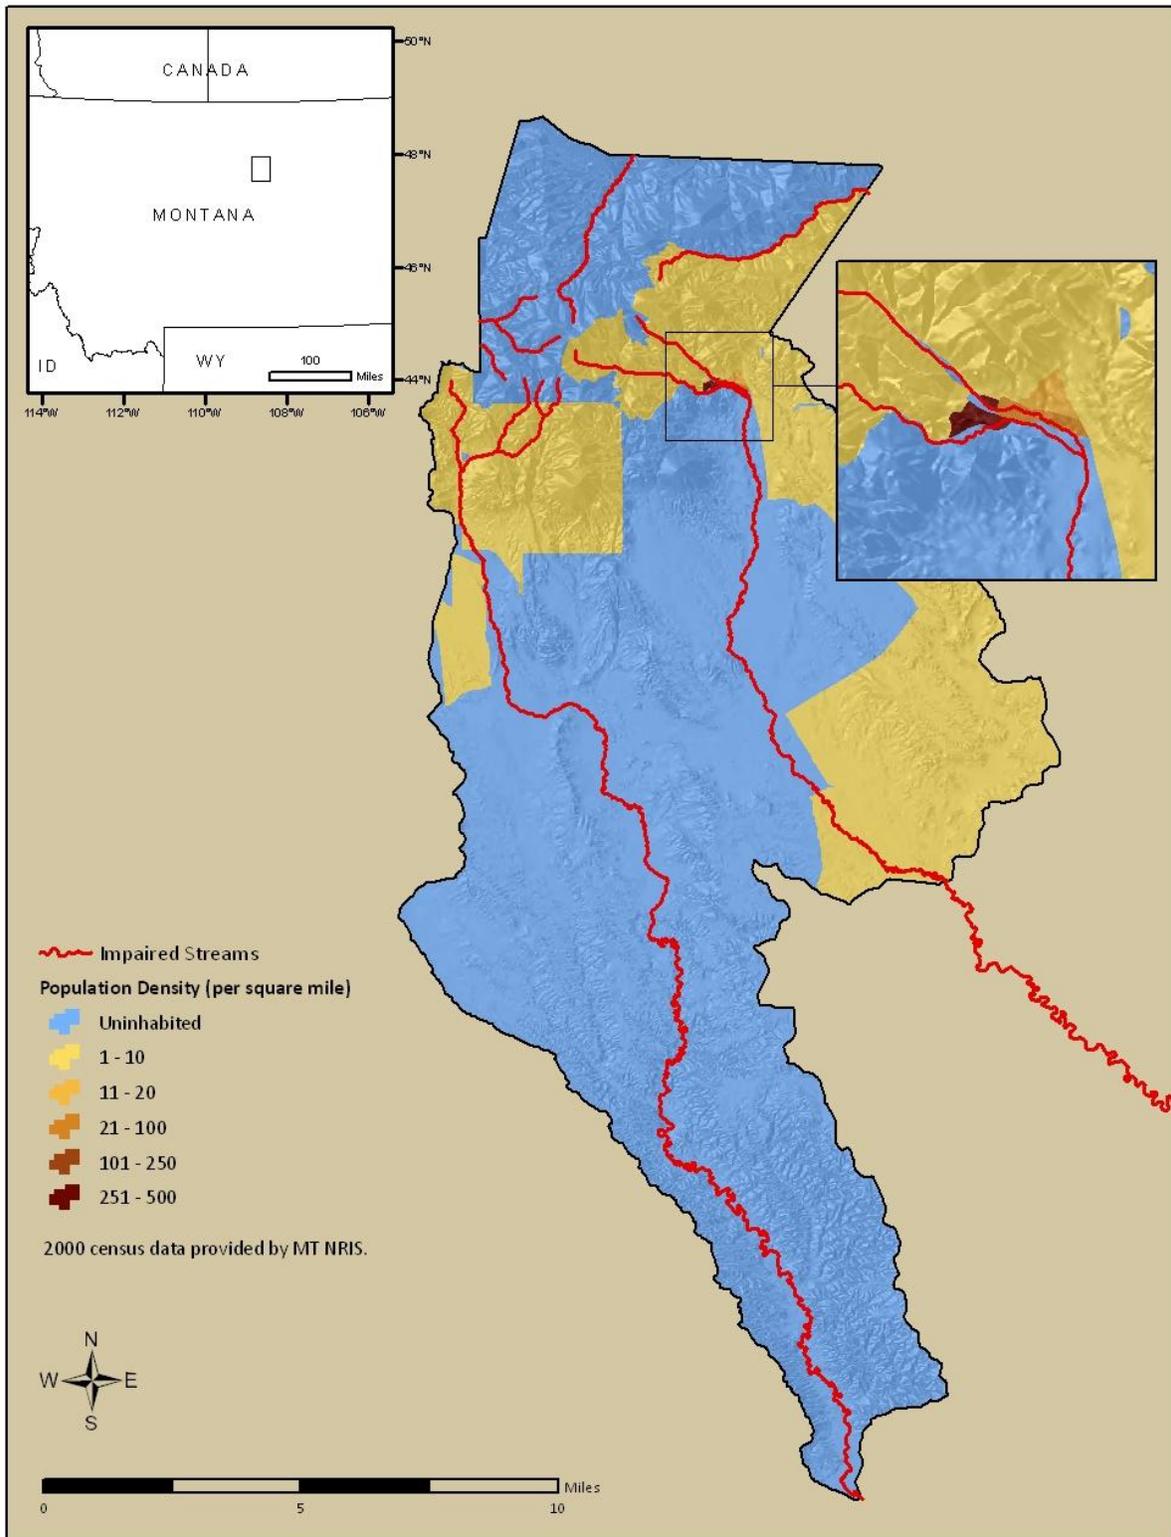


Figure A-12. Population Density

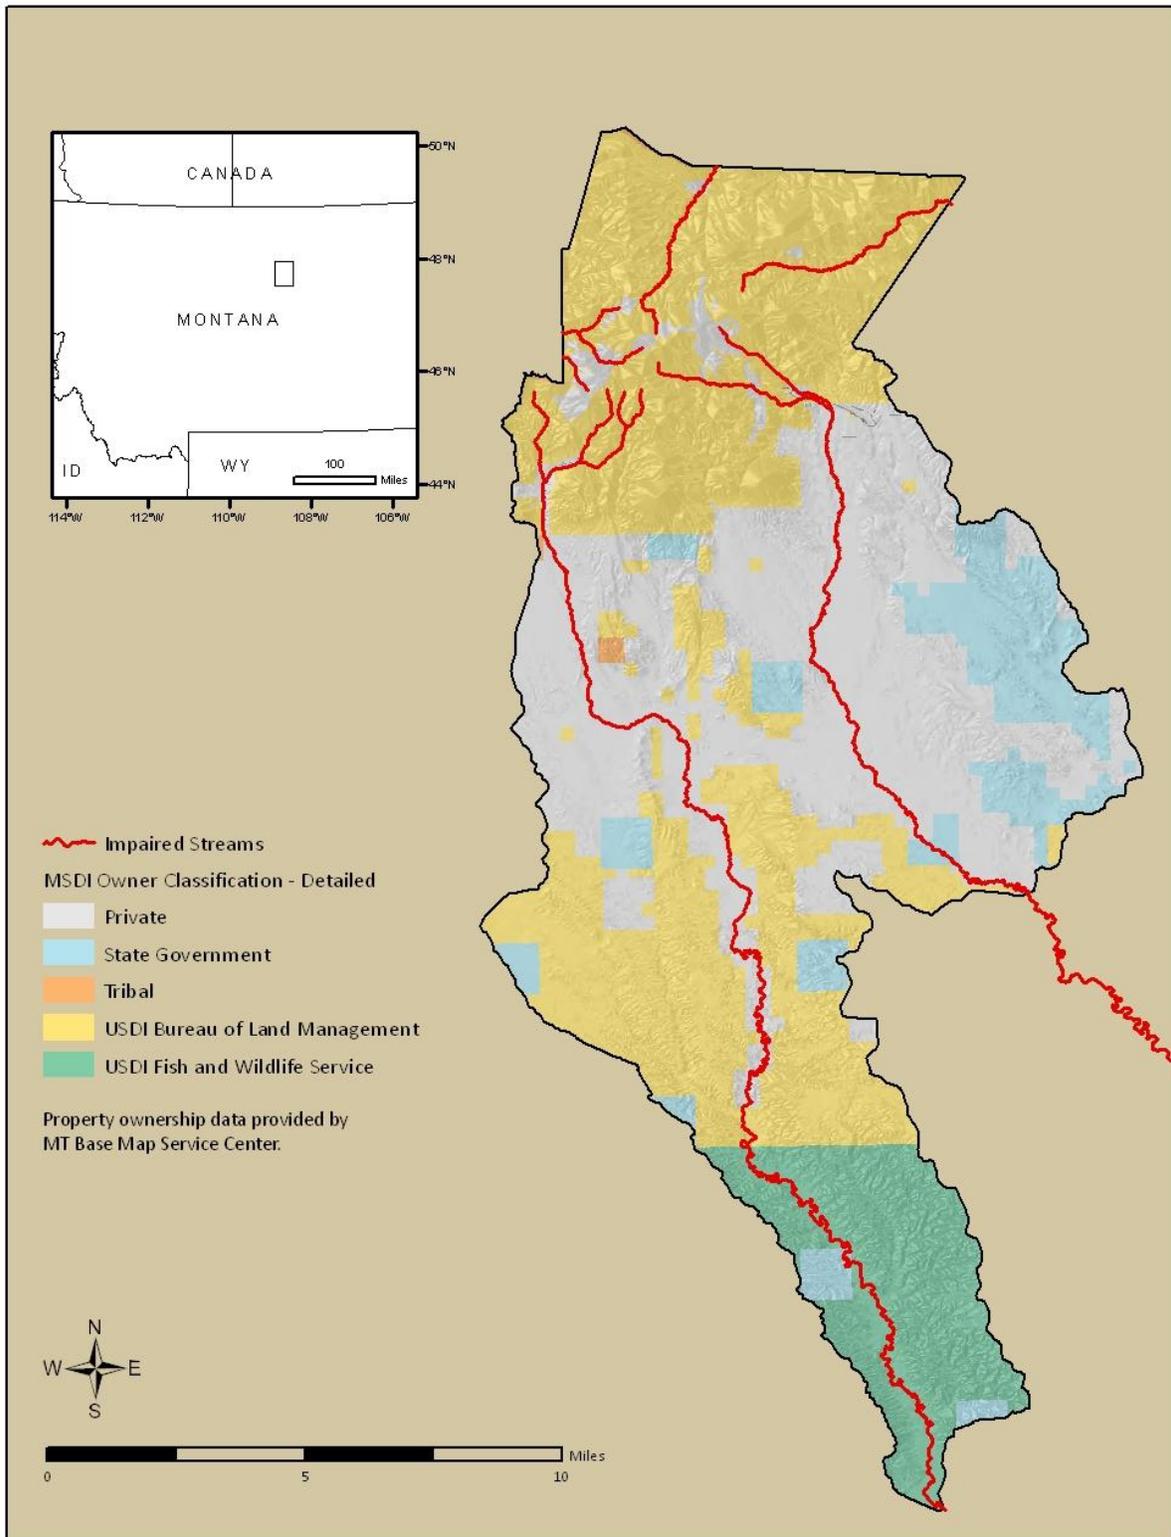


Figure A-13. Ownership

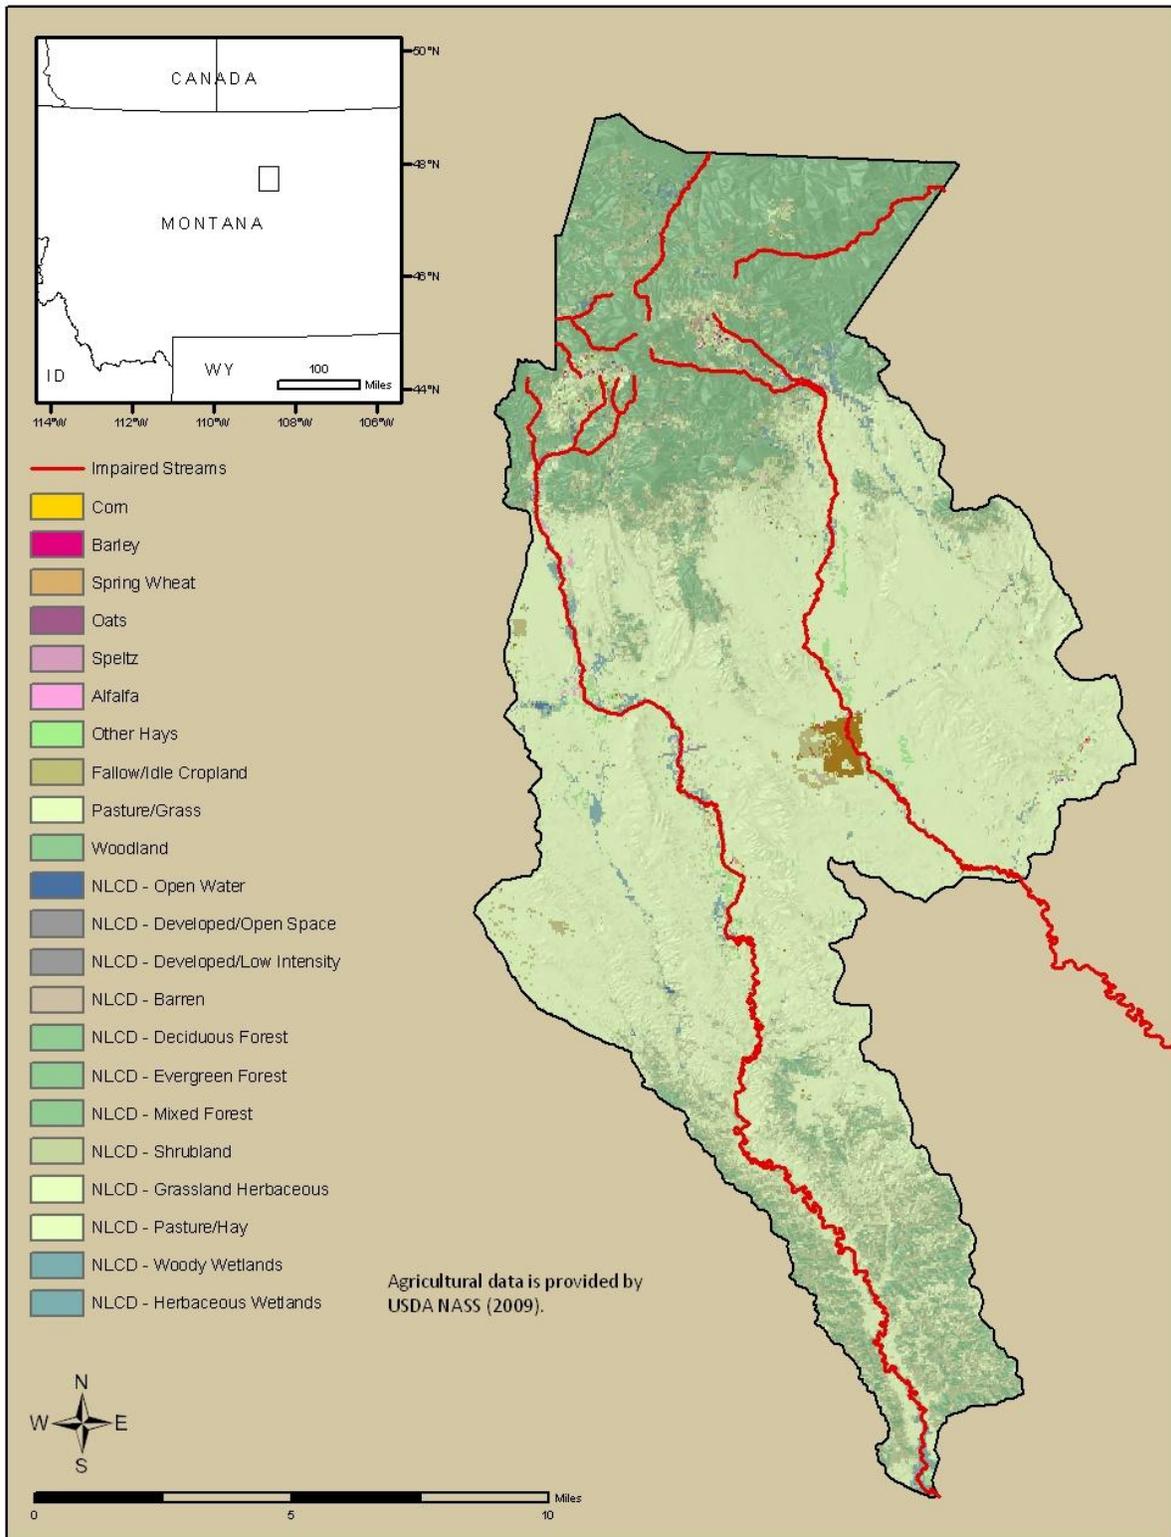


Figure A-14. Agricultural Use

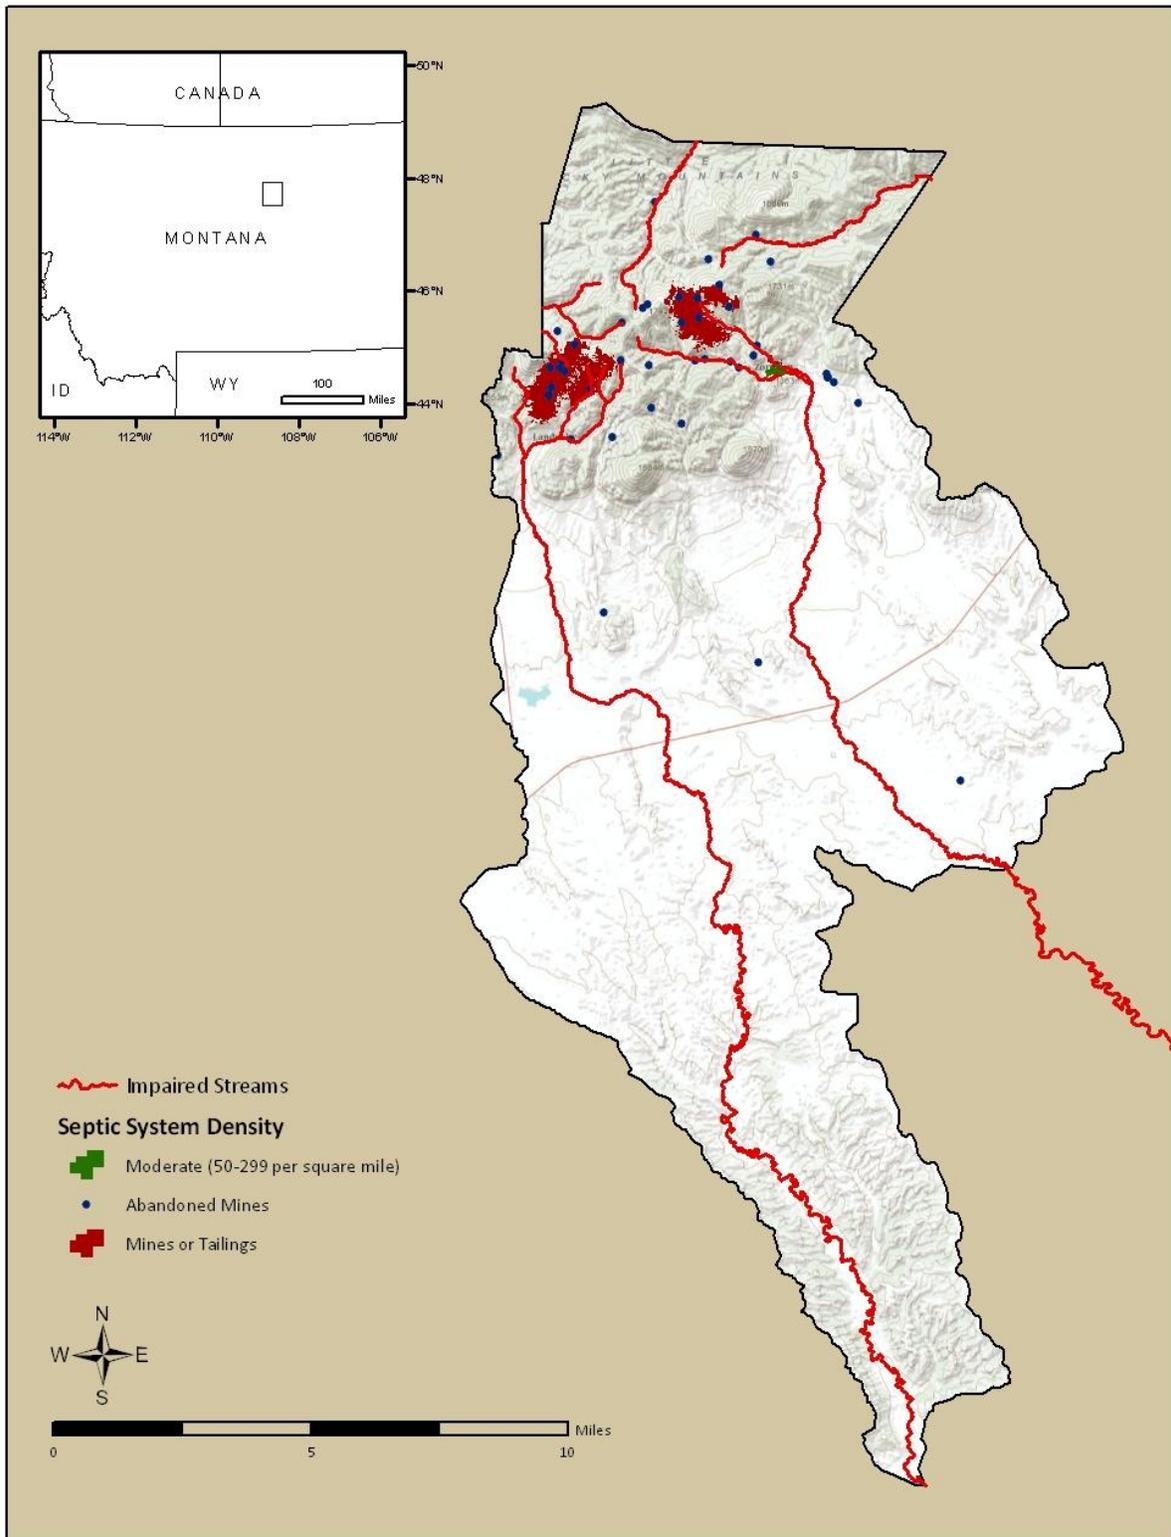


Figure A-15. Discharges

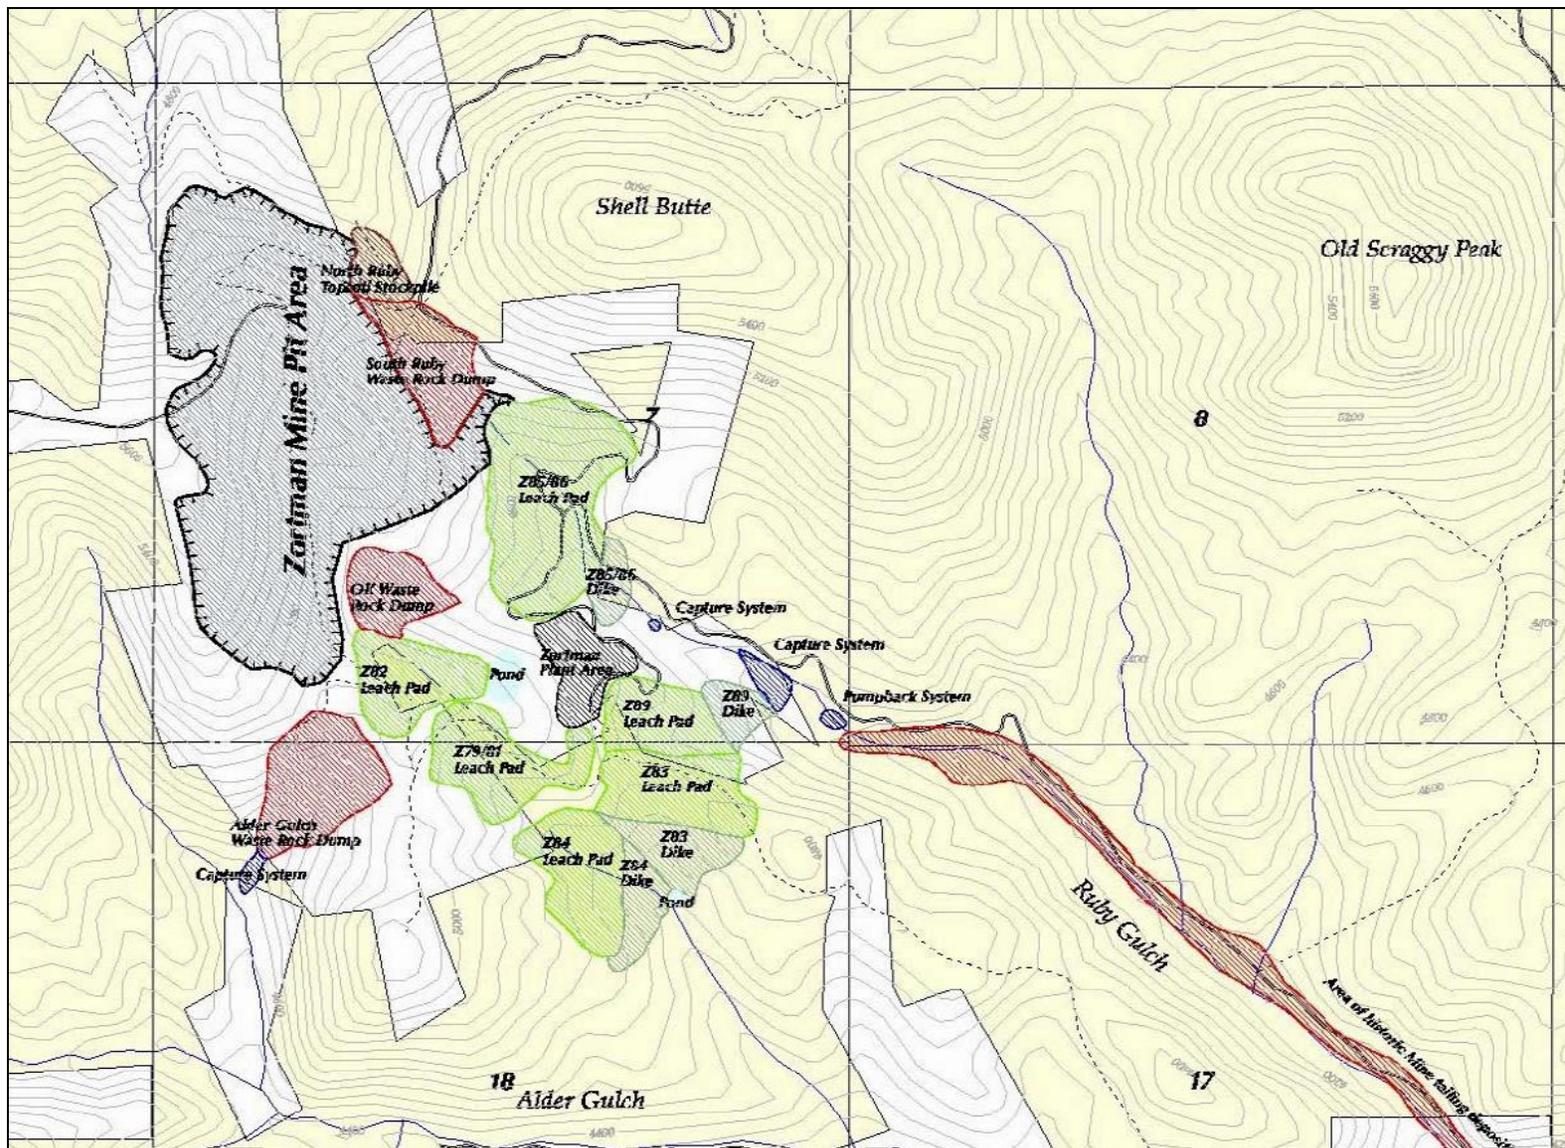


Figure A-16. Zortman Mine Facilities Map (Haight 2004).

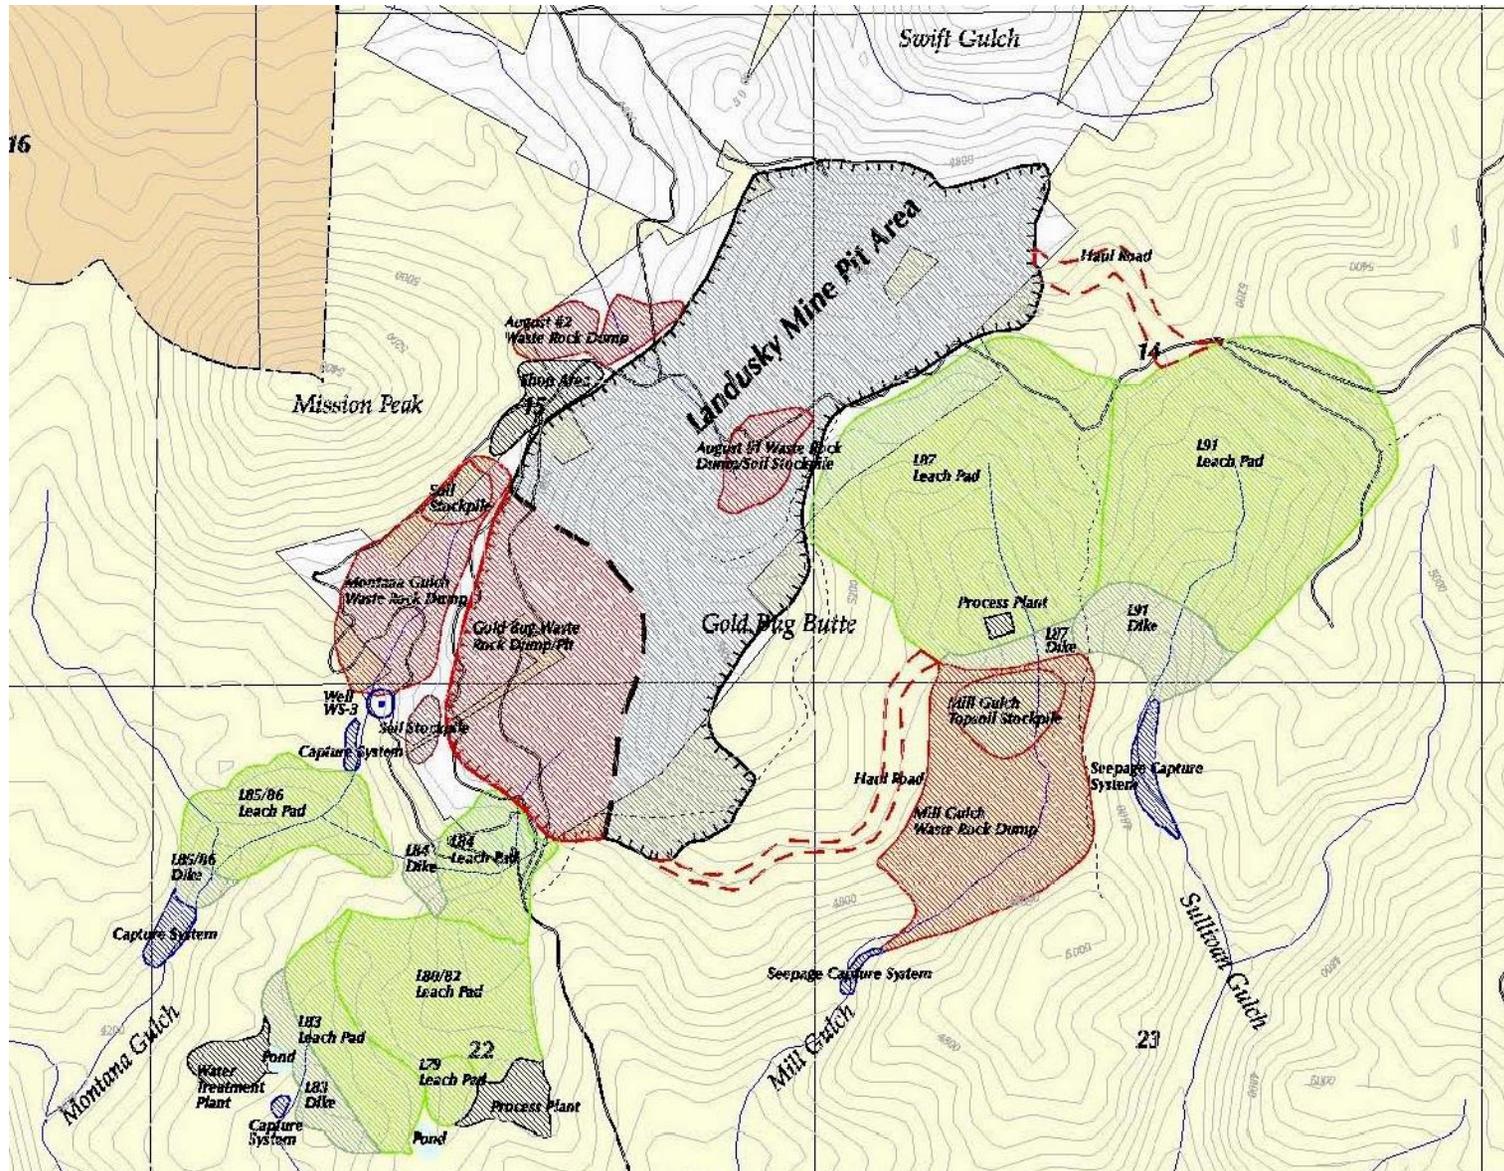


Figure A-17. Landusky Mine Facilities Map (Haight 2004).

APPENDIX B – SURFACE WATER CHEMISTRY DATA

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Alder Gulch	Z-16	Lower Alder Gulch	5/3/1990	65	3514	6.9	123	56	--	10	< 1	< 5	< 20	60	5300	< 1	< 30	20	< 5	120.00	348
Alder Gulch	Z-16	Lower Alder Gulch	5/15/1990	126	884	6.8	206	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Alder Gulch	Z-16	Lower Alder Gulch	5/29/1990	154	675	7.1	222	116	--	< 5	7.00	11	< 20	70	690	< 1	50	10	< 5	140.00	29
Alder Gulch	Z-16	Lower Alder Gulch	6/13/1990	238	296	7	370	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Alder Gulch	Z-16	Lower Alder Gulch	6/27/1990	330	120	6.8	486	--	--	--	--	15	--	--	--	--	--	--	--	--	--
Alder Gulch	Z-16	Lower Alder Gulch	6/27/1990	329	120	7.1	480	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Alder Gulch	Z-16	Lower Alder Gulch	7/18/1990	490	5	8.1	713	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Alder Gulch	Z-16	Lower Alder Gulch	7/31/1990	469	13	7.5	696	392	--	< 5	2.00	11	< 20	20	280	< 1	< 30	< 10	< 5	80.00	13
Alder Gulch	Z-16	Lower Alder Gulch	5/14/1991	168	170	6.9	220	144	--	< 5	7.00	9	< 20	100	280	< 0.2	90	< 2	< 5	240.00	21
Alder Gulch	Z-16	Lower Alder Gulch	6/11/1991	244	182	5.3	352	213	--	--	--	13	--	--	--	--	--	--	--	--	--
Alder Gulch	Z-16	Lower Alder Gulch	7/23/1991	593	46	4.5	1030	575	--	--	--	5	--	--	--	--	--	--	--	--	--
Alder Gulch	Z-16	Lower Alder Gulch	5/17/1994	121	25	7.4	189	65	--	< 5	< 1	< 5	< 10	< 10	270	< 1	< 10	20	< 5	90.00	98
Alder Gulch	Z-16	Lower Alder Gulch	5/30/1996	80	135	6.6	114	34	300	8	0.20	< 5	< 1	7	820	< 0.6	< 20	< 3	< 1	20.00	21
Alder Gulch	Z-2	Alder Gulch Below Carter	5/3/1990	29	4237	6.9	45	20	--	< 5	< 1	< 5	< 20	20	< 30	< 1	< 30	10	< 5	50.00	22
Alder Gulch	Z-2	Alder Gulch Below Carter	5/15/1990	63	0	6.7	125	--	--	--	--	--	--	--	980	--	--	--	--	--	--
Alder Gulch	Z-2	Alder Gulch Below Carter	5/29/1990	69	1346	6.8	123	59	--	< 5	5.00	< 5	< 20	50	--	< 1	30	< 10	< 5	140.00	35
Alder Gulch	Z-2	Alder Gulch Below Carter	6/13/1990	162	291.7	4.7	290	--	--	--	--	--	--	--	490	--	--	--	--	--	--
Alder Gulch	Z-2	Alder Gulch Below Carter	6/27/1990	240	94	4.7	412	--	--	--	--	5	--	--	--	--	--	--	--	--	--
Alder Gulch	Z-2	Alder Gulch Below Carter	7/18/1990	425	37	4.3	768	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Alder Gulch	Z-2	Alder Gulch Below Carter	7/31/1990	437	31	4.3	903	--	--	< 5	90.00	< 5	< 20	570	--	< 1	550	< 10	< 5	1860.00	20
Alder Gulch	Z-2	Alder Gulch Below Carter	8/22/1990	462	45	4.6	882	--	--	--	--	--	--	--	< 30	--	--	--	--	--	--
Alder Gulch	Z-2	Alder Gulch Below Carter	10/10/1990	501	15	4.7	825	--	--	9	79.00	< 5	< 20	560	--	< 1	530	< 10	< 5	1710.00	73
Alder Gulch	Z-2	Alder Gulch Below Carter	10/31/1990	498	15	4.6	821	--	--	--	--	--	--	--	100	--	--	--	--	--	--
Alder Gulch	Z-2	Alder Gulch Below Carter	12/11/1990	375	11.2	5.4	564	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Alder Gulch	Z-2	Alder Gulch Below Carter	1/10/1991	918	3	6.5	1390	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Alder Gulch	Z-2	Alder Gulch Below Carter	3/20/1991	307	0	6.9	456	280	--	< 5	20.00	< 5	< 20	10	--	< 1	130	20	< 5	370.00	6
Alder Gulch	Z-2	Alder Gulch Below Carter	5/14/1991	68	1640.3	5.9	127	64	--	< 5	7.00	< 5	< 20	70	< 30	< 2	40	< 2	< 5	160.00	33
Alder Gulch	Z-2	Alder Gulch Below Carter	6/11/1991	126	798.92	4.4	282	176	--	--	--	< 5	--	--	310	--	--	--	--	--	--
Alder Gulch	Z-2	Alder Gulch Below Carter	7/23/1991	515	62.84	3.8	1280	849	--	--	--	< 5	--	--	--	--	--	20	--	--	--
Alder Gulch	Z-2	Alder Gulch Below Carter	9/4/1991	917	17.06	4	2160	1420	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Alder Gulch	Z-2	Alder Gulch Below Carter	10/16/1991	533	22.4	4.2	1400	902	--	< 5	172.00	< 5	< 20	2010	--	< 1	990	< 10	< 5	3650.00	18
Alder Gulch	Z-2	Alder Gulch Below Carter	5/28/1992	368	14.81	7.5	571	345	--	< 5	12.00	< 5	< 10	90	60	< 1	70	< 10	< 5	140.00	5
Alder Gulch	Z-2	Alder Gulch Below Carter	10/14/1992	233	83.9	7.5	335	197	--	< 5	15.00	< 5	< 10	30	140	< 1	90	< 10	184	340.00	10
Alder Gulch	Z-2	Alder Gulch Below Carter	5/11/1993	47	224.42	7.2	71	30	--	< 5	1.00	< 5	< 10	< 10	< 30	< 1	< 10	< 10	< 5	30.00	7
Alder Gulch	Z-2	Alder Gulch Below Carter	10/14/1993	162	64.99	7.3	237	110	--	< 5	3.00	< 5	< 10	< 10	750	< 1	30	< 10	< 5	90.00	4
Alder Gulch	Z-2	Alder Gulch Below Carter	5/17/1994	73	242.4	7	122	43	--	< 5	< 1	< 5	< 10	< 10	< 30	< 1	< 10	10	< 5	20.00	7
Alder Gulch	Z-2	Alder Gulch Below Carter	5/17/1994	74	242.4	7	124	43	--	< 5	< 1	< 5	< 10	< 10	290	< 1	< 10	< 10	< 5	40.00	5
Alder Gulch	Z-2	Alder Gulch Below Carter	10/26/1994	225	26.9	7.7	330	169	--	< 5	< 1	< 5	< 10	< 10	250	< 1	< 10	< 10	< 5	20.00	1
Alder Gulch	Z-2	Alder Gulch Below Carter	5/11/1995	36	0	6.8	61	22	--	5	< 1	< 5	< 10	< 10	< 30	< 1	< 10	< 10	< 5	30.00	10
Alder Gulch	Z-2	Alder Gulch Below Carter	10/17/1995	120	67.3	7.55	179	105	210	< 3	0.55	< 5	< 10	3	1440	< 1	15	< 3	3	30.00	5.5

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Alder Gulch	Z-2	Alder Gulch Below Carter	5/30/1996	42	1369	6.6	80	21	400	< 3	0.20	5	< 1	6	70	< 0.6	< 20	< 3	< 1	10.00	10
Alder Gulch	Z-2	Alder Gulch Below Carter	10/25/1996	194	22.66	7.36	288	152	180	< 3	1.93	< 5	< 1	8	870	< 0.6	< 20	< 3	< 1	87.33	7
Alder Gulch	Z-2	Alder Gulch Below Carter	10/25/1996	194	22.67	7.5	293	158	100	< 3	1.60	< 4	< 1	6	30	< 0.6	30	< 3	2	90.00	10
Alder Gulch	Z-2	Alder Gulch Below Carter	4/14/1997	81	213.19	7.4	127	50	200	3	< 1	< 5	--	3	< 10	--	< 20	< 3	< 1	20.00	10
Alder Gulch	Z-2	Alder Gulch Below Carter	5/12/1997	62	126.17	7.4	110	39	100	< 3	< 1	< 5	--	3	710	--	< 20	< 3	< 1	20.00	10
Alder Gulch	Z-2	Alder Gulch Below Carter	6/17/1997	59	330.34	7.84	117	40	170	4	< 1	< 5	--	34	110	--	< 20	< 3	< 1	20.00	10
Alder Gulch	Z-2	Alder Gulch Below Carter	6/17/1997	60	330.34	7.83	115	40	180	4	< 1	< 5	--	31	260	--	< 20	< 3	< 1	20.00	10
Alder Gulch	Z-2	Alder Gulch Below Carter	8/11/1997	139	27.83	7.8	239	108	< 100	5	< 1	< 5	--	< 1	220	--	< 20	< 3	< 1	20.00	10
Alder Gulch	Z-2	Alder Gulch Below Carter	10/23/1997	--	--	--	--	--	< 100	5	< 1	< 5	--	< 1	< 10	--	20	< 3	< 1	--	10
Alder Gulch	Z-2	Alder Gulch Below Carter	4/28/1998	265	--	--	312	104	110	107	< 1	< 5	--	2	< 10	--	< 20	< 3	1	90.00	10
Alder Gulch	Z-2	Alder Gulch Below Carter	6/3/1998	95	--	--	136	56	< 100	4	< 1	< 5	--	35	1820	--	< 20	8	< 1	10.00	10
Alder Gulch	Z-2	Alder Gulch Below Carter	8/20/1998	500	--	--	763	482	120	< 3	1.00	< 5	--	1	180	--	< 20	< 3	< 1	30.00	10
Alder Gulch	Z-2	Alder Gulch Below Carter	10/30/1998	190	--	--	295	144	< 100	5	< 1	< 5	--	3	< 10	--	< 20	< 3	< 1	10.00	10
Alder Gulch	Z-8	Below Alder Spur	5/3/1990	54	4071	7.2	--	--	--	10	2.00	< 5	< 20	--	5640	< 1	< 30	30	< 5	140.00	460
Alder Gulch	Z-8	Below Alder Spur	5/3/1990	52	4071	7	115	34	--	13	3.00	< 5	20	--	5460	< 1	< 30	30	< 5	130.00	430
Alder Gulch	Z-8	Below Alder Spur	5/15/1990	180	852.8	6.8	261	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Alder Gulch	Z-8	Below Alder Spur	5/29/1990	122	1571	6.9	190	92	--	< 5	6.00	8	< 20	--	490	< 1	50	< 10	< 5	140.00	27
Alder Gulch	Z-8	Below Alder Spur	6/13/1990	216	417.4	6.7	339	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Alder Gulch	Z-8	Below Alder Spur	6/27/1990	321	129	6.7	447	--	--	--	--	12	--	--	--	--	--	--	--	--	--
Alder Gulch	Z-8	Below Alder Spur	7/18/1990	480	28	7.1	703	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Alder Gulch	Z-8	Below Alder Spur	7/31/1990	438	28	6.6	648	392	--	< 5	27.00	9	< 20	--	80	< 1	190	< 10	< 5	810.00	8
Alder Gulch	Z-8	Below Alder Spur	8/22/1990	422	--	6.5	630	--	--	--	--	--	--	--	--	--	--	0	--	--	--
Alder Gulch	Z-8	Below Alder Spur	12/11/1990	335	0.36	7.1	481	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Alder Gulch	Z-8	Below Alder Spur	3/20/1991	294	10	7.3	404	236	--	< 5	< 1	< 5	< 20	< 10	120	< 1	< 30	< 10	< 5	50.00	8
Alder Gulch	Z-8	Below Alder Spur	5/14/1991	154	1826.74	6.5	183	136	--	< 5	8.00	8	< 20	120	290	0.2	80	< 2	< 5	250.00	35
Alder Gulch	Z-8	Below Alder Spur	6/11/1991	222	929.08	4.7	364	218	--	--	--	11	--	--	--	--	--	--	--	--	--
Alder Gulch	Z-8	Below Alder Spur	7/23/1991	564	62.84	4.4	1110	617	--	--	--	8	--	--	--	--	--	--	--	--	--
Alder Gulch	Z-8	Below Alder Spur	9/4/1991	768	3.14	4.3	1370	904	--	--	--	< 5	--	--	--	--	--	0	--	--	--
Alder Gulch	Z-8	Below Alder Spur	10/16/1991	454	23.4	4.5	877	519	--	< 5	109.00	< 5	< 20	630	2900	< 1	640	< 10	< 5	3140.00	68
Alder Gulch	Z-8	Below Alder Spur	5/28/1992	277	0.6	6.6	416	262	--	< 5	< 1	< 5	< 10	< 10	230	< 1	< 30	< 10	< 5	60.00	1
Alder Gulch	Z-8	Below Alder Spur	10/14/1992	275	22.4	8	368	192	--	< 5	< 1	< 5	< 10	< 10	< 30	< 1	< 30	< 10	< 5	150.00	3
Alder Gulch	Z-8	Below Alder Spur	5/11/1993	71	157.09	5.8	94	38	--	< 5	< 1	< 5	< 10	< 10	260	< 1	< 10	20	< 5	20.00	5
Alder Gulch	Z-8	Below Alder Spur	10/14/1993	203	75.63	7.6	256	128	--	< 5	2.00	< 5	< 10	< 10	< 30	< 1	10	20	< 5	60.00	1
Alder Gulch	Z-8	Below Alder Spur	5/17/1994	90	212	7.2	129	48	--	< 5	< 1	< 5	< 10	< 10	240	< 1	< 10	10	< 5	10.00	10
Alder Gulch	Z-8	Below Alder Spur	8/2/1994	207	15.4	8.05	310.5	134	--	6	< 1	< 5	< 10	< 10	< 30	< 0.2	< 10	< 10	< 5	< 10	2.5
Alder Gulch	Z-8	Below Alder Spur	10/27/1994	238	26.9	7.8	290.5	151	--	< 5	< 1	< 5	< 10	< 10	64	< 0.5	< 10	< 10	< 5	25.50	1
Alder Gulch	Z-8	Below Alder Spur	1/31/1995	323	60	7.8	461	205	< 100	< 5	< 1	< 5	< 10	< 10	< 30	< 1	< 10	< 10	< 5	30.00	1
Alder Gulch	Z-8	Below Alder Spur	1/31/1995	316	60	7.8	468	216	< 100	< 5	< 1	< 5	< 10	< 10	< 30	< 1	< 10	< 10	< 5	30.00	1
Alder Gulch	Z-8	Below Alder Spur	5/11/1995	50	605.9	7.2	84.5	27	--	< 5	< 1	< 5	< 10	< 10	1360	< 1	< 10	10	< 5	105.00	14
Alder Gulch	Z-8	Below Alder Spur	8/3/1995	193	25	7.6	270	117	< 100	2	0.20	< 5	< 10	2	10	< 1	< 10	< 20	< 5	40.00	10

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Alder Gulch	Z-8	Below Alder Spur	10/17/1995	154	80.1	7.4	218	90	< 100	< 3	0.20	< 5	< 10	2	20	< 1	< 10	< 3	< 5	10.00	10
Alder Gulch	Z-8	Below Alder Spur	5/30/1996	60	1351	7.2	82	28	500	4	0.20	< 5	< 1	7	930	< 0.6	< 20	< 3	< 1	30.00	10
Alder Gulch	Z-8	Below Alder Spur	8/12/1996	225	4.8	7.1	305	149	< 100	3	0.20	< 5	< 1	4	100	< 0.6	< 20	< 3	< 1	20.00	10
Alder Gulch	Z-8	Below Alder Spur	10/24/1996	233	31.64	7.6	324	170	< 100	< 3	0.17	< 5	< 1	< 1	< 20	< 0.6	< 20	< 3	< 1	25.00	7
Alder Gulch	Z-8	Below Alder Spur	10/24/1996	243	31.64	7.5	332	172	< 100	< 3	0.10	< 5	< 1	< 1	< 10	< 0.6	< 20	< 3	< 1	40.00	10
Alder Gulch	Z-8	Below Alder Spur	2/11/1997	298	10	7.7	391	182	< 100	< 3	0.10	< 5	2	1	< 10	< 0.6	< 20	< 3	< 1	30.00	10
Alder Gulch	Z-8	Below Alder Spur	2/11/1997	282	10	7.7	386	180	< 100	< 3	0.20	< 5	< 1	2	10	< 0.6	< 20	< 3	< 1	20.00	10
Alder Gulch	Z-8	Below Alder Spur	4/14/1997	136	223.29	7.7	180	72	300	< 3	< 0.1	< 5	--	< 1	150	< 0.6	< 20	< 3	< 1	30.00	10
Alder Gulch	Z-8	Below Alder Spur	5/12/1997	89	220.37	7.5	150	52	< 100	< 3	< 0.1	< 5	--	2	50	--	< 20	< 3	< 1	20.00	10
Alder Gulch	Z-8	Below Alder Spur	6/17/1997	91	453.76	7.83	151	53	< 100	< 3	< 0.1	< 5	--	17	270	--	< 20	4	< 1	20.00	10
Alder Gulch	Z-8	Below Alder Spur	8/11/1997	168	46.22	7.75	271	113	< 100	< 3	0.10	< 5	--	< 1	< 10	--	< 20	< 3	< 1	10.00	10
Alder Gulch	Z-8	Below Alder Spur	9/12/1997	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Alder Gulch	Z-8	Below Alder Spur	10/23/1997	--	--	--	--	--	< 100	< 3	< 0.1	< 5	--	--	< 10	--	20	< 3	< 1	--	10
Alder Gulch	Z-8	Below Alder Spur	10/23/1997	--	--	--	--	--	< 100	< 3	< 0.1	< 5	--	< 1	< 10	--	20	< 3	< 1	--	10
Alder Gulch	Z-8	Below Alder Spur	12/1/1997	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	< 3	--	--	--
Alder Gulch	Z-8	Below Alder Spur	4/28/1998	128	--	--	159	65	< 100	3	< 0.1	< 5	--	2	150	--	< 20	< 3	< 1	< 10	10
Alder Gulch	Z-8	Below Alder Spur	6/3/1998	130	--	--	165	65	< 100	< 3	< 0.1	< 5	--	3	20	--	< 20	< 3	< 1	20.00	10
Alder Gulch	Z-8	Below Alder Spur	6/16/1998	164	--	--	207	83	< 100	< 3	0.20	< 5	--	1	10	--	< 20	< 3	< 1	< 10	10
Alder Gulch	Z-8	Below Alder Spur	8/20/1998	158	--	--	237	98	< 100	< 3	< 0.1	< 5	--	2	< 10	--	< 20	< 3	< 1	< 10	10
Alder Gulch	Z-8	Below Alder Spur	10/30/1998	213	--	--	323	143	< 100	< 3	< 0.1	< 5	--	2	< 10	--	< 20	< 3	< 1	< 10	10
Beaver Creek	Z-31	Upper Beaver Creek	5/15/1990	83	125	7.3	111	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Beaver Creek	Z-31	Upper Beaver Creek	5/29/1990	82	243	8	88	6	--	< 5	2	< 5	< 20	< 10	320	< 1	< 30	20	< 5	10	2
Beaver Creek	Z-31	Upper Beaver Creek	5/29/1990	81	243	8.1	89	6	--	< 5	3	< 5	< 20	< 10	320	< 1	< 30	--	< 5	10	--
Beaver Creek	Z-31	Upper Beaver Creek	6/14/1990	97	34	8	120	--	--	--	--	--	--	< 10	--	--	--	--	--	--	--
Beaver Creek	Z-31	Upper Beaver Creek	6/14/1990	95	34	8	124	--	--	--	--	--	--	< 10	--	--	--	--	--	--	--
Beaver Creek	Z-31	Upper Beaver Creek	6/26/1990	113	28	7.5	151	--	--	--	--	< 5	--	< 10	--	--	--	--	--	--	--
Beaver Creek	Z-31	Upper Beaver Creek	7/18/1990	124	1.5	7.3	135	--	--	--	--	--	--	< 10	--	--	--	--	--	--	--
Beaver Creek	Z-31	Upper Beaver Creek	5/15/1991	69	315	7.8	65	7	--	< 5	< 0.1	< 5	< 20	< 1	110	< 0.2	< 30	< 2	< 5	< 10	6
Beaver Creek	Z-31	Upper Beaver Creek	6/12/1991	89	121.18	8	121	6	--	--	--	< 5	--	< 1	--	--	--	--	--	--	--
Beaver Creek	Z-31	Upper Beaver Creek	7/24/1991	110	9.43	8	106	7	--	< 5	< 1	< 5	< 20	< 10	< 30	< 1	< 30	< 10	< 5	70	1
Beaver Creek	Z-31	Upper Beaver Creek	5/11/1993	93	34.6	7.3	130	6	--	< 5	< 1	< 5	< 10	< 10	< 30	< 1	< 10	< 10	< 5	< 10	2
Beaver Creek	Z-31	Upper Beaver Creek	10/13/1993	123	4.49	7.8	158	8	--	--	--	< 5	--	< 10	--	--	--	--	--	--	8
Beaver Creek	Z-31	Upper Beaver Creek	5/18/1994	105	54.8	8	128	5	--	< 5	< 1	< 5	< 10	< 10	50	< 1	< 10	20	< 5	30	2
Beaver Creek	Z-31	Upper Beaver Creek	5/15/1995	82	80.6	7.7	135	5	--	< 5	< 1	< 5	< 10	10.5	265	< 1	12	< 10	< 5	16.5	5.95
Beaver Creek	Z-31	Upper Beaver Creek	8/3/1995	114	35	7.7	140	16	< 100	< 1	< 1	< 5	< 10	< 1	15	< 1	< 10	< 2	< 5	20	10
Beaver Creek	Z-31	Upper Beaver Creek	5/28/1996	80	208.4	7.2	115	4	< 100	< 3	< 0.1	< 5	< 1	2	200	< 0.6	< 20	< 3	< 1	30	10
Beaver Creek	Z-31	Upper Beaver Creek	5/14/1997	105	17	7.6	125	5	< 100	< 3	< 0.1	< 5	--	< 1	20	--	< 20	< 3	< 1	< 20	10
Beaver Creek	Z-31	Upper Beaver Creek	6/16/1997	76	80.79	7.91	101	5	< 100	< 3	< 0.1	< 5	--	< 1	20	--	< 20	< 3	< 1	< 10	10
Beaver Creek	Z-31	Upper Beaver Creek	8/12/1997	115	0.59	7.55	137	6	< 100	< 3	< 0.1	< 5	--	< 1	10	--	< 20	< 3	< 1	30	10

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Beaver Creek	Z-39	Beaver Creek Below Whitcomb House	5/18/1994	108	228.9	8.1	122	10	--	< 5	< 1	< 5	< 10	< 10	60	< 1	< 10	20	< 5	30	2
Beaver Creek	Z-39	Beaver Creek Below Whitcomb House	8/2/1994	171	0	8.2	243	20	--	< 5	< 1	< 5	< 10	< 10	30	< 1	< 10	< 10	< 5	< 10	8
Beaver Creek	Z-39	Beaver Creek Below Whitcomb House	10/26/1994	169	170.5	8	204	24	--	--	--	< 5	--	< 10	--	--	--	--	--	--	--
Beaver Creek	Z-39	Beaver Creek Below Whitcomb House	5/15/1995	82	610.4	7.9	135	6	--	< 5	< 1	< 5	< 10	< 10	500	< 1	< 10	< 10	< 5	20	10
Beaver Creek	Z-39	Beaver Creek Below Whitcomb House	10/18/1995	166	27.8	7.5	215	18	--	--	--	< 5	--	< 10	--	--	--	--	--	--	--
Beaver Creek	Z-39	Beaver Creek Below Whitcomb House	5/30/1996	86	1050.26	7.4	110	7	100	< 5	< 0.1	< 5	< 1	2	300	< 0.6	20	< 3	< 1	20	10
Beaver Creek	Z-39	Beaver Creek Below Whitcomb House	10/22/1996	171	36.8	7.6	210	21	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Beaver Creek	Z-39	Beaver Creek Below Whitcomb House	7/30/1997	--	--	--	122	10	--	3	< 0.1	--	< 1	--	--	--	20	< 3	< 1	--	--
Beaver Creek	M41BEVRC03	Beaver Creek 1 mile of Reservation line	6/30/2005	204	--	--	--	11	--	3	< .08	--	< 1	1	50	< 0.6	< 10	< .5	--	1000	1
Big Horn Creek	L-48	Reservation Boundary	4/1/2003	430	--	7.4	653	395	--	0	0.1	0	--	0	10	0	0	0	1	20.0	--
Big Horn Creek	L-48	Reservation Boundary	4/23/2003	219	--	7.6	361	200	--	0	0	0	--	0	10	0	0	0	0	10.0	--
Big Horn Creek	L-48	Reservation Boundary	5/22/2003	202	--	7.5	339	177	--	0	0.7	0	--	1	20	0	0	0	0	10.0	0
Big Horn Creek	L-48	Reservation Boundary	6/27/2003	392	--	7.6	621	349	--	0	0	0	--	0	810	--	0	0	0	30.0	17
Big Horn Creek	L-48	Reservation Boundary	5/26/2004	86	--	6.9	162	63	--	33	0.8	0	--	4	14200	--	0	0	0	100.0	42
Big Horn Creek	L-48	Reservation Boundary	6/16/2004	149	--	7.5	233	117	--	--	0.9	0	--	3	920	--	0	0	0	80.0	0
Big Horn Creek	L-48	Reservation Boundary	7/14/2004	372	--	7.4	582	342	--	0	0.2	0	--	2	370	--	0	0	1	130.0	0
Big Horn Creek	L-48	Reservation Boundary	5/9/2005	227	--	7.4	378	213	--	0	0.9	0	--	3	1570	--	30	0	0	290.0	--
Big Horn Creek	L-48	Reservation Boundary	5/20/2005	304	--	7.4	422	251	--	0	0.7	0	--	0	230	0	20	5	0	250.0	--
Big Horn Creek	L-48	Reservation Boundary	6/24/2005	202	--	7.8	298	143	--	0	0.4	0	--	1	130	0	0	0	1	90.0	--
Big Horn Creek	L-48	Reservation Boundary	7/21/2005	386	--	7.8	594	348	--	0	0.2	0	--	0	30	--	0	0	0	80.0	--
Big Horn Creek	L-48	Reservation Boundary	4/11/2006	137	--	7.4	235	122	--	3	1.1	0	--	3	1600	0	24	0	1	227.0	--
Big Horn Creek	L-48	Reservation Boundary	6/30/2006	318	--	7.7	489	286	--	1	0.8	0	--	1	110	0	32	0	1	323.0	--
Big Horn Creek	L-48	Reservation Boundary	11/8/2006	434	--	7.4	--	405	--	0	1.6	0	--	3	520	--	63	--	0	818.0	--
Big Horn Creek	L-48	Reservation Boundary	3/27/2007	577	--	7.1	--	601	--	0	2.1	0	--	1	0	--	124	--	0	1610.0	--
Big Horn Creek	L-48	Reservation Boundary	4/23/2007	88	--	7.1	--	69	--	8	0.8	0	--	5	4960	--	22	--	0	214.0	--
Big Horn Creek	L-48	Reservation Boundary	5/30/2007	78	--	7.4	--	48	--	5	1	0	--	6	3000	--	12	--	0	81.0	--
Big Horn Creek	L-48	Reservation Boundary	6/26/2007	224	--	7.5	--	172	--	3	0.5	--	--	1	2110	--	32	--	0	276.0	--
Big Horn Creek	L-48	Reservation Boundary	10/11/2007	759	--	6.8	--	812	--	0	2.9	--	--	3	230	--	151	--	1	2170.0	--
Big Horn Creek	L-48	Reservation Boundary	5/13/2008	289	--	6	--	305	--	3	2.9	--	--	5	3300	--	140	--	0	1390.0	18
Big Horn Creek	L-48	Reservation Boundary	6/3/2008	186	--	6.7	--	153	--	4	0.9	--	--	2	2920	--	41	--	0	392.0	--
Big Horn Creek	L-48	Reservation Boundary	7/30/2008	554	--	7.6	--	567	--	0	0.6	--	--	2	90	--	35	--	0	348.0	--
Big Horn Creek	L-48	Reservation Boundary	8/11/2008	686	--	7.4	--	640	--	0	0.9	--	--	0	0	--	41	--	0	580.0	--
Big Horn Creek	L-48	Reservation Boundary	9/18/2008	846	--	7.2	--	877	--	0	3.3	--	--	0	110	--	183	--	0	2450.0	--
Big Horn Creek	L-48	Reservation Boundary	10/29/2008	979	--	7.3	--	990	--	2	1.8	--	--	2	190	--	92	--	0	1400.0	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Big Horn Creek	L-48	Reservation Boundary	6/17/2009	385	--	7.4	--	378	--	0	0.7	--	--	3	420	--	49	--	0	507.0	--
Big Horn Creek	L-48	Reservation Boundary	7/29/2009	794	--	7.5	--	772	--	0	0.9	--	--	2	60	--	46	--	0	628.0	--
Big Horn Creek	L-48	Reservation Boundary	8/31/2009	863	--	7.5	--	890	--	0	1	--	--	0	390	--	55	--	0	698.0	--
Big Horn Creek	L-48	Reservation Boundary	9/28/2009	1220	--	7.4	--	1150	--	2	1.5	--	--	5	970	--	75	--	0	1040.0	--
Big Horn Creek	L-48	Reservation Boundary	10/31/2009	908	--	6.2	--	968	--	0	3.7	--	--	4	20	--	235	--	0	3210.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	4/1/2003	401	--	7.3	630	390	--	0	0.1	0	--	0	0	0	0	0	1	60.0	0
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	4/23/2003	211	--	7.4	356	186	--	0	0	0	--	1	20	0	0	--	0	20.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	5/22/2003	202	--	--	353	179	--	0	0.4	0	--	1	50	0	0	--	0	20.0	0
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	6/27/2003	411	--	7	654	393	--	0	0.2	0	--	0	40	0	0	--	0	30.0	0
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	7/18/2003	574	--	6.9	1030	603	--	0	0.7	0	--	2	190	--	0	--	0	50.0	0
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	8/14/2003	803	--	7.1	1360	883	--	4	0.2	0	--	5	1090	--	0	0	1	80.0	0
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	9/10/2003	887	--	7	1500	939	--	0	0.2	0	--	6	150	--	0	--	0	80.0	0
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	10/18/2003	889	--	6.8	1390	944	--	0	0.3	0	--	2	60	0	0	--	0	100.0	0
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	11/25/2003	825	--	7.3	1220	807	--	0	0.1	0	--	2	40	0	0	--	0	150.0	0
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	4/21/2004	296	--	7.3	500	327	--	0	0	0	--	1	50	0	0	--	1	150.0	0
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	5/26/2004	85	--	7	177	67	--	42	0.8	0	--	6	18300	--	0	4	0	130.0	61
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	6/16/2004	143	--	7.4	235	118	--	0	1.1	0	--	3	1100	--	0	0	0	100.0	24
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	7/14/2004	359	--	7.7	540	317	--	0	0.2	0	--	2	80	--	20	0	0	70.0	0
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	8/18/2004	716	--	7	1160	744	--	0	0.4	0	--	3	400	--	0	0	0	220.0	0
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	10/25/2004	776	--	7.2	1300	819	--	0	0.6	0	--	0	70	0	30	0	0	420.0	0
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	11/19/2004	880	--	7.1	1240	784	--	0	0.8	0	--	2	120	0	50	0	0	890.0	0
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	12/1/2004	920	--	6.8	1320	865	--	0	0.8	0	--	1	20	0	50	0	0	700.0	0
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	3/10/2005	967	--	7.1	1270	854	--	0	2	0	--	2	20	--	140	0	1	1950.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	5/9/2005	215	--	7.1	1470	979	--	0	1	0	--	2	840	0	30	0	1	340.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	5/20/2005	263	--	7.2	374	208	--	0	0.9	0	--	6	460	0	30	0	1	320.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	6/24/2005	205	--	7.4	415	246	--	0	0.4	0	--	2	500	--	0	--	0	130.0	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	7/21/2005	425	--	7.3	298	147	--	0	0.4	0	--	3	0	0	0	0	1	190.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	8/19/2005	794	--	7.2	1160	689	--	0	0.6	0	--	1	10	0	0	--	0	300.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	9/20/2005	928	--	7.3	1450	921	--	0	0.7	0	--	4	30	--	30	--	0	570.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	10/27/2005	915	--	6.9	1310	842	--	0	1.5	0	--	8	110	0	60	--	0	790.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	11/20/2005	880	--	7.2	1350	869	--	0	1.6	0	--	7	60	0	90	--	0	1030.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	4/11/2006	129	--	7.3	231	118	--	3	1.1	0	--	1	1960	0	24	--	1	249.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	6/30/2006	336	--	7.3	521	305	--	0	1.3	0	--	1	80	0	41	--	0	449.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	8/24/2006	1050	--	7	1600	1080	--	0	2.1	0	--	2	80	--	87	--	1	1350.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	9/30/2006	553	--	6.7	883	544	10	0	1.5	0	--	2	30	--	58	--	0	838.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	11/8/2006	443	--	6.9	--	406	--	0	2.5	0	--	3	50	--	100	--	2	1200.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	3/27/2007	566	--	6.5	--	576	--	0	3.2	0	--	1	0	--	165	--	0	2030.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	4/23/2007	83	--	7	--	66	--	8	0.7	0	--	5	5470	--	22	0	0	204.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	5/30/2007	75	--	7.4	--	49	--	4	1	0	--	4	3130	--	12	0	0	81.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	6/26/2007	228	--	7.1	--	179	--	4	0.6	--	--	1	2690	--	38	0	0	344.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	9/18/2007	1040	--	6.4	--	1100	--	0	5	--	--	1	30	--	228	0	0	2950.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	10/11/2007	770	--	6	--	820	--	0	4.8	--	--	4	860	--	222	0	1	3040.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	11/26/2007	1000	--	4.2	--	1060	--	0	8.2	--	--	0	20	--	392	--	0	4930.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	5/13/2008	321	--	5.8	--	288	--	3	3	--	--	6	4010	--	140	0	0	1360.0	15
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	6/3/2008	185	--	6.5	--	157	--	10	1.2	--	--	4	7120	--	45	0	0	488.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	7/30/2008	642	--	6.7	--	688	--	7	1.1	--	--	0	0	--	50	0	0	621.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	8/6/2008	730	--	6.6	--	709	60	0	1	--	--	0	25	--	63	0	0	799.5	0
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	8/7/2008	743	--	6.6	--	715	65	0	1.35	--	--	0	10	--	63.5	0	0	827.5	0
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	9/18/2008	939	--	5.9	--	984	--	0	8.8	--	--	2	80	--	446	0	0	5480.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	10/29/2008	1020	--	6.3	--	970	--	--	1.8	--	--	2	0	--	107	0	1	1190.0	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	11/23/2008	828	--	6	--	873	--	0	5.4	--	--	1	70	--	278	0	0	3640.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	6/17/2009	403	--	6.8	--	398	--	0	0.8	--	--	2	490	--	50	0	0	509.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	7/29/2009	914	--	6.6	--	902	--	0	0.9	--	--	2	20	--	45	0	0	588.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	8/31/2009	946	--	6.6	--	890	--	0	1.1	--	--	3	20	--	55	--	1	688.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	9/28/2009	1380	--	6.5	--	1360	--	0	1.4	--	--	0	40	--	65	0	1	927.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	10/31/2009	826	--	6.8	--	892	--	1	2.6	--	--	5	680	--	167	0	0	2340.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	4/27/2010	337	--	--	--	--	--	3	4.6	--	--	10	4400	--	270	--	0	2590.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	5/27/2010	70	--	--	--	--	--	4	0.4	--	--	4	3130	--	15	--	0	128.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	6/16/2010	377	--	--	--	--	--	2	0.4	--	--	0	320	--	21	--	0	164.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	7/27/2010	565	--	--	--	--	--	0	0.4	--	--	2	10	--	29	--	0	269.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	8/16/2010	929	--	--	--	--	--	0	0.8	--	--	0	20	--	33	--	0	428.0	--
Big Horn Creek	L-48 A	Below Swift Gulch Between L-48 and L-49	11/28/2010	1020	--	--	--	--	--	0	7.6	--	--	7	0	--	427	--	2	6210.0	--
King Creek	503	King Creek Cumberland Dam Pond Inlet	5/15/2000	326	--	8.01	--	--	--	< 3	0.1	< 5	--	9	--	--	--	34	--	< 10	10
King Creek	503	King Creek Cumberland Dam Pond Inlet	6/4/2001	221	--	7.94	--	136	--	10	0.2	< 5	--	30	--	--	--	3	--	40.0	208
King Creek	503	King Creek Cumberland Dam Pond Inlet	6/10/2002	360	--	8	--	199	--	8	0.1	0	--	7	--	--	--	17	--	20.0	92
King Creek	503	King Creek Cumberland Dam Pond Inlet	8/8/2002	--	--	7.8	--	366	--	13	0.2	0	--	11	--	--	--	34	--	40.0	175
King Creek	503	King Creek Cumberland Dam Pond Inlet	6/11/2004	345	--	--	--	213	--	14	0.4	0	--	8	--	--	--	20	--	60.0	164
King Creek	503	King Creek Cumberland Dam Pond Inlet	6/13/2005	284	--	7.9	--	159	--	5	0.2	0	--	4	--	--	--	6	--	20.0	50
King Creek	L-39	King Creek at Reservation boundary	3/29/2000	457	--	8.12	702	328	--	< 3	< 0.1	< 5	--	38	80	--	< 20	20	14.0	< 10	10
King Creek	L-39	King Creek at Reservation boundary	4/28/2000	433	--	7.93	639	317	--	< 3	< 0.1	< 5	--	< 1	20	--	< 20	10	17.0	< 10	10
King Creek	L-39	King Creek at Reservation boundary	5/30/2000	415	--	7.98	592	291	--	< 3	< 0.1	< 5	--	19	80	--	< 20	10	9.0	< 10	10
King Creek	L-39	King Creek at Reservation boundary	6/28/2000	487	--	7.9	733	365	--	< 3	< 0.1	< 5	--	< 1	40	--	< 20	10	12.0	10.0	19
King Creek	L-39	King Creek at Reservation boundary	7/25/2000	517	--	7.98	769	373	--	< 3	< 0.1	< 5	--	< 1	30	--	< 20	2	5.0	10.0	10
King Creek	L-39	King Creek at Reservation boundary	10/9/2000	550	--	7.73	732	333	160	5	0.2	< 5	--	21	260	--	< 20	3	< 1	10.0	10

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
King Creek	L-39	King Creek at Reservation boundary	11/13/2000	564	--	--	753	355	--	< 3	0.1	< 5	--	6	280	--	< 20	3	8.0	20.0	17
King Creek	L-39	King Creek at Reservation boundary	11/13/2000	564	--	7.74	753	355	--	< 3	0.1	< 5	--	6	280	--	< 20	3	8.0	20.0	17
King Creek	L-39	King Creek at Reservation boundary	5/9/2001	421	--	7.61	607	285	--	4	< 0.1	< 5	--	< 1	< 10	--	< 20	3	< 1	< 10	10
King Creek	L-39	King Creek at Reservation boundary	6/7/2001	366	--	7.76	494	232	--	< 3	< 0.1	< 5	--	6	120	--	< 20	4	4.0	20.0	16
King Creek	L-39	King Creek at Reservation boundary	7/16/2001	503	--	7.62	710	326	--	< 3	0.1	< 5	--	1	30	--	< 20	--	--	10.0	12
King Creek	L-39	King Creek at Reservation boundary	8/30/2001	419	--	7.45	778	356	--	5	0.7	< 5	--	15	460	--	< 20	--	< 1	20.0	11
King Creek	L-39	King Creek at Reservation boundary	11/7/2001	583	--	7.6	848	373	--	3	< 0.1	< 5	--	8	80	--	< 20	--	< 1	20.0	10
King Creek	L-39	King Creek at Reservation boundary	5/21/2002	424	--	7.6	602	284	--	3	0	0	--	2	0	0	0	3	4.0	0.0	0
King Creek	L-39	King Creek at Reservation boundary	6/25/2002	292	--	7.6	462	214	--	0	0	0	--	--	150	--	0	--	7.0	--	0
King Creek	L-39	King Creek at Reservation boundary	7/25/2002	519	--	7.5	791	362	--	4	0.4	0	--	2	80	0	0	3	1.0	10.0	--
King Creek	L-39	King Creek at Reservation boundary	3/18/2003	357	--	7.6	515	251	--	3	0.2	0	--	3	100	--	0	3	9.0	30.0	--
King Creek	L-39	King Creek at Reservation boundary	4/23/2003	337	--	7.3	531	235	--	3	0	0	--	3	0	0	0	3	3.0	20.0	--
King Creek	L-39	King Creek at Reservation boundary	5/22/2003	353	--	7.5	560	235	--	0	0.6	0	--	2	20	0	0	3	4.0	10.0	0
King Creek	L-39	King Creek at Reservation boundary	3/24/2004	517	--	7.3	732	399	--	4	0.1	0	--	2	0	0	0	3	15.0	20.0	0
King Creek	L-39	King Creek at Reservation boundary	4/21/2004	443	--	7.4	596	310	--	0	0	0	--	2	0	0	0	3	8.0	10.0	0
King Creek	L-39	King Creek at Reservation boundary	5/26/2004	407	--	7.4	--	--	--	4	0.2	0	--	2	60	--	0	--	5.0	10.0	0
King Creek	L-39	King Creek at Reservation boundary	6/16/2004	336	--	7.6	521	247	--	6	0.2	0	--	4	640	--	0	3	7.0	20.0	46
King Creek	L-39	King Creek at Reservation boundary	5/9/2005	395	--	7.4	569	256	--	0	0	0	--	2	70	--	0	--	8.0	10.0	--
King Creek	L-39	King Creek at Reservation boundary	4/11/2006	291	--	7.9	435	205	--	2	0	0	--	2	30	0	2	--	6.0	10.0	--
King Creek	L-39	King Creek at Reservation boundary	5/31/2007	239	--	7.7	--	--	--	4	0	0	--	3	740	--	4	--	2.0	10.0	--
King Creek	L-39	King Creek at Reservation boundary	6/26/2007	350	--	7.5	--	203	--	4	0	--	--	2	40	--	0	--	2.0	9.0	--
King Creek	L-39	King Creek at Reservation boundary	5/13/2008	362	--	7.3	--	223	--	3	0	--	--	2	120	--	2	--	4.0	15.0	0
King Creek	L-39	King Creek at Reservation boundary	6/26/2008	350	--	7.3	--	229	--	5	0.8	--	--	13	100	--	1	--	3.0	17.0	--
King Creek	L-39	King Creek at Reservation boundary	7/31/2008	495	--	7.4	--	274	--	4	0.1	--	--	3	100	--	0	--	0.0	14.0	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
King Creek	L-39	King Creek at Reservation boundary	8/11/2008	475	--	7	--	278	--	3	0	--	--	0	100	--	0	--	0.0	11.0	--
King Creek	L-39	King Creek at Reservation boundary	6/18/2009	338	--	7.7	--	213	--	3	0	--	--	2	10	--	0	--	3.0	8.0	--
King Creek	L-39	King Creek at Reservation boundary	7/28/2009	430	--	7.6	--	238	--	3	0	--	--	2	180	--	0	--	2.0	7.0	--
King Creek	L-39	King Creek at Reservation boundary	3/31/2010	362	--	--	--	--	--	3	0	--	--	2	0	--	0	--	--	--	--
King Creek	L-39	King Creek at Reservation boundary	4/27/2010	334	--	--	--	--	--	0	1	--	--	0	30	--	4	--	--	--	--
King Creek	L-39	King Creek at Reservation boundary	5/27/2010	207	--	--	--	--	--	8	2	--	--	6	1140	--	4	--	--	--	--
King Creek	L-39	King Creek at Reservation boundary	6/24/2010	228	--	--	--	--	--	2	0	--	--	2	150	--	0	--	--	--	--
King Creek	L-39	King Creek at Reservation boundary	7/29/2010	401	--	--	--	--	--	5	0	--	--	2	0	--	2	--	--	--	--
King Creek	L-5	King Creek Interception Trench Overflow	5/16/2000	--	--	--	--	--	--	--	< 1	--	--	--	--	--	--	--	--	--	--
King Creek	L-5	King Creek Interception Trench Overflow	5/16/2000	510	--	7.49	--	--	--	--	--	--	--	--	--	--	--	--	10.0	56.0	2.8
King Creek	L-5	King Creek Interception Trench Overflow	5/21/2001	917	--	7.79	1415	826	--	--	--	< 5	--	--	--	--	--	--	--	--	10
King Creek	L-5	King Creek Interception Trench Overflow	5/30/2001	874.2	--	--	1403	816.5	100	--	--	< 5	--	--	--	--	--	--	--	--	10
King Creek	L-5	King Creek Interception Trench Overflow	9/28/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
King Creek	L-5	King Creek Interception Trench Overflow	5/21/2002	960	--	--	1560	908	--	--	1.5	0	--	5	--	--	--	--	--	90.0	0
King Creek	L-5	King Creek Interception Trench Overflow	3/24/2004	646	--	7.5	923	537	--	0	0.4	0	--	2	120	--	0	--	24.0	40.0	0
King Creek	L-5	King Creek Interception Trench Overflow	5/3/2004	1060	--	7.3	1550	940	--	0	2.9	0	--	3	0	0	60	--	38.0	180.0	0
King Creek	L-5	King Creek Interception Trench Overflow	5/26/2004	628	--	7.4	924	450	--	0	1.1	0	--	3	30	--	0	--	16.0	70.0	12
King Creek	L-5	King Creek Interception Trench Overflow	6/16/2004	131	--	7.8	202	51	--	0	0	0	--	0	130	--	0	--	0.0	0.0	0
King Creek	L-5	King Creek Interception Trench Overflow	7/15/2004	--	--	--	2090	1190	--	0	--	0	--	--	30	--	70	--	60.0	--	18
King Creek	L-5	King Creek Interception Trench Overflow	9/30/2004	1160	--	7.4	1820	1030	--	0	3.1	0	--	4	0	0	50	3	46.0	190.0	13
King Creek	L-5	King Creek Interception Trench Overflow	10/30/2004	1190	--	7.8	1660	1030	--	0	2.6	0	--	3	10	--	40	--	39.0	160.0	0
King Creek	L-5	King Creek Interception Trench Overflow	11/19/2004	1170	--	7.8	1680	995	--	0	2.3	0	--	4	0	0	40	--	39.0	210.0	0
King Creek	L-5	King Creek Interception Trench Overflow	1/27/2005	1160	--	7.5	1450	1000	--	0	1.3	0	--	4	60	--	20	3	46.0	80.0	0
King Creek	L-5	King Creek Interception Trench Overflow	3/10/2005	1010	--	8	1540	891	--	0	1.4	0	--	2	0	0	20	--	41.0	80.0	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
King Creek	L-5	King Creek Interception Trench Overflow	4/29/2005	1160	--	7.7	1700	979	--	0	1.8	0	--	2	0	0	30	3	43.0	90.0	--
King Creek	L-5	King Creek Interception Trench Overflow	5/20/2005	1090	--	7.5	1540	846	--	0	1.8	0	--	2	20	0	30	--	41.0	100.0	--
King Creek	L-5	King Creek Interception Trench Overflow	6/24/2005	1300	--	6.9	2020	1180	--	0	5.2	0	--	8	0	0	80	8	51.0	330.0	--
King Creek	L-5	King Creek Interception Trench Overflow	7/21/2005	1340	--	7.2	1950	1150	--	0	4.3	0	--	25	50	--	70	10	45.0	240.0	--
King Creek	L-5	King Creek Interception Trench Overflow	8/19/2005	1280	--	7.5	1850	1040	--	0	4.2	0	--	5	10	0	60	10	46.0	240.0	--
King Creek	L-5	King Creek Interception Trench Overflow	4/11/2006	1070	--	7.3	1590	998	--	1	7.4	0	--	5	30	0	103	10	25.0	495.0	--
King Creek	L-5	King Creek Interception Trench Overflow	6/30/2006	1200	--	7	1820	--	--	2	3.6	0	--	5	0	0	54	10	42.0	228.0	--
King Creek	L-5	King Creek Interception Trench Overflow	8/24/2006	1170	--	7.5	1740	1050	--	1	4.4	0	--	5	30	--	64	3	40.0	259.0	--
King Creek	L-5	King Creek Interception Trench Overflow	11/8/2006	1120	--	7.5	--	943	--	1	3	0	--	4	0	--	47	3	33.0	176.0	--
King Creek	L-5	King Creek Interception Trench Overflow	3/27/2007	883	--	7.6	--	745	--	0	1.3	0	--	3	0	--	24	--	25.0	81.0	--
King Creek	L-5	King Creek Interception Trench Overflow	4/23/2007	724	--	7.2	--	594	--	1	1.8	0	--	3	0	--	27	3	17.0	106.0	--
King Creek	L-5	King Creek Interception Trench Overflow	11/27/2007	983	--	7.5	--	913	--	2	2.7	--	--	4	0	--	41	3	32.0	198.0	--
King Creek	L-5	King Creek Interception Trench Overflow	5/13/2008	890	--	7.2	--	712	--	9	1.7	--	--	2	40	--	24	0	22.0	100.0	0
King Creek	L-5	King Creek Interception Trench Overflow	6/9/2008	688	--	6.7	--	--	--	2	2.3	--	--	7	130	--	34	1	15.0	144.0	--
King Creek	L-5	King Creek Interception Trench Overflow	7/30/2008	1140	--	6.8	--	1050	--	11	5.8	--	--	33	1050	--	90	--	38.0	684.0	--
King Creek	L-5	King Creek Interception Trench Overflow	8/18/2008	1080	--	6.8	--	979	--	--	5.1	--	--	5	30	--	78	--	32.0	296.0	--
King Creek	L-5	King Creek Interception Trench Overflow	9/18/2008	1050	--	7	--	959	--	69	3.6	--	--	4	0	--	54	3	30.0	207.0	--
King Creek	L-5	King Creek Interception Trench Overflow	6/17/2009	958	--	7.2	--	871	--	43	3.3	--	--	4	120	--	52	3	26.0	204.0	--
King Creek	L-5	King Creek Interception Trench Overflow	7/28/2009	1070	--	7.1	--	934	--	2	3.6	--	--	5	30	--	54	3	31.0	202.0	--
King Creek	L-5	King Creek Interception Trench Overflow	4/27/2010	861	--	--	--	766	--	0	3.2	--	--	6	30	--	61	--	--	--	--
King Creek	L-5	King Creek Interception Trench Overflow	5/27/2010	721	--	--	--	--	--	2	3.2	--	--	8	40	--	23	--	--	--	--
King Creek	L-5	King Creek Interception Trench Overflow	6/23/2010	866	--	--	--	--	--	0	3.7	--	--	5	10	--	58	--	--	--	--
King Creek	L-5	King Creek Interception Trench Overflow	7/29/2010	1060	--	--	--	--	--	1	4.6	--	--	6	30	--	76	--	--	--	--
King Creek	L-5A	King Creek Interception Trench Sump	1/27/2005	1270	--	6.8	--	1010	--	246	63	17	--	396	28400	--	700	3	66.0	13800.0	12400

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
King Creek	L-5A	King Creek Interception Trench Sump	3/10/2005	1050	--	7.4	--	907	--	152	38.2	0	--	390	22900	--	450	3	51.0	8470.0	--
King Creek	L-5A	King Creek Interception Trench Sump	3/17/2005	1070	--	7.4	--	859	--	67	--	0	--	86	9950	--	170	3	31.0	1770.0	--
King Creek	L-5A	King Creek Interception Trench Sump	11/27/2007	989	--	7.3	--	922	--	11	5.2	--	--	27	210	--	58	3	35.0	990.0	--
King Creek	L-5A	King Creek Interception Trench Sump	5/13/2008	937	--	7.2	--	706	--	3	3	--	--	8	570	--	32	7	22.0	197.0	78
King Creek	L-5A	King Creek Interception Trench Sump	6/9/2008	696	--	6.8	--	606	--	2	2.1	--	--	7	80	--	30	--	14.0	135.0	--
King Creek	L-5A	King Creek Interception Trench Sump	7/30/2008	1130	--	6.8	--	1050	--	14	6.2	--	--	35	1690	--	91	--	38.0	735.0	--
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	5/4/1990	61	982.9	7.1	80	13	--	< 5	< 1	< 5	<20	< 10	300	< 1	< 30	10	< 5	10	19
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	5/16/1990	79	627	7.2	105	--	--	--	--	--	--	--	--	--	--	--	--	0	--
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	5/29/1990	111	350	8.2	125	16	--	< 5	< 1	< 5	<20	< 10	310	< 1	< 30	< 10	< 5	20	7
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	6/14/1990	166	160	7.8	189	--	--	--	--	--	--	--	--	--	--	--	--	0	--
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	6/26/1990	167	140	7.8	158	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	7/19/1990	208	50	8.1	202	--	--	--	--	--	--	--	--	--	--	--	--	0	--
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	7/31/1990	222	31	7.8	218	23	--	< 5	< 1	< 5	<20	< 10	70	< 1	< 30	< 10	< 5	< 10	< 1
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	8/22/1990	221	20	7.9	240	--	--	--	--	--	--	--	--	--	--	--	--	0	--
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	10/12/1990	242	63	7.7	223	23	--	< 5	< 1	< 5	<20	< 10	120	< 1	< 30	< 10	< 5	20	1
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	10/30/1990	240	11	7.9	245	25	--	< 5	2	< 5	<20	< 10	210	< 1	--	< 10	< 5	< 10	34
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	12/11/1990	228	11.2	7.9	216	27	--	< 5	< 1	< 5	<20	< 10	30	< 1	< 30	--	< 5	< 10	6
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	1/11/1991	252	10	6.9	229	25	--	< 5	< 1	< 5	<20	< 10	< 30	< 1	< 30	< 10	< 5	40	6
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	3/20/1991	196	50	7.9	217	40	--	< 5	< 1	< 5	<20	< 10	160	< 1	< 30	< 10	< 5	30	34
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	5/16/1991	89	745.06	7.7	122	14	--	< 5	< 0.1	< 5	<20	< 1	260	< 0.2	< 30	2	< 5	30	< 1
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	6/12/1991	121	212.75	8.1	135	22	--	< 5	< 1	< 5	<20	< 10	60	< 1	< 30	< 10	< 5	< 10	54
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	7/23/1991	216	58.35	8.1	228	21	--	< 5	< 1	< 5	<20	< 10	70	< 1	< 30	< 10	< 5	30	2
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	9/5/1991	260	15	8.2	222	22	--	< 5	< 1	< 5	<20	< 10	710	< 1	< 30	< 10	--	< 10	50
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	10/18/1991	247	15	8	244	25	--	5	< 1	< 5	<20	< 10	4390	< 1	< 30	20	< 5	30	26

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	5/29/1992	245	5.39	8.1	215	27	< 100	< 5	< 1	< 5	20	20	11400	< 1	< 30	20	< 5	60	512
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	10/14/1992	212	25.1	8	209	30	--	< 5	< 1	< 5	< 10	< 10	40	< 1	< 30	< 10	< 5	< 10	7
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	5/11/1993	90	193	7	113	21	--	< 5	< 1	< 5	< 10	< 10	70	< 1	< 10	30	< 5	10	3
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	10/13/1993	173	75.63	7.9	192	30	--	--	--	< 5	--	--	--	--	--	--	--	0	< 1
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	5/18/1994	166	130.2	8.1	168	20	--	< 5	< 1	< 5	< 10	< 10	30	< 1	< 10	< 10	< 5	20	2
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	10/26/1994	222	13.5	7.9	229	28	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	5/15/1995	69	371	7.7	138	18	--	< 5	< 1	< 5	< 10	< 10	840	< 1	< 10	< 10	< 5	20	< 10
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	10/20/1995	191	34.6	7.6	199	36	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	5/29/1996	100	489.2	7.5	139	19	--	< 3	< 0.1	< 5	< 1	2	430	< 0.6	< 20	< 3	< 1	20	< 10
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	10/21/1996	222	11.49	7.6	247	28	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	2/11/1997	221	1.46	7.9	219	29	< 100	< 3	< 0.1	< 5	3	2	420	< 0.6	< 20	< 3	< 1	40	17
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	4/15/1997	147	28.8	7.8	171	30	< 100	< 3	< 0.1	< 5	--	< 1	10	--	< 20	< 3	< 1	< 20	< 10
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	5/15/1997	113	105.03	6.9	147	22	< 100	< 3	< 0.1	< 5	--	< 1	30	--	< 20	< 3	< 1	< 20	< 10
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	6/16/1997	121.9	271.99	7.94	144	29.1	< 100	< 3	< 0.1	< 5	--	< 1	30	--	< 20	< 3	< 1	< 20	< 10
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	8/12/1997	201	14.81	7.9	216	26.3	< 100	< 3	< 0.1	< 5	--	5	90	--	< 20	< 3	< 1	20	< 10
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	8/12/1997	201.8	--	7.89	218	26.2	< 100	< 3	--	< 5	--	4	90	--	< 20	< 3	< 1	30	< 10
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	10/23/1997	--	--	--	--	--	< 100	< 3	--	< 5	--	< 1	--	--	--	< 3	< 1	0	< 10
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	1/22/1998	220.6	--	--	229	28	< 100	< 3	< 0.1	< 5	--	45	90	--	< 20	11	2	10	< 10
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	4/23/1998	146.2	--	--	138	18	< 100	< 3	< 0.1	< 5	--	< 1	30	--	< 20	< 3	< 1	< 10	< 10
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	5/26/1998	158.5	--	--	199	36	< 100	< 3	< 0.1	< 5	--	< 1	10	--	< 20	< 3	< 1	< 10	< 10
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	6/18/1998	111.7	--	--	139	19	< 100	< 3	--	< 5	--	36	160	--	< 20	5	< 1	< 10	< 10
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	8/19/1998	201	--	--	247	28	< 100	< 3	< 0.1	< 5	--	36	110	--	< 20	8	< 1	< 10	< 10
Lodge Pole Creek	Z-29	Upper Lodge Pole Creek, Middle East Trib	10/23/1998	211.2	--	--	219	29	< 100	< 3	< 0.1	< 5	--	< 1	20	--	< 20	3	< 1	< 10	< 10
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	5/29/1990	136	2693	8.3	132	15	--	--	--	< 5	--	--	200	--	--	--	--	20	2

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	11/1/1990	243	85	8.2	267	34	--	< 5	< 1	< 5	<20	< 10	< 30	< 1	< 30	< 10	< 5	< 10	< 1
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	12/12/1990	231	89.8	8.1	232	33	--	< 5	< 1	< 5	<20	< 10	< 30	< 1	< 30	--	< 5	10	1
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	12/12/1990	231	89.8	8.2	221	33	--	< 5	< 1	< 5	<20	< 10	< 30	< 1	< 30	--	< 5	< 10	1
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	1/12/1991	--	0	--	--	--	--	--	--	--	--	--	--	--	--	--	--	0	--
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	3/21/1991	--	0	--	--	--	--	--	--	--	--	--	--	--	--	--	--	0	--
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	5/15/1991	114	8954.16	8	83	17	--	< 5	0.1	< 5	<20	< 1	100	< 0.2	< 30	< 2	< 5	10	< 1
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	6/12/1991	146	5561	8.3	162	14	--	< 5	< 1	< 5	<20	< 10	60	< 1	< 30	< 10	< 5	10	118
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	7/24/1991	211	1149	8.3	234	19	--	< 5	< 1	< 5	<20	< 10	< 30	< 1	< 30	< 10	< 5	< 10	< 1
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	9/5/1991	252	242.37	8.5	238	25	--	< 5	< 1	< 5	<20	< 10	< 30	< 1	< 30	< 10	< 5	< 10	< 1
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	9/5/1991	253	242.37	8.5	235	23	--	< 5	< 1	< 5	<20	< 10	< 30	< 1	< 30	< 10	< 5	< 10	< 1
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	10/18/1991	248	210.95	8.3	260	30	--	< 5	< 1	< 5	<20	< 10	< 30	< 1	< 30	< 10	< 5	20	< 1
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	5/29/1992	235	58.8	8.3	233	36	--	< 5	< 1	< 5	< 10	< 10	100	< 1	< 30	< 10	< 5	10	1
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	10/14/1992	211	336	8.3	242	29	--	< 5	< 1	< 5	< 10	< 10	< 30	< 1	< 30	< 10	< 5	< 10	< 1
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	5/11/1993	141	2477.54	7.4	151	17	--	< 5	--	< 5	< 10	--	< 30	--	< 10	< 10	< 5	0	2
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	5/11/1993	128	2477.54	8	157	22	--	< 5	< 10	< 5	<20	< 10	--	< 1	--	--	--	< 10	1
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	10/13/1993	189	978.45	8.1	210	24	--	< 5	1	< 5	< 10	< 10	< 30	< 1	< 10	< 10	< 5	< 10	2
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	5/18/1994	170	2055.6	8.4	189	17	--	< 5	< 1	< 5	< 10	< 10	< 30	< 1	< 10	< 10	< 5	20	< 1
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	10/26/1994	223	161.6	8.3	240	32	--	< 5	< 1	< 5	< 10	< 10	< 30	< 1	< 10	< 10	< 5	10	< 1
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	10/26/1994	223	161.6	8.3	249	31	--	< 5	< 1	< 5	< 10	< 10	< 30	< 1	< 10	< 10	< 5	10	< 1
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	5/15/1995	93	5327.6	8	125	13	--	< 5	< 1	< 5	< 10	< 10	700	< 1	< 10	< 10	< 5	20	< 10
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	5/15/1995	93	5327.6	8.1	86	12	--	< 5	< 1	< 5	< 10	< 10	680	< 1	< 10	< 10	< 5	10	< 10
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	8/3/1995	191	0	8	215	18	< 100	< 1	< 0.1	< 5	< 10	< 1	8	< 1	< 10	< 2	< 5	10	< 10
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	10/20/1995	184	266.9	7.9	232	30	< 100	< 3	< 0.1	< 5	< 1	< 1	< 10	< 0.6	< 20	< 3	< 1	20	< 10
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	5/29/1996	110	6247.7	7.7	111	12	< 100	< 3	< 0.1	< 5	< 1	2	290	< 0.6	< 20	< 3	< 1	20	< 10

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	8/14/1996	205	121.2	7.5	210	23	< 100	< 3	< 0.1	< 5	< 1	< 1	< 10	< 0.6	< 20	< 3	< 1	30	< 10
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	10/21/1996	219.2	157.09	7.8	246	29.9	< 100	< 3	< 0.1	< 5	< 1	< 1	< 10	< 0.6	< 20	< 3	< 1	20	< 10
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	10/21/1996	205	157.09	8.22	218	30	< 100	< 3	< 0.1	< 5	< 1	< 1	< 10	< 0.6	< 20	< 3	1	20	< 10
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	2/11/1997	--	0	--	--	--	--	--	--	--	--	--	--	--	--	--	--	0	--
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	4/15/1997	--	0	--	--	--	--	--	--	--	--	--	--	--	--	--	--	0	--
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	5/14/1997	134	1252.24	7.8	153	17	< 100	< 3	< 0.1	< 5	--	< 1	< 10	--	< 20	< 3	< 1	20	< 10
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	6/16/1997	130.6	3913.8	8.08	155	15.7	< 100	< 3	< 0.1	< 5	--	< 1	20	--	< 20	< 3	< 1	< 10	< 10
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	8/12/1997	192.5	436.26	7.9	224	21.6	< 100	< 3	< 0.1	< 5	--	< 1	< 10	--	< 20	< 3	< 1	20	< 10
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	10/23/1997	--	--	--	--	--	< 100	< 3	--	< 5	--	< 1	< 10	--	--	< 3	< 1	0	< 10
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	1/22/1998	228.8	--	--	279	37.1	< 100	< 3	< 0.1	< 5	--	< 1	< 10	--	< 20	< 3	2	< 10	< 10
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	4/23/1998	166.5	--	--	171	25.3	< 100	< 3	< 0.1	< 5	--	< 1	< 10	--	< 20	< 3	< 1	10	< 10
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	5/26/1998	184	--	--	186	22	< 100	< 3	0.8	< 5	--	5	< 10	--	< 20	< 3	< 1	< 10	< 10
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	6/26/1998	105.4	--	--	132	11.8	160	< 3	< 0.1	< 5	--	21	30	--	< 20	< 3	< 1	< 10	12
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	8/19/1998	201.9	--	--	241	19.3	< 100	< 3	< 0.1	< 5	--	< 1	10	--	< 20	< 3	< 1	< 10	< 10
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	10/9/1998	208.8	--	--	232	26.7	< 100	< 3	< 0.1	< 5	--	2	< 10	--	< 20	< 3	< 1	< 10	< 10
Lodge Pole Creek	Z-7	Lodge Pole Creek, Below Emerson Cr.	4/30/2004	127	--	7.6	159	18	--	0	0	0	--	0	20	--	0	0	0	--	0
Mill Gulch	506	Mill Gulch below capture "stormwater"	5/14/2000	369.3	--	8.04	--	--	--	7	< 0.1	< 5	--	7	--	--	--	13	--	20	56
Mill Gulch	506	Mill Gulch below capture "stormwater"	6/4/2001	207.8	--	7.55	--	--	--	< 3	0.1	< 5	--	7	--	--	--	12	--	30	12
Mill Gulch	506	Mill Gulch below capture "stormwater"	6/10/2002	273	--	7.8	--	200	--	9	0	0	--	5	--	--	--	7	--	20	337
Mill Gulch	506	Mill Gulch below capture "stormwater"	6/11/2004	233	--	7.8	--	184	--	9	0	0	--	4	--	--	--	5	--	20	29
Mill Gulch	506	Mill Gulch below capture "stormwater"	6/13/2005	450	--	7.8	--	370	--	12	2.2	0	--	5	--	--	--	7	--	80	65
Mill Gulch	506	Mill Gulch below capture "stormwater"	5/22/2008	101	--	7.1	--	161	--	9	0	--	--	3	2520	--	3	--	0	22	--
Mill Gulch	L-22	Lower Mill Gulch Spring Box	3/30/2000	318.2	--	8.02	--	--	--	< 3	< 0.1	< 5	--	< 1	--	--	< 20	< 3	< 10000	< 10	< 10
Mill Gulch	L-22	Lower Mill Gulch Spring Box	4/27/2000	405.3	--	7.58	--	--	--	< 3	< 0.1	< 5	--	< 1	--	--	< 20	< 3	< 10000	< 10	< 10

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Mill Gulch	L-22	Lower Mill Gulch Spring Box	6/29/2000	423.8	--	7.71	--	--	--	< 3	< 0.1	11	--	< 1	--	--	< 20	< 3	< 10000	< 10	< 10
Mill Gulch	L-22	Lower Mill Gulch Spring Box	7/25/2000	440.6	--	7.6	--	--	--	< 3	< 0.1	13	--	< 1	--	--	< 20	< 3	< 10000	< 10	< 10
Mill Gulch	L-22	Lower Mill Gulch Spring Box	8/30/2000	426.6	--	7.66	--	--	--	< 3	< 0.1	10	--	< 1	--	--	< 20	< 3	< 10000	< 10	< 10
Mill Gulch	L-22	Lower Mill Gulch Spring Box	9/8/2000	465	--	7.36	--	--	--	3	< 0.1	< 5	--	< 1	--	--	< 20	< 3	< 10000	10	< 10
Mill Gulch	L-22	Lower Mill Gulch Spring Box	10/31/2000	436.5	--	7.39	--	--	--	3	< 0.1	8	--	1	--	--	< 20	< 3	< 10000	< 10	< 10
Mill Gulch	L-22	Lower Mill Gulch Spring Box	11/3/2000	436.5	--	--	--	--	--	< 3	< 0.1	8	--	1	--	--	< 20	< 3	< 10000	< 10	< 10
Mill Gulch	L-22	Lower Mill Gulch Spring Box	11/14/2000	450.2	--	--	--	--	--	< 3	< 0.1	16	--	< 1	--	--	< 20	< 3	< 10000	< 10	< 10
Mill Gulch	L-22	Lower Mill Gulch Spring Box	3/21/2001	302.9	--	7.27	--	--	--	< 3	< 0.1	< 5	--	6	--	--	--	< 3	< 10000	--	< 10
Mill Gulch	L-22	Lower Mill Gulch Spring Box	3/21/2001	--	--	--	443	172.9	--	--	--	--	--	--	--	--	--	--	--	< 10	< 10
Mill Gulch	L-22	Lower Mill Gulch Spring Box	4/16/2001	397.6	--	7.44	811	282	--	< 3	< 0.1	< 5	--	1	--	--	< 20	< 3	< 10000	< 10	--
Mill Gulch	L-22	Lower Mill Gulch Spring Box	5/9/2001	398.4	--	7.63	558	228	--	3	< 0.1	5	--	< 1	--	--	< 20	< 3	< 10000	< 10	< 10
Mill Gulch	L-22	Lower Mill Gulch Spring Box	6/12/2001	425.1	--	7.42	520	272.5	--	3	< 0.1	8	--	< 1	--	--	< 20	< 3	< 10000	< 10	< 10
Mill Gulch	L-22	Lower Mill Gulch Spring Box	7/16/2001	480	--	7.39	647	239	--	3	< 0.1	14	--	< 1	--	--	< 20	< 3	< 10000	< 10	< 10
Mill Gulch	L-22	Lower Mill Gulch Spring Box	8/22/2001	404	--	7.5	612	198.4	--	3	< 0.1	15	--	< 1	--	--	< 20	< 3	< 10000	< 10	< 10
Mill Gulch	L-22	Lower Mill Gulch Spring Box	11/5/2001	497.9	--	7.33	677	249	--	3	< 0.1	12	--	--	--	--	< 20	< 3	< 10000	260	< 10
Mill Gulch	L-22	Lower Mill Gulch Spring Box	4/15/2002	357	--	7.5	518	292	--	0	0	0	--	0	--	0	0	0	--	0	--
Mill Gulch	L-22	Lower Mill Gulch Spring Box	5/14/2002	457	--	7.5	666	365	--	0	0	0	--	2	--	0	0	13	--	0	--
Mill Gulch	L-22	Lower Mill Gulch Spring Box	6/25/2002	353	--	7.3	550	267	--	0	0	0	--	0	--	0	0	0	0	0	0
Mill Gulch	L-22	Lower Mill Gulch Spring Box	7/22/2002	434	--	8	669	243	--	0	0	20	--	0	--	0	0	0	0	0	0
Mill Gulch	L-22	Lower Mill Gulch Spring Box	8/26/2002	444	--	7.4	655	234	--	0	0	23	--	1	--	0	0	0	--	0	--
Mill Gulch	L-22	Lower Mill Gulch Spring Box	9/26/2002	486	--	7.6	693	270	--	0	0	61	--	0	--	0	0	0	--	0	--
Mill Gulch	L-22	Lower Mill Gulch Spring Box	10/16/2002	468	--	7.5	660	258	--	0	0	18	--	0	--	0	0	0	0	0	0
Mill Gulch	L-22	Lower Mill Gulch Spring Box	11/7/2002	430	--	7.4	627	217	--	0	0	13	--	0	--	0	0	0	--	0	--
Mill Gulch	L-22	Lower Mill Gulch Spring Box	3/19/2003	273	--	7.4	402	193	--	0	0	0	--	0	--	0	0	0	--	40	--
Mill Gulch	L-22	Lower Mill Gulch Spring Box	4/22/2003	278	--	7.2	432	157	--	0	0	0	--	0	--	0	0	0	--	0	--
Mill Gulch	L-22	Lower Mill Gulch Spring Box	5/9/2003	255	--	7.4	382	149	--	0	0	0	--	2	--	0	0	0	--	0	--
Mill Gulch	L-22	Lower Mill Gulch Spring Box	6/27/2003	383	--	7.1	531	175	--	0	0	8	--	0	--	0	0	0	0	0	0
Mill Gulch	L-22	Lower Mill Gulch Spring Box	7/15/2003	395	--	7.3	545	177	--	0	0	11	--	0	--	0	0	0	0	0	0
Mill Gulch	L-22	Lower Mill Gulch Spring Box	3/23/2004	265	--	7.4	358	153	--	0	0	0	--	0	--	0	0	0	0	0	0
Mill Gulch	L-22	Lower Mill Gulch Spring Box	4/20/2004	315	--	7.2	426	165	--	0	0	0	--	0	--	0	0	0	0	0	0
Mill Gulch	L-22	Lower Mill Gulch Spring Box	5/28/2004	330	--	7	493	271	--	0	0	0	--	1	--	0	0	0	0	0	0

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Mill Gulch	L-22	Lower Mill Gulch Spring Box	6/28/2004	328	--	7.3	465	150	--	0	0	7	--	0	--	--	0	0	0	0	0
Mill Gulch	L-22	Lower Mill Gulch Spring Box	7/22/2004	422	--	7.4	562	185	--	0	0	12	--	0	--	0	0	0	0	0	0
Mill Gulch	L-22	Lower Mill Gulch Spring Box	4/1/2005	395	--	7.5	577	270	--	0	0	0	--	0	--	0	0	0	0	0	--
Mill Gulch	L-22	Lower Mill Gulch Spring Box	5/9/2005	296	--	7.4	422	141	--	0	0	0	--	0	--	0	0	0	--	0	--
Mill Gulch	L-22	Lower Mill Gulch Spring Box	5/20/2005	303	--	7.3	400	133	--	0	0	0	--	0	--	0	0	0	--	0	--
Mill Gulch	L-22	Lower Mill Gulch Spring Box	6/24/2005	329	--	7.3	425	135	--	0	0	0	--	1	--	0	0	0	--	0	--
Mill Gulch	L-22	Lower Mill Gulch Spring Box	7/13/2005	424	--	7.4	514	148	--	0	0	0	--	2	--	0	0	0	--	0	--
Mill Gulch	L-22	Lower Mill Gulch Spring Box	8/19/2005	484	--	7.5	567	163	--	0	0	0	--	0	--	0	0	0	--	0	--
Mill Gulch	L-22	Lower Mill Gulch Spring Box	8/19/2005	484	--	7.5	567	163	--	0	0	0	--	0	--	0	0	0	--	0	--
Mill Gulch	L-22	Lower Mill Gulch Spring Box	4/12/2006	255	--	8	350	138	--	2	0	0	--	0	--	0	2	0	--	8	--
Mill Gulch	L-22	Lower Mill Gulch Spring Box	5/29/2006	340	--	7.9	433	136	--	2	0	0	--	1	--	0	2	0	--	4	--
Mill Gulch	L-22	Lower Mill Gulch Spring Box	6/27/2006	391	--	7.2	--	--	--	2	0	0	--	0	--	0	0	0	--	4	--
Mill Gulch	L-22	Lower Mill Gulch Spring Box	11/7/2006	446	--	7.3	--	254	--	1	0	0	--	0	--	--	2	--	--	15	--
Mill Gulch	L-22	Lower Mill Gulch Spring Box	3/29/2007	294	--	7.4	--	137	--	2	0	0	--	0	--	--	1	--	--	6	--
Mill Gulch	L-22	Lower Mill Gulch Spring Box	6/26/2007	300	--	7.2	--	107	--	2	0	--	--	0	--	--	0	--	--	6	--
Mill Gulch	L-22	Lower Mill Gulch Spring Box	9/18/2007	667	--	7.1	--	390	--	1	0	--	--	0	--	--	0	--	--	8	--
Mill Gulch	L-22	Lower Mill Gulch Spring Box	5/13/2008	320	--	7.3	--	337	--	7	0	--	--	0	--	--	0	--	--	0	0
Mill Gulch	L-22	Lower Mill Gulch Spring Box	6/9/2008	288	--	7	--	170	--	2	0	--	--	2	--	--	0	--	--	8	--
Mill Gulch	L-22	Lower Mill Gulch Spring Box	9/23/2008	512	--	--	--	205	--	1	0	--	--	0	--	--	0	--	--	5	--
Mill Gulch	L-22	Lower Mill Gulch Spring Box	12/10/2008	430	--	7.4	--	230	--	1	0.2	--	--	2	--	--	5	--	--	10	--
Mill Gulch	L-22	Lower Mill Gulch Spring Box	6/16/2009	336	--	7.4	--	137	--	2	0	--	--	0	--	--	0	--	--	6	--
Mill Gulch	L-22	Lower Mill Gulch Spring Box	9/18/2009	483	--	7.3	--	181	--	1	0	--	--	0	--	--	0	--	--	5	--
Mill Gulch	L-22	Lower Mill Gulch Spring Box	3/29/2010	237	--	7.5	--	122	--	2	0	--	--	0	--	--	2	--	--	5	--
Mill Gulch	L-22	Lower Mill Gulch Spring Box	6/23/2010	346	--	7.2	--	--	--	2	0	--	--	2	--	--	0	--	--	4	--
Mill Gulch	L-22	Lower Mill Gulch Spring Box	8/16/2010	486	--	7.2	--	--	--	2	--	--	--	0	--	--	0	--	--	6	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	1/4/2000	--	--	--	--	--	--	--	--	5	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	1/13/2000	--	--	--	--	--	--	--	--	6	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	1/19/2000	--	--	--	--	--	--	--	--	9	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	1/27/2000	--	--	--	--	--	--	--	--	5	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	2/2/2000	--	--	--	--	--	--	--	--	10	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	2/7/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	2/14/2000	--	--	--	--	--	--	--	--	5	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	2/21/2000	--	--	--	--	--	--	--	--	6	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	2/28/2000	--	--	--	--	--	--	--	--	6	--	--	--	--	--	--	--	0	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	3/6/2000	--	--	--	--	--	--	--	--	5	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	3/14/2000	--	--	--	--	--	--	--	--	7	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	3/20/2000	--	--	--	--	--	--	--	--	7	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	3/27/2000	--	--	--	--	--	--	--	--	8	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	4/3/2000	--	--	--	--	--	--	--	--	9	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	4/10/2000	--	--	--	--	--	--	--	--	7	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	4/17/2000	--	--	--	--	--	--	--	--	8	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	4/26/2000	--	--	--	--	--	--	--	--	11	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	5/8/2000	--	--	--	--	--	--	--	--	9	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	5/17/2000	--	--	--	--	--	--	--	--	10	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	5/23/2000	--	--	--	--	--	--	--	--	26	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	5/29/2000	--	--	--	--	--	--	--	--	18	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	6/4/2000	--	--	--	--	--	--	--	--	13	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	6/12/2000	--	--	--	--	--	--	--	--	27	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	6/19/2000	--	--	--	--	--	--	--	--	9	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	6/26/2000	--	--	--	--	--	--	--	--	5	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	7/3/2000	--	--	--	--	--	--	--	--	7	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	7/10/2000	--	--	--	--	--	--	--	--	8	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	7/24/2000	--	--	--	--	--	--	--	--	11	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	7/31/2000	--	--	--	--	--	--	--	--	8	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	8/7/2000	--	--	--	--	--	--	--	--	9	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	8/18/2000	--	--	--	--	--	--	--	--	8	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	8/21/2000	--	--	--	--	--	--	--	--	8	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	8/28/2000	--	--	--	--	--	--	--	--	6	--	--	--	--	--	--	--	0	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	9/4/2000	--	--	--	--	--	--	--	--	6	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	9/11/2000	--	--	--	--	--	--	--	--	7	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	9/18/2000	--	--	--	--	--	--	--	--	5	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	9/25/2000	--	--	--	--	--	--	--	--	8	--	--	--	--	--	--	--	0	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	2/18/2002	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	650	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	12/17/2002	530	--	4.4	1040	686	10600	4	53	0	0	120	--	--	370	0	10	2170	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	7/8/2004	1080	--	4.3	2440	715	< 100	0	209	0	--	383	--	--	730	0	23	3930	57
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	9/6/2005	1080	--	--	2450	1740	--	0	254	0	--	624	--	--	890	0	16	4930	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	9/6/2005	1080	--	4.3	2450	2310	--	0	254	0	--	624	--	--	890	0	16	4930	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	4/1/2009	2190	--	3.9	--	2310	--	9	496	--	--	2400	--	--	2050	--	149	11500	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	4/28/2009	1710	--	4	--	4150	--	8	366	--	--	1650	--	--	1690	--	112	8970	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	9/28/2009	1230	--	4.1	--	3620	99600	2	269	--	--	821	--	--	939	--	41	6380	--
Mill Gulch	L-36	Seepage Collection-Bypass 554/594	11/2/2009	904	--	4.3	--	--	56800	2	179	--	--	640	--	--	614	--	27	3590	--
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	8/1/1990	307	22	8.1	550	252	--	< 5	< 1	< 5	< 20	< 10	< 30	< 1	< 30	< 10	< 5	< 10	1
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	9/27/1990	407	8.2	8.6	554	246	--	< 5	< 1	< 5	< 20	< 10	< 30	< 1	--	< 10	< 5	< 10	4
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	10/9/1990	552	17	7.4	504	244	--	< 5	< 1	< 5	< 20	< 10	< 30	< 1	< 30	< 10	< 5	< 10	< 1
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	11/6/1990	512	25	7.8	475	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	12/13/1990	583	10	8	441	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	3/21/1991	478	6.73	8.2	360	164	--	< 5	< 1	< 5	< 20	< 10	< 30	< 1	< 30	< 10	< 5	20	4
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	5/17/1991	350	98	7.9	522	340	--	< 5	0.1	< 5	< 20	< 1	60	< 0.2	< 30	2	< 5	20	< 1
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	6/13/1991	389	67.32	8.1	796	419	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	7/24/1991	407	19.75	8.2	736	353	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	9/5/1991	644	4.49	7.1	776	409	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	10/20/1991	395	17.1	8	696	360	--	< 5	< 1	< 5	< 20	< 10	< 30	< 1	< 30	< 10	< 5	30	3

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	5/30/1992	663	4.49	8.3	419	173	--	< 5	< 1	< 5	< 10	< 10	60	< 1	< 30	< 10	< 5	< 10	2
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	10/15/1992	666	7	8.3	512	240	--	< 5	< 1	< 5	< 10	< 10	200	< 1	< 30	< 10	< 5	30	6
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	5/15/1993	420	27.83	7.8	537	279	--	< 5	< 1	< 5	< 10	< 10	< 30	< 1	< 10	< 10	< 5	10	4
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	10/16/1993	615	35.05	7.9	921	515	--	--	--	< 5	--	--	--	--	--	--	--	0	16
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	5/22/1994	890	25	8.4	482	176	--	< 5	< 1	< 5	< 10	< 10	950	< 1	20	< 10	< 5	80	73
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	8/3/1994	713	0.99	8.1	846	417	--	< 5	< 1	< 5	< 10	< 10	< 30	< 1	< 10	< 10	< 5	30	< 1
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	8/3/1994	318.8	0.99	8.1	845	410	--	< 5	< 1	< 5	< 10	< 10	< 30	< 1	< 10	< 10	6	40	3
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	10/30/1994	--	0	--	--	--	--	--	--	--	--	--	--	--	--	--	--	0	--
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	1/26/1995	640	8	7.5	611	300	< 100	< 5	< 1	< 5	< 10	< 10	< 30	< 1	< 10	< 10	< 5	20	< 1
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	5/14/1995	651	25	7.9	891	531	--	< 5	< 1	< 5	< 10	< 10	< 30	< 1	< 10	< 10	9	20	< 10
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	7/25/1995	619	25	7.7	1300	778	--	< 5	1	< 5	< 10	< 10	120	< 1	20	< 10	7	80	< 10
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	10/19/1995	497	27.8	7.6	1140	653	--	--	0	< 5	--	--	0	--	0	--	--	0	--
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	6/1/1996	605	152	7.4	990	572.6	--	4	16.6	9	< 1	23	580	< 0.6	120	< 3	7	780	29
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	6/1/1996	665	152	7.73	943	570	--	4	14.9	< 5	< 1	19	430	< 0.6	110	< 3	3	740	26
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	8/13/1996	664	6.73	7.1	1010	580	< 100	< 3	1.5	< 5	< 1	< 1	< 10	< 0.6	20	< 3	3	120	< 10
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	10/23/1996	726.1	17.64	7.1	878	541	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	2/13/1997	1073.5	0	7.2	690	398	< 100	3	< 0.5	< 5	< 1	< 1	20	< 0.6	< 20	< 3	4	70	< 10
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	4/19/1997	291.3	99.7	7.4	847	504	< 100	< 3	2.5	< 5	--	2	50	--	< 20	< 3	4	150	< 10
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	5/15/1997	612.5	22.44	7.9	902	544	< 100	< 3	0.9	< 5	--	2	120	--	< 20	< 3	5	60	< 10
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	5/15/1997	544.5	22.44	7.9	918	546	< 100	3	< 0.9	< 5	--	2	90	--	< 20	< 3	--	70	< 10
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	6/20/1997	527.9	80.1	7.8	1285	791.3	< 100	3	18.1	< 5	--	13	1330	--	150	< 3	4	890	30
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	8/13/1997	427.8	17.06	8.3	1488	910.4	< 100	< 3	0.8	< 5	--	< 1	< 10	--	30	< 3	8	80	< 10
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	9/5/1997	--	--	--	--	--	--	--	0	< 5	--	--	--	--	--	--	--	0	--
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	10/25/1997	--	--	--	--	--	< 100	< 3	0	< 5	--	--	--	--	--	--	--	0	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	12/1/1997	--	--	--	--	--	--	--	0	< 5	--	--	--	--	--	--	--	0	--
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	2/13/1998	--	--	--	424	242.3	< 100	8	2	< 5	--	21	560	--	--	--	< 1	140	11
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	4/16/1998	--	--	--	829	432.1	< 100	< 3	0.2	< 5	--	< 1	20	--	--	--	3	20	< 10
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	5/13/1998	--	--	--	802	379.9	< 100	< 3	0.2	< 5	--	2	30	--	--	--	14	30	< 10
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	6/23/1998	--	--	--	803	435.3	< 100	< 3	0.2	< 5	--	13	250	--	--	--	< 1	30	17
Mill Gulch	L-7	Lower Mill Gulch Below Spring Box	8/6/1998	--	--	--	611	259.9	< 100	3	2.8	7	--	3	20	--	--	--	< 1	10	< 10
Montana Gulch	591-MT POND	Montana Pond Overflow	1/4/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/6/2000	510.7	--	--	--	--	--	15	0.9	5	--	1	--	--	--	3	--	120	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/10/2000	495.9	--	--	--	--	--	--	0.9	< 5	--	3	--	--	0	< 3	--	120	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/11/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/17/2000	515.2	--	--	--	--	--	--	1	< 5	--	< 1	--	--	0	< 3	--	170	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/18/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/24/2000	494	--	--	--	--	--	--	1.7	< 5	--	2	--	--	0	< 3	--	250	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/25/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/31/2000	484	--	--	--	--	--	--	1.8	7	--	< 1	--	--	0	< 3	--	220	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/1/2000	--	--	--	--	--	--	--	--	6	--	--	--	--	0	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/8/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/11/2000	471	--	--	--	--	--	49	2	5	--	1	1510	--	90	3	--	290	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/14/2000	461	--	--	--	--	--	--	2.3	< 5	--	< 1	--	--	0	< 3	1	260	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/15/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/21/2000	468	--	--	--	--	--	--	1.8	< 5	--	< 1	--	--	0	< 3	--	< 10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/21/2000	< 1	--	--	--	--	--	--	< 0.1	< 5	--	< 1	--	--	0	< 3	--	280	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/21/2000	463	--	--	--	--	--	--	1.9	< 5	--	< 1	--	--	0	< 3	--	280	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/22/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/28/2000	477.7	--	--	--	--	--	--	1.4	< 5	--	12	--	--	0	< 3	--	250	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/29/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/7/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/10/2000	481	--	--	--	--	--	13	0.4	5	--	1	1390	--	20	3	1	60	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/14/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/20/2000	478.1	--	--	--	--	--	--	< 0.1	5	--	1	--	--	--	3	--	10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/20/2000	539.3	--	--	--	--	--	--	0.2	5	--	1	--	--	--	< 3	--	10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/21/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/27/2000	480.5	--	--	--	--	--	--	< 0.1	< 5	--	< 1	--	--	--	< 3	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/28/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/3/2000	456.4	--	--	--	--	--	17	< 0.1	< 5	--	< 1	270	--	< 20	< 3	< 1	10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/4/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)	
Montana Gulch	591-MT POND	Montana Pond Overflow	4/10/2000	991.2	--	--	--	--	--	--	0.9	8	--	< 1	--	--	--	< 3	--	30	--	
Montana Gulch	591-MT POND	Montana Pond Overflow	4/11/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/17/2000	458.7	--	--	--	--	--	--	0.2	< 5	--	< 1	--	--	--	< 3	--	20	--	
Montana Gulch	591-MT POND	Montana Pond Overflow	4/18/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/24/2000	494.9	--	--	--	--	--	--	0.2	< 5	--	< 1	--	--	--	< 3	--	20	--	
Montana Gulch	591-MT POND	Montana Pond Overflow	4/25/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/1/2000	477	--	--	--	--	--	45	0.3	< 5	--	< 1	80	--	60	< 3	< 1	30	--	
Montana Gulch	591-MT POND	Montana Pond Overflow	5/3/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/8/2000	455.9	--	--	--	--	--	--	0.2	< 5	--	< 1	--	--	0	< 3	--	30	--	
Montana Gulch	591-MT POND	Montana Pond Overflow	5/9/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/15/2000	532.2	--	--	--	--	--	--	0.6	< 5	--	< 1	--	--	0	< 3	--	40	--	
Montana Gulch	591-MT POND	Montana Pond Overflow	5/16/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/22/2000	843.8	--	--	--	--	--	--	3.9	6	--	4	--	--	0	< 3	--	70	--	
Montana Gulch	591-MT POND	Montana Pond Overflow	5/23/2000	--	--	--	--	--	--	--	--	6	--	--	--	--	0	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/29/2000	662.1	--	--	--	--	--	--	5.9	7	--	6	--	--	0	< 3	--	80	--	
Montana Gulch	591-MT POND	Montana Pond Overflow	5/30/2000	--	--	--	--	--	--	--	--	6	--	--	--	--	0	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/5/2000	520	--	--	--	--	--	--	0.7	< 5	--	< 1	--	--	0	< 3	--	40	--	
Montana Gulch	591-MT POND	Montana Pond Overflow	6/6/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/12/2000	559.8	--	--	--	--	--	--	0.3	< 5	--	< 1	--	--	0	< 3	--	30	--	
Montana Gulch	591-MT POND	Montana Pond Overflow	6/13/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/19/2000	547.8	--	--	--	--	--	--	< 0.1	< 5	--	2	--	--	0	< 3	--	70	--	
Montana Gulch	591-MT POND	Montana Pond Overflow	6/19/2000	< 1	--	--	--	--	--	--	2.1	< 5	--	< 1	--	--	0	< 3	--	< 10	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/19/2000	547.8	--	--	--	--	--	--	2	< 5	--	2	--	--	0	< 3	--	70	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/20/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/22/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/26/2000	507	--	--	--	--	--	49	0.6	< 5	--	< 1	100	--	70	< 3	2	40	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/27/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/3/2000	486.6	--	--	--	--	--	47	< 0.1	< 5	--	2	110	--	70	< 3	27	40	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/4/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/10/2000	533.4	--	8.19	--	--	--	--	1.2	< 5	--	27	--	--	0	< 3	--	40	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/11/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/17/2000	502.7	--	--	--	--	--	--	0.2	< 5	--	10	--	--	0	< 3	--	30	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/18/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/24/2000	511.9	--	--	--	--	--	--	0.3	< 5	--	< 1	--	--	0	< 3	--	30	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/25/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/31/2000	494	--	--	--	--	--	--	0.4	< 5	--	< 1	--	--	0	< 3	--	30	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/1/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/7/2000	570	--	--	--	--	--	34	0.6	< 5	--	2	60	--	70	< 3	< 1	40	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/8/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/14/2000	540	--	--	--	--	--	--	1	< 5	--	1	--	--	0	< 3	--	50	--	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Montana Gulch	591-MT POND	Montana Pond Overflow	8/15/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/21/2000	530	--	--	--	--	--	--	1.2	< 5	--	1	--	--	0	< 3	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/28/2000	500.3	--	--	--	--	--	--	0.3	< 5	--	< 1	--	--	0	< 3	--	40	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/29/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/4/2000	516.5	--	--	--	--	--	21	< 0.1	< 5	--	< 1	150	--	90	< 3	< 1	< 10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/4/2000	514.4	--	--	--	--	--	22	1.2	< 5	--	< 1	< 10	--	< 20	< 3	< 1	50	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/4/2000	4.2	--	--	--	--	--	< 3	1.2	< 5	--	< 1	150	--	90	< 3	1	50	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/5/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/11/2000	502.8	--	--	--	--	--	28	0.4	< 5	--	< 1	100	--	--	< 3	1	50	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/18/2000	530.4	--	8.29	--	--	--	0	0.4	< 5	--	< 1	--	--	0	< 3	--	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/19/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/25/2000	526.6	--	--	--	--	--	0	2	< 5	--	2	--	--	0	< 3	--	80	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/26/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/2/2000	587	--	--	--	--	--	0	4	< 5	--	2	--	--	0	< 3	--	100	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/3/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/9/2000	561.7	--	--	--	--	--	0	3.5	< 5	--	< 1	--	--	0	< 3	--	90	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/10/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/16/2000	559	--	--	--	--	--	0	2.9	< 5	--	1	--	--	0	< 3	--	90	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/17/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/23/2000	531.5	--	--	--	--	--	34	2.1	< 5	--	2	520	--	80	< 3	2	80	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/24/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/30/2000	600.3	--	--	--	--	--	0	2.6	< 5	--	< 1	--	--	0	< 3	--	70	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/31/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/6/2000	534.7	--	--	--	--	--	46	1.2	< 5	--	3	310	--	70	< 3	< 1	60	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/7/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/13/2000	580	--	--	--	--	--	0	1.2	< 5	--	2	--	--	0	< 3	--	40	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/14/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/20/2000	564.7	--	--	--	--	--	0	1.5	< 5	--	6	--	--	0	< 3	--	50	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/21/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/27/2000	567.2	--	--	--	--	--	0	< 0.1	< 5	--	4	--	--	0	< 3	--	70	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/28/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/4/2000	542	--	--	--	--	--	41	1.8	< 5	--	2	370	--	120	< 3	< 1	60	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/4/2000	546.1	--	--	--	--	--	35	1.8	< 5	--	1	420	--	120	< 3	< 1	60	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/5/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/11/2000	533	--	--	--	--	--	--	1.7	< 5	--	< 1	--	--	--	< 3	--	80	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/12/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/18/2000	508.9	--	--	--	--	--	--	1.2	< 5	--	2	--	--	--	< 3	--	100	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/19/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/25/2000	501.7	--	--	--	--	--	--	1.1	< 5	--	< 1	--	--	--	< 3	--	100	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/26/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Montana Gulch	591-MT POND	Montana Pond Overflow	1/1/2001	494.7	--	--	769	< 1	--	< 3	< 0.1	< 5	--	< 1	630	--	< 20	< 3	< 1	< 10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/1/2001	< 1	--	--	< 10	426	--	59	0.7	< 5	--	< 1	20	--	70	< 3	< 1	90	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/2/2001	491.6	--	--	771	427	--	60	0.7	< 5	--	< 1	630	--	70	< 3	< 1	90	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/8/2001	480	--	--	753	426	--	0	0.7	< 5	--	< 1	--	--	0	< 3	--	70	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/9/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/15/2001	478.9	--	--	747	422	--	0	0.8	< 5	--	< 1	--	--	0	< 3	--	80	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/15/2001	--	--	--	--	--	--	--	--	592	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/16/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/22/2001	475.6	--	--	754	423	--	0	0.7	< 5	--	< 1	--	--	0	< 3	--	80	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/23/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/29/2001	165.5	--	--	748	418.9	--	0	1	< 5	--	< 1	--	--	0	< 3	--	140	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/30/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/5/2001	454.3	--	--	692	418	--	0	0.7	< 5	--	< 1	--	--	0	< 3	--	130	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/6/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/12/2001	477.4	--	--	788	411	--	0	0.5	< 5	--	< 1	--	--	0	< 3	--	120	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/13/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/19/2001	458.9	--	--	755	336	--	0	0.4	< 5	--	2	--	--	0	< 3	--	90	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/20/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/26/2001	450.1	--	--	735	406	--	0	0.4	< 5	--	1	--	--	0	< 3	--	100	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/27/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/5/2001	485.8	--	--	745	411.7	--	0	0.2	< 5	--	< 1	810	--	60	< 3	< 1	70	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/6/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/12/2001	495	--	--	734	415.6	--	39	0.3	< 5	--	2	--	--	0	< 3	--	70	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/13/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/19/2001	515.4	--	--	723	409	--	0	0.2	< 5	--	< 1	--	--	0	< 3	--	60	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/20/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/26/2001	458.2	--	7.99	711	413	--	0	< 0.1	< 5	--	1	--	--	0	< 3	--	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/27/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/2/2001	482.3	--	--	759	413.8	--	44	0.2	< 5	--	< 1	580	--	60	< 3	< 1	60	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/3/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/9/2001	491.4	--	--	732	418	--	0	0.3	< 5	--	< 1	--	--	0	< 3	--	60	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/10/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/16/2001	485.3	--	--	643	441	--	0	0.9	< 5	--	2	--	--	0	< 3	--	100	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/17/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/23/2001	489.6	--	--	806	470	--	0	1.4	< 5	--	2	--	--	0	< 3	--	100	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/24/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/30/2001	574.2	--	--	902	545.2	--	0	2	< 5	--	3	--	--	0	< 3	--	80	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/1/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/7/2001	522	--	--	844	490.7	--	38	1.3	< 5	--	< 1	580	--	90	< 3	2	80	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/7/2001	531	--	--	845	492	--	37	1.3	< 5	--	< 1	590	--	80	< 3	2	80	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Montana Gulch	591-MT POND	Montana Pond Overflow	5/8/2001	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/14/2001	526.9	--	--	870	500	--	0	1	< 5	--	1	--	--	--	< 3	--	70	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/15/2001	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/21/2001	508.3	--	--	812	468	--	0	0.4	< 5	--	< 1	--	--	--	< 3	--	40	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/22/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/23/2001	455.4	--	--	736	437	--	0	0.2	< 5	--	< 1	--	--	--	< 3	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/29/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	40	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/4/2001	487.6	--	--	730	422.3	--	26	0.2	< 5	--	< 1	180	--	40	< 3	< 1	50	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/5/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/11/2001	696.4	--	--	1084	695	--	< 3	< 0.1	< 5	--	6	100	--	< 20	< 3	< 1	< 10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/12/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/18/2001	771.5	--	--	1209	782	--	14	4.4	< 5	--	3	60	--	70	< 3	4	50	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/19/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/25/2001	795.7	--	--	1207	772	--	0	3.5	< 5	--	< 1	--	--	--	< 3	--	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/26/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/2/2001	692.5	--	--	1114	704	--	0	2	< 5	--	< 1	--	--	--	< 3	--	40	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/3/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/9/2001	643.4	--	--	986	618	--	0	0.8	< 5	--	< 1	--	--	--	< 3	--	40	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/10/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/16/2001	608.2	--	--	935	618	--	0	0.6	< 5	--	< 1	--	--	--	< 3	--	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/17/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/23/2001	716.8	--	--	1077	671	--	0	0.9	< 5	--	< 1	--	--	--	< 3	--	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/24/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/30/2001	636.6	--	--	1016	607	--	0	2.3	< 5	--	< 1	--	--	--	< 3	--	80	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/31/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/6/2001	700.2	--	--	1006	636	--	0	2	< 5	--	1	--	--	--	< 3	--	50	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/7/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/13/2001	658.2	--	--	937	580	--	0	0.7	6	--	< 1	--	--	--	< 3	--	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/14/2001	--	--	--	--	--	--	--	--	592	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/14/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/20/2001	620.5	--	--	982	614	--	0	0.3	< 5	--	< 1	--	--	--	< 3	--	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/22/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/27/2001	621.8	--	--	--	--	--	33	0.8	< 5	--	< 1	90	--	80	< 3	2	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/28/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/3/2001	669.9	--	8.24	959	620	--	26	1.3	< 5	--	1	160	--	90	< 3	2	40	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/4/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/10/2001	551.7	--	--	871	531	--	0	0.3	< 5	--	< 1	--	--	--	< 3	--	40	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/11/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/17/2001	591.7	--	--	884	516	--	0	0.8	< 5	--	1	--	--	--	< 3	--	50	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/18/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Montana Gulch	591-MT POND	Montana Pond Overflow	9/24/2001	577.3	--	--	890	50	--	0	1.9	< 5	--	2	--	--	--	< 3	--	140	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/25/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/1/2001	616.2	--	--	929	567	--	22	1.7	< 5	--	4	430	--	100	< 3	< 1	90	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/1/2001	1.9	--	--	< 10	< 1	--	< 3	1.7	< 5	--	1	< 10	--	< 20	< 3	< 1	80	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/1/2001	604	--	--	936	570	--	21	< 0.1	< 5	--	3	440	--	100	< 3	< 1	< 10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/2/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/8/2001	704	--	--	1075	674	--	--	2.2	< 5	--	4	--	--	--	< 3	--	80	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/9/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/15/2001	571.5	--	--	886	509	--	--	3	< 5	--	< 1	--	--	--	< 3	--	170	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/16/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/22/2001	578.8	--	--	898	494	--	--	2.2	< 5	--	< 1	--	--	--	< 3	--	190	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/23/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/29/2001	543	--	8.09	890	481	--	--	< 0.1	< 5	--	< 1	--	--	--	< 3	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/30/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/5/2001	532.9	--	--	878	468	--	52	2.2	< 5	--	2	460	--	90	< 3	< 1	210	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/7/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/12/2001	598.4	--	--	928	549	--	--	3.1	< 5	--	< 1	--	--	--	12	--	160	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/13/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/19/2001	521	--	--	858	490	--	--	2	< 5	--	< 10	--	--	--	< 10	--	150	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/20/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/26/2001	539	--	--	812	434	--	--	3	< 5	--	< 10	--	--	--	< 10	--	200	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/27/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/3/2001	--	--	--	3950	435	--	59	2	< 5	--	1	--	--	60	--	2	190	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/4/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/10/2001	541	--	--	818	441	--	--	2	< 5	--	< 10	--	--	--	< 2	--	210	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/11/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/17/2001	515	--	--	787	447	--	62	2	< 5	--	< 10	530	--	--	< 2	--	190	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/18/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/24/2001	567	--	--	834	458	--	--	1	< 5	--	< 10	--	--	--	< 2	--	110	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/25/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/31/2001	567	--	--	802	462	--	--	1	< 5	--	< 10	--	--	--	< 2	--	70	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/1/2002	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	< 5	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/7/2002	559	--	--	791	437	--	59	< 1	< 5	--	< 10	360	--	70	< 2	--	150	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/8/2002	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/14/2002	525	--	--	787	452	--	--	1	0	--	0	--	--	--	0	--	110	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/15/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/21/2002	556	--	--	791	455	--	--	1.2	0	--	2	--	--	--	0	--	140	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/22/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/28/2002	532	--	--	803	442	--	--	0.9	0	--	--	--	--	--	0	--	80	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/29/2002	--	--	--	--	--	--	--	--	0	--	1	--	--	--	--	--	0	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Montana Gulch	591-MT POND	Montana Pond Overflow	2/4/2002	508	--	--	783	425	--	63	0.8	0	--	1	510	--	50	0	2	110	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/5/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/11/2002	592	--	--	774	427	--	--	1.9	0	--	3	--	--	--	0	--	330	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/12/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/18/2002	551	--	--	817	502	--	30	0.2	0	--	0	330	--	30	0	1	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/19/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/25/2002	570	--	--	907	537	--	--	0.2	0	--	2	--	--	--	0	--	10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/26/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/4/2002	529	--	--	854	527	--	19	0.1	0	--	0	670	--	30	0	1	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/5/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/11/2002	506	--	--	810	473	--	--	0.1	0	--	0	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/12/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/18/2002	496	--	--	850	514	--	--	0	0	--	0	--	--	20	0	1	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/19/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/25/2002	499	--	--	810	499	--	--	0	0	--	1	--	--	--	0	--	10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/26/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/29/2002	--	--	--	--	--	--	20	--	--	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/30/2002	--	--	--	--	--	--	23	--	--	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/31/2002	--	--	--	--	--	--	25	--	--	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/1/2002	512	--	--	818	469	--	23	0	0	--	1	620	--	30	0	1	10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/2/2002	--	--	--	--	--	--	21	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/3/2002	--	--	--	--	--	--	24	--	--	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/4/2002	--	--	--	--	--	--	23	--	--	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/5/2002	--	--	--	--	--	--	24	--	--	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/6/2002	--	--	--	--	--	--	24	--	--	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/7/2002	--	--	--	--	--	--	23	--	--	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/8/2002	480	--	--	775	461	--	22	6	0	--	15	--	--	--	13	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/8/2002	480	--	--	775	461	--	--	6	0	--	15	--	--	--	13	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/9/2002	--	--	--	--	--	--	23	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/12/2002	--	--	--	--	--	--	17	--	--	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/13/2002	--	--	--	--	--	--	16	--	--	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/14/2002	--	--	--	--	--	--	14	--	--	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/15/2002	499	--	--	809	500	--	--	--	0	--	--	--	--	--	0	--	10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/15/2002	--	--	--	--	--	--	13	0	--	--	2	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/16/2002	--	--	--	--	--	--	14	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/17/2002	--	--	--	--	--	--	15	--	--	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/18/2002	--	--	--	--	--	--	15	--	--	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/19/2002	--	--	--	--	--	--	14	--	--	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/20/2002	--	--	--	--	--	--	10	--	--	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/21/2002	--	--	--	--	--	--	8	--	--	--	--	--	--	--	--	--	--	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)	
Montana Gulch	591-MT POND	Montana Pond Overflow	4/22/2002	681	--	--	1150	691	--	7	0.4	0	--	2	--	--	--	0	--	10	--	
Montana Gulch	591-MT POND	Montana Pond Overflow	4/23/2002	--	--	--	--	--	--	8	--	0	--	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/24/2002	--	--	--	--	--	--	9	--	--	--	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/25/2002	--	--	--	--	--	--	10	--	--	--	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/26/2002	--	--	--	--	--	--	11	--	--	--	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/27/2002	--	--	--	--	--	--	12	--	--	--	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/28/2002	--	--	--	--	--	--	13	--	--	--	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/29/2002	--	--	--	976	632	--	14	0.5	--	--	--	--	--	--	0	--	20	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/29/2002	599	--	--	--	--	--	--	--	0	--	3	--	--	--	--	--	0	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/30/2002	--	--	--	--	--	--	14	--	0	--	--	--	--	--	--	--	0	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/1/2002	--	--	--	--	--	--	15	--	--	--	--	--	--	--	--	--	0	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/1/2002	--	--	--	--	--	--	16	--	--	--	--	--	--	--	--	--	0	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/2/2002	--	--	--	--	--	--	18	--	--	--	--	--	--	--	--	--	0	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/3/2002	--	--	--	--	--	--	20	--	--	--	--	--	--	--	--	--	0	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/4/2002	--	--	--	--	--	--	19	--	--	--	--	--	--	--	--	--	0	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/5/2002	--	--	--	--	--	--	21	--	--	--	--	--	--	--	--	--	0	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/6/2002	523	--	--	907	582	--	23	0.9	0	--	2	380	--	30	0	3	70	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/6/2002	--	--	--	--	--	--	23	--	--	--	--	--	--	--	--	--	0	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/7/2002	--	--	--	--	--	--	23	--	0	--	--	--	--	--	--	--	0	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/8/2002	--	--	--	--	--	--	23	--	--	--	--	--	--	--	--	--	0	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/9/2002	--	--	--	--	--	--	25	--	--	--	--	--	--	--	--	--	0	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/13/2002	557	--	--	870	553	--	--	0	0	--	2	--	--	--	0	--	20	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/14/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/20/2002	616	--	--	892	576	--	--	0.2	0	--	2	--	--	--	0	--	10	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/21/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/22/2002	--	--	--	--	--	--	36	--	--	--	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/29/2002	486	--	--	870	531	--	--	0.2	0	--	2	--	--	--	0	--	0	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/10/2002	566	--	--	985	606	--	--	0.1	0	--	2	--	--	--	0	--	0	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/11/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/17/2002	812	--	--	1380	870	--	8	2.9	0	--	2	50	--	50	0	7	30	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/24/2002	865	--	--	1450	883	--	--	4	0	--	4	--	--	--	0	--	40	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/26/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/8/2002	793	--	--	1290	766	--	--	1.7	0	--	4	--	--	--	0	--	30	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/15/2002	671	--	--	1230	761	--	--	2.8	0	--	4	--	--	--	0	--	30	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/22/2002	648	--	--	1170	730	--	--	2.2	0	--	5	--	--	--	0	--	50	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/23/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/29/2002	685	--	--	1160	--	--	--	1.2	0	--	3	--	--	--	0	--	30	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/30/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/5/2002	628	--	--	1140	682	--	23	3.2	0	--	4	330	--	90	0	5	50	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/6/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Montana Gulch	591-MT POND	Montana Pond Overflow	8/11/2002	753	--	--	1290	695	--	--	5.7	0	--	5	--	--	--	0	--	60	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/12/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/19/2002	918	--	--	1510	925	--	--	5.7	0	--	4	--	--	--	0	--	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/20/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/26/2002	1720	--	--	3020	1830	--	--	2.2	0	--	10	--	--	--	0	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/27/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/2/2002	810	--	--	1340	827	--	--	1.4	0	--	3	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/3/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/9/2002	764	--	--	1230	845	--	13	1.8	0	--	2	240	--	60	0	4	10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/10/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/16/2002	787	--	--	1170	710	--	--	2.5	0	--	3	--	--	--	0	--	50	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/17/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/23/2002	632	--	--	1110	669	--	--	2.4	0	--	3	--	--	--	0	--	60	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/24/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/30/2002	656	--	--	1100	694	--	--	2.5	0	--	2	--	--	--	0	--	70	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/1/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/7/2002	628	--	--	1080	673	--	27	2	0	--	2	650	--	80	0	3	70	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/8/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/21/2002	653	--	--	--	667	--	--	1.3	0	--	1	--	--	--	0	--	40	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/22/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/28/2002	258	--	--	988	581	--	--	0.3	0	--	2	--	--	--	0	--	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/29/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/4/2002	673	--	--	1100	607	--	23	0.4	0	--	1	--	--	20	0	4	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/11/2002	578	--	--	1000	572	--	--	0.2	0	--	0	220	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/12/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/18/2002	526	--	--	963	617	--	--	0.2	0	--	1	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/19/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/25/2002	551	--	--	885	533	--	--	0.2	0	--	0	--	--	--	0	--	10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/26/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/2/2002	534	--	--	826	514	--	23	0.1	0	--	0	140	--	10	0	2	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/3/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/9/2002	513	--	--	--	561	--	--	0	0	--	2	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/10/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/16/2002	496	--	--	835	535	--	--	0	0	--	0	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/17/2002	528	--	8.2	834	513	--	28	0.3	0	--	1	250	--	20	0	3	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/26/2002	517	--	--	859	527	--	--	0.2	0	--	1	--	--	--	0	--	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/27/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/30/2002	532	--	--	--	--	--	--	0.2	--	--	1	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/31/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/6/2003	524	--	--	871	512	--	20	0.3	0	--	2	330	--	30	0	4	30	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Montana Gulch	591-MT POND	Montana Pond Overflow	1/7/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/13/2003	565	--	--	859	506	--	--	0.3	0	--	1	--	--	--	0	--	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/14/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/20/2003	514	--	--	--	454	--	--	0	0	--	2	--	--	--	0	--	40	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/21/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/27/2003	509	--	--	--	454	--	--	0.3	0	--	2	--	--	--	0	--	40	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/28/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/3/2003	510	--	--	--	459	--	17	0.2	0	--	4	310	--	30	0	2	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/4/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/10/2003	517	--	--	808	467	--	--	0.2	0	--	1	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/11/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/17/2003	520	--	--	817	467	--	--	0.4	0	--	3	--	--	--	0	--	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/18/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/24/2003	503	--	--	787	530	--	--	0.4	0	--	0	--	--	--	0	--	40	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/25/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/3/2003	464	--	--	801	431	--	22	0.2	0	--	0	560	--	30	0	2	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/4/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/10/2003	478	--	--	797	456	--	--	0	0	--	0	--	--	--	0	--	10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/11/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/17/2003	534	--	--	813	537	--	--	0.2	0	--	4	--	--	--	0	--	100	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/18/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/24/2003	555	--	--	894	561	--	--	0.2	0	--	1	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/25/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/1/2003	781	--	--	1270	847	--	14	2	0	--	2	60	--	50	0	8	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/2/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/7/2003	711	--	--	1210	800	--	--	1.3	0	--	6	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/8/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/14/2003	739	--	--	1230	--	--	--	0.8	0	--	2	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/15/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/21/2003	784	--	--	1350	804	--	--	0.6	0	--	3	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/22/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/28/2003	627	--	--	1110	737	--	--	0.9	0	--	2	--	--	--	0	--	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/29/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/5/2003	648	--	--	1020	704	--	6	2.2	0	--	4	60	--	40	0	5	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/6/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/19/2003	760	--	--	--	--	--	--	1.6	--	--	0	--	--	--	0	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/20/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/26/2003	614	--	--	1040	638	--	--	1.1	0	--	4	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/26/2003	614	--	--	1040	638	--	--	1.1	0	--	4	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/27/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Montana Gulch	591-MT POND	Montana Pond Overflow	5/27/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/2/2003	563	--	--	966	--	--	4	0.8	0	--	2	0	--	20	0	3	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/3/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/9/2003	567	--	--	948	547	--	--	0.9	0	--	2	--	--	--	0	--	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/10/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/16/2003	635	--	--	1020	619	--	--	0.5	0	--	2	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/17/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/23/2003	613	--	--	1030	617	--	--	1.1	0	--	1	--	--	--	0	--	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/24/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/30/2003	613	--	--	1010	--	--	--	0.4	0	--	1	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/1/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/7/2003	574	--	--	988	580	--	--	1	0	--	2	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/8/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/14/2003	557	--	--	961	593	--	4	1	0	--	5	60	--	30	0	4	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/15/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/21/2003	558	--	--	985	595	--	--	1	0	--	0	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/22/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/28/2003	548	--	--	914	522	--	--	0.5	0	--	2	--	--	--	--	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/28/2003	546	--	--	914	525	--	--	0.5	0	--	2	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/29/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/4/2003	610	--	--	981	313	--	13	1.2	11	--	2	50	--	50	0	3	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/5/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/11/2003	576	--	--	957	596	--	--	1	0	--	1	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/12/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/18/2003	499	--	--	889	562	--	--	0.7	0	--	1	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/19/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/25/2003	507	--	--	--	--	--	--	0.2	--	--	2	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/26/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/1/2003	558	--	--	881	543	--	4	0.6	0	--	3	70	--	30	0	3	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/2/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/8/2003	568	--	--	912	548	--	--	0.7	0	--	1	--	--	--	0	--	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/9/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/15/2003	489	--	--	845	507	--	--	1.4	0	--	0	--	--	--	0	--	50	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/16/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/22/2003	465	--	--	819	--	--	--	0.5	0	--	0	--	--	--	0	--	40	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/23/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/29/2003	553	--	--	825	494	--	--	0.3	0	--	2	--	--	--	0	--	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/30/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/6/2003	548	--	--	802	486	--	9	0.5	0	--	0	440	--	30	0	0	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/7/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Montana Gulch	591-MT POND	Montana Pond Overflow	10/8/2003	570	--	8.1	971	626	--	7	0.4	14	--	1	540	--	40	0	5	40	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/8/2003	577	--	7.8	1060	652	--	6	0.5	8	--	1	520	--	40	0	7	50	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/9/2003	566	--	7.9	1090	671	--	7	0.5	14	--	1	810	--	40	0	7	50	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/9/2003	575	--	8	1100	711	--	6	0.5	16	--	1	660	--	40	0	6	50	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/10/2003	544	--	7.9	1130	724	--	6	0.4	18	--	0	830	--	40	0	7	50	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/13/2003	542	--	--	--	--	--	--	0.7	--	--	2	--	--	--	0	--	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/13/2003	--	--	--	--	--	--	--	--	10	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/14/2003	--	--	--	--	--	--	--	--	10	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/20/2003	550	--	--	--	--	--	--	0.4	--	--	0	--	--	--	0	--	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/21/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/27/2003	526	--	--	834	486	--	--	0.3	0	--	1	--	--	--	0	--	40	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/28/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/3/2003	472	--	--	798	482	--	11	0.3	0	--	1	370	--	30	0	1	40	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/4/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/10/2003	548	--	--	838	489	--	--	0.5	0	--	1	--	--	--	0	--	50	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/11/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/17/2003	529	--	--	823	475	--	--	0.4	0	--	2	--	--	--	0	--	40	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/18/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/24/2003	536	--	--	830	491	--	--	0.8	0	--	1	--	--	--	0	--	60	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/25/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/1/2003	512	--	--	831	478	--	13	1.2	0	--	2	690	--	40	0	2	50	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/2/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/8/2003	528	--	--	829	492	--	--	0.6	0	--	1	--	--	--	0	--	50	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/9/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/15/2003	533	--	--	833	507	--	--	0	0	--	2	--	--	--	0	--	50	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/16/2003	--	--	--	--	--	--	--	37242.0	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/22/2003	559	--	--	841	--	--	--	0.5	0	--	3	--	--	--	0	--	60	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/23/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/29/2003	457	--	--	--	432	--	--	0.4	0	--	2	--	--	--	0	--	50	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/30/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/5/2004	440	--	--	732	435	--	25	0.3	0	--	2	820	--	40	0	0	50	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/6/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/12/2004	476	--	--	721	452	--	--	0.1	0	--	0	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/13/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/19/2004	534	--	--	784	503	--	--	0.1	0	--	3	--	--	--	0	--	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/20/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/26/2004	498	--	--	799	497	--	--	0.2	0	--	2	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/27/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/2/2004	488	--	--	738	457	--	22	0.2	0	--	2	310	--	50	2	0	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/3/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Montana Gulch	591-MT POND	Montana Pond Overflow	2/9/2004	479	--	--	737	455	--	--	0	0	--	1	--	--	--	0	--	10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/10/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/16/2004	458	--	--	704	452	--	--	0.4	0	--	1	--	--	--	0	--	50	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/17/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/23/2004	567	--	--	880	571	--	--	0.4	0	--	2	--	--	--	0	--	40	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/24/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/2/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/3/2004	1120	--	--	1730	1220	--	6	1.9	0	--	3	80	--	30	0	9	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/8/2004	890	--	--	1490	999	--	--	2.1	0	--	5	--	--	--	0	--	270	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/8/2004	2380	--	--	1490	999	--	--	11.6	0	--	6	--	--	--	0	--	40	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/9/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/15/2004	934	--	--	1390	950	--	--	3.9	0	--	5	--	--	--	0	--	70	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/16/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/22/2004	818	--	--	--	--	--	--	1.9	--	--	3	--	--	--	0	--	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/23/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/29/2004	855	--	--	1310	891	--	--	8.1	0	--	4	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/30/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/5/2004	745	--	--	1150	769	--	11	3.4	0	--	5	70	--	70	0	6	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/6/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/12/2004	729	--	--	1170	811	--	--	3.2	0	--	4	--	--	--	0	--	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/13/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/19/2004	750	--	--	1150	785	--	--	1.2	0	--	0	--	--	--	0	--	10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/20/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/26/2004	759	--	--	1210	--	--	--	0.9	0	--	2	--	--	--	0	--	10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/27/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/3/2004	677	--	--	1040	683	--	19	1.1	0	--	2	200	--	70	0	3	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/4/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/10/2004	572	--	--	959	600	--	--	0.4	0	--	0	--	--	--	0	--	10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/11/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/17/2004	591	--	--	915	459	--	--	0.3	0	--	1	--	--	--	0	--	10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/18/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/24/2004	557	--	--	863	597	--	--	0	0	--	2	--	--	--	0	--	10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/25/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/31/2004	646	--	--	1080	736	--	--	1.2	0	--	1	--	--	--	0	--	50	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/1/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/7/2004	746	--	--	1270	828	--	4	1.9	0	--	2	0	--	30	0	6	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/8/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/14/2004	721	--	--	1230	--	--	--	2	0	--	2	--	--	--	0	--	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/15/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/21/2004	853	--	--	1330	852	--	--	1.1	0	--	3	--	--	--	0	--	20	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Montana Gulch	591-MT POND	Montana Pond Overflow	6/22/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/28/2004	759	--	--	1310	748	--	--	0	0	--	4	--	--	--	0	--	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/29/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/5/2004	708	--	--	1120	651	--	5	1.5	0	--	3	90	--	10	0	4	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/6/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/11/2004	895	--	--	2200	1350	--	7	1.3	29	--	7	410	--	50	0	12	70	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/12/2004	--	--	--	--	--	--	--	--	33	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/19/2004	951	--	--	2310	1490	--	10	1.2	50	--	2	190	--	60	0	13	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/20/2004	--	--	--	--	--	--	--	--	43	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/26/2004	994	--	--	2580	1650	--	7	0.3	45	--	6	50	--	50	0	18	10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/27/2004	--	--	--	--	--	--	--	--	46	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/2/2004	889	--	--	2380	1470	--	13	0.5	61	--	7	200	--	60	0	27	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/3/2004	--	--	--	--	--	--	--	--	61	--	--	--	--	--	--	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/9/2004	831	--	--	2380	1400	--	11	1.5	59	--	9	360	--	70	0	31	40	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/10/2004	--	--	--	--	--	--	--	--	69	--	--	--	--	--	--	--	--	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/16/2004	828	--	--	2360	1520	--	--	0.6	54	--	5	--	--	--	0	--	10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/23/2004	823	--	--	2590	1620	--	--	0.4	88	--	5	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/30/2004	807	--	--	2320	1440	--	--	0.7	73	--	3	--	--	--	0	--	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/6/2004	840	--	--	2380	1470	--	10	0.3	68	--	4	120	--	60	0	65	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/13/2004	931	--	--	2530	1540	--	7	0.5	46	--	4	140	--	70	0	76	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/20/2004	876	--	--	--	1580	--	--	0.5	51	--	2	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/27/2004	885	--	--	2590	1620	--	--	0.4	49	--	4	--	--	--	0	--	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/4/2004	887	--	--	2480	--	--	12	0.6	43	--	2	150	--	80	0	87	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/11/2004	968	--	--	2690	--	--	--	0.5	51	--	1	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/18/2004	1000	--	--	3020	1840	--	--	0.4	57	--	3	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/25/2004	834	--	--	--	1550	--	--	0.5	30	--	3	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/1/2004	849	--	--	2440	1420	--	9	0.6	53	--	2	50	--	90	0	17	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/8/2004	698	--	--	1360	823	--	5	0.7	16	--	2	70	--	50	0	8	50	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/15/2004	702	--	--	1090	666	--	--	0.5	0	--	2	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/22/2004	719	--	--	1100	695	--	--	0.6	0	--	1	--	--	--	0	--	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/29/2004	652	--	--	1030	642	--	--	0.5	0	--	0	--	--	--	0	--	40	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/5/2004	661	--	--	--	592	--	7	0.2	0	--	0	0	--	30	0	3	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/13/2004	630	--	--	950	589	--	--	0.2	0	--	1	--	--	--	0	--	10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/20/2004	619	--	--	883	565	--	--	0.2	0	--	1	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/27/2004	594	--	--	878	537	--	--	0	0	--	2	--	--	--	0	--	10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/3/2005	495	--	--	824	543	--	3	0	0	--	3	0	--	30	0	0	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/10/2005	520	--	--	835	520	--	--	0	0	--	0	--	--	--	0	--	10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/17/2005	593	--	--	903	544	--	--	0.2	0	--	5	--	--	--	0	--	40	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/24/2005	586	--	--	925	536	--	--	0.2	0	--	0	--	--	--	0	--	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/31/2005	659	--	--	1050	--	--	--	0.7	12	--	2	--	--	--	0	--	70	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Montana Gulch	591-MT POND	Montana Pond Overflow	2/7/2005	761	--	--	1670	--	--	8	0.7	56	--	2	440	--	60	0	19	90	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/14/2005	734	--	--	1760	1050	--	--	0	63	--	2	--	--	--	0	0	50	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/21/2005	690	--	--	1440	--	--	--	0.4	46	--	3	--	--	--	0	0	50	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/28/2005	625	--	--	1170	704	--	--	0.4	22	--	2	--	--	--	0	0	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/7/2005	767	--	--	1910	1160	--	7	0.8	64	--	2	650	--	70	0	13	140	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/14/2005	531	--	--	840	435	--	--	0.4	0	--	2	--	--	--	0	--	70	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/21/2005	552	--	--	885	527	--	--	3.1	0	--	4	--	--	--	0	--	280	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/28/2005	597	--	--	909	564	--	--	3.4	0	--	3	--	--	--	0	--	200	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/4/2005	616	--	--	932	563	--	4	3.2	0	--	4	260	--	110	0	2	160	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/11/2005	544	--	--	867	527	--	--	5.1	0	--	3	--	--	--	0	--	200	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/18/2005	909	--	--	1440	--	--	--	2.1	0	--	2	--	--	--	0	--	10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/25/2005	1300	--	--	1900	1270	--	--	5.5	0	--	3	--	--	--	0	--	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/2/2005	1430	--	--	--	--	--	0	5.2	--	--	2	0	--	40	0	12	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/9/2005	1410	--	--	2110	1350	--	--	5.3	0	--	6	--	--	--	0	0	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/16/2005	1320	--	--	1880	1240	--	--	5.3	0	--	7	--	--	--	0	0	10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/23/2005	1080	--	--	1770	1140	--	--	4.8	0	--	4	--	--	--	0	0	10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/30/2005	1150	--	--	--	1060	--	--	3.7	0	--	2	--	--	--	0	0	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/6/2005	1030	--	--	1580	1060	--	4	2.8	0	--	3	70	--	30	0	8	10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/13/2005	939	--	--	1470	970	--	--	2.6	0	--	2	--	--	--	0	0	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/20/2005	1150	--	--	1900	1220	--	--	2.3	0	--	5	--	--	--	0	0	10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/27/2005	1190	--	--	1810	1170	--	--	1.7	0	--	1	--	--	--	0	0	10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/4/2005	1060	--	--	--	1190	--	3	4.6	0	--	8	40	--	20	0	10	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/18/2005	1110	--	--	1510	1000	--	--	5	0	--	2	--	--	--	0	--	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/25/2005	920	--	--	1430	936	--	--	1.6	0	--	4	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/1/2005	975	--	8.6	1430	921	--	0	1.8	0	--	1	80	--	30	0	7	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/8/2005	892	--	--	1380	892	--	--	2.9	0	--	3	--	--	--	0	--	40	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/12/2005	882	--	--	1290	798	--	--	2.4	0	--	3	--	--	--	0	--	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/15/2005	812	--	--	1320	809	--	--	2.1	0	--	3	--	--	--	0	--	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/29/2005	937	--	--	1380	859	--	--	3	0	--	0	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/5/2005	873	--	--	--	--	--	5	0.8	0	--	5	70	--	20	0	4	0	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/12/2005	867	--	--	--	--	--	--	3	0	--	0	--	--	--	0	--	10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/14/2005	1250	--	7.8	--	--	--	3	4.3	48	--	10	330	--	140	0	10	540	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/19/2005	825	--	--	--	--	--	--	1.7	0	--	2	--	--	--	0	--	10	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/26/2005	762	--	--	--	--	--	--	2.7	--	--	6	--	--	--	0	--	60	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/3/2005	936	--	--	--	--	--	7	1.8	--	--	2	90	--	50	0	6	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/10/2005	949	--	--	--	--	--	--	4.5	0	--	69	--	--	--	2	--	450	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/25/2005	710	--	--	--	680	--	--	0.7	0	--	0	--	--	--	0	--	50	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/31/2005	784	--	--	--	1170	--	--	1	0	--	0	--	--	--	0	--	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/7/2005	652	--	--	986	638	--	15	2	0	--	9	570	--	60	0	3	100	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/2/2006	724	--	--	1070	702	--	13	13.8	0	--	10	870	--	146	0	3	276	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Montana Gulch	591-MT POND	Montana Pond Overflow	1/9/2006	777	--	--	1170	782	--	--	4.8	0	--	3	--	--	--	0	--	32	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/16/2006	829	--	--	1260	836	--	--	4.3	0	--	8	--	--	--	0	--	32	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/23/2006	830	--	--	1170	781	--	--	3.7	0	--	3	--	--	--	0	--	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/17/2006	1440	--	--	3610	2230	--	5	11	121	--	5	200	--	108	0	40	267	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/25/2006	1310	--	--	3320	2280	--	4	14.9	106	--	16	400	--	135	0	30	525	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/14/2006	865	--	--	1320	858	--	--	4	0	--	6	--	--	--	0	0	53	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/16/2006	1400	--	--	4750	3060	--	5	6.7	137	--	8	600	--	108	0	43	304	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/25/2006	894	--	8.3	--	955	--	7	4.2	10	--	9	130	--	72	--	8	22	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/13/2006	1000	--	8.2	--	--	--	7	4.2	11	--	12	80	--	67	--	9	21	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/3/2007	683	--	8.7	--	709	--	11	0.3	0	--	2	80	--	42	--	3	11	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/26/2007	676	--	8.7	--	--	--	3	0.8	0	--	0	110	--	83	--	3	35	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/19/2007	755	--	8.3	--	799	--	2	10.8	0	--	4	60	--	126	--	5	79	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/25/2007	969	--	8	--	--	--	6	5.1	36	--	10	450	--	92	--	9	64	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/23/2007	1200	--	8	--	1620	--	3	4	25	--	5	450	--	68	--	18	72	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/19/2007	1450	--	8.2	--	1680	--	7	4	--	--	9	90	--	75	--	19	34	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/24/2007	1620	--	8.3	--	--	--	12	5.2	--	--	3	150	--	161	--	22	91	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/29/2007	1400	--	7.7	--	2290	--	13	8.8	--	--	7	740	--	116	--	28	388	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/26/2007	1440	--	7.9	--	2390	--	15	14.6	--	--	13	270	--	337	--	39	655	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/25/2007	1150	--	7.8	--	--	--	12	9.6	--	--	4	0	--	213	--	19	171	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/27/2007	1020	--	6.6	--	1260	--	16	6.9	--	--	3	90	--	160	--	14	57	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/17/2007	913	--	8.2	--	--	--	17	4.9	--	--	5	270	--	131	--	9	80	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/22/2008	893	--	8.4	--	--	--	5	2.8	--	--	5	450	--	99	--	7	55	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/25/2008	817	--	8.3	--	--	--	4	2.1	--	--	2	360	--	78	--	4	43	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/19/2008	795	--	8.2	--	--	--	3	2.2	--	--	5	320	--	93	--	6	40	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/22/2008	901	--	7.8	--	--	--	3	3	--	--	7	220	--	69	--	8	30	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/20/2008	961	--	8.2	--	--	--	9	2.4	--	--	6	160	--	41	--	8	20	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/29/2008	1520	--	7.6	--	2080	--	7	16.4	--	--	8	300	--	213	--	23	434	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/29/2008	1560	--	7.4	--	2210	--	5	14.4	--	--	7	140	--	300	--	17	420	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/27/2008	1710	--	7.8	--	2590	--	4	8.1	--	--	4	260	--	100	--	36	224	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/29/2008	1620	--	8	--	1910	--	4	4.8	--	--	3	0	--	102	--	15	49	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/29/2008	1320	--	7.3	--	2330	--	4	21.8	--	--	30	200	--	377	--	33	757	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/13/2008	1320	--	7.7	--	1970	--	5	13.1	--	--	12	110	--	248	--	16	292	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/17/2008	1330	--	7.2	--	1380	--	8	35.2	--	--	6	370	--	212	--	8	440	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/28/2009	1520	--	8.5	--	1540	--	7	8.2	--	--	2	50	--	34	--	17	14	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/17/2009	1410	--	8.3	--	1640	--	6	5.3	--	--	2	50	--	40	--	24	16	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/26/2009	1430	--	6.7	--	1700	--	9	61.2	--	--	16	310	--	316	--	27	1210	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/31/2009	1480	--	7.5	--	1740	--	6	17.3	--	--	4	0	--	149	--	31	61	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/29/2009	1210	--	--	--	1800	--	3	2.8	--	--	10	1060	--	47	--	37	96	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/27/2009	1740	--	7.7	--	2270	--	3	4.5	--	--	12	210	--	42	--	63	144	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/24/2009	1740	--	7.7	--	3250	--	2	15.3	--	--	27	390	--	284	--	55	618	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Montana Gulch	591-MT POND	Montana Pond Overflow	8/5/2009	1540	--	7.5	--	2690	70	2	10.2	--	--	16	310	--	505	--	58	869	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/25/2009	1710	--	7.4	--	3840	80	7	9	--	--	25	180	--	310	--	182	575	--
Montana Gulch	591-MT POND	Montana Pond Overflow	9/29/2009	1460	--	7.8	--	2470	7450	3	8.3	--	--	19	540	--	190	--	54	422	--
Montana Gulch	591-MT POND	Montana Pond Overflow	10/30/2009	1270	--	8.2	--	1640	590	3	1.8	--	--	11	110	--	83	--	36	92	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/19/2009	1740	--	7.2	--	3220	--	2	7.4	--	--	13	100	--	601	--	210	440	--
Montana Gulch	591-MT POND	Montana Pond Overflow	11/30/2009	1620	--	7.4	--	3300	--	5	11.8	--	--	33	180	--	570	--	214	720	--
Montana Gulch	591-MT POND	Montana Pond Overflow	12/27/2009	1250	--	9	--	1230	--	3	1.1	--	--	1	20	--	32	--	9	22	--
Montana Gulch	591-MT POND	Montana Pond Overflow	1/17/2010	1080	--	9	--	1150	--	3	0.6	--	--	4	0	--	41	--	7	14	--
Montana Gulch	591-MT POND	Montana Pond Overflow	2/28/2010	1080	--	7.8	--	1160	--	7	9.8	--	--	2	180	--	225	--	10	137	--
Montana Gulch	591-MT POND	Montana Pond Overflow	3/29/2010	1480	--	7.3	--	2990	--	6	8	--	--	24	170	--	143	--	164	240	--
Montana Gulch	591-MT POND	Montana Pond Overflow	4/27/2010	1160	--	7.3	--	1930	--	3	7.5	--	--	26	690	--	150	--	37	238	--
Montana Gulch	591-MT POND	Montana Pond Overflow	5/25/2010	1350	--	7.2	--	--	--	3	8.4	--	--	15	310	--	76	--	32	159	--
Montana Gulch	591-MT POND	Montana Pond Overflow	6/23/2010	1910	--	7	--	--	--	0	5.4	--	--	36	500	--	67	--	43	237	--
Montana Gulch	591-MT POND	Montana Pond Overflow	7/31/2010	1920	--	7	--	--	--	2	10.2	--	--	10	210	--	244	--	28	684	--
Montana Gulch	591-MT POND	Montana Pond Overflow	8/31/2010	1580	--	7.4	--	--	--	2	10.3	--	--	8	140	--	350	--	54	919	--
Montana Gulch	L-16	Below MT Pond at Flume	9/27/2001	--	--	--	--	--	--	26	--	--	--	--	190	--	--	--	--	40	--
Montana Gulch	L-16	Below MT Pond at Flume	4/19/2005	480	--	--	680	437	--	17	3.2	0	--	35	4940	0	60	--	5	240	--
Montana Gulch	L-16	Below MT Pond at Flume	5/10/2005	852	--	7.1	1300	765	--	14	2.1	0	--	28	4080	--	40	--	8	250	--
Montana Gulch	L-16	Below MT Pond at Flume	6/29/2005	1140	--	--	--	1980	--	0	1.5	122	--	12	550	--	50	--	70	70	--
Montana Gulch	L-16	Below MT Pond at Flume	7/11/2005	968	--	--	1600	1120	--	--	4	0	--	5	--	--	--	--	--	0	--
Montana Gulch	L-16	Below MT Pond at Flume	3/31/2009	1410	--	7.2	--	1630	--	5	15.7	--	--	4	0	--	137	--	27	105	--
Montana Gulch	L-2	Lower MT Gulch	6/7/2001	628.3	--	8.03	922	560	--	--	--	< 5	--	--	--	--	--	0	--	--	24
Montana Gulch	L-2	Lower MT Gulch	9/27/2001	--	--	--	--	--	--	58	--	--	--	--	1990	--	--	0	--	310	--
Montana Gulch	L-2	Lower MT Gulch	8/11/2004	877	--	8.2	2370	1460	--	15	0.5	54	--	3	210	--	40	0	27	30	0
Montana Gulch	L-2	Lower MT Gulch	8/16/2006	1270	--	8.4	3830	2490	--	18	1.5	12	--	6	1440	--	93	2	42	115	--
Montana Gulch	L-47	Above Campground	6/7/2001	635.3	--	8.03	922	560	--	3	--	< 5	--	--	--	--	--	3	--	--	12
Montana Gulch	L-47	Above Campground	9/27/2001	--	--	--	926	--	--	24	--	--	--	--	230	--	--	3	--	40	--
Montana Gulch	L-47	Above Campground	9/27/2001	--	--	--	926	--	--	24	--	--	--	--	230	--	--	3	--	40	--
Montana Gulch	L-47	Above Campground	8/11/2004	874	--	8.1	--	1440	--	11	0.5	55	--	4	100	--	40	13	29	20	0
Montana Gulch	L-47	Above Campground	6/29/2005	999	--	--	2360	--	--	--	1.6	62	--	11	--	--	--	0	--	60	--
Montana Gulch	L-47	Above Campground	8/16/2006	1300	--	8.3	2410	2740	--	8	2.1	34	--	5	370	--	96	0	55	115	--
Montana Gulch	L-47	Above Campground	3/31/2009	1340	--	7.6	4250	1550	--	4	11.7	--	--	2	70	--	94	10	25	84	--
Rock Creek	L-1	Kolczak Crossing	5/30/1990	273	--	8.2	338	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Rock Creek	L-1	Kolczak Crossing	11/6/1990	411	0	7.4	551	--	--	12	--	--	--	--	--	--	--	--	--	--	--
Rock Creek	L-1	Kolczak Crossing	12/13/1990	372	--	7.7	546	275.5	--	25	< 1	< 5	< 20	< 10	780	< 1	40	--	< 5	220	4
Rock Creek	L-1	Kolczak Crossing	3/21/1991	363	91.56	8.3	477	247	--	29	< 1	< 5	< 20	< 10	710	< 1	< 30	10	< 5	90	2
Rock Creek	L-1	Kolczak Crossing	5/17/1991	348	785.45	8.3	399	180	--	14	0.1	< 5	< 20	1	730	< 0.2	< 30	< 2	< 5	80	8
Rock Creek	L-1	Kolczak Crossing	6/13/1991	391	848.29	8.4	487	217	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Rock Creek	L-1	Kolczak Crossing	7/24/1991	421	584.6	8.2	598	296	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Rock Creek	L-1	Kolczak Crossing	9/5/1991	460	315	8.3	605	329	--	--	--	< 5	--	--	--	--	--	--	--	--	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Rock Creek	L-1	Kolczak Crossing	9/5/1991	467	315	7.9	599	313	--	--	--	< 5	--	--	--	--	--	--	--	--	4
Rock Creek	L-1	Kolczak Crossing	10/20/1991	357	212.7	8	575	236	--	8	< 1	< 5	< 20	< 10	310	< 1	40	< 10	< 5	270	13
Rock Creek	L-1	Kolczak Crossing	5/30/1992	388	58.34	8.2	512	251	--	27	< 1	< 5	< 10	< 10	1170	< 1	< 30	< 10	< 5	130	16
Rock Creek	L-1	Kolczak Crossing	10/16/1992	389	260.32	8.1	584	315	--	< 5	< 1	< 5	< 10	< 10	720	< 1	70	10	< 5	270	11
Rock Creek	L-1	Kolczak Crossing	5/15/1993	429	341.11	8.2	563	276	--	16	2	< 5	< 10	< 10	850	< 1	20	< 10	< 5	100	8
Rock Creek	L-1	Kolczak Crossing	10/16/1993	526	718.13	7.8	747	410	--	5	5	< 5	< 10	< 10	240	< 1	90	20	< 5	730	1
Rock Creek	L-1	Kolczak Crossing	5/21/1994	443	650.8	8.3	579	289	--	14	< 1	< 5	< 10	< 10	1660	< 1	20	< 10	< 5	170	112
Rock Creek	L-1	Kolczak Crossing	10/29/1994	517	207.3	7.7	752	440	--	14	< 1	< 5	< 10	< 10	1270	< 1	50	< 10	< 5	280	40
Rock Creek	L-1	Kolczak Crossing	5/13/1995	436	267	7.9	656	358	--	48	< 1	< 5	< 10	10	5770	< 1	30	< 10	4	320	216
Rock Creek	L-1	Kolczak Crossing	10/18/1995	579	175	7.4	829	494	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Rock Creek	L-1	Kolczak Crossing	5/31/1996	448	1207.4	7.6	541	288	< 100	12	0.2	< 5	< 1	< 1	740	< 0.6	20	< 3	2	110	17
Rock Creek	L-1	Kolczak Crossing	10/23/1996	481	201.97	7.5	684	407	< 100	10	0.6	< 5	< 1	< 1	540	< 0.6	50	< 3	2	300	15
Rock Creek	L-1	Kolczak Crossing	4/19/1997	468	273.79	8	591	135	< 100	7	0.1	< 5	--	< 1	1090	--	< 20	< 3	1	140	24
Rock Creek	L-1	Kolczak Crossing	5/15/1997	483	259.87	7.3	622	311	< 100	10	< 0.1	< 5	--	2	420	--	< 20	< 3	2	90	10
Rock Creek	L-1	Kolczak Crossing	6/19/1997	494.6	1207.4	8.12	750	427.6	< 100	7	12.3	< 5	--	29	1180	--	130	4	2	1040	12
Rock Creek	L-1	Kolczak Crossing	8/14/1997	587.4	668.75	8.14	934	459.8	< 100	15	1.8	< 5	--	7	1580	--	60	< 3	5	330	10
Rock Creek	L-1	Kolczak Crossing	10/25/1997	--	--	--	--	--	< 100	--	--	< 5	--	< 1	--	--	--	< 3	--	--	10
Rock Creek	L-1	Kolczak Crossing	2/12/1998	626.2	--	--	830	503.2	< 100	4	0.2	< 5	--	11	120	--	< 20	< 3	< 1	50	10
Rock Creek	L-1	Kolczak Crossing	4/16/1998	689.8	--	--	993	556.4	< 100	< 3	0.3	< 5	--	2	10	--	< 20	< 3	3	70	10
Rock Creek	L-1	Kolczak Crossing	5/13/1998	646.2	--	--	928	528.6	160	< 3	0.1	< 5	--	30	150	--	< 20	5	2	60	10
Rock Creek	L-1	Kolczak Crossing	6/19/1998	666.4	--	--	988	588.1	< 100	7	0.4	< 5	--	13	490	--	< 20	< 3	3	80	10
Rock Creek	L-1	Kolczak Crossing	8/6/1998	813.1	--	--	1231	715.8	< 100	8	0.6	< 5	--	58	710	--	< 20	11	2	90	26
Rock Creek	L-1	Kolczak Crossing	10/8/1998	913.1	--	--	1336	816.2	< 100	< 3	0.2	< 5	--	36	110	--	< 20	< 3	< 1	60	12
Rock Creek	L-1	Kolczak Crossing	8/11/2004	769	--	8.2	1710	1020	--	9	0.2	33	--	4	500	--	20	0	9	40	14
Rock Creek	L-23	Rock Creek at Flume	5/30/1990	94	--	8	115	24	--	--	--	< 5	--	--	780	--	--	0	--	20	3
Rock Creek	L-23	Rock Creek at Flume	10/10/1990	299	17	7.8	312	113	--	< 5	< 1	< 5	< 20	< 10	< 30	< 1	< 30	10	< 5	20	1
Rock Creek	L-23	Rock Creek at Flume	11/6/1990	300	6.7	7.8	354	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Rock Creek	L-23	Rock Creek at Flume	12/13/1990	284	0	8.1	334	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Rock Creek	L-23	Rock Creek at Flume	1/12/1991	390	5	7.7	472	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Rock Creek	L-23	Rock Creek at Flume	3/21/1991	254	20	8	273	108	--	< 5	< 1	< 5	< 20	< 10	160	< 1	< 30	< 10	< 5	20	6
Rock Creek	L-23	Rock Creek at Flume	5/16/1991	131	359.06	7.9	149	78	--	< 5	0	< 5	< 20	2	250	< 0.2	< 30	2	< 5	10	1
Rock Creek	L-23	Rock Creek at Flume	6/13/1991	149	291.29	8.3	217	82	--	--	--	< 5	--	--	--	--	--	0	--	--	--
Rock Creek	L-23	Rock Creek at Flume	7/24/1991	281	22.44	8.1	392	163	--	--	--	< 5	--	--	--	--	--	0	--	--	--
Rock Creek	L-23	Rock Creek at Flume	9/5/1991	357	15	7.6	431	174	--	--	--	< 5	--	--	--	--	--	0	--	--	--
Rock Creek	L-23	Rock Creek at Flume	10/18/1991	311	6.67	8.1	426	165	--	< 5	< 1	< 5	< 20	< 10	< 30	< 1	< 30	10	< 5	20	5
Rock Creek	L-23	Rock Creek at Flume	5/30/1992	354	0.05	8.2	408	152	--	< 5	< 1	< 5	< 10	< 10	< 30	< 1	< 30	< 10	< 5	< 10	1
Rock Creek	L-23	Rock Creek at Flume	10/15/1992	304	5.5	7	375	149	--	< 5	< 1	< 5	< 10	< 10	160	< 1	< 30	< 10	< 5	20	8
Rock Creek	L-23	Rock Creek at Flume	5/15/1993	141	62.84	8.1	175	43	--	< 5	< 1	< 5	< 10	< 10	100	< 1	< 10	< 10	< 5	10	1
Rock Creek	L-23	Rock Creek at Flume	10/16/1993	220	38.69	7.8	264	83	--	< 5	< 1	< 5	< 10	< 10	< 30	< 1	< 10	10	< 5	110	18
Rock Creek	L-23	Rock Creek at Flume	5/21/1994	140	170.8	8.2	171	46	--	< 5	< 1	< 5	< 10	< 10	280	< 1	< 10	< 10	< 5	30	24

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Rock Creek	L-23	Rock Creek at Flume	8/3/1994	274	7.32	8.2	343	99	--	< 5	< 1	< 5	< 10	< 10	< 30	< 1	< 10	< 10	< 5	< 10	1
Rock Creek	L-23	Rock Creek at Flume	10/30/1994	295	9.42	8	367	120	--	< 5	< 1	< 5	< 10	< 10	< 30	< 1	< 10	< 10	< 5	10	14
Rock Creek	L-23	Rock Creek at Flume	1/26/1995	297	0	7.9	428	140	< 100	< 5	< 1	< 5	< 10	< 10	< 30	< 1	< 10	< 10	< 5	20	1
Rock Creek	L-23	Rock Creek at Flume	5/13/1995	107	107.5	7.8	161	42	--	< 5	< 1	7	< 10	< 10	370	< 1	< 10	< 10	< 5	20	10
Rock Creek	L-23	Rock Creek at Flume	6/22/1995	--	0	--	--	--	--	< 5	--	< 5	--	--	--	--	--	--	--	--	--
Rock Creek	L-23	Rock Creek at Flume	7/25/1995	162	15	7.9	213	60	--	< 5	< 1	< 5	< 10	< 10	100	< 1	< 10	< 10	< 5	20	10
Rock Creek	L-23	Rock Creek at Flume	10/19/1995	234	9.42	7.5	306	98	< 100	< 3	< 0.1	< 5	< 10	< 1	10	< 1	< 10	< 3	< 5	< 10	10
Rock Creek	L-23	Rock Creek at Flume	5/31/1996	108	513	7.9	129	39	< 100	5	< 0.1	< 5	< 1	2	480	< 0.6	< 20	< 3	< 1	30	10
Rock Creek	L-23	Rock Creek at Flume	8/13/1996	265	0	7.2	334	111	< 100	< 3	< 0.1	< 5	< 2	3	430	< 0.6	< 20	< 3	< 1	30	10
Rock Creek	L-23	Rock Creek at Flume	10/23/1996	290	4.49	7.5	368	135	< 100	< 3	< 0.1	< 5	< 1	< 1	20	< 0.6	< 20	< 3	< 1	20	10
Rock Creek	L-23	Rock Creek at Flume	2/14/1997	334	0	7.9	405	149	< 100	< 3	< 0.2	< 5	< 1	< 1	30	< 0.6	< 20	< 3	1	40	10
Rock Creek	L-23	Rock Creek at Flume	4/19/1997	105	273.34	7.9	157	49	< 100	< 3	< 0.1	< 5	--	3	900	--	< 20	< 3	< 1	30	10
Rock Creek	L-23	Rock Creek at Flume	5/15/1997	160	38.15	8	219	60	< 100	< 3	< 0.1	< 5	--	< 1	20	--	< 20	< 3	< 1	20	10
Rock Creek	L-23	Rock Creek at Flume	6/19/1997	176.1	85.28	8.25	304	113.6	< 100	< 3	< 0.1	< 5	--	4	30	--	< 20	< 3	< 1	20	10
Rock Creek	L-23	Rock Creek at Flume	6/19/1998	86.3	--	--	140	31.7	590	< 3	< 0.1	< 5	--	26	1820	--	< 20	< 3	1	30	10
Rock Creek	L-23	Rock Creek at Flume	8/6/1998	175.8	--	--	242	72.1	< 100	< 3	0.5	< 5	--	2	20	--	< 20	< 3	< 1	< 10	10
Rock Creek	L-29	Rock Creek Above Sullivan	8/23/1990	145	--	7.5	215	96	--	7	< 1	--	< 20	< 10	40	< 1	< 30	< 10	< 5	30	1
Rock Creek	L-29	Rock Creek Above Sullivan	11/1/1990	182	2	7	272	129	--	< 5	< 1	< 5	< 20	< 10	40	< 1	< 30	< 10	< 5	80	16
Rock Creek	L-29	Rock Creek Above Sullivan	12/12/1990	177	1.5	7.1	257	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Rock Creek	L-29	Rock Creek Above Sullivan	3/21/1991	--	328	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Rock Creek	L-29	Rock Creek Above Sullivan	5/15/1991	29	327.65	7	48	14	--	< 5	< 0.1	< 5	< 20	5	860	< 0.2	< 30	3	< 5	10	1
Rock Creek	L-29	Rock Creek Above Sullivan	6/12/1991	36	302.96	7.4	56	14	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Rock Creek	L-29	Rock Creek Above Sullivan	7/24/1991	87	19.75	7	148	49	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Rock Creek	L-29	Rock Creek Above Sullivan	9/5/1991	161	8	7.2	224	104	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Rock Creek	L-29	Rock Creek Above Sullivan	10/17/1991	185	1	7.4	252	110	--	5	1	< 5	< 20	< 10	260	< 1	< 30	< 10	< 5	100	28
Rock Creek	L-29	Rock Creek Above Sullivan	10/15/1992	103	2.61	7.6	149	59	--	< 5	< 1	< 5	< 10	< 10	< 30	< 1	< 30	< 10	< 5	60	5
Rock Creek	L-29	Rock Creek Above Sullivan	5/16/1993	49	38.15	7.2	89	21	--	< 5	< 1	< 5	< 10	< 10	390	< 1	< 10	< 10	< 5	30	4
Rock Creek	L-29	Rock Creek Above Sullivan	10/15/1993	90	17.64	7.3	140	54	--	--	--	< 5	--	--	--	--	--	--	--	--	24
Rock Creek	L-29	Rock Creek Above Sullivan	5/20/1994	48	108.5	7.6	85	21	--	< 5	< 1	< 5	< 10	< 10	1060	< 1	< 10	< 10	< 5	30	60
Rock Creek	L-29	Rock Creek Above Sullivan	8/3/1994	148	31.4	7.7	217	94	--	6	< 1	< 5	< 10	< 10	130	< 1	10	< 10	< 5	40	7
Rock Creek	L-29	Rock Creek Above Sullivan	10/30/1994	181	2.69	7.4	269	124	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Rock Creek	L-29	Rock Creek Above Sullivan	5/14/1995	30	76	7.2	69	15	--	5	< 1	9	< 10	< 10	2520	< 1	< 10	< 10	< 5	40	10
Rock Creek	L-29	Rock Creek Above Sullivan	10/19/1995	81	3	7.7	141	51	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Rock Creek	L-29	Rock Creek Above Sullivan	10/19/1995	77	3	7.6	132	52	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Rock Creek	L-29	Rock Creek Above Sullivan	6/1/1996	34	256	6	87	14	2500	8	< 0.1	< 5	2	6	1620	< 0.6	< 20	< 3	< 1	50	10
Rock Creek	L-29	Rock Creek Above Sullivan	10/24/1996	159	0.63	7.1	223	114	--	--	--	< 5	--	0	--	--	--	--	--	--	--
Rock Creek	L-29	Rock Creek Above Sullivan	4/16/1997	50	30.97	7.1	112	30	300	4	< 0.1	< 5	--	6	1140	--	< 20	< 3	< 1	40	10
Rock Creek	L-29	Rock Creek Above Sullivan	5/15/1997	38	34.56	7.1	100	24	400	4	< 0.1	< 5	--	4	750	--	< 20	< 3	< 1	< 30	10
Rock Creek	L-29	Rock Creek Above Sullivan	6/19/1997	32.2	76.3	7.6	105	23.3	380	< 3	< 0.1	< 5	--	23	460	--	< 20	< 3	< 1	< 50	10
Rock Creek	L-29	Rock Creek Above Sullivan	8/14/1997	93.9	4.49	7.48	194	80.2	< 100	4	< 0.1	< 5	--	< 1	40	--	< 20	< 3	< 1	< 10	10

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Rock Creek	L-29	Rock Creek Above Sullivan	10/25/1997	--	--	--	--	--	< 100	--	--	< 5	--	--	--	--	--	--	< 1	--	10
Rock Creek	L-29	Rock Creek Above Sullivan	4/23/1998	63.2	--	--	102	30	460	4	0.2	< 5	--	6	920	--	< 20	16	< 1	30	10
Rock Creek	L-29	Rock Creek Above Sullivan	5/20/1998	75.9	--	--	137	44	140	6	< 0.1	< 5	--	42	100	--	< 20	12	< 1	20	10
Rock Creek	L-29	Rock Creek Above Sullivan	6/24/1998	29.3	--	--	112	12	810	< 3	< 0.1	< 5	--	16	2470	--	< 20	8	< 1	40	11
Rock Creek	L-29	Rock Creek Above Sullivan	8/6/1998	52.9	--	--	162	29	710	12	< 0.1	< 5	--	22	780	--	< 20	10	< 1	20	10
Rock Creek	L-4	Rock Creek at Landusky	5/30/1990	136	--	7.5	181	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Rock Creek	L-4	Rock Creek at Landusky	5/17/1991	199	341.11	8	237	122	--	< 3	< 0.1	< 5	< 20	< 1	90	< 0.2	< 30	< 3	< 5	< 10	1
Rock Creek	L-4	Rock Creek at Landusky	6/13/1991	253	161.58	8.4	339	151	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Rock Creek	L-4	Rock Creek at Landusky	5/31/1996	291	580	7.4	351	193	400	< 3	3.4	< 5	< 1	3	270	< 0.6	30	< 3	< 2	150	10
Rock Creek	L-4	Rock Creek at Landusky	4/19/1997	216	189.5	7.7	274	120	< 100	< 3	0.2	< 5	--	2	420	--	< 20	< 3	< 1	30	10
Rock Creek	L-4	Rock Creek at Landusky	6/19/1997	442.6	53.85	8.26	703	372	< 100	< 3	0.2	< 5	--	< 1	20	--	< 20	< 3	< 2	< 50	10
Rock Creek	L-4	Rock Creek at Landusky	6/23/1998	194	--	--	287	108	290	9	0.2	< 5	--	17	2650	--	< 20	8	< 1	40	162
Ruby Creek	R-22	Spring below Goslin Flats LAD	7/13/2000	--	--	7.27	2865	1273	--	< 3	0.5	125	--	< 1	--	--	--	--	22	20	--
Ruby Creek	R-22	Spring below Goslin Flats LAD	9/8/2000	--	--	6.98	2928	1326	--	< 3	0.1	185	--	< 1	--	--	--	--	36	20	--
Ruby Creek	R-22	Spring below Goslin Flats LAD	9/18/2001	--	--	7.22	3232	1478	--	< 3	0.3	163	--	< 1	--	--	--	--	66	30	--
Ruby Creek	R-22	Spring below Goslin Flats LAD	10/18/2001	--	--	7.59	3269	1541	--	< 3	0.2	196	--	3	--	--	--	--	165	20	--
Ruby Creek	R-22	Spring below Goslin Flats LAD	6/30/2002	--	--	7.6	3320	1580	--	< 3	0.4	470	--	3	--	--	--	--	70	30	--
Ruby Creek	R-22	Spring below Goslin Flats LAD	8/2/2002	--	--	7.4	3370	1600	--	< 3	0.5	600	--	3	< 10	--	--	--	144	20	--
Ruby Creek	R-22	Spring below Goslin Flats LAD	8/21/2002	--	--	7.3	3400	1630	--	< 3	0.3	700	--	6	--	--	--	--	157	20	--
Ruby Creek	R-22	Spring below Goslin Flats LAD	10/29/2002	--	--	7.6	3290	1770	--	< 3	0.1	521	--	4	--	--	--	--	183	20	--
Ruby Creek	R-22	Spring below Goslin Flats LAD	2/20/2003	--	--	7.6	--	1450	--	< 3	< 0.1	460	--	10	--	--	--	--	175	10	--
Ruby Creek	R-22	Spring below Goslin Flats LAD	4/24/2003	--	--	7.4	2820	1330	--	< 3	< 0.1	340	--	9	--	--	--	--	131	10	--
Ruby Creek	R-22	Spring below Goslin Flats LAD	7/15/2003	--	--	7.2	2940	1470	--	< 3	0.4	440	--	5	--	--	--	--	210	20	--
Ruby Creek	R-22	Spring below Goslin Flats LAD	10/16/2003	--	--	7.3	2880	1440	--	< 3	0.3	381	--	5	--	--	--	--	198	20	--
Ruby Creek	R-22	Spring below Goslin Flats LAD	3/11/2004	--	--	7.4	2960	1470	--	< 3	0.1	460	--	9	--	--	--	--	257	60	--
Ruby Creek	R-22	Spring below Goslin Flats LAD	6/3/2004	--	--	7.5	3040	1640	--	< 3	0.2	400	--	4	--	--	--	--	138	< 10	--
Ruby Creek	R-22	Spring below Goslin Flats LAD	8/17/2004	--	--	7.2	3180	1530	--	< 3	0.2	478	--	4	--	--	--	--	167	10	--
Ruby Creek	R-22	Spring below Goslin Flats LAD	11/2/2004	--	--	7.5	--	1690	--	< 3	0.2	520	--	4	--	--	--	--	201	< 10	--
Ruby Creek	R-22	Spring below Goslin Flats LAD	3/17/2005	--	--	7.6	3360	1550	--	< 3	0.2	470	--	4	--	--	--	--	216	10	--
Ruby Creek	R-22	Spring below Goslin Flats LAD	6/23/2005	--	--	7.6	3460	1520	--	< 3	0.3	--	--	9	--	--	--	--	246	20	--
Ruby Creek	R-22	Spring below Goslin Flats LAD	8/21/2005	--	--	7.3	3490	1590	--	< 3	0.3	359	--	4	--	--	--	--	301	20	--
Ruby Creek	R-22	Spring below Goslin Flats LAD	8/21/2005	--	--	7.3	3490	1590	--	< 3	0.3	359	--	4	--	--	--	--	301	20	--
Ruby Creek	R-22	Spring below Goslin Flats LAD	11/9/2005	--	--	7.5	3830	1920	--	< 3	0.3	486	--	9	--	--	--	--	376	20	--
Ruby Creek	R-22	Spring below Goslin Flats LAD	6/27/2006	--	--	7.2	3190	1500	--	4	0.2	120	--	6	--	--	--	--	197	15	--
Ruby Creek	R-22	Spring below Goslin Flats LAD	9/12/2006	--	--	7.4	3280	1590	--	4	0.3	108	--	8	--	--	--	--	242	15	--
Ruby Creek	R-22	Spring below Goslin Flats LAD	10/11/2006	1860	--	7.3	--	1680	--	4	0.2	152	--	3	50	8	--	--	302	15	--
Ruby Creek	R-22	Spring below Goslin Flats LAD	6/9/2008	1330	--	7.3	--	1350	--	2	0.2	--	--	4	< 0.01	3	--	--	108	10	--
Ruby Creek	R-22	Spring below Goslin Flats LAD	11/23/2008	1340	--	7.5	--	1290	--	2	0.2	--	--	4	< 0.01	13	--	--	69	10	--
Ruby Creek	R-22	Spring below Goslin Flats LAD	6/18/2009	1650	--	7.4	--	1790	--	2	0.2	--	--	2	< 0.01	4	--	--	177	13	--
Ruby Creek	R-22	Spring below Goslin Flats LAD	12/28/2009	1750	--	7.3	--	1650	--	1	0.2	--	--	2	< 0.01	3	--	--	249	15	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Ruby Creek	R-22	Spring below Goslin Flats LAD	6/14/2010	1570	--	7.3	--	--	--	2	< 0.1	--	--	2	60	3	--	--	163	12	--
Ruby Creek	R-22	Spring below Goslin Flats LAD	7/13/2010	1180	--	7.6	--	--	--	2	0.2	--	--	< 1	20	2	--	--	50	9	--
Ruby Creek	Z-22C	Goslin South Boundary	7/13/2010	978	--	8.2	--	--	--	8	0.2	--	--	8	1710	--	7	--	41	23	--
Ruby Creek	Z-23	CK Creek at cut across	7/13/2010	1060	0	8.2	--	--	--	4	< 0.1	--	--	4	260	--	5	--	43	7	--
Ruby Creek	Z-17	Ruby Creek	5/4/1990	246	64.5	7.5	381	194	--	133	24	9	40	900	49200	1	200	240	< 5	2560.0	4100
Ruby Creek	Z-17	Ruby Creek	5/14/1991	785	219.92	4.5	1200	797	--	212	115	16	50	3660	90600	3	750	250	< 5	8250.0	9710
Ruby Creek	Z-17	Ruby Creek	6/11/1991	783	112.21	4.8	1380	854	--	--	--	42	--	--	--	--	--	--	--	--	--
Ruby Creek	Z-32	Ruby Creek above Goslin Gulch	9/27/1990	408	--	8.1	518	195	--	< 5	< 1	< 5	20	< 10	110	1	< 30	< 10	< 5	10.0	4
Ruby Creek	Z-32	Ruby Creek above Goslin Gulch	11/1/1990	484.5	1	7.85	654.5	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Ruby Creek	Z-32	Ruby Creek above Goslin Gulch	12/11/1990	472	--	7.8	623	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Ruby Creek	Z-32	Ruby Creek above Goslin Gulch	5/14/1991	722	98.74	4.7	1200	841	--	182	119	10	40	2760	68100	2.4	700	190	< 5	8050.0	5810
Ruby Creek	Z-32	Ruby Creek above Goslin Gulch	6/11/1991	794	46.23	5	1370	849	--	--	--	7	--	--	--	--	--	--	--	--	--
Ruby Creek	Z-32	Ruby Creek above Goslin Gulch	7/23/1991	537	3.14	7.8	727	286	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Creek	Z-32	Ruby Creek above Goslin Gulch	9/4/1991	464	107.72	8.2	594	216	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Creek	Z-32	Ruby Creek above Goslin Gulch	10/16/1991	432	14.81	7.9	574	199	--	< 5	< 1	< 5	20	< 10	90	1	< 30	< 10	< 5	< 10	3
Ruby Creek	Z-32	Ruby Creek above Goslin Gulch	10/14/1993	415	229.44	8.1	567	207	--	--	--	< 5	--	--	--	--	--	--	--	--	20
Ruby Creek	Z-32	Ruby Creek above Goslin Gulch	8/11/1997	396.6	219.92	8.14	576	214	< 100	27	0.7	< 5	--	--	2890	--	--	--	2.0	--	132
Ruby Creek	Z-32	Ruby Creek above Goslin Gulch	10/23/1997	--	--	--	--	--	< 100	--	< 0.1	< 5	--	--	--	--	--	--	< 1	--	--
Ruby Creek	Z-32	Ruby Creek above Goslin Gulch	10/30/1998	421.6	--	--	609	225	< 100	< 3	< 0.1	< 5	--	79	50	--	< 20	4	< 1	< 10	10
Ruby Creek	Z-32	Ruby Creek above Goslin Gulch	7/13/2010	788	--	8.1	--	--	--	3	0	--	--	33	260	--	2	--	25.0	8.0	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/5/2000	3078.9	--	--	--	--	--	< 3	1.8	< 5	--	11	320	--	40	< 3	1	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/6/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/27/2000	1949	--	--	--	--	--	--	1.7	< 5	--	4	--	--	--	< 3	--	< 10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/28/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/31/2000	1875.8	--	--	--	--	--	--	2.4	< 5	--	10	--	--	--	< 3	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/31/2000	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/1/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/8/2000	1644	--	--	--	--	--	< 3	1.5	< 5	--	14	560	--	< 20	< 3	3	30	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/10/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/14/2000	1508.6	--	--	--	--	--	--	1.7	< 5	--	13	--	--	--	< 3	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/15/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/6/2000	1703	--	--	--	--	--	< 3	4.3	< 5	--	15	550	--	80	< 3	< 1	30	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/7/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/15/2000	1579	--	--	--	--	--	--	1.4	< 5	--	10	--	--	--	< 3	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/15/2000	1560	--	--	--	--	--	--	1.5	< 5	--	10	--	--	--	< 3	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/15/2000	1	--	--	--	--	--	--	0.1	< 5	--	1	--	--	--	< 3	--	< 10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/16/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/20/2000	1633	--	--	--	--	--	--	1.4	< 5	--	7	--	--	--	< 3	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/21/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/27/2000	1680	--	--	--	--	--	--	0.1	< 5	--	6	--	--	--	< 3	--	10	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/28/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/10/2000	1718.3	--	--	--	--	--	< 3	0.8	< 5	--	4	130	--	< 20	< 3	< 1	< 10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/11/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/17/2000	1789.1	--	--	--	--	--	--	0.9	< 5	--	5	--	--	--	< 3	--	< 10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/18/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/24/2000	1916	--	--	--	--	--	--	1.1	< 5	--	8	--	--	--	< 3	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/25/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/9/2000	2196.6	--	--	--	--	--	< 3	1	< 5	--	6	180	--	< 20	< 3	2	< 10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/10/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/15/2000	2111	--	--	--	--	--	--	1	< 5	--	7	--	--	--	< 3	--	< 10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/16/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/23/2000	1927.6	--	--	--	--	--	--	0.7	5	--	37	--	--	--	< 3	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/23/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/31/2000	1972.3	--	--	--	--	--	--	0.6	< 5	--	6	--	--	--	< 3	--	< 10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/1/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/12/2000	2603.1	--	--	--	--	--	< 3	2.6	< 5	--	9	220	--	50	< 3	< 1	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/21/2000	2296	--	--	--	--	--	--	1.2	< 5	--	9	--	--	--	< 3	--	150	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/21/2000	2276	--	--	--	--	--	--	1.1	< 5	--	8	--	--	--	< 3	--	40	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/21/2000	1	--	--	--	--	--	--	< 0.1	< 5	--	1	--	--	--	< 3	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/29/2000	2260	--	--	--	--	--	--	1.4	< 5	--	9	--	--	--	< 3	--	< 10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/30/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/7/2000	2297	--	7.59	--	--	--	8	1.3	< 5	--	8	230	--	< 20	< 3	< 1	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/8/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/17/2000	2227	--	--	--	--	--	--	2.1	< 5	--	20	--	--	--	< 3	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/18/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/31/2000	2318	--	--	--	--	--	--	1.2	< 5	--	10	--	--	--	< 3	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/1/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/16/2000	1869	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/16/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/30/2000	2423	--	--	--	--	--	--	1.8	< 5	--	8	--	--	--	< 3	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/31/2000	--	--	--	--	--	--	--	--	14	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	9/13/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	9/15/2000	2527.9	--	--	--	--	--	< 3	2.8	< 5	--	6	200	--	60	< 3	1	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	9/28/2000	2284	--	--	--	--	--	--	3.3	< 5	--	9	--	--	--	< 3	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	9/29/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	10/12/2000	2092	--	--	--	--	--	< 3	1.8	< 5	--	11	200	--	< 20	< 3	2	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	10/13/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	10/30/2000	2419	--	--	--	--	--	--	5	< 5	--	12	--	--	--	< 3	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	10/31/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/13/2000	2152	--	--	--	--	--	< 3	1.9	< 5	--	10	210	--	< 20	< 3	< 1	20	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/14/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/20/2000	2339	--	--	--	--	--	--	--	< 5	--	11	--	--	--	< 3	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/21/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/27/2000	2186	--	--	--	--	--	--	0.2	< 5	--	13	--	--	--	< 3	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/28/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/4/2000	--	--	--	--	--	--	< 3	--	--	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/4/2000	2401	--	--	--	--	--	< 3	1.3	< 5	--	7	180	--	30	< 3	< 1	< 10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/4/2000	2154	--	--	--	--	--	< 3	1.3	< 5	--	8	190	--	30	< 3	< 1	< 10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/5/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/18/2000	2019.8	--	--	--	--	--	--	1.8	< 5	--	18	--	--	0	< 3	--	30	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/19/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/26/2000	2020.9	--	--	--	--	--	--	1.6	< 5	--	7	--	--	0	< 3	--	< 10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/27/2000	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/2/2001	1815	--	--	2709	1775.0	--	< 3	1.3	< 5	--	18	460	--	30	< 3	3	30	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/3/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/15/2001	1745	--	--	2720	1792.0	--	--	0.9	< 5	--	6	--	--	--	< 3	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/16/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/30/2001	1843.3	--	--	2775	1822.0	--	--	2.2	< 5	--	8	--	--	--	< 3	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/31/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/6/2001	1944.2	--	--	2699	1763.0	--	< 3	2.3	8	--	12	360	--	< 20	< 3	< 1	30	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/7/2001	--	--	--	--	--	--	--	--	12	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/14/2001	1743.1	--	--	2276	1756.0	--	--	2.5	< 5	--	9	--	--	--	< 3	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/15/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/19/2001	1784.9	--	--	2615	1754.0	--	--	2.1	< 5	--	6	--	--	--	< 3	--	< 10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/20/2001	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/6/2001	1876.6	--	--	2789	1860.3	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/7/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/19/2001	1634.3	--	--	2511	1650.0	--	--	2.8	< 5	--	16	--	--	--	< 3	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/20/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/28/2001	1452.4	--	--	2305	1520.0	--	--	1.6	< 5	--	9	--	--	--	< 3	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/29/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/2/2001	1556.3	--	--	2384	1580.5	--	< 3	1.9	< 5	--	6	260	--	40	< 3	2	< 10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/3/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/9/2001	499	--	--	2286	1511.2	--	--	1.7	< 5	--	10	--	--	0	< 3	--	20	10
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/10/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/16/2001	1466	--	--	2374	1554.0	--	--	1.5	< 5	--	7	--	--	0	< 3	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/17/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/23/2001	1545.1	--	--	2280	1549.0	--	--	1	< 5	--	6	--	--	0	< 3	--	< 10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/24/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/9/2001	1644.4	--	--	2587	1773.0	--	< 3	1.1	< 5	--	38	440	--	20	< 3	< 1	20	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/10/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/23/2001	1962	--	--	3077	2049.0	--	--	1.5	< 5	--	19	--	--	--	< 3	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/5/2001	1766	--	--	2749	1828.0	--	< 3	0.7	< 5	--	7	270	--	< 20	< 3	< 1	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/6/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/11/2001	2574	--	--	3787	2666	--	< 3	0.9	< 5	--	48	340	--	< 20	< 3	< 1	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/12/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/18/2001	2803	--	--	4035	2739	--	< 3	1.7	< 5	--	3	100	--	< 20	< 3	3	< 10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/19/2001	--	--	--	--	--	--	--	--	5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/25/2001	2174	--	--	3269	2180	--	--	0.5	< 5	--	< 1	--	--	--	< 3	--	< 10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/26/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/9/2001	2191.4	--	--	3818	2549	--	--	1.8	< 5	--	6	--	--	--	< 3	--	< 10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/10/2001	--	--	--	--	--	--	--	--	< 5	--	0	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/17/2001	2435	--	--	3996	2695	--	--	3.6	< 5	--	2	--	--	--	< 3	--	< 10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/18/2001	--	--	--	--	--	--	--	--	< 5	--	0	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/26/2001	2379	--	--	3625	2506	--	--	13.9	< 5	--	6	--	--	--	< 3	--	50	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/27/2001	--	--	--	--	--	--	--	--	< 5	--	0	--	--	--	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/7/2001	2742.5	--	--	4027	2703	--	< 3	15.3	6	--	4	180	--	190	< 3	< 1	70	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/8/2001	--	--	--	--	--	--	--	--	8	--	0	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/14/2001	--	--	--	--	--	--	--	248	--	--	0	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/21/2001	2081.7	--	--	3421	2299	--	--	2.8	< 5	--	6	--	--	0	< 3	--	< 10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/22/2001	--	--	--	--	--	--	--	--	< 5	--	0	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	9/10/2001	2755	--	--	4191	2834	--	< 3	4.9	< 5	--	6	110	--	70	< 3	4	< 10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	9/11/2001	--	--	--	--	--	--	--	--	< 5	--	0	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	10/1/2001	1796.7	--	--	2818	1930	--	< 3	14.1	< 5	--	20	193	--	160	< 3	< 1	30	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	10/2/2001	--	--	--	--	--	--	--	--	< 5	--	0	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	10/15/2001	2855	--	--	4258	2930	--	--	34.1	< 5	--	29	--	--	0	< 3	--	100	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	10/16/2001	--	--	--	--	--	--	--	--	< 5	--	0	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	10/23/2001	2738	--	--	4128	2790	--	--	43.6	< 5	--	14	--	--	0	< 3	--	140	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	10/24/2001	--	--	--	--	--	--	--	--	< 5	--	0	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/5/2001	3110	--	--	4756	3152	--	< 3	42	< 5	--	6	150	--	520	< 3	< 1	100	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/6/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/19/2001	2550	--	--	4030	2630	--	--	31	13	--	< 1	--	--	0	< 10	--	60	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/20/2001	--	--	--	--	--	--	--	--	14	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/27/2001	2700	--	--	4100	2630	--	--	44	0	--	7	--	--	340	0	10	90	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/28/2001	--	--	--	--	--	--	--	--	0	--	0	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/4/2001	--	--	--	820	2630	--	0	27	0	--	7	--	--	250	--	9	40	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/5/2001	--	--	--	--	--	--	--	--	0	--	0	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/11/2001	2300	--	--	3530	2320	--	--	4	< 5	--	50	--	--	0	< 2	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/12/2001	--	--	--	--	--	--	--	--	< 5	--	0	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/17/2001	2270	--	--	3510	2500	--	--	9	< 5	--	10	--	--	0	2	--	30	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/18/2001	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/2/2002	2670	--	--	3910	2890	--	--	13	< 5	--	< 1	--	--	0	< 2	--	20	10
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/3/2002	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/7/2002	2260	--	--	3450	2330	--	< 5	6	< 5	--	< 1	150	--	80	< 2	9	< 10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/8/2002	--	--	--	--	--	--	--	--	< 5	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/14/2002	2370	--	--	2930	2420	--	--	4.4	0	--	13	--	--	0	0	--	20	11
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/23/2002	2350	--	--	3700	2500	--	--	10.7	0	--	5	--	--	0	0	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/24/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/28/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/29/2002	1900	--	--	3270	2170	--	--	2.4	0	--	6	--	--	0	0	--	0	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/5/2002	1940	--	--	3060	1900	--	0	2.1	0	--	10	320	--	20	0	12	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/6/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/13/2002	1920	--	--	3000	2040	--	--	1.4	0	--	7	--	--	0	0	--	0	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/14/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/19/2002	1850	--	--	2810	1930	--	0	1.2	0	--	10	410	--	20	0	8	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/20/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/4/2002	1990	--	--	2940	2000	--	0	1.4	0	--	6	270	--	20	0	7	0	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/5/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/13/2002	1680	--	--	2710	1730	--	--	1.7	0	--	20	--	--	0	0	--	40	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/14/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/25/2002	1630	--	--	2680	1800	--	--	0.6	0	--	11	--	--	0	0	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/26/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/9/2002	1720	--	--	2750	1810	--	0	1	0	--	13	440	--	40	0	8	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/10/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/15/2002	1700	--	--	2790	1860	--	--	1.4	0	--	12	--	--	0	0	--	0	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/16/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/22/2002	2030	--	--	3130	1990	--	--	1.1	0	--	10	--	--	0	0	--	0	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/23/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/29/2002	1940	--	--	3040	2040	--	--	0.8	0	--	12	--	--	0	0	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/30/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/6/2002	1950	--	--	3480	2170	--	0	1.1	0	--	8	220	--	10	0	10	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/7/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/14/2002	2220	--	--	3470	2340	--	--	1.3	0	--	10	--	--	0	0	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/15/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/21/2002	1970	--	--	3360	1950	--	--	0.9	0	--	12	--	--	0	0	--	10	24
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/22/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/29/2002	1940	--	--	3610	1730	--	--	1.2	0	--	8	--	--	0	0	--	0	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/30/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/10/2002	1770	--	--	3100	1760	--	0	1.1	0	--	10	100	--	40	0	12	0	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/11/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/17/2002	2080	--	--	3530	2370	--	0	0.7	0	--	8	140	--	0	0	12	0	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/19/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/24/2002	2090	--	--	3290	2100	--	--	1.1	0	--	10	--	--	0	0	--	30	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/25/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/8/2002	2200	--	--	3390	2200	--	--	1.9	0	--	11	--	--	0	0	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/9/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/17/2002	1950	--	--	3560	2350	--	--	1.8	0	--	14	--	--	0	0	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/18/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/23/2002	2175	--	--	3265	2040	--	--	5.7	0	--	10.5	--	--	0	0	--	30	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/24/2002	--	--	--	--	--	--	--	--	18	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/6/2002	2150	--	--	3790	2450	--	0	2.3	0	--	7	150	--	30	0	9	0	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/7/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/12/2002	2140	--	--	3670	2180	--	--	3.4	0	--	4	--	--	0	0	--	0	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/13/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/19/2002	1900	--	--	3110	1790	--	--	4.7	0	--	7	--	--	0	0	--	0	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/20/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/28/2002	781	--	--	1370	831	--	--	2.7	0	--	3	--	--	0	0	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/29/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	9/5/2002	2080	--	--	3750	2150	--	0	2.2	0	--	8	230	--	20	0	8	0	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	9/6/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	9/18/2002	2410	--	--	3870	2450	--	--	9.5	0	--	10	--	--	0	0	--	50	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	9/19/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	10/2/2002	2220	--	--	3660	2640	--	0	3.4	0	--	14	310	--	50	0	15	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	10/3/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	10/15/2002	1358	--	--	2421	1453	--	--	4.2	0	--	5	--	--	0	0	--	17	0
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	10/16/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	10/28/2002	1920	--	--	3490	2080	--	--	3.6	0	--	8	--	--	0	0	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	10/29/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/4/2002	2320	--	--	3810	2460	--	0	9.5	0	--	13	220	--	80	0	12	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/7/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/11/2002	2180	--	--	3890	2320	--	--	6.4	7	--	9	--	--	0	0	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/13/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/19/2002	1930	--	--	4080	2660	--	--	9.4	0	--	14	--	--	0	0	--	50	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/20/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/26/2002	2250	--	--	3820	2410	--	--	5.2	0	--	7	--	--	0	0	--	0	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/27/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/2/2002	2320	--	--	3740	2520	--	0	5.6	0	--	9	50	--	110	0	9	20	0
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/3/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/10/2002	2170	--	--	3670	2700	--	--	4.4	0	--	15	--	--	0	0	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/11/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/17/2002	2090	--	--	--	2850	--	--	4.8	0	--	18	--	--	0	0	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/18/2002	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/22/2002	2200	--	--	3500	2420	--	--	3.2	0	--	14	--	--	0	0	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/23/2002	--	--	--	--	--	--	--	--	7	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/6/2003	2040	--	--	3480	2380	--	0	4.4	46	--	14	140	--	30	0	7	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/7/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/14/2003	2390	--	--	3630	2490	--	--	2.5	0	--	8	--	--	0	0	--	0	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/15/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/20/2003	2170	--	--	3280	2200	--	--	4.8	0	--	12	--	--	0	0	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/21/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/27/2003	1950	--	--	3380	2030	--	0	4.4	0	--	9	--	--	0	0	9	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/28/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/5/2003	1880	--	--	3160	2110	--	0	5.3	--	--	24	370	--	70	0	6	40	0
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/6/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/12/2003	1920	--	--	3140	2090	--	--	4.2	0	--	7	--	--	0	0	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/13/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/17/2003	1970	--	--	3140	2070	--	--	4.6	0	--	14	--	--	0	0	--	40	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/18/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/25/2003	1880	--	--	3020	1960	--	--	4.8	0	--	13	--	--	0	0	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/26/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/10/2003	1770	--	--	3110	1990	--	0	6.7	0	--	14	400	--	140	0	9	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/13/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/17/2003	2240	--	--	3530	2600	--	--	7.6	0	--	13	--	--	0	0	--	40	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/18/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/24/2003	5260	--	--	3580	2480	--	--	4.3	0	--	8	--	--	0	0	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/25/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/1/2003	2280	--	--	3870	2440	--	0	4.6	0	--	7	140	--	60	0	13	0	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/2/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/7/2003	1900	--	--	4040	2780	--	--	2.7	0	--	10	--	--	0	0	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/8/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/14/2003	1850	--	--	3040	2020	--	--	1.5	56	--	33	--	--	0	0	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/15/2003	--	--	--	--	--	--	--	--	67	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/22/2003	2050	--	--	3880	2030	--	--	5.8	100	--	46	--	--	0	0	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/23/2003	--	--	--	--	--	--	--	--	111	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/28/2003	59	--	--	3820	2750	--	--	1.7	136	--	66	--	2	0	0	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/29/2003	--	--	--	--	--	--	--	--	134	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/5/2003	2060	--	--	3890	2710	--	0	2.7	131	--	67	250	--	40	0	12	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/6/2003	--	--	--	--	--	--	--	--	137	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/19/2003	2240	--	--	3630	2710	--	--	2.8	76	--	20	--	--	0	0	--	0	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/20/2003	--	--	--	--	--	--	--	--	46	--	--	--	--	0	--	--	--	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/27/2003	2060	--	--	3330	2230	--	--	1.8	43	--	21	--	--	0	0	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/28/2003	--	--	--	--	--	--	--	--	46	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/4/2003	2280	--	--	3740	2650	--	0	4	29	--	27	510	--	70	0	9	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/5/2003	--	--	--	--	--	--	--	--	26	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/11/2003	2140	--	--	3480	2450	--	--	3.5	26	--	20	--	--	0	0	--	30	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/12/2003	--	--	--	--	--	--	--	--	34	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/1/2003	2170	--	--	3620	2370	--	0	2.2	14	--	16	330	--	10	0	9	0	14
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/2/2003	--	--	--	--	--	--	--	--	18	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/14/2003	--	--	--	--	--	--	--	--	11	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/15/2003	1790	--	--	3030	1880	--	--	1	10	--	12	--	--	0	0	--	0	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/29/2003	2350	--	--	3790	2505	--	--	0.95	14.5	--	26.5	--	--	0	0	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/30/2003	--	--	--	--	--	--	--	--	15	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/18/2003	1970	--	--	3690	2500	--	0	1.8	7	--	12	340	--	10	0	7	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/19/2003	--	--	--	--	--	--	--	--	7	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	9/9/2003	2100	--	--	3450	2250	--	0	1.6	0	--	25	490	--	30	0	9	20	15
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	9/10/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	9/22/2003	2140	--	--	3570	2330	--	--	1.5	24	--	15	--	--	0	0	--	70	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	9/23/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	10/13/2003	2390	--	--	3820	2530	--	0	2.3	7	--	17	440	--	30	0	7	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	10/14/2003	--	--	--	--	--	--	--	--	8	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	10/27/2003	2260	--	--	3560	2310	--	--	5.7	8	--	13	--	--	0	0	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	10/28/2003	--	--	--	--	--	--	--	--	10	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/10/2003	1870	--	--	4720	2380	--	0	3.1	19	--	18	430	--	30	0	11	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/11/2003	--	--	--	--	--	--	--	--	13	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/16/2003	2250	--	--	3510	2380	--	--	3.2	8	--	12	--	--	0	0	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/17/2003	--	--	--	--	--	--	--	--	8	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/24/2003	2400	--	--	3710	2500	--	--	3.4	10	--	64	--	--	0	0	--	40	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/25/2003	--	--	--	--	--	--	--	--	11	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/3/2003	2400	--	--	3710	2470	--	0	3.5	0	--	16	370	--	40	0	11	20	0
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/4/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/8/2003	2360	--	--	3840	2640	--	--	3.4	0	--	12	--	--	0	0	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/9/2003	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/15/2003	2490	--	--	3850	2740	--	--	3.6	8	--	13	--	--	0	0	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/16/2003	--	--	--	--	--	--	--	--	9	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/21/2003	2610	--	--	3900	2630	--	--	3.5	10	--	14	--	--	0	0	--	30	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/23/2003	--	--	--	--	--	--	--	--	8	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/9/2004	2500	--	--	3700	2600	--	0	3.9	9	--	13	330	--	80	0	9	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/10/2004	--	--	--	--	--	--	--	--	9	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/12/2004	2710	--	--	4010	2830	--	--	4	8	--	10	--	--	0	0	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/13/2004	--	--	--	--	--	--	--	--	9	--	--	--	--	0	--	--	--	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/20/2004	1467	--	--	--	--	--	--	2.4	6	--	5	--	--	0	0	--	13	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/20/2004	2240	--	--	2233	1603	--	--	3.7	9	--	8	--	--	0	0	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/20/2004	2220	--	--	3330	2400	--	--	3.5	9	--	7	--	--	0	0	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/20/2004	0	--	--	3370	2410	--	--	0	0	--	0	--	--	0	0	--	0	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/21/2004	--	--	--	--	--	--	--	--	9	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/21/2004	--	--	--	--	--	--	--	--	9	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/4/2004	2300	--	--	3520	2320	--	0	4.3	13	--	14	210	--	70	0	11	20	11
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/5/2004	--	--	--	--	--	--	--	--	34	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/18/2004	2140	--	--	3600	2420	--	--	3.5	9	--	13	--	--	0	0	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/19/2004	--	--	--	--	--	--	--	--	9	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/25/2004	2370	--	--	3640	2550	--	0	3.6	8	--	10	170	--	80	0	10	10	0
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/26/2004	--	--	--	--	--	--	--	--	8	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/2/2004	2240	--	--	3490	2430	--	0	3.9	7	--	13	220	--	80	0	9	20	0
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/3/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/8/2004	950	--	--	3970	2570	--	--	3.1	0	--	16	--	--	0	0	--	30	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/9/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/14/2004	2730	--	--	4120	2110	--	--	5.5	0	--	6	--	--	0	0	--	0	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/16/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/22/2004	2260	--	--	3510	2060	--	--	10.7	0	--	12	--	--	0	0	--	80	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/23/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/29/2004	2380	--	--	3680	2160	--	--	4.4	0	--	19	--	--	0	0	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/30/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/5/2004	2850	--	--	3830	2730	--	0	3.2	6	--	11	230	--	30	0	9	0	42
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/6/2004	--	--	--	--	--	--	--	--	10	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/12/2004	2690	--	--	--	2330	--	--	10.1	9	--	12	--	--	0	0	--	30	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/13/2004	--	--	--	--	--	--	--	--	11	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/19/2004	2770	--	--	4310	2330	--	--	6.4	10	--	13	--	--	0	0	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/20/2004	--	--	--	--	--	--	--	--	10	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/26/2004	2610	--	--	4160		--	--	18.7	12	--	11	--	--	0	0	--	30	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/28/2004	--	--	--	--	--	--	--	--	10	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/3/2004	2320	--	--	3620	2390	--	0	4.2	9	--	6	120	--	60	0	8	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/5/2004	--	--	--	--	--	--	--	--	8	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/10/2004	2290	--	--	3630	2650	--	--	3.5	--	--	12	--	--	0	0	--	100	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/12/2004	--	--	--	--	--	--	--	--	8	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/18/2004	2460	--	--	3740	2350	--	--	5.7	--	--	10	--	--	0	0	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/19/2004	--	--	--	--	--	--	--	--	8	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/26/2004	2020	--	--	3380		--	--	5	0	--	9	--	--	0	0	--	0	347
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/27/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/1/2004	2710	--	--	3940	2200	--	0	3	0	--	2	130	--	30	0	7	0	433
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/2/2004	--	--	--	--	--	--	--	--	0	--	--	--	--	0	--	--	--	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/8/2004	2320	--	--	3860	1990	--	--	3.8	8	--	24	--	--	0	0	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/9/2004	--	--	--	--	--	--	--	--	8	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/13/2004	2360	--	--	--	2470	--	--	3.1	8	--	8	--	--	0	0	--	10	23
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/14/2004	--	--	--	--	--	--	--	--	8	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/21/2004	2540	--	--	3600	2040	--	--	4.4	7	--	13	--	--	0	0	--	20	524
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/22/2004	--	--	--	--	--	--	--	--	7	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/28/2004	2540	--	--	3200	2510	--	--	7.1	--	--	11	--	--	0	0	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/29/2004	--	--	--	--	--	--	--	--	9	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/6/2004	2280	--	--	3430	2160	--	0	9.4	10	--	10	150	--	90	0	9	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/7/2004	--	--	--	--	--	--	--	--	10	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/13/2004	2370	--	--	3650	--	--	--	7.8	9	--	12	--	--	0	0	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/14/2004	--	--	--	--	--	--	--	--	9	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/20/2004	2210	--	--	3460	1780	--	--	1.9	8	--	12	--	--	0	0	--	30	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/21/2004	--	--	--	--	--	--	--	--	7	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/29/2004	1890	--	--	2800	1760	--	--	3.1	13	--	35	--	--	0	0	--	30	281
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/30/2004	--	--	--	--	--	--	--	--	9	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/9/2004	2570	--	--	3970	2170	--	3	3.9	9	--	17	270	--	0	0	13	0	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/11/2004	--	--	--	--	--	--	--	--	10	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/24/2004	2570	--	--	4030	2000	--	--	4.2	8	--	13	--	--	0	0	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	9/9/2004	2280	--	--	--	2100	--	0	5.3	10	--	21	180	--	60	0	8	20	407
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	9/20/2004	2510	--	--	3760	--	--	--	3.5	8	--	21	--	--	0	0	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	10/4/2004	2490	--	--	3980	2410	--	0	5.3	9	--	15	170	--	60	0	9	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	10/27/2004	2820	--	--	3980	2260	--	0	4.9	7	--	5	80	--	70	0	9	0	227
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/1/2004	2510	--	6.9	4040	2230	--	0	5.3	8	--	8	100	--	50	0	9	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/15/2004	2450	--	--	3680	1970	--	0	3.1	0	--	14	130	--	0	0	8	0	0
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/12/2004	2400	--	--	3480	2320	--	0	9.6	7	--	17	260	--	80	0	9	20	0
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/20/2005	2060	--	--	3100	2110	--	0	2.8	--	--	20	320	--	20	0	9	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/24/2005	2390	--	--	3690	2460	--	--	4.2	6	--	10	--	--	0	0	--	0	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/8/2005	1980	--	--	2920	--	--	0	1.7	0	--	12	220	--	0	0	7	0	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/13/2005	2130	--	--	3300	2210	--	--	3.5	8	--	16	--	--	0	0	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/27/2005	2250	--	--	3360	2220	--	--	2.8	0	--	14	--	--	0	0	--	10	0
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/6/2005	2290	--	--	3440	2260	--	0	3	0	--	12	220	--	20	0	7	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/13/2005	2310	--	--	3550	2340	--	--	3.6	0	--	15	--	--	0	0	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/25/2005	2270	--	--	3310	2290	--	--	2.7	0	--	16	--	--	0	0	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/1/2005	2230	--	--	--	2220	--	0	3.7	0	--	17	60	--	40	0	7	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/8/2005	2120	--	--	3260	2140	--	--	3.3	0	--	8	--	--	0	0	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/12/2005	2090	--	--	3210	2070	--	--	3.6	0	--	10	--	--	0	0	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/17/2005	2600	--	--	3920	2520	--	--	5.7	0	--	7	--	--	0	0	--	0	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/24/2005	2520	--	--	3770	1950	--	--	1.8	0	--	9	--	--	0	0	--	0	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/1/2005	2930	--	--	4370	2420	--	0	7.9	0	--	11	240	--	90	0	10	0	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/8/2005	2830	--	--	4170	2890	--	--	4.5	0	--	25	--	--	0	0	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/11/2005	3350	--	--	4990	2620	--	0	5.9	0	--	13	150	--	90	0	9	0	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/15/2005	2980	--	--	4490	2530	--	--	3.7	0	--	19	--	--	0	0	--	0	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/23/2005	2860	--	--	4320	2760	--	--	2	0	--	17	--	--	0	0	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/1/2005	2530	--	--	3980	2000	--	0	1.7	0	--	20	310	--	20	0	8	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/5/2005	2760	--	--	4320	2350	--	--	4.1	0	--	7	--	--	0	0	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/12/2005	2930	--	--	4470	2570	--	--	4.1	0	--	10	--	--	0	0	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/19/2005	2550	--	--	4470	2440	--	--	2.1	0	--	23	--	--	0	0	--	0	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/26/2005	2810	--	--	4320	2580	--	--	2.6	0	--	21	--	--	0	0	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/3/2005	2660	--	--	4400	--	--	0	3.8	8	--	21	60	--	70	0	11	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/13/2005	2210	--	--	--	2350	--	--	7.7	0	--	8	--	--	0	0	--	0	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/20/2005	2610	--	--	4030	2400	--	--	5.2	0	--	11	--	--	0	0	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/27/2005	2770	--	--	4140	2720	--	--	9.7	0	--	28	--	--	0	0	--	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/1/2005	2830	--	7	4330	2620	--	0	13.9	0	--	20	130	--	90	0	10	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/14/2005	2840	--	--	4540	2890	--	--	17.8	8	--	24	--	--	0	0	--	30	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	9/4/2005	2810	--	--	4290	2820	--	0	18.6	9	--	20	130	--	120	0	8	0	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	9/26/2005	2700	--	--	4120	2450	--	--	22.3	0	--	12	--	--	0	0	--	60	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	10/9/2005	2890	--	--	4330	2700	--	0	15.8	--	--	5	690	--	160	0	10	30	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/1/2005	2640	--	--	3840	2610	--	0	17.6	0	--	32	90	--	120	0	10	30	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/11/2005	2890	--	--	4020	2700	--	2	17.5	0	--	15	130	--	129	0	10	38	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/9/2006	2820	--	--	4090	2690	--	1	16.8	0	--	22	150	--	181	0	9	44	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/14/2006	2720	--	--	4070	2600	--	1	17.6	0	--	32	210	--	209	0	10	43	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/13/2006	2920	--	--	--	2830	--	2	27.5	0	--	15	140	--	258	0	8	36	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/2/2006	2810	--	--	3950	--	--	3	15	0	--	25	290	--	158	0	9	39	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/19/2006	2550	--	--	--	2420	--	2	16.1	0	--	13	--	--	0	0	--	22	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/2/2006	2320	--	--	3520	2400	--	2	9.4	0	--	11	120	--	97	0	8	17	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/23/2006	3150	--	--	4700	2520	--	--	10.3	0	--	13	--	--	0	0	--	31	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/1/2006	2990	--	--	4000	263	--	1	8	0	--	14	190	--	88	0	8	14	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/9/2006	2980	--	--	--	2550	--	2	11.5	8	--	15	--	--	0	0	--	19	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/16/2006	2820	--	--	3810	2400	--	2	10.4	0	--	12	--	--	0	0	--	14	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/23/2006	2750	--	--	4060	2310	--	1	11.1	0	--	9	--	--	0	0	--	4	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/30/2006	2860	--	--	4210	2210	--	2	10.5	0	--	11	--	--	0	0	--	14	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/4/2006	2800	--	--	4200	2150	--	2	11.6	0	--	11	220	--	87	0	9	16	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/11/2006	2770	--	--	4040	2390	--	0	8.3	0	--	8	--	--	0	0	--	15	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/18/2006	2420	--	--	--	2430	--	2	12.2	0	--	15	--	--	0	0	--	18	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/25/2006	2620	--	--	3810	2570	--	2	5.6	0	--	11	--	--	0	0	--	11	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/2/2006	2610	--	--	3740	2480	--	2	13.5	0	--	19	260	--	99	0	9	25	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/10/2006	2560	--	--	3690	--	--	2	6.2	12	--	14	--	--	0	0	--	12	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/1/2006	2740	--	--	4010	2610	--	2	16.4	0	--	10	110	--	74	0	8	16	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/14/2006	2560	--	--	3660	2520	--	2	9.6	0	--	7	--	--	0	0	--	11	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/28/2006	2700	--	--	3950	2430	--	2	11.5	0	--	5	--	--	0	0	--	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	9/11/2006	2600	--	--	--	2580	--	3	9.4	0	--	8	60	--	66	0	11	12	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	9/18/2006	2700	--	--	3950	2550	--	2	18.4	0	--	23	--	--	0	0	--	24	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	10/1/2006	3070	--	--	4180	2260	--	3	4.3	0	--	10	60	--	44	0	9	10	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	10/8/2006	3010	--	7.2	--	--	--	2	18	0	--	8	110	--	128	--	9	16	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/12/2006	2810	--	7	--	--	--	2	13.4	0	--	14	140	--	148	--	7	21	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/10/2006	2880	--	7.3	--	2780	920	--	--	0	--	--	--	--	0	--	--	--	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/2/2007	2640	--	7.1	--	2620	--	2	17.5	0	--	19	160	--	231	--	8	31	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/19/2007	2070	--	7.5	--	2120	--	3	11.9	0	--	12	0	--	132	--	8	21	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/25/2007	2750	--	6.9	--	--	--	2	15	0	--	19	190	--	166	--	8	26	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/23/2007	2500	--	7	--	2240	--	1	11.6	10	--	9	90	--	121	--	6	21	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/18/2007	2600	--	6.6	--	2570	--	3	15.1	--	--	15	90	--	195	--	8	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/24/2007	2620	--	7.1	--	--	--	1	17.8	--	--	7	130	--	77	--	6	17	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/23/2007	2720	--	6.7	--	--	--	2	17.7	--	--	7	280	--	102	--	8	14	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	9/19/2007	2730	--	--	--	2450	--	2	10.5	--	--	8	120	--	78	--	7	13	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	10/25/2007	2650	--	7.1	--	--	--	2	8.6	--	--	10	100	--	83	--	10	13	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/27/2007	2560	--	6.5	--	--	--	0	19.6	--	--	9	120	--	223	--	8	26	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/17/2007	2400	--	--	--	2370	--	0	13.1	--	--	15	130	--	154	--	7	27	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/22/2008	2180	--	7	--	--	--	1	15.9	--	--	8	60	--	173	--	7	27	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/25/2008	1700	--	7.2	--	--	--	2	24	--	--	6	80	--	305	--	6	47	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/19/2008	1610	--	6.9	--	1670	--	3	16.4	--	--	9	100	--	214	--	7	30	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/20/2008	2820	--	6.8	--	--	--	0	12.4	--	--	9	190	--	146	--	6	19	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/30/2008	2790	--	7.9	--	2620	--	2	12	--	--	11	140	--	123	--	10	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/29/2008	2890	--	7.1	--	2780	--	1	21.2	--	--	10	90	--	149	--	7	21	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/27/2008	2920	--	7.4	--	2960	--	1	8.9	--	--	8	160	--	61	--	6	16	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	9/29/2008	2500	--	7.4	--	2320	--	0	9.1	--	--	5	190	--	56	--	6	477	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	10/29/2008	2350	--	7.2	--	2420	--	2	7.1	--	--	9	0	--	72	--	9	14	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/12/2008	2080	--	7	--	2240	--	0	8.6	--	--	10	120	--	91	--	6	23	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/17/2008	2440	--	6.9	--	--	--	0	8.8	--	--	5	130	--	48	--	7	13	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/17/2009	1970	--	7.5	--	1990	--	2	9.6	--	--	14	100	--	117	--	6	31	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/28/2009	2280	--	6.7	--	2190	--	3	7.3	--	--	16	170	--	127	--	6	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/27/2009	2370	--	6.9	--	2360	--	4	9.7	--	--	9	190	--	104	--	7	19	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/24/2009	2100	--	7.4	--	2220	--	2	6.3	--	--	15	140	--	41	--	5	22	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/28/2009	2010	--	8	--	1960	--	2	4.4	--	--	16	180	--	25	--	6	31	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/5/2009	1970	--	7.3	--	2020	6000	2	12.4	--	--	9	100	--	54	--	5	19	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/24/2009	1890	--	9.4	--	1870	9070	1	0.9	--	--	21	210	--	19	--	6	26	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	9/29/2009	1830	--	8.3	--	1740	1510	2	2.1	--	--	30	230	--	16	--	5	36	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	10/27/2009	1780	--	7.5	--	1820	620	2	2.4	--	--	28	220	--	27	--	7	35	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	11/30/2009	1940	--	7.9	--	1860	--	2	2.2	--	--	41	90	--	33	--	7	40	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	12/27/2009	1980	--	8.2	--	1930	--	0	2.5	--	--	18	150	--	23	--	6	23	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	1/20/2010	1600	--	8.3	--	1580	--	0	3	--	--	23	180	--	33	--	7	41	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	2/28/2010	1570	--	8.4	--	1550	--	0	3.2	--	--	17	160	--	25	--	5	38	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	3/29/2010	1810	--	7.9	--	1940	--	2	3.7	--	--	19	270	--	58	--	5	35	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	4/27/2010	2340	--	7.6	--	2350	--	2	2	--	--	33	390	--	19	--	6	27	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	5/25/2010	2420	--	--	--	--	--	3	2.1	--	--	14	300	--	36	--	8	19	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	6/22/2010	2700	--	7.8	--	--	--	1	2.4	--	--	10	280	--	33	--	4	20	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	7/31/2010	2440	--	7.9	--	--	--	3	4.2	--	--	30	370	--	34	--	5	35	--
Ruby Gulch	667-ZWTP	Zortman Water Treatment Plant	8/29/2010	1910	--	--	--	--	--	2	1.1	--	--	8	150	--	8	--	5	15	--
Ruby Gulch	Z-15	Near Permit Boundary	10/31/2000	2147	--	7.37	3189	2150	--	< 3	3.1	< 5	--	7	70	--	90	< 3	< 1	< 10	10
Ruby Gulch	Z-15	Near Permit Boundary	11/3/2000	2147	--	--	3189	2150	--	< 3	3.1	< 5	--	7	70	--	90	< 3	< 1	< 10	10
Ruby Gulch	Z-15	Near Permit Boundary	6/27/2003	187	--	7.6	270	89	--	11	0	0	--	0	0	0	0	0	0	0	0
Ruby Gulch	Z-15	Near Permit Boundary	7/21/2003	188	--	7.7	295	124	--	13	0	0	--	0	10	0	0	0	0	0	0
Ruby Gulch	Z-15	Near Permit Boundary	8/25/2003	172	--	7.8	253	76	--	16	0	0	--	0	0	0	0	0	0	0	0
Ruby Gulch	Z-15	Near Permit Boundary	9/16/2003	166	--	7.7	267	85	--	15	0	0	--	0	20	0	0	0	0	0	0
Ruby Gulch	Z-15	Near Permit Boundary	11/3/2003	173	--	8	277	96	--	18	0	0	--	0	20	0	0	0	0	0	0
Ruby Gulch	Z-15	Near Permit Boundary	11/23/2003	200	--	7.7	286	97	--	18	0	0	--	0	0	0	0	0	0	0	0
Ruby Gulch	Z-15	Near Permit Boundary	3/28/2004	485	--	6.6	748	454	--	0	1.4	0	--	5	0	0	40	0	1	50	0
Ruby Gulch	Z-15	Near Permit Boundary	4/27/2004	451	--	7.4	695	418	--	4	0.1	0	--	1	10	0	0	0	0	0	0
Ruby Gulch	Z-15	Near Permit Boundary	5/21/2004	288	--	7.6	447	218	--	6	0	0	--	0	0	0	0	0	0	0	0
Ruby Gulch	Z-15	Near Permit Boundary	6/24/2004	332	--	7.8	510	248	--	4	0	0	--	0	0	--	0	0	0	0	0
Ruby Gulch	Z-15	Near Permit Boundary	7/26/2004	231	--	7.8	351	147	--	7	0	0	--	0	0	0	0	0	0	80	0
Ruby Gulch	Z-15	Near Permit Boundary	8/17/2004	219	--	7.9	344	138	--	10	0	0	--	0	10	0	0	0	0	0	0
Ruby Gulch	Z-15	Near Permit Boundary	9/30/2004	233	--	7.4	343	144	--	4	0	0	--	1	30	0	0	0	0	0	0
Ruby Gulch	Z-15	Near Permit Boundary	10/25/2004	182	--	7.6	276	--	--	18	0	0	--	0	0	0	0	0	0	0	0
Ruby Gulch	Z-15	Near Permit Boundary	11/12/2004	215	--	7.8	303	111	--	15	0	0	--	0	0	0	0	0	0	0	0
Ruby Gulch	Z-15	Near Permit Boundary	3/17/2005	236	--	7.9	333	131	--	15	0.1	0	--	4	--	0	0	0	0	0	--
Ruby Gulch	Z-15	Near Permit Boundary	4/27/2005	965	--	7.2	1440	936	--	0	0.6	0	--	3	0	0	0	0	3	10	--
Ruby Gulch	Z-15	Near Permit Boundary	5/23/2005	417	--	7.5	569	298	--	5	0	0	--	0	0	0	0	0	0	0	--
Ruby Gulch	Z-15	Near Permit Boundary	6/24/2005	598	--	7.2	913	537	--	3	0.4	0	--	6	20	0	0	0	2	10	--
Ruby Gulch	Z-15	Near Permit Boundary	7/11/2005	466	--	7.5	692	406	--	4	0.1	0	--	0	0	0	0	0	0	0	--
Ruby Gulch	Z-15	Near Permit Boundary	8/26/2005	298	--	7.6	386	161	--	8	0	0	--	0	0	--	0	0	0	0	--
Ruby Gulch	Z-15	Near Permit Boundary	9/20/2005	248	--	7.9	349	140	--	10	0.2	0	--	4	190	--	0	0	0	10	--
Ruby Gulch	Z-15	Near Permit Boundary	10/20/2005	236	--	7.7	350	151	--	9	0	0	--	2	0	0	0	0	0	0	--
Ruby Gulch	Z-15	Near Permit Boundary	11/29/2005	234	--	7.7	--	127	--	10	0	0	--	0	10	0	1	0	0	3	--
Ruby Gulch	Z-15	Near Permit Boundary	3/30/2006	306	--	8	--	228	--	8	0	0	--	0	0	0	1	0	0	6	--
Ruby Gulch	Z-15	Near Permit Boundary	5/30/2006	766	--	7.9	1150	736	--	4	1.1	0	--	5	130	0	18	0	1	54	--
Ruby Gulch	Z-15	Near Permit Boundary	6/13/2006	715	--	7.6	1070	672	--	4	0.5	0	--	4	10	0	1	0	2	24	--
Ruby Gulch	Z-15	Near Permit Boundary	7/18/2006	407	--	7.8	600	311	--	6	0.8	0	--	6	20	0	9	0	0	35	--
Ruby Gulch	Z-15	Near Permit Boundary	8/16/2006	562	--	7.8	800	466	--	8	0.3	0	--	0	0	0	5	0	1	9	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Ruby Gulch	Z-100	Ruby Guch midway between Ruby Pond and town	11/14/2006	1250	--	7.6	--	1190	--	2	3.2	0	--	4	20	--	39	--	3	19	--
Ruby Gulch	Z-100	Ruby Guch midway between Ruby Pond and town	8/14/2007	927	--	7.6	--	--	--	2	0.9	--	--	2	0	--	7	--	1	8	--
Ruby Gulch	Z-100	Ruby Guch midway between Ruby Pond and town	3/18/2008	434	--	7.5	--	378	--	3	0	--	--	2	140	--	5	--	1	5	--
Ruby Gulch	Z-100	Ruby Guch midway between Ruby Pond and town	6/9/2008	671	--	7.2	--	659	--	3	3.6	--	--	9	1180	--	44	--	2	57	--
Ruby Gulch	Z-100	Ruby Guch midway between Ruby Pond and town	9/18/2008	736	--	--	--	663	--	2	0.4	--	--	2	0	--	4	--	1	7	--
Ruby Gulch	Z-100	Ruby Guch midway between Ruby Pond and town	11/23/2008	525	--	--	--	448	--	14	5.6	--	--	17	100	--	17	--	1	25	--
Ruby Gulch	Z-100	Ruby Guch midway between Ruby Pond and town	6/23/2009	1220	--	7.6	--	--	--	3	2.8	--	--	6	70	--	20	--	3	16	--
Ruby Gulch	Z-100	Ruby Guch midway between Ruby Pond and town	9/18/2009	918	--	7.9	--	839	--	2	0.4	--	--	2	10	--	2	--	2	8	--
Ruby Gulch	Z-100	Ruby Guch midway between Ruby Pond and town	3/25/2010	951	--	7.7	--	923	--	3	1.5	--	--	2	50	--	13	--	3	0	--
Ruby Gulch	Z-100	Ruby Guch midway between Ruby Pond and town	6/24/2010	1640	--	7.5	--	--	--	1	1.3	--	--	4	330	--	14	--	3	18	--
Ruby Gulch	Z-100	Ruby Guch midway between Ruby Pond and town	8/16/2010	1000	--	7.9	--	--	--	2	0.5	--	--	3	90	--	2	--	0	7	--
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	5/4/1990	256	1086.2	5.8	400	252		104	24	< 5	20	510	18200	< 1	190	110	< 5	2110	
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	5/15/1990	681	270	6.3	1010	--					40								
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	5/29/1990	608	450	4.9	1070	680		130	64	8	< 20	1340	43300	< 1	680		< 5	6180	
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	6/26/1990	1150	81	5.5	1880	--				6	< 20						< 5		
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	7/18/1990	1419	3.1	5.6	2450	--					< 20						< 5		
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	7/31/1990	1400	6.7	5.2	2410	1480		24	40	< 5	< 20	50	2420	< 1	1750	< 10	< 5	13500	
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	8/22/1990	--	0	--	--	--					< 10						< 5		
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	10/12/1990	1100	46	4.7	1740	1150		52	89	< 5	< 10	600	13700	< 1	1460	40	< 5	10600	
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	10/31/1990	816	46	5.2	1470	--					10						< 5		
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	12/11/1990	--	0	--	--	--					20						< 5		
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	1/10/1991	--	0	--	--	--					61						2		
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	3/20/1991	330	38.15	5.5	568	343		27	18	< 5		100	4360	< 1	290	40	8	2430	
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	5/17/1991	603	191.6	4.9	1000	628		117	60	6		870	23000	< 0.2	530	130	9	5320	

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	6/11/1991	740	250.9	4.8	1310	818				< 5									
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	7/23/1991	--	0	--	--	--													
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	9/5/1991	--	0	--	--	--													
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	10/16/1991	--	0	--	--	--													
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	5/31/1992	--	0	--	--	--													
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	10/16/1992	--	0	--	--	--													
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	5/16/1993	--	0	--	--	--													
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	10/13/1993	--	0	--	--	--													
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	5/17/1994	95	50.3	7	131	21		13	< 1	< 5		20	2510	< 1	< 10	40		80	
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	8/1/1994	--	0	--	--	--													
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	10/25/1994	--	0	--	--	--													
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	1/31/1995	396	20	6.6	614	424	100	23	< 1	< 5		20	3490	< 1	< 10	< 10		150	
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	5/10/1995	60	217	7.8	81	16		23	< 1	< 5		70	4970	< 1	< 10	20		80	
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	7/24/1995	754	100	5.3	1160	764		73	52	< 5		730	14100	< 1	350	40		2810	
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	10/20/1995	--	0		--	--													
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	5/28/1996	616	781	6.9	909	576	< 300	763	7	< 5		420	74200	< 0.6	120	26		1370	
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	8/12/1996	--	0	--	--	--													
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	10/22/1996	--	0	--	--	--													
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	2/12/1997	--	0	--	--	--													
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	4/18/1997	632	311.94	7.2	815	521	< 100	808	11	< 5		892	150000		120	577		1720	
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	5/12/1997	--	0	--	--	--													
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	6/17/1997	1469.9	228.9	7.25	2624	1786.5	< 100	235	18	7		1290	48000		120	78		1020	
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	8/11/1997	--	0	--	--	--													
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	3/8/2004	3	--	--	--	--			0	0		0				0		0	

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	5/18/2004	0	--	5	--	--	0			0									
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	11/3/2004	3	--	7.5	--	--	0			0									
Ruby Gulch	Z-1B	1600 m D/S of Ruby Gulch Pump Station	6/13/2010	1140	38	5.7	1940	--													
Sullivan Gulch	505	Sullivan Park	5/14/2000	225	--	7.13	--	194	--	< 3	0.6	< 5	--	9	--	--	--	16	--	60	57
Sullivan Gulch	505	Sullivan Park	6/4/2001	67.2	--	7.54	--	52	--	11	0.7	< 5	--	43	--	--	--	43	--	110	478
Sullivan Gulch	505	Sullivan Park	6/10/2002	180	--	7.2	--	107	--	8	0.2	0	--	14	--	--	--	12	--	40	312
Sullivan Gulch	505	Sullivan Park	8/8/2002	--	--	7.9	--	177	--	0	0.2	0	--	3	--	--	--	0	--	0	11
Sullivan Gulch	505	Sullivan Park	6/11/2004	206	--	8	--	123	--	0	0	0	--	2	--	--	--	0	--	0	24
Sullivan Gulch	505	Sullivan Park	6/13/2005	202	--	6.9	--	173	--	5	1.9	0	--	14	--	--	--	9	--	130	100
Sullivan Gulch	505	Sullivan Park	5/21/2008	127	--	6.9	--	--	--	107	2.7	--	--	324	19800 0	--	214	--	3	870	--
Sullivan Gulch	595	Sullivan Capture Trench Overflow	5/23/2008	633	--	6.8	--	511	--	0	1.4	--	--	3	130	--	17	--	2	47	--
Sullivan Gulch	595	Sullivan Capture Trench Overflow	5/17/2010	167	--	7.6	--	90	--	1	0.1	--	--	3	1010	--	4	--	0	13	--
Sullivan Gulch	595	Sullivan Capture Trench Overflow	5/25/2010	659	--	6.9	--	--	--	0	4.4	--	--	7	220	--	120	--	11	1217	--
Sullivan Gulch	595	Sullivan Capture Trench Overflow	6/19/2010	663	--	6.4	--	--	--	1	11.2	--	--	24	350	--	226	--	13	1390	--
Sullivan Gulch	D-4	Lower Sullivan	3/31/2000	314	--	7.76	545	303	--	3	0.6	5	--	17	150	--	20	3	1	260	10
Sullivan Gulch	D-4	Lower Sullivan	5/1/2000	291.7	--	7.5	471	283	--	< 3	0.4	< 5	--	11	700	--	< 20	6	2	270	10
Sullivan Gulch	D-4	Lower Sullivan	11/3/2000	291.9	--	7.45	467	255	--	< 3	0.2	< 5	--	< 1	10	--	< 20	< 3	< 1	190	10
Sullivan Gulch	D-4	Lower Sullivan	6/7/2001	165.9	--	7.46	268	151	--	< 3	0.1	< 5	--	4	360	--	< 20	11	< 1	110	10
Sullivan Gulch	D-4	Lower Sullivan	7/16/2001	812.7	--	7.33	1145	620	--	< 3	0.3	< 5	--	23	2030	--	30	10	< 1	30	10
Sullivan Gulch	D-4	Lower Sullivan	6/25/2002	161	--	7.2	269	133	--	< 3	0.1	6	--	4	1370	0	0	0	1	140	30
Sullivan Gulch	D-4	Lower Sullivan	8/27/2002	226	--	7.6	384	181	--	0	0.2	0	--	2	480	0	0	0	0	110	--
Sullivan Gulch	D-4	Lower Sullivan	3/28/2003	207	--	7.2	343	194	--	0	0.1	0	--	2	150	0	0	0	1	90	--
Sullivan Gulch	D-4	Lower Sullivan	4/22/2003	173	--	7.3	300	147	--	0	0.4	0	--	3	360	0	0	0	0	90	--
Sullivan Gulch	D-4	Lower Sullivan	5/29/2003	197	--	7.3	342	163	--	0	0	0	--	2	250	0	0	0	0	100	--
Sullivan Gulch	D-4	Lower Sullivan	5/19/2005	291	--	7.1	400	233	--	0	0.2	0	--	2	220	0	0	0	0	150	--
Sullivan Gulch	D-4	Lower Sullivan	6/23/2005	202	--	7.4	310	137	--	0	0	0	--	3	100	0	0	0	0	120	--
Sullivan Gulch	D-4	Lower Sullivan	4/12/2006	115	--	7.5	208	89	--	1	0	0	--	3	220	0	4	0	0	84	--
Sullivan Gulch	L-37	Seep Below Sullivan Capture (old 555)	1/4/2000	--	--	--	--	--	--	--	--	24	--	--	--	--	--	--	--	--	--
Sullivan Gulch	L-37	Seep Below Sullivan Capture (old 555)	8/22/2001	901.5	--	7.28	1456	805	--	< 3	0.1	< 5	--	26	500	--	< 20	10	< 1	20	10
Swift Gulch	L-19	Swift Gulch Below L-20	4/27/2000	403.9	--	7.3	645	426	--	21	1.4	< 5	--	< 1	2240	--	30	< 3	2	290	10
Swift Gulch	L-19	Swift Gulch Below L-20	5/30/2000	446	--	7.14	716	463	--	19	2.4	< 5	--	< 1	2010	--	50	< 3	1	400	10
Swift Gulch	L-19	Swift Gulch Below L-20	6/28/2000	521.1	--	7.42	829	571	--	5	1.7	< 5	--	< 1	420	--	50	< 3	< 1	440	10
Swift Gulch	L-19	Swift Gulch Below L-20	7/25/2000	579.3	--	7.38	983	626	--	5	1.5	< 5	--	< 1	420	--	60	< 3	< 1	440	10
Swift Gulch	L-19	Swift Gulch Below L-20	8/30/2000	607.5	--	7.25	1009	645	--	3	0.9	< 5	--	12	1460	--	30	10	< 1	260	10
Swift Gulch	L-19	Swift Gulch Below L-20	9/6/2000	567.4	--	7.07	935	607	--	9	1.8	8	--	< 1	2550	--	60	< 3	< 1	550	10
Swift Gulch	L-19	Swift Gulch Below L-20	10/31/2000	649	--	6.8	1044	681	--	43	1.8	< 5	--	< 1	7560	--	70	< 3	< 1	730	29

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Swift Gulch	L-19	Swift Gulch Below L-20	11/3/2000	649	--	--	1044	681	--	43	1.8	< 5	--	< 1	7560	--	70	< 3	< 1	730	29
Swift Gulch	L-19	Swift Gulch Below L-20	11/14/2000	669.7	--	6.8	1033	700	--	10	4	< 5	--	2	1740	--	90	< 3	< 1	910	10
Swift Gulch	L-19	Swift Gulch Below L-20	5/31/2001	739.3	--	--	1143	766	360	42	2.6	18	--	< 1	9280	--	80	< 3	< 1	980	21
Swift Gulch	L-19	Swift Gulch Below L-20	6/21/2001	330.6	--	6.12	503	338	--	28	9.3	< 5	--	11	5590	--	60	12	3	400	20
Swift Gulch	L-19	Swift Gulch Below L-20	7/19/2001	428.4	--	6.12	668	434	--	55	3.1	< 5	--	16	13200	--	70	6	0	550	48
Swift Gulch	L-19	Swift Gulch Below L-20	8/21/2001	504.8	--	7.245	804.5	472	--	9.5	2.4	< 5	--	1.5	2300	--	85	< 3	2	640	10.5
Swift Gulch	L-19	Swift Gulch Below L-20	9/25/2001	865.9	--	6.08	1343	792	--	32	5.5	< 5	--	1	7190	--	160	< 3	< 1	1330	17
Swift Gulch	L-19	Swift Gulch Below L-20	9/26/2001	--	--	--	1310	780	--	20	--	--	< 1	2	5040	--	170	--	< 1	1440	--
Swift Gulch	L-19	Swift Gulch Below L-20	10/15/2001	765.8	--	6.15	1297	858	--	38	4.9	< 5	--	2	11600	--	170	3	< 1	1500	21
Swift Gulch	L-19	Swift Gulch Below L-20	11/7/2001	826.9	--	6.07	1351	872	--	33	5.1	< 5	--	2	10100	--	170	3	< 1	1490	12
Swift Gulch	L-19	Swift Gulch Below L-20	4/30/2002	749	--	5.6	1200	820	--	26	4.9	0	--	4	8310	--	150	0	2	1400	--
Swift Gulch	L-19	Swift Gulch Below L-20	5/21/2002	459	--	5.8	765	535	--	20	3.3	0	--	3	5970	0	110	0	3	950	0
Swift Gulch	L-19	Swift Gulch Below L-20	6/26/2002	174	--	5.8	312	183	--	26	7.9	0	--	9	7650	0	40	0	4	280	14
Swift Gulch	L-19	Swift Gulch Below L-20	7/30/2002	736	--	4	1340	843	--	25	6.1	0	--	5	7090	0	160	0	1	1280	--
Swift Gulch	L-19	Swift Gulch Below L-20	8/27/2002	654	--	3.9	1160	725	--	47	4.5	0	--	5	11300	0	140	0	2	1130	--
Swift Gulch	L-19	Swift Gulch Below L-20	9/26/2002	861	--	3.9	1460	975	--	45	4.3	0	--	5	18300	0	170	0	0	1320	--
Swift Gulch	L-19	Swift Gulch Below L-20	10/31/2002	827	--	5.7	1550	984	--	58	5.6	0	--	6	21300	0	180	0	1	1650	--
Swift Gulch	L-19	Swift Gulch Below L-20	12/11/2002	--	--	5.1	1500	1060	1600	34	10	--	--	< 1	18700	--	220	0	0	2130	--
Swift Gulch	L-19	Swift Gulch Below L-20	3/31/2003	466	--	5.4	--	545	--	62	2.9	0	--	6	22500	0	90	0	2	750	--
Swift Gulch	L-19	Swift Gulch Below L-20	4/30/2003	401	--	3.8	729	409	--	35	2.6	0	--	6	15200	0	100	0	2	880	28
Swift Gulch	L-19	Swift Gulch Below L-20	5/30/2003	620	--	3.6	1070	708	--	36	2.9	0	--	5	19500	0	130	0	2	1040	--
Swift Gulch	L-19	Swift Gulch Below L-20	6/30/2003	732	--	3.3	1300	843	--	29	3.3	0	--	7	12700	0	190	0	2	1640	15
Swift Gulch	L-19	Swift Gulch Below L-20	7/16/2003	887	--	3.2	1610	1020	--	51	4.7	0	--	9	22400	0	250	0	2	1860	47
Swift Gulch	L-19	Swift Gulch Below L-20	8/19/2003	1030	--	3.5	1710	1150	--	51	5.7	0	--	11	29400	0	270	0	1	1880	36
Swift Gulch	L-19	Swift Gulch Below L-20	9/29/2003	957	--	3.7	1710	1160	--	61	4.8	0	--	9	34500	0	260	0	1	1920	43
Swift Gulch	L-19	Swift Gulch Below L-20	10/29/2003	888	--	4.5	1590	1050	--	48	5.2	0	--	9	32100	0	280	0	1	2820	0
Swift Gulch	L-19	Swift Gulch Below L-20	11/25/2003	992	--	3.4	1670	1150	--	67	4.3	0	--	9	38800	0	240	0	2	2570	51
Swift Gulch	L-19	Swift Gulch Below L-20	4/20/2004	459	--	4.4	748	535	--	41	2.3	0	--	5	23100	0	130	0	2	1150	51
Swift Gulch	L-19	Swift Gulch Below L-20	5/27/2004	96	--	4.4	202	114	--	28	3.6	0	--	8	11000	0	30	3	2	200	23
Swift Gulch	L-19	Swift Gulch Below L-20	6/29/2004	657	--	3.7	1180	803	--	62	2.9	0	--	6	31400	--	220	0	2	1880	90
Swift Gulch	L-19	Swift Gulch Below L-20	7/29/2004	947	--	3.4	1730	--	--	84	3.4	0	--	9	52700	--	260	0	0	1450	43
Swift Gulch	L-19	Swift Gulch Below L-20	8/19/2004	--	--	3.2	1890	1330	--	82	3.5	0	--	8	51400	--	310	0	1	2350	--
Swift Gulch	L-19	Swift Gulch Below L-20	9/29/2004	--	--	3.1	1840	1220	--	56	3.3	0	--	6	47500	--	270	0	0	1930	--
Swift Gulch	L-19	Swift Gulch Below L-20	10/29/2004	--	--	3.3	1890	1380	--	78	3.3	0	--	8	54800	--	330	0	0	2910	--
Swift Gulch	L-19	Swift Gulch Below L-20	12/1/2004	--	--	3.3	1780	1240	--	137	3.5	0	--	9	62500	--	330	0	0	2730	--
Swift Gulch	L-19	Swift Gulch Below L-20	5/9/2005	278	--	4.1	505	348	--	84	2.8	0	--	7	23100	0	90	0	2	800	--
Swift Gulch	L-19	Swift Gulch Below L-20	5/31/2005	465	--	3.9	854	502	--	35	2.1	0	--	4	23700	0	150	0	1	1410	--
Swift Gulch	L-19	Swift Gulch Below L-20	6/24/2005	462	--	3.6	829	641	--	32	3.6	0	--	7	20000	0	150	0	3	1360	--
Swift Gulch	L-19	Swift Gulch Below L-20	7/21/2005	1030	--	3.4	1810	--	--	49	5.2	0	--	12	36600	0	350	0	1	2870	--
Swift Gulch	L-19	Swift Gulch Below L-20	8/26/2005	1230	--	3.4	2070	1660	--	50	5.1	0	--	12	51300	0	450	3	0	4290	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Swift Gulch	L-19	Swift Gulch Below L-20	9/26/2005	1160	--	3.4	2060	1460	--	50	4.7	0	--	16	48000	0	420	3	0	3200	--
Swift Gulch	L-19	Swift Gulch Below L-20	10/27/2005	1230	--	--	2010	1460	--	47	4.3	0	--	19	51800	0	490	4	2	4240	--
Swift Gulch	L-19	Swift Gulch Below L-20	11/20/2005	1220	--	3.2	2020	1480	--	57	4.2	0	--	21	47800	0	420	3	1	3190	--
Swift Gulch	L-19	Swift Gulch Below L-20	4/27/2006	315	--	3.7	525	442	--	59	2.2	0	--	4.9	23900	0	100	1	2	978	--
Swift Gulch	L-19	Swift Gulch Below L-20	6/30/2006	733	--	3.1	1300	885	--	52	2.5	0	--	6	41000	0	264	1	2	2620	--
Swift Gulch	L-19	Swift Gulch Below L-20	7/18/2006	1130	--	3.2	2060	1330	--	59	3.7	0	--	10	59400	0	420	3	2	3910	--
Swift Gulch	L-19	Swift Gulch Below L-20	8/28/2006	1330	--	--	2270	1570	--	56	3.4	0	--	11	66700	0	486	4	2	4300	--
Swift Gulch	L-19	Swift Gulch Below L-20	9/27/2006	471	--	3.6	857	565	--	42	2	0	--	11	34700	0	191	2	1	1860	--
Swift Gulch	L-19	Swift Gulch Below L-20	11/1/2006	524	--	3.7	--	637	--	50	1.7	0	--	7	38900	--	211	--	2	2010	--
Swift Gulch	L-19	Swift Gulch Below L-20	3/27/2007	729	--	3.2	--	852	--	49	2.1	0	--	8	46700	--	281	--	0	2560	--
Swift Gulch	L-19	Swift Gulch Below L-20	4/23/2007	89	--	4.6	--	109	--	47	1.7	0	--	9	21600	--	33	--	2	303	--
Swift Gulch	L-19	Swift Gulch Below L-20	5/30/2007	92	--	6	--	99	--	8	3.2	0	--	7	5150	--	26	--	2	162	--
Swift Gulch	L-19	Swift Gulch Below L-20	6/28/2007	547	--	3.4	--	674	--	50	2.5	--	--	4	40000	--	220	--	1	2170	--
Swift Gulch	L-19	Swift Gulch Below L-20	7/26/2007	1090	--	2.9	--	1360	--	65	3.6	--	--	10	74000	--	519	--	0	4380	--
Swift Gulch	L-19	Swift Gulch Below L-20	8/29/2007	1270	--	3	--	1540	--	127	3.3	--	--	13	110000	--	588	--	0	5900	--
Swift Gulch	L-19	Swift Gulch Below L-20	9/18/2007	1270	--	3	--	1570	--	93	2.8	--	--	11	102000	--	574	--	0	6230	--
Swift Gulch	L-19	Swift Gulch Below L-20	10/11/2007	1040	--	3	--	1320	--	54	3.1	--	--	10	64100	--	444	--	1	5190	--
Swift Gulch	L-19	Swift Gulch Below L-20	11/26/2007	1220	--	2.6	--	1510	--	75	3.3	--	--	12	95600	--	608	--	0	5850	--
Swift Gulch	L-19	Swift Gulch Below L-20	5/15/2008	325	--	3.6	--	415	--	38	1.7	--	--	7	33800	--	154	--	1	1500	32
Swift Gulch	L-19	Swift Gulch Below L-20	6/3/2008	320	--	3.8	--	368	900	33	2.3	--	--	5	24900	--	120	--	1	1280	18
Swift Gulch	L-19	Swift Gulch Below L-20	7/31/2008	1200	--	3.1	--	1590	--	77	4.2	--	--	17	94400	--	660	--	0	7020	--
Swift Gulch	L-19	Swift Gulch Below L-20	8/6/2008	1215	--	3.1	2265	1475	5560	69	4.05	--	--	16	94500	--	610.5	--	0.5	6840	17
Swift Gulch	L-19	Swift Gulch Below L-20	8/7/2008	1230	--	3.15	2270	1490	5535	68.5	4.3	--	--	16	96400	--	649	--	0	7200	14.5
Swift Gulch	L-19	Swift Gulch Below L-20	9/18/2008	1260	--	3.1	--	1610	--	85	4.1	--	--	16	119000	--	720	--	0	7830	--
Swift Gulch	L-19	Swift Gulch Below L-20	10/29/2008	1250	--	3.1	--	1660	--	71	3.8	--	--	17	114000	--	644	--	2	8140	--
Swift Gulch	L-19	Swift Gulch Below L-20	11/23/2008	1060	--	3.1	--	1390	--	76	3.1	--	--	14	103000	--	556	--	2	6490	--
Swift Gulch	L-19	Swift Gulch Below L-20	6/18/2009	676	--	3.1	--	--	--	78	2	--	--	6	76700	--	370	--	0	4400	--
Swift Gulch	L-19	Swift Gulch Below L-20	7/28/2009	1220	--	3	--	1730	--	110	3.1	--	--	14	147000	--	647	--	1	8600	--
Swift Gulch	L-19	Swift Gulch Below L-20	8/31/2009	1250	--	3	--	1670	--	102	3.2	--	--	15	148000	--	719	--	1	9700	--
Swift Gulch	L-19	Swift Gulch Below L-20	9/29/2009	1340	--	3	--	1940	--	97	3.5	--	--	12	156000	--	790	--	0	9830	--
Swift Gulch	L-19	Swift Gulch Below L-20	10/31/2009	956	--	3	--	1370	--	78	3.2	--	--	15	111000	--	552	--	1	7300	--
Swift Gulch	L-19	Swift Gulch Below L-20	11/28/2009	--	--	--	--	--	--	105	3.3	--	--	19	160000	--	738	--	2	9580	--
Swift Gulch	L-19	Swift Gulch Below L-20	4/27/2010	--	--	--	--	--	--	76	2.1	--	--	9	76900	--	313	--	1	3670	--
Swift Gulch	L-19	Swift Gulch Below L-20	5/27/2010	--	--	--	--	--	--	22	1	--	--	6	20900	--	72	--	1	863	--
Swift Gulch	L-19	Swift Gulch Below L-20	6/24/2010	--	--	--	--	--	--	43	1.5	--	--	5	39900	--	161	--	0	1880	--
Swift Gulch	L-19	Swift Gulch Below L-20	7/26/2010	--	--	--	--	--	--	113	2.9	--	--	15	144000	--	670	--	0	7910	--
Swift Gulch	L-19	Swift Gulch Below L-20	8/16/2010	--	--	--	--	--	--	115	3.2	--	--	0	--	--	--	--	0	9840	--
Swift Gulch	BKSS-2	Upper Swift Gulch	5/31/2001	14.4	--	--	60	9	180	--	--	21	--	--	--	--	0	--	0	--	10
Swift Gulch	BKSS-3	Upper Swift Gulch Below BKSS-1	12/6/2000	252	--	--	406	227	0	--	--	--	--	--	--	--	0	--	0	--	--
Swift Gulch	BKSS-3	Upper Swift Gulch Below BKSS-1	12/6/2000	252	--	6.85	406	227	0	--	--	--	--	--	--	--	0	--	0	--	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Swift Gulch	BKSS-3	Upper Swift Gulch Below BKSS-1	5/31/2001	171.6	--	--	288	163	100	--	--	< 5	--	--	--	--	0	--	0	--	15
Swift Gulch	BKSS-3	Upper Swift Gulch Below BKSS-1	12/11/2002	--	--	6.2	405	248	200	26	3	--	--	--	2170	--	20	--	0	140	--
Swift Gulch	BKSS-3	Upper Swift Gulch Below BKSS-1	3/31/2003	203	--	6.1	332	227	--	0	5.5	75	--	4	130	0	20	0	5	120	--
Swift Gulch	BKSS-3	Upper Swift Gulch Below BKSS-1	4/30/2003	110	--	6.1	177	110	--	0	4.2	0	--	15	330	0	0	0	4	80	0
Swift Gulch	BKSS-3	Upper Swift Gulch Below BKSS-1	5/30/2003	167	--	6	304	187	--	0	4.2	0	--	5	350	0	20	0	4	130	--
Swift Gulch	BKSS-3	Upper Swift Gulch Below BKSS-1	6/30/2003	238	--	6.1	399	247	--	0	6.2	0	--	2	70	0	20	0	5	150	0
Swift Gulch	BKSS-3	Upper Swift Gulch Below BKSS-1	7/16/2003	257	--	6.5	424	257	--	3	3	0	--	5	200	0	0	0	3	100	0
Swift Gulch	BKSS-3	Upper Swift Gulch Below BKSS-1	8/19/2003	209	--	6.5	347	203	--	6	1.5	0	--	3	430	--	0	0	3	60	0
Swift Gulch	BKSS-3	Upper Swift Gulch Below BKSS-1	9/29/2003	209	--	6.5	353	201	--	10	1.8	0	--	3	900	0	0	0	3	80	0
Swift Gulch	BKSS-3	Upper Swift Gulch Below BKSS-1	10/29/2003	247	--	6.9	389	215	--	9	2.8	0	--	7	1090	0	0	0	3	100	0
Swift Gulch	BKSS-3	Upper Swift Gulch Below BKSS-1	11/25/2003	289	--	6.8	433	264	--	5	1.7	0	--	7	230	0	0	0	2	70	0
Swift Gulch	BKSS-3	Upper Swift Gulch Below BKSS-1	4/20/2004	118	--	5.8	160	114	--	0	3.7	0	--	5	200	0	0	0	3	70	0
Swift Gulch	BKSS-3	Upper Swift Gulch Below BKSS-1	5/27/2004	62	--	5.5	143	61	--	4	5.6	0	--	11	1880	0	0	0	2	60	0
Swift Gulch	BKSS-3	Upper Swift Gulch Below BKSS-1	6/29/2004	214	--	6.6	382	225	--	0	4.6	0	--	5	600	--	20	0	5	120	0
Swift Gulch	BKSS-3	Upper Swift Gulch Below BKSS-1	7/29/2004	264	--	6.4	452	280	--	0	4.5	0	--	4	290	--	30	0	3	130	0
Swift Gulch	BKSS-3	Upper Swift Gulch Below BKSS-1	8/19/2004	--	--	7	421	247	--	0	2.4	0	--	2	110	--	10	0	3	100	--
Swift Gulch	BKSS-3	Upper Swift Gulch Below BKSS-1	5/15/2008	89	--	6.2	--	73	--	3	2	--	--	6	1460	--	10	--	2	48	0
Swift Gulch	BKSS-9	Upper Swift Gulch	5/31/2001	12.2	--	--	65	8	340	--	--	< 5	--	--	--	--	--	--	--	--	10
Swift Gulch	BKSS-9	Upper Swift Gulch	4/8/2004	8	--	6.1	53	5	0	7	0	--	--	7	1460	0	0	0	0	0	0
Swift Gulch	BKSS-9	Upper Swift Gulch	5/15/2008	10	--	6.3	--	12	0	6	0	--	--	6	1600	--	3	--	0	11	0
Swift Gulch	L-49	Above Confluence of South Big Horn	5/30/2007	81	--	6.7	--	73	0	7	2	0	--	6	4410	--	19	--	1	119	--
Swift Gulch	L-49	Above Confluence of South Big Horn	10/11/2007	921	--	3.1	--	1080	0	2	4.5	--	--	17	18000	--	362	--	2	4190	--
Swift Gulch	L-49	Above Confluence of South Big Horn	6/4/2008	256	--	5.9	--	258	120	13	1.8	--	--	4	13200	--	82	--	0	861	16
Swift Gulch	L-49	Above Confluence of South Big Horn	7/30/2008	987	--	3.6	--	1150	0	0	13.5	--	--	26	3300	--	557	--	0	5920	--
Swift Gulch	L-49	Above Confluence of South Big Horn	8/11/2008	1070	--	3.3	--	1180	0	0	13.5	--	--	33	8890	--	642	--	0	8200	--
Swift Gulch	L-49	Above Confluence of South Big Horn	9/18/2008	1130	--	6.3	--	1170	0	1	6.1	--	--	16	1520	--	279	--	0	2330	--
Swift Gulch	L-49	Above Confluence of South Big Horn	10/29/2008	1130	--	3.4	--	1260	0	2	8.9	--	--	31	13400	--	562	--	2	6300	--
Swift Gulch	L-49	Above Confluence of South Big Horn	11/23/2008	963	--	3.1	--	1140	0	4	6.6	--	--	29	25600	--	525	--	0	5660	--
Swift Gulch	L-49	Above Confluence of South Big Horn	6/17/2009	620	--	7.2	--	632	0	2	1.1	--	--	1	1770	--	71	--	0	722	--
Swift Gulch	L-49	Above Confluence of South Big Horn	7/29/2009	1280	--	6.6	--	1200	0	0	1.5	--	--	3	150	--	93	--	1	798	--
Swift Gulch	L-49	Above Confluence of South Big Horn	8/31/2009	875	--	6.3	--	943	0	0	3.7	--	--	4	310	--	233	--	0	1920	--
Swift Gulch	L-49	Above Confluence of South Big Horn	9/28/2009	1000	--	5.6	--	1030	0	0	7.2	--	--	7	170	--	428	--	0	4140	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO4 (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se (µg/l)	Zn trm (µg/l)	TSS (mg/L)
Swift Gulch	L-49	Above Confluence of South Big Horn	10/31/2009	901	--	3.2	--	1100	0	8	7.7	--	--	45	24100	--	546	--	2	6540	--
Swift Gulch	L-49	Above Confluence of South Big Horn	11/28/2009	1110	--	--	--	--	0	6	6.7	--	--	47	39000	--	646	--	3	7750	--
Swift Gulch	L-49	Above Confluence of South Big Horn	4/27/2010	400	--	--	--	--	0	32	2.1	--	--	9	33700	--	232	--	0	2650	--
Swift Gulch	L-49	Above Confluence of South Big Horn	5/27/2010	73	--	--	--	--	0	7	0.7	--	--	5	5180	--	20	--	0	202	--
Swift Gulch	L-49	Above Confluence of South Big Horn	6/16/2010	570	--	--	--	--	0	0	0.2	--	--	1	240	--	12	--	0	132	--
Swift Gulch	L-49	Above Confluence of South Big Horn	7/28/2010	960	--	--	--	--	0	0	0.3	--	--	0	90	--	12	--	0	140	--
Swift Gulch	L-49	Above Confluence of South Big Horn	8/16/2010	--	--	--	--	--	0	--	0.3	--	--	--	--	--	--	--	--	119	--
Swift Gulch	M37SWFGC01	Swift Gulch Creek, U/S of South Big Horn confluence	7/20/2005	798	450	6.16	--	--		3	5.43		< 1000	3	< 10	< 50	180	< .5	2	1670	3400

APPENDIX C – SURFACE WATER CHEMISTRY DATA – SELECTED BACKGROUND SITES

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO ₄ (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se trm (µg/l)	Tl trm (µg/L)	Zn trm (µg/l)	TSS (mg/L)
Alder Gulch	AGSS-10	Upper Alder Gulch U/S of Hawkeye	5/12/1997	34	39	6.5	63	17	200	< 3	< 1	< 5	< 1	5	430	< 0.6	< 20	< 3	< 1	0.003	< 10	--
Alder Gulch	Z-60	Upper Alder Gulch	6/7/1996	16	29	8	59	13	400	< 3	0.20	< 5	< 1	24	510	< 0.6	< 20	< 3	< 1	0.006	20	10
Alder Gulch	Z-60	Upper Alder Gulch	5/13/1997	14	3.14	6.6	62	10	200	< 3	< 0.1	< 5	1	7	750	< 0.6	< 20	< 3	< 1	0.003	20	--
Alder Gulch	Z-61	Upper Alder Gulch	6/7/1996	14	17	7.8	40	14	300	< 3	0.10	< 5	< 1	7	380	< 0.6	< 20	< 3	< 1	0.005	10	10
Alder Gulch	Z-61	Upper Alder Gulch	5/13/1997	11	6.39	6.8	59	11	200	< 3	< 0.1	< 5	1	7	700	< 0.6	< 20	< 3	< 1	0.003	30	--
Alder Gulch	Z-61	Upper Alder Gulch	9/9/1998	--	--	--	--	--	--	--	0.20	--	< 1	--	--	--	--	--	< 1	--	< 5	--
Alder Gulch	Z-61	Upper Alder Gulch	9/9/1998	18	--	4.15	--	19.9	--	--	--	--	--	--	--	--	--	--	--	0.017	--	--
Alder Gulch	Z-62	Upper Alder Gulch	6/7/1996	17	12	7.7	60	13	300	< 3	0.10	< 5	< 1	7	490	< 0.6	< 20	< 3	< 1	0.003	30	10
Alder Gulch	Z-62	Upper Alder Gulch	5/13/1997	15	4.49	6.8	74	9	300	< 3	< 0.1	< 5	< 1	6	780	< 0.6	< 20	< 3	< 1	0.003	20	--
Alder Gulch	Z-62	Upper Alder Gulch	9/9/1998	--	--	--	--	--	230	2	< 0.2	--	--	--	--	--	--	--	< 1	--	< 5	--
Alder Gulch	Z-62	Upper Alder Gulch	9/9/1998	15	--	6.98	--	64.9	--	--	--	--	--	--	--	--	--	--	--	0.011	--	--
Beaver Creek	Z-27	Upper Beaver Creek, headwater trib.	5/4/1990	39	22	6.9	71	18	--	--	< 1	< 5	20	< 10	440	< 1	< 30	< 10	< 5	--	< 10	44
Beaver Creek	Z-27	Upper Beaver Creek, headwater trib.	5/15/1990	57	9.4	6.9	96	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Beaver Creek	Z-27	Upper Beaver Creek, headwater trib.	5/29/1990	61	27	7.2	68	10	--	--	3	< 5	20	< 10	640	< 1	< 30	< 10	< 5	--	< 10	4
Beaver Creek	Z-27	Upper Beaver Creek, headwater trib.	6/14/1990	87	1	7.4	129	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Beaver Creek	Z-27	Upper Beaver Creek, headwater trib.	6/26/1990	99	0.3	7.3	120	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--	--
Beaver Creek	Z-27	Upper Beaver Creek, headwater trib.	7/19/1990	137	0.2	7.5	147	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Beaver Creek	Z-27	Upper Beaver Creek, headwater trib.	10/31/1990	168	1	7.1	236	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Beaver Creek	Z-27	Upper Beaver Creek, headwater trib.	5/14/1991	49	13.38	7.1	41	10	--	--	< 0.1	< 5	20	< 1	200	0.2	< 30	< 2	< 5	--	0	1
Beaver Creek	Z-27	Upper Beaver Creek, headwater trib.	6/12/1991	68	5.39	6.8	110	8	--	--	--	< 5	--	--	--	--	--	--	--	--	--	--
Beaver Creek	Z-27	Upper Beaver Creek, headwater trib.	7/24/1991	126	0.5	7.8	157	8	--	--	< 1	< 5	20	< 10	50	< 1	< 30	< 10	< 5	--	< 10	1
Beaver Creek	Z-27	Upper Beaver Creek, headwater trib.	9/5/1991	178	0.03	7.9	169	7	--	--	< 1	< 5	20	< 10	100	< 1	< 30	< 10	< 5	--	< 10	26
Beaver Creek	Z-27	Upper Beaver Creek, headwater trib.	5/11/1993	71	0.6	7.1	102	5	--	--	< 1	< 5	10	< 10	350	< 1	< 10	20	< 5	--	0	8
Beaver Creek	Z-27	Upper Beaver Creek, headwater trib.	10/13/1993	123	0.99	7.5	141	5	--	--	--	< 5	--	--	--	--	--	--	--	--	--	12
Beaver Creek	Z-27	Upper Beaver Creek, headwater trib.	5/18/1994	95	--	7.8	--	--	--	< 5	1	< 5	< 10	< 10.00	1210	< 1	< 10	< 10	< 5	--	0	8
Beaver Creek	Z-27	Upper Beaver Creek, headwater trib.	10/26/1994	158	0.04	7.9	180	6	--	--	--	< 5	--	--	--	--	--	--	--	--	--	--
Beaver Creek	Z-27	Upper Beaver Creek, headwater trib.	5/15/1995	37	7.32	7.1	105	3	--	< 5	< 1	< 5	< 10	< 10	890	< 1	< 10	< 10	< 5	--	0	10
Beaver Creek	Z-27	Upper Beaver Creek, headwater trib.	5/28/1996	42	9.8	6.9	47	4	< 300	< 3	< 0.1	< 5	1	2	630	< 0.6	< 20	< 3	< 1	3	0	10
Beaver Creek	Z-27	Upper Beaver Creek, headwater trib.	5/15/1997	93	0.72	7	111	4	< 100	< 3	< 0.1	< 5	--	2	150	< 0.6	< 20	4	< 1	--	0	22

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO ₄ (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se trm (µg/l)	Tl trm (µg/L)	Zn trm (µg/l)	TSS (mg/L)
Beaver Creek	Z-27	Upper Beaver Creek, headwater trib.	6/16/1997	52	2.37	7.64	144	2.5	< 100	< 3	< 0.1	< 5	--	17	180	< 0.6	< 20	3	< 1	--	0	10
Beaver Creek	Z-27	Upper Beaver Creek, headwater trib.	7/30/1997	150	100	--	--	--	--	< 3	< 0.1	< 5	--	< 1	--	< 0.6	< 20	< 3	< 1	--	--	10
Beaver Creek	Z-27	Upper Beaver Creek, headwater trib.	8/26/1997	150	--	--	--	--	--	< 3	< 0.1	< 5	--	--	--	< 0.6	< 20	< 3	< 1	--	--	--
Beaver Creek	Z-27	Upper Beaver Creek, headwater trib.	9/4/1997	150	--	--	--	--	--	< 3	< 0.1	< 5	--	< 1	--	< 0.6	< 20	< 3	< 1	--	--	10
Beaver Creek	Z-27	Upper Beaver Creek, headwater trib.	6/18/1998	108	--	--	132	3	< 100	< 3	< 0.1	< 5	--	10	230	< 0.6	< 20	< 3	< 1	--	< 10	10
Beaver Creek	Z-27	Upper Beaver Creek, headwater trib.	5/18/1999	35	6	--	44	1.9	--	< 3	0.1	< 5	--	7	670	< 0.6	< 20	15	< 1	--	< 10	10
Beaver Creek	Z-27	Upper Beaver Creek, headwater trib.	6/16/1999	68	1.3	--	86	2.1	--	< 3	< 0.1	< 5	--	17	240	< 0.6	< 20	< 3	< 1	--	< 10	10
Beaver Creek	Z-27	Upper Beaver Creek, headwater trib.	6/21/2001	62	--	7.13	80	1.8	--	< 3	< 0.1	< 5	--	7	430	--	< 20	23	< 1	--	< 10	10
Big Horn Creek	L-21	U/S of Swift Gulch confluence	6/18/1985	--	0		--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	10/17/1985	66	4039	7.4	78	16	--	--	--	< 10	--	--	610	--	--	--	--	--	20	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	6/5/1986	124	1350	7.6	143	22	--	< 5	--	--	--	--	< 30	--	--	--	--	--	< 10	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	10/29/1986	144	200	7.2	134	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	6/3/1987	118	900	7.4	152	21	--	--	--	--	--	--	120	--	--	--	--	--	80	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	10/15/1987	--	0		--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	5/12/1988	103	250	7.8	160	22	--	--	--	< 10	--	--	210	--	--	--	--	--	20	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	10/14/1988	233	50	7.6	341	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	5/24/1989	123	20	8.2	138	24	--	--	--	< 10	--	--	100	--	--	--	--	--	30	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	10/5/1989	--	0	8.1	143	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	6/1/1990	130	--			18	--	< 5	< 1	--	--	< 10	170	< 1	< 30	--	--	--	< 10	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	11/2/1990	--	0		--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	12/12/1990	--	0		--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	1/11/1991	--	0		--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	3/21/1991	228	10	8	228	56	--	< 5	< 1	< 5	< 20	< 10	< 30	< 1	< 30	< 10	< 5	--	< 10	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	5/16/1991	102	--	7.9	94	17	--	< 5	< 0.1	< 5	< 20	1	470	< 0.2	< 30	< 2	< 5	--	< 10	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO ₄ (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se trm (µg/l)	Tl trm (µg/L)	Zn trm (µg/l)	TSS (mg/L)
Big Horn Creek	L-21	U/S of Swift Gulch confluence	6/13/1991	134	228.45	8.2	157	19	--	< 5	1	< 5	< 20	< 10	50	< 1	< 30	< 10	< 5	--	< 10	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	7/24/1991	202	11.2	8	210	29	--	< 5	1	< 5	< 20	< 10	30	< 1	< 30	< 10	< 5	--	< 10	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	9/6/1991	--	0		--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	10/18/1991	--	0		--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	5/31/1992	--	0		--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	10/15/1992	218	1.4	8	246	43	--	< 5	< 1	< 5	< 10	< 10	< 30	< 1	< 30	< 10	< 5	--	< 10	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	10/15/1992	217	1.4	7.9	254	42	--	< 5	< 1	< 5	< 10	< 10	< 30	< 1	< 30	< 10	< 5	--	20	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	5/12/1993	133	112.21	8.1	153	22	--	< 5	< 1	< 5	< 10	< 10	40	< 1	< 10	< 10	< 5	--	< 10	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	10/12/1993	185	52.96	7.9	213	32	--	--	--	< 5	--	< 10	--	--	--	--	--	--	--	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	5/20/1994	154	212	8.2	162	21	--	< 5	< 1	< 5	< 10	< 10	180	< 1	< 10	< 10	< 5	--	< 10	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	5/20/1994	153	212	8.1	169	21	--	< 5	< 1	< 5	< 10	--	220	< 1	< 10	< 10	< 5	--	10	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	10/27/1994	254	1.35	8	274	45	--	--	--	< 5	--	--	--	--	--	--	--	--	--	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	5/9/1995	79	170	7.7	119	14	--	< 5	< 1	< 5	< 10	< 10	2680	< 1	< 10	< 10	< 5	--	20	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	8/17/1995	194	35	7.8	247	29	--	< 1	< 0.1	< 5	< 10	< 1	14	< 1	< 10	< 2	< 5	--	20	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	10/21/1995	211	17	7.5	235	39	--	--	--	< 5	--	--	--	--	--	--	--	--	--	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	6/1/1996	101	435.4	7.7	139	14	200	< 3	< 0.1	< 5	< 1	2	350	< 0.6	< 20	< 3	< 1	--	< 10	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	8/13/1996	--	0		--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	10/24/1996	--	0		--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	2/12/1997	--	0		--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	4/18/1997	80	219.93	7.8	113	11	200	< 3	< 0.1	< 5	--	2	1100	--	< 20	< 3	< 1	--	20	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	5/14/1997	103	18	7.5	150	10	< 100	< 3	0.1	< 5	--	< 1	30	--	< 20	< 3	< 1	--	< 10	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	6/18/1997	100.3	107.72	8.06	211	18	< 100	< 3	< 0.1	< 5	--	< 1	< 10	--	< 20	< 3	< 1	--	< 10	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	8/13/1997	191.1	1.94	7.87	248	29.8	< 100	< 3	< 0.1	< 5	--	< 1	< 10	--	< 20	< 3	< 1	--	< 10	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	10/24/1997	--	--		--	--	< 100	< 3	< 0.1	< 5	--	< 1	< 10	--	< 20	< 3	< 1	--	--	--

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO ₄ (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se trm (µg/l)	Tl trm (µg/L)	Zn trm (µg/l)	TSS (mg/L)
Big Horn Creek	L-21	U/S of Swift Gulch confluence	4/22/1998	134.5	--		155	22	< 100	< 3	0.3	< 5	--	6	40	--	< 20	< 3	< 1	--	< 10	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	5/22/1998	159.9	--		177	26.5	< 100	< 3	< 0.1	< 5	--	< 1	40	--	< 20	< 3	7	--	< 10	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	6/26/1998	83.4	--		130	12.2	460	< 3	< 0.1	< 5	--	19	1220	--	< 20	6	< 1	--	--	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	8/12/1998	167.5	--		212	24.6	< 100	< 3	< 0.1	< 5	--	1	< 10	--	< 20	< 3	< 1	--	< 10	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	6/3/2008	115	--	7.6		17	--	< 3	< 0.1	--	--	< 1	130	--	0	--	0	--	6	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	8/6/2008	258	--	7.6	266	34	< 100	< 3	< 0.1	--	--	< 1	10	--	0	--	0	--	2	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	8/6/2008	217	--	7.5	272	34	< 100	< 3	< 0.1	--	--	< 1	20	--	0	--	0	--	2	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	8/6/2008	258	--	7.6	266	34	< 100	< 3	< 0.1	--	--	< 1	10	--	1	--	0	--	1	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	8/6/2008	217	--	7.5	272	34	< 100	< 3	< 0.1	--	--	< 1	20	--	1	--	0	--	1	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	8/7/2008	219	--	7.5	268	34	< 100	< 3	< 0.1	--	--	< 1	< 10	--	0	--	0	--	1	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	8/7/2008	267	--	7.6	266	34	< 100	< 3	< 0.1	--	--	< 1	10	--	0	--	0	--	0	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	8/7/2008	219	--	7.5	268	34	< 100	< 3	< 0.1	--	--	< 1	< 10	--	0	--	0	--	1	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	8/7/2008	267	--	7.6	266	34	< 100	< 3	< 0.1	--	--	< 1	10	--	0	--	0	--	0	--
Big Horn Creek	L-21	U/S of Swift Gulch confluence	8/7/2008	123	--	7.8	--	--	--	< 1	< 0.1	--	--	< 1	310	--	< 1	--	< 1	--	7	--
King Creek (see Montana Gulch sites)	L-40	Upper Montana Gulch	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Lodge Pole Creek	Z-28	Upper Lodge Pole Creek, Upper Middle East Trib	5/4/1990	42	251.3	7.1	66	19	--	< 5	< 1	< 5	<20	< 10	330	< 1	< 30	20	< 5	--	< 10	12
Lodge Pole Creek	Z-28	Upper Lodge Pole Creek, Upper Middle East Trib	5/16/1990	38	200	7	59	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Lodge Pole Creek	Z-28	Upper Lodge Pole Creek, Upper Middle East Trib	5/29/1990	33	80	12.2	611	10	--	< 5	< 1	< 5	<20	< 10	480	< 1	< 30	< 10	< 5	--	< 10	9
Lodge Pole Creek	Z-28	Upper Lodge Pole Creek, Upper Middle East Trib	6/14/1990	68	20	7.4	110	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Lodge Pole Creek	Z-28	Upper Lodge Pole Creek, Upper Middle East Trib	6/26/1990	76	9.4	7.2	66	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--	--
Lodge Pole Creek	Z-28	Upper Lodge Pole Creek, Upper Middle East Trib	7/19/1990	95	1	7.3	91	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Lodge Pole Creek	Z-28	Upper Lodge Pole Creek, Upper Middle East Trib	5/15/1991	41	138.24	7.3	31	8	--	< 5	< 0.1	< 5	<20	< 1	180	2	< 30	2	< 5	--	< 10	< 1
Lodge Pole Creek	Z-28	Upper Lodge Pole Creek, Upper Middle East Trib	6/12/1991	52	14.81	7.5	69	8	--	< 5	< 1	< 5	<20	< 10	70	< 1	< 30	< 10	< 5	--	< 10	8
Lodge Pole Creek	Z-28	Upper Lodge Pole Creek, Upper Middle East Trib	7/23/1991	90	4.49	7.5	141	12	--	< 5	< 1	< 5	<20	< 10	70	< 1	< 30	< 10	< 5	--	20	35

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO ₄ (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se trm (µg/l)	Tl trm (µg/L)	Zn trm (µg/l)	TSS (mg/L)	
Lodge Pole Creek	Z-28	Upper Lodge Pole Creek, Upper Middle East Trib	5/11/1993	44	6.7	6.7	62	10	--	< 5	< 1	< 5	< 10	< 10	70	< 1	< 10	30	< 5	--	< 10	4	
Lodge Pole Creek	Z-28	Upper Lodge Pole Creek, Upper Middle East Trib	10/13/1993	83	2.02	7.4	105	14	--	--	--	< 5	--	--	--	--	--	--	--	--	0	< 1	
Lodge Pole Creek	Z-28	Upper Lodge Pole Creek, Upper Middle East Trib	5/18/1994	64	15.1	7.8	84	11	--	< 5	< 1	< 5	< 10	< 10	240	< 1	< 10	10	< 5	--	30	4	
Lodge Pole Creek	Z-28	Upper Lodge Pole Creek, Upper Middle East Trib	10/26/1994	--	0	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	
Lodge Pole Creek	Z-28	Upper Lodge Pole Creek, Upper Middle East Trib	5/15/1995	44	129	7.5	119	9	--	< 5	< 1	< 5	< 10	< 10	840	< 1	< 10	< 10	< 5	--	20	< 10	
Lodge Pole Creek	Z-28	Upper Lodge Pole Creek, Upper Middle East Trib	8/2/1995	102	20	7.3	141	16	< 100	< 1	< 0.1	< 5	< 10	< 1	19	< 1	< 10	< 2	< 5	--	30	< 10	
Lodge Pole Creek	Z-28	Upper Lodge Pole Creek, Upper Middle East Trib	10/20/1995	--	0	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	0	--
Lodge Pole Creek	Z-28	Upper Lodge Pole Creek, Upper Middle East Trib	5/29/1996	45	60.1	7.6	90	9	200	< 3	< 0.1	< 5	< 10	2	730	< 0.6	< 20	< 3	< 1	--	< 10	< 10	
Lodge Pole Creek	Z-28	Upper Lodge Pole Creek, Upper Middle East Trib	4/15/1997	88	5	7.7	126	16	< 100	< 3	< 0.1	< 5	--	< 1	10	--	< 20	< 3	< 1	--	< 10	< 10	
Lodge Pole Creek	Z-28	Upper Lodge Pole Creek, Upper Middle East Trib	5/13/1997	59	31.96	7.8	86	10	< 100	< 3	< 0.1	< 5	--	< 1	30	--	< 20	< 3	< 1	--	< 10	< 10	
Lodge Pole Creek	Z-28	Upper Lodge Pole Creek, Upper Middle East Trib	6/16/1997	54.6	53.86	7.69	87	9.8	< 100	< 3	< 0.1	< 5	--	2	60	--	< 20	5	< 1	--	< 10	< 10	
Lodge Pole Creek	Z-28	Upper Lodge Pole Creek, Upper Middle East Trib	8/12/1997	101.1	0.5	7.41	132	17	< 100	< 3	< 0.1	< 5	--	< 1	10	--	< 20	< 3	< 1	--	30	< 10	
Lodge Pole Creek	Z-28	Upper Lodge Pole Creek, Upper Middle East Trib	4/23/1998	97.8	--	--	94	16.6	1290	< 3	0.2	< 5	--	2	30	--	< 20	< 3	< 1	--	< 10	< 10	
Lodge Pole Creek	Z-28	Upper Lodge Pole Creek, Upper Middle East Trib	5/26/1998	93.6	--	--	104	14	< 100	< 3	< 0.1	< 5	--	< 1	20	--	< 20	< 3	< 1	--	< 10	< 10	
Lodge Pole Creek	Z-28	Upper Lodge Pole Creek, Upper Middle East Trib	6/18/1998	57.8	--	--	82	8.5	< 100	< 3	< 0.1	< 5	--	30	260	--	< 20	16	< 1	--	< 10	< 10	
Lodge Pole Creek	Z-30	Upper Lodge Pole Creek, Upper East Trib	5/4/1990	25	80	6.7	56	6	--	< 5	< 1	< 5	<20	< 10	800	< 1	< 30	< 10	< 5	--	< 10	7	
Lodge Pole Creek	Z-30	Upper Lodge Pole Creek, Upper East Trib	5/16/1990	25	58	6.9	55	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	
Lodge Pole Creek	Z-30	Upper Lodge Pole Creek, Upper East Trib	5/29/1990	42	31	7.2	54	9	--	< 5	< 1	< 5	<20	< 10	710	< 1	< 30	< 10	< 5	--	10	4	
Lodge Pole Creek	Z-30	Upper Lodge Pole Creek, Upper East Trib	6/14/1990	26	1	6.9	70	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	
Lodge Pole Creek	Z-30	Upper Lodge Pole Creek, Upper East Trib	6/26/1990	65	9.4	7	99	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--	--	
Lodge Pole Creek	Z-30	Upper Lodge Pole Creek, Upper East Trib	7/19/1990	86	1	7.3	100	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	
Lodge Pole Creek	Z-30	Upper Lodge Pole Creek, Upper East Trib	7/31/1990	98	1	7.2	122	25	--	< 5	< 1	< 5	<20	< 10	40	< 1	< 30	< 10	< 5	--	< 10	< 1	
Lodge Pole Creek	Z-30	Upper Lodge Pole Creek, Upper East Trib	8/22/1990	112	1	6.9	150	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	
Lodge Pole Creek	Z-30	Upper Lodge Pole Creek, Upper East Trib	10/12/1990	--	0	--	--	--	--	--	--	< 5	--	--	--	--	--	--	--	--	--	--	

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO ₄ (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se trm (µg/l)	Tl trm (µg/L)	Zn trm (µg/l)	TSS (mg/L)
Lodge Pole Creek	Z-30	Upper Lodge Pole Creek, Upper East Trib	10/31/1990	140	2	7.3	182	50	--	< 5	< 1	--	<20	< 10	160	< 1	< 30	< 10	< 5	--	< 10	109
Lodge Pole Creek	Z-30	Upper Lodge Pole Creek, Upper East Trib	12/12/1990	148	--	7	163	53	--	< 5	< 1	< 5	<20	< 10	1670	< 1	< 30	--	< 5	--	70	676
Lodge Pole Creek	Z-30	Upper Lodge Pole Creek, Upper East Trib	1/10/1991	--	0	--	--	--	--	--	--	--	--	--	--	--	--	0	--	--	--	--
Lodge Pole Creek	Z-30	Upper Lodge Pole Creek, Upper East Trib	3/20/1991	--	0	--	--	--	--	--	--	--	--	--	--	--	--	0	--	--	--	--
Lodge Pole Creek	Z-30	Upper Lodge Pole Creek, Upper East Trib	5/15/1991	29	28.46	7.1	25	15	--	< 5	5	< 5	<20	< 20	530	3	< 20	50	< 5	--	< 20	< 1
Lodge Pole Creek	Z-30	Upper Lodge Pole Creek, Upper East Trib	5/15/1991	29	28.46	7	48	7	--	< 5	0.1	< 5	<20	< 1	160	< 0.2	< 30	< 2	< 5	--	< 10	< 20
Lodge Pole Creek	Z-30	Upper Lodge Pole Creek, Upper East Trib	6/12/1991	44	8.08	7.4	67	9	--	< 5	< 1	< 5	<20	< 10	360	< 1	< 30	< 10	< 5	--	< 10	9
Lodge Pole Creek	Z-30	Upper Lodge Pole Creek, Upper East Trib	7/24/1991	95	1	7.3	111	20	--	< 5	< 1	< 5	<20	< 10	480	< 1	< 30	< 10	< 5	--	40	46
Lodge Pole Creek	Z-30	Upper Lodge Pole Creek, Upper East Trib	10/14/1992	39	0.19	7	67	9	--	< 5	< 1	< 5	< 10	< 10	220	< 1	< 30	20	< 5	--	< 10	14
Lodge Pole Creek	Z-30	Upper Lodge Pole Creek, Upper East Trib	5/11/1993	25	1.38	5.5	33	6	--	< 5	< 1	< 5	< 10	< 10	410	< 1	< 10	30	< 5	--	70	7
Lodge Pole Creek	Z-30	Upper Lodge Pole Creek, Upper East Trib	10/13/1993	35	1.44	6.8	52	8	--	--	--	< 5	--	--	--	--	--	--	--	--	--	4
Lodge Pole Creek	Z-30	Upper Lodge Pole Creek, Upper East Trib	5/18/1994	25	4.3	7.2	43	6	--	< 5	< 1	< 5	< 10	< 10	400	< 1	10	< 10	< 5	--	30	10
Lodge Pole Creek	Z-30	Upper Lodge Pole Creek, Upper East Trib	10/26/1994	--	0	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Lodge Pole Creek	Z-30	Upper Lodge Pole Creek, Upper East Trib	5/15/1995	25	4.88	7	65	5	--	< 5	< 1	< 5	< 10	< 10	930	< 1	< 10	< 10	< 5	--	20	< 10
Lodge Pole Creek	Z-30	Upper Lodge Pole Creek, Upper East Trib	10/20/1995	--	0	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Lodge Pole Creek	Z-30	Upper Lodge Pole Creek, Upper East Trib	5/29/1996	25	17.6	7.5	38	6	300	< 3	< 0.1	< 5	1	2	1010	< 0.6	< 20	< 3	< 1	--	20	< 10
Lodge Pole Creek	Z-30	Upper Lodge Pole Creek, Upper East Trib	10/21/1996	--	0	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Lodge Pole Creek	Z-30	Upper Lodge Pole Creek, Upper East Trib	2/11/1997	--	0	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Lodge Pole Creek	Z-30	Upper Lodge Pole Creek, Upper East Trib	4/15/1997	--	0	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Lodge Pole Creek	Z-30	Upper Lodge Pole Creek, Upper East Trib	5/15/1997	25	2.26	6.8	57	5	< 100	< 3	< 0.1	< 5	--	2	850	--	< 20	< 3	< 1	--	40	< 10
Lodge Pole Creek	Z-30	Upper Lodge Pole Creek, Upper East Trib	6/16/1997	25	1.93	6.89	49	5	< 100	< 3	< 0.1	< 5	--	12	340	--	< 20	5	1	--	--	< 10
Lodge Pole Creek	Z-30	Upper Lodge Pole Creek, Upper East Trib	8/12/1997	--	0	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Lodge Pole Creek	Z-30	Upper Lodge Pole Creek, Upper East Trib	6/18/1998	27.7	--	--	54	4.3	120	< 3	< 0.1	< 5	--	11	540	--	< 20	6	< 1	--	< 10	< 10
Mill Gulch (see Montana Gulch sites)	L-40, RCSS-5	Upper Montana Gulch, Upper Rock Creek	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Montana Gulch	L-40	Upper MT West of L85 Pad	5/20/1994	204	60	8.1	244	23	--	< 5	< 1	< 5	< 10	< 10	< 30	< 1	< 10	< 10	< 5	--	< 0.01	< 10

Water Body Segment	Site ID	Site Description	Sample_Date	Hardness (mg/L)	Flow (GPM)	pH	TDS (mg/L)	SO ₄ (mg/L)	AL dis (µg/L)	As trm (µg/L)	Cd trm (µg/l)	CN tot (µg/L)	Cr trm (µg/L)	Cu trm (µg/l)	Fe trm (µg/L)	Hg trm (µg/L)	Ni trm (µg/l)	Pb trm (µg/l)	Se trm (µg/l)	Tl trm (µg/L)	Zn trm (µg/l)	TSS (mg/L)
Montana Gulch	L-40	Upper MT West of L85 Pad	8/3/1994	284	2.74	8	336	43	--	< 5	< 1	< 5	< 10	< 10	< 30	< 1	< 10	< 10	< 5	--	0.01	10
Montana Gulch	L-40	Upper MT West of L85 Pad	10/31/1994	287	0.93	7.8	330	47	--	< 5	< 1	< 5	< 10	< 10	< 30	< 1	< 10	< 10	< 5	--	0.01	10
Montana Gulch	L-40	Upper MT West of L85 Pad	5/14/1995	249	37	7.9	273	45	--	< 5	< 1	< 5	< 10	< 10	270	< 1	< 10	< 10	9	--	0.01	10
Montana Gulch	L-40	Upper MT West of L85 Pad	6/1/1996	175	93	7.3	192	21	< 100	< 5	< 0.1	< 5	< 1	< 1	< 10	< 0.6	< 20	< 3	< 1	--	< 0.01	< 10
Montana Gulch	L-40	Upper MT West of L85 Pad	6/1/1996	181	93	6.8	199	21	< 100	< 5	< 0.1	< 5	< 1	< 1	< 10	< 0.6	< 20	< 3	< 1	--	< 0.01	< 10
Rock Creek	RCSS-5	Rock Creek	5/15/1997	17	0.59	6.6	--	--	800	< 3	< 0.1	< 5	2	6	1300	< 0.6	< 20	< 3	< 1	--	< 20	--
Rock Creek (see Alder Gulch, Rock Creek sites)	Z-60-62 RCSS-5	Upper Alder Gulch, Upper Rock Creek	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Ruby Creek (see Alder Gulch, Ruby Gulch sites)	AGSS-10	Upper Alder Gulch U/S of Hawkeye	5/12/1997	34.00	39	6.5	63	17	200	< 3	< 1	< 5	< 1	5	430	< 0.6	< 20	< 3	< 1	0.003	< 10	--
Ruby Creek	RGSP-1	Upper Ruby Gulch, North Trib	5/16/1997	41	3	7.1	50	8	200	< 3	< 0.1	< 5	1	< 1	440	< 0.6	< 20	< 3	< 1	--	< 20	--
Ruby Creek	RGSS-1	Upper Ruby Gulch, North Trib	5/12/1997	65	5	7.6	71	--	--	< 3	< 0.1	< 5	< 1	1	160	< 0.6	--	< 3	< 1	--	< 20	--
Ruby Creek	Z-52	East Ruby Gulch Trib	5/19/1994	85	85	8.1	105	12	--	< 5	< 1	< 5	< 10	< 10	110	< 1	< 10	< 10	< 5	--	20	23
Ruby Creek	Z-52	East Ruby Gulch Trib	5/16/1995	45	85	7.7	71	9	--	< 5	< 1	< 5	< 10	< 10	860	< 1	< 10	< 10	< 5	--	10	10
Ruby Creek	Z-52	East Ruby Gulch Trib	6/3/1996	138	8	7.1	171	53	200	< 3	< 0.1	< 5	< 1	< 1	300	< 0.6	< 20	< 3	< 1	--	20	10
Ruby Creek (see Alder Gulch sites)	Z-60-62	Upper Alder Gulch	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Ruby Creek	Z-9	East Ruby Gulch Trib	7/3/1997	75	--	--	--	--	--	< 3	< 0.1	--	< 1	--	--	--	< 20	< 3	< 1	--	--	--
Ruby Gulch (see Ruby Creek and Alder Gulch sites)	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Sullivan Creek (see Rock Creek Site RCSS-5, upper Alder Gulch sites Z-60-62, Montana Gulch site L-40)	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--
Swift Gulch Creek	L-41	Upper Swift Gulch	5/14/1997	12	5	7.2	43	7	200	6	< 0.1	< 5	1	5	750	< 0.6	< 20	< 3	< 1	< 3	< 20	--
Swift Gulch Creek	L-45	Upper Swift Gulch	5/14/1997	11	1	6.9	65	8	200	< 3	< 0.1	< 5	1	4	610	< 0.6	< 20	< 3	< 1	< 3	< 20	--
Swift Gulch Creek	L-45	Upper Swift Gulch	4/8/2004	9	--	6.1	61	6	0	3	0	--	--	7	1270	< 0.6	0	0	0	--	0	< 10
Swift Gulch Creek (see South Big Horn site L-21)	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--

APPENDIX D – GROUNDWATER CHEMISTRY EXAMPLES ZORTMAN AND LANDUSKY MINES**Table D-1. Selected Groundwater chemistry data for wells at the Zortman and Landusky Mines**

Waterbody Segment	Site ID	Site Description	Sample Date	Hardness (mg/L)	Water Level (ft)	Field pH (su)	TDS (mg/L)	SO ₄ (mg/L)	AL dis (µg/L)	As dis (µg/L)	Cd dis (µg/l)	CN tot (µg/L)	Cr dis (µg/L)	Cu dis (µg/l)	Fe dis (µg/L)	Hg dis (µg/L)	Ni dis (µg/l)	Pb dis (µg/l)	Se (µg/l)	Zn dis (µg/l)
Ruby Gulch	RG-110	Ruby Gulch Near Permit Boundary	9/26/1994	848	27.6	8.18	1310	764	< 100	< 3	2.0	< 5	< 10	< 10	< 30	< 1	40	< 10	30	260
Ruby Gulch	RG-110	Ruby Gulch Near Permit Boundary	10/24/1994	743	23.64	7.31	1090	629	< 100	< 3	< 1	< 5	< 10	< 10	< 30	< 1	20	< 10	< 5	110
Ruby Gulch	RG-110	Ruby Gulch Near Permit Boundary	1/25/1995	739	20.7	7.4	1030	670	< 100	< 3	1.0	< 5	< 10	< 10	< 30	< 1	40	< 10	< 5	340
Ruby Gulch	RG-110	Ruby Gulch Near Permit Boundary	5/10/1995	773	21.7	7.17	1150	690	300	< 3	9.0	< 5	< 10	< 10	< 30	< 1	170	< 10	< 5	1580
Ruby Gulch	RG-110	Ruby Gulch Near Permit Boundary	8/3/1995		20.4	6.7						< 5			< 10					
Ruby Gulch	RG-110	Ruby Gulch Near Permit Boundary	5/30/1996	623	17.6	6.68	969	587	3100	< 3	17.4	< 5	< 1	29		< 0.6	210	< 3	1	1820
Ruby Gulch	RG-110	Ruby Gulch Near Permit Boundary	8/12/1996	855	23.4	6.52	1420	884	1500	< 3	23.0	< 5	< 1	11	< 10	< 0.6	250	< 3	1	2060
Ruby Gulch	RG-110	Ruby Gulch Near Permit Boundary	10/22/1996	391	23.11	7.98	950	522				< 5								
Ruby Gulch	RG-110	Ruby Gulch Near Permit Boundary	2/12/1997	599	24.28	6.89	878	475	< 100	< 3	1.5	< 5	< 1	2	< 10	< 0.6	< 20	< 3	< 1	< 100
Ruby Gulch	RG-110	Ruby Gulch Near Permit Boundary	4/15/1997	621	21.66	7.71	869	486	< 100	< 3	1.1	< 5		2	< 10		< 20	< 3	1	< 100
Ruby Gulch	RG-110	Ruby Gulch Near Permit Boundary	5/12/1997	643		6.94	1070	678	1600	< 3	16.6	< 5		20	< 10		190	< 3	2	1950
Ruby Gulch	RG-110	Ruby Gulch Near Permit Boundary	8/11/1997	788	23.68	6.55	1240	725	800	< 3	16.5	< 5		7	50		160	< 3	< 1	950
Ruby Gulch	RG-110	Ruby Gulch Near Permit Boundary	10/23/1997						< 100			< 5						< 3	< 1	
Ruby Gulch	RG-110	Ruby Gulch Near Permit Boundary	1/21/1998	798.2			1090	651	220	< 3	3.4	< 5		5	50		30	< 3	3	240
Ruby Gulch	RG-110	Ruby Gulch Near Permit Boundary	4/28/1998	1888.5			2480	1619.7	10600	< 3	24.2	< 5		97	30		230	< 3	5	2300
Ruby Gulch	RG-110	Ruby Gulch Near Permit Boundary	5/29/1998	928.3			1408	935	3390	< 3	2.8	< 5		2	190		400	< 3	< 1	2080
Ruby Gulch	RG-110	Ruby Gulch Near Permit Boundary	6/19/1998	1072.3			1552	1022.3	15400	< 3	51.1	< 5		255	20		390	< 3	5	4600
Ruby Gulch	RG-110	Ruby Gulch Near Permit Boundary	8/20/1998	843.5			1356	894.1	3930	< 3	18.7	< 5		80	< 10		270	< 3	< 1	2510
Ruby Gulch	RG-110	Ruby Gulch Near Permit Boundary	10/22/1998	656.6			1075	652.8	980	< 3	14.6	< 5		21	130		130	< 3	< 1	990
Ruby Gulch	RG-110	Ruby Gulch Near Permit Boundary	4/12/1999	994.2	22.49		1430	907	7160	< 3	35.6	< 5		75	< 10		230	< 3	< 1	3810
Ruby Gulch	RG-110	Ruby Gulch Near Permit Boundary	5/20/1999	947.6	17.94		1400	862	5170	< 3	27.6	< 5	< 1	50	< 10	< 0.6	280	< 3	2	2310
Ruby Gulch	RG-110	Ruby Gulch Near Permit Boundary	6/21/1999	656.7	22.65		1091	695	4250	< 3	21.3	< 5		43	20		340	< 3	1	1530

Table D-1. Selected Groundwater chemistry data for wells at the Zortman and Landusky Mines

Waterbody Segment	Site ID	Site Description	Sample Date	Hardness (mg/L)	Water Level (ft)	Field pH (su)	TDS (mg/L)	SO ₄ (mg/L)	AL dis (µg/L)	As dis (µg/L)	Cd dis (µg/l)	CN tot (µg/L)	Cr dis (µg/L)	Cu dis (µg/l)	Fe dis (µg/L)	Hg dis (µg/L)	Ni dis (µg/l)	Pb dis (µg/l)	Se (µg/l)	Zn dis (µg/l)
Ruby Gulch	RG-110	Ruby Gulch Near Permit Boundary	8/31/1999	727.9	23.64		1150	729.9	< 100	< 3	7.2	< 5		< 1	50		180	< 3	< 1	1260
Ruby Gulch	RG-110	Ruby Gulch Near Permit Boundary	11/1/1999	599.7	24.08		922	541	140	< 3	4.4	< 5		8	10		40	< 3	< 1	350
Ruby Gulch	RG-110	Ruby Gulch Near Permit Boundary	5/25/2000	584.2			1021	656.2	4840	< 3	29.3	< 5		69	10		280	< 3	< 1	1700
Ruby Gulch	RG-110	Ruby Gulch Near Permit Boundary	11/16/2000	680		7.22	1002	592	< 100	< 3	2.5	< 5		< 1	< 10		20	< 3	< 1	220
Ruby Gulch	RG-110	Ruby Gulch Near Permit Boundary	11/16/2000	680			1002	592	< 100	< 3	2.5	< 5		< 1	< 10		20	< 3	< 1	220
Ruby Gulch	RG-110	Ruby Gulch Near Permit Boundary	4/23/2001	442.1		5.96	797	496	5650	< 3	23.7	< 5		84	< 10		270	3	4	2370
Ruby Gulch	RG-110	Ruby Gulch Near Permit Boundary	10/25/2001	672.5			1026	580	120	< 3	3.1	< 5		4	240		40	< 3	< 1	220
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	9/13/1990	359	31.06	7.4	448	141	< 100	< 5	<1	< 5	< 20	< 10	< 30	< 1	< 30	< 10	< 5	220
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	9/13/1990	359	31.06	7.4	451	140	< 100	< 5	<1	< 5	< 20	< 10	< 30	< 1	< 30	10	< 5	190
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	10/9/1990	396	32.07	7.29	435	158	< 100	< 5	<1	< 5	< 20	< 10	< 30	< 1	< 30	< 10	< 5	20
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	11/6/1990	397	31.54	7.46	482													
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	12/13/1990	386	31.59		474													
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	1/12/1991	400	25.46		470													
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	3/20/1991	368	29.32		420	180	< 100	< 5	<1	< 5	< 20	< 10	< 30	< 1	< 30	< 10	< 5	70
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	5/17/1991	377	25.45		442	170	< 100	< 5	1.4	< 5	< 20	0.005	< 30	< 0.2	< 30	0.002	< 5	60
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	6/13/1991	379	26.78		468	169				< 5								
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	7/24/1991	438	28.78		533	181				< 5								
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	9/5/1991	426	31.7		546	200				< 5								
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	10/20/1991	498	31.77		584	285	< 100	< 5	<1	< 5	< 20	< 10	< 30	< 1	< 30	< 10	< 5	40
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	10/16/1992	465	33.42	7.74	642	244	< 100	< 5	<1	< 5	< 10	< 10	< 30	< 1	< 30	10	< 5	70
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	10/16/1992	448	33.42	7.74	587	251	< 100	< 5	<1	< 5	< 10	< 10	< 30	< 1	< 30	0.01	< 5	70
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	5/15/1993	406	29.45	7.49	538	219	< 100	< 5	2	< 5	< 10	< 10	< 30	< 1	< 10	20	< 5	90
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	10/13/1993	537	31.23	6.76	709	305	< 100	< 5	<1	< 5	< 10	< 10	< 30	< 1	< 10	< 10	< 5	130
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	5/21/1994	574	27.84	7.7	713	315	< 100	< 5	<1	< 5	< 10	< 10	< 30	< 1	< 10	20	< 5	260

Table D-1. Selected Groundwater chemistry data for wells at the Zortman and Landusky Mines

Waterbody Segment	Site ID	Site Description	Sample Date	Hardness (mg/L)	Water Level (ft)	Field pH (su)	TDS (mg/L)	SO ₄ (mg/L)	AL dis (µg/L)	As dis (µg/L)	Cd dis (µg/l)	CN tot (µg/L)	Cr dis (µg/L)	Cu dis (µg/l)	Fe dis (µg/L)	Hg dis (µg/L)	Ni dis (µg/l)	Pb dis (µg/l)	Se (µg/l)	Zn dis (µg/l)
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	10/30/1994	632	29.44	7.33	836	401	< 100	< 5	<1	< 5	< 10	< 10	< 30	< 1	< 10	< 10	< 5	10
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	5/13/1995	504	26.24	7.76	763	366	< 100	< 5	<1	< 5	< 10	< 10	< 30	< 1	< 10	< 10	< 5	30
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	10/19/1995	759	29.83	7.44	996	526	< 100	< 3	0.1	< 5	< 10	< 1	< 10	< 1	< 10	< 3	< 5	20
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	10/19/1995	795	29.83	7.44	990	524	< 100	< 3	0.1	< 5	< 10	< 1	< 10	< 1	< 10	< 3	< 5	10
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	6/1/1996	575	26	7.1	813	402	< 100	< 3	<0.1	< 5	< 1	< 1	< 10	< 0.6	< 20	< 3	3	20
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	10/23/1996	668	30	6.95	930	494	< 100	< 3	0.2	< 5	< 1	< 1	60	< 0.6	< 20	< 3	2	40
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	2/13/1997	604	29.9	7.8	842	452	< 100	< 3	0.4	< 5	9	0.003	< 10	< 0.6	< 20	< 3	5	40
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	4/17/1997	614	25.72	7.88	789	439	< 100	< 3	<0.1	< 5		0.001	< 10		< 20	< 3	4	20
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	5/15/1997	601	27	7.41	789	423	< 100	< 3	0.2	< 5		< 1	< 10		< 20	< 3	3	20
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	6/20/1997	778	26.49	7.17	1120	618	< 100	< 3	<0.1	< 5		0.001	< 10		< 20	< 3	6	10
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	8/14/1997	635	30.6	7.16	960	497	< 100	< 3	0.1	< 5		0.001	< 10		< 20	< 3	5	10
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	2/11/1998	703.7			956	518.3	< 100	< 3	<0.1	< 5		< 1	< 10		< 20	< 3	4	10
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	4/20/1998	662.8			901	468.1	< 100	< 3	<0.1	< 5		< 1	< 10		< 20	< 3	4	30
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	5/21/1998	628.9			881	465.5	< 100	< 3	<0.1	< 5		0.001	< 10		< 20	< 3	1	20
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	6/23/1998	607.9			896	474.8	< 100	< 3	<0.1	< 5		< 1	< 10		< 20	< 3	1	20
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	8/6/1998	596.4			838	440.1	< 100	< 3	<0.1	< 5		0.002	< 10		< 20	< 3	1	10
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	10/7/1998	573.7			816	396	< 100	< 3	<0.1	< 5		0.004	< 10		< 20	< 3	< 1	20
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	2/16/1999	510.2	28.34		691	330.9	< 100	< 3	<0.1	< 5		< 1	< 10		< 20	3	< 1	10
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	4/7/1999	488.4	23.49		652	306.9	< 100	< 3	<0.1	6		< 1	< 10		< 20	< 3	< 1	10
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	5/5/1999	479.3	22.62		660	301	< 100	< 3	<0.1	< 5		< 1	20		< 20	< 3	< 1	10
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	6/2/1999	495	23.21		674	192	< 100	< 3	<0.1	< 5		0.001	30		< 20	< 3	< 1	10
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	8/4/1999	464.7	30.67		683	287	< 100	< 3	<0.1	< 5		0.002	< 10		< 20	< 3	< 1	10
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	10/20/1999	481.9	29.69		641	271.2	< 100	< 3	<0.1	< 5		< 1	< 10		< 20	< 3	< 1	10
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	5/23/2000	415.6			562	229.9	< 100	< 3	0.1	< 5		0.004	< 10		< 20	< 3	< 1	10

Table D-1. Selected Groundwater chemistry data for wells at the Zortman and Landusky Mines

Waterbody Segment	Site ID	Site Description	Sample Date	Hardness (mg/L)	Water Level (ft)	Field pH (su)	TDS (mg/L)	SO ₄ (mg/L)	AL dis (µg/L)	As dis (µg/L)	Cd dis (µg/l)	CN tot (µg/L)	Cr dis (µg/L)	Cu dis (µg/l)	Fe dis (µg/L)	Hg dis (µg/L)	Ni dis (µg/l)	Pb dis (µg/l)	Se (µg/l)	Zn dis (µg/l)
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	11/14/2000	460.7		7.7	614	245	< 100	< 3	< 0.1	< 5		< 1	80		< 20	< 3	< 1	10
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	11/14/2000	460.7			614	245	< 100	< 3	< 0.1	< 5		< 1	80		< 20	< 3	< 1	10
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	4/23/2001	400.3		7.63	555	213.7	< 100	< 3	< 0.1	83		< 1	< 10		< 20	< 3	< 1	10
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	10/29/2001	456.8			629	243	< 100	< 3	0.1	< 5		< 1	< 10		< 20	< 3	2	10
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	11/7/2002	435			626	229	< 100	< 3	0.1	< 5		0.001	< 10		< 20	< 3	2	< 10
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	5/23/2003	404			522	186	< 100	< 3	< 0.1	< 5		0.001	< 10		< 20	< 3	2	< 10
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	10/7/2003	472			642	257	200	< 3	0.1			0.001	10		< 20	< 3	2	40
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	5/28/2004	375			501	204	< 100	< 3	< 0.1	< 5		0.001	30		< 20	< 3	2	20
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	10/25/2004	419			560	200	< 100	< 3	0.1	< 5		< 1	20		< 20	< 3	2	40
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	6/6/2005	360			487	180	< 100	3	< 0.1	< 5		0.003	< 10		< 20	< 3	2	20
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	10/6/2005	482			549	192	< 100	< 3	0.2	< 5		0.003	140		< 20	< 3	2	40
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	5/17/2006	377			477	171	< 100	2	< 0.1	< 5		0.002	70		4	< 3	2	22
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	11/8/2006	430					< 100	2	< 0.1	< 5		0.002	40		4		2	21
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	7/19/2007	401				172	< 100	< 3	< 0.1			0.002	30		5		1	31
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	9/26/2007	482					< 100	1	< 0.1			0.001	< 10		2		< 1	26
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	6/30/2009	428				217	< 100	1	< 0.1			0.006	400		8		1	38
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	9/18/2009	426				208	< 100	1	< 0.1			0.003	390		5		1	61
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	8/16/2010	462					< 100	1	< 0.1			0.004	830		8		2	33
Mill Gulch	ZL-136	Mouth of Mill Gulch (660 Feet North of Rock Creek)	10/14/2010	436					< 100	1	< 0.1			0.004	400		6		1	32

APPENDIX E – LANDUSKY TMDL PLANNING AREA FISH DISTRIBUTION REPORT

Table E-1. Landusky TPA Fish Distribution Report

Waterbody Name	Tributary To	Beginning Stream Mile	Ending Stream Mile	Species Name	Abundance	Fish Presence Value	Genetics Description	Origin	Use Type	Life History	Data Source
Beaver Creek	Milk River	166.5	167.6	Brook Trout	Unknown	Extrapolated from a single survey/observation	Not Applicable	Introduced	Unknown	Unknown	Unknown
Lodge Pole Creek	South Fork Peoples Creek	0	35.14	Brook Stickleback	Rare	No Survey, Professional judgment	Not Applicable	Native	Year-round resident	Not applicable	FWP
Lodge Pole Creek	South Fork Peoples Creek	0	35.14	Brook Trout	Rare	Extrapolated from multiple surveys/observations	Not Applicable	Introduced	Year-round resident	Not applicable	FWP
Lodge Pole Creek	South Fork Peoples Creek	0	35.14	Fathead Minnow	Common	No Survey, Professional judgment	Not Applicable	Native	Year-round resident	Not applicable	FWP
Lodge Pole Creek	South Fork Peoples Creek	0	35.14	Lake Chub	Common	Extrapolated from a single survey/observation	Not Applicable	Native	Year-round resident	Not applicable	FWP
Lodge Pole Creek	South Fork Peoples Creek	0	35.14	Longnose Dace	Common	Extrapolated from a single survey/observation	Not Applicable	Native	Year-round resident	Not applicable	FWP
Lodge Pole Creek	South Fork Peoples Creek	0	35.14	Mountain Sucker	Rare	Extrapolated from a single survey/observation	Not Applicable	Native	Year-round resident	Not applicable	FWP
Lodge Pole Creek	South Fork Peoples Creek	0	35.14	Northern Redbelly Dace	Common	Extrapolated from a single survey/observation	Not Applicable	Native	Year-round resident	Not applicable	FWP
Lodge Pole Creek	South Fork Peoples Creek	0	35.14	White Sucker	Rare	Extrapolated from a single survey/observation	Not Applicable	Native	Year-round resident	Not applicable	FWP
Montana Gulch	Rock Creek	0	1	Brook Trout	Unknown	Extrapolated from a single survey/observation	Not Applicable	Introduced	Unknown	Unknown	Unknown
Montana Gulch	Rock Creek	0	1.969	No Survey	Not Applicable	No Survey, Professional judgment	Not Applicable	Not applicable	Not Applicable	Not applicable	FWP
Rock Creek	Missouri River	0	7	Brassy Minnow	Unknown	Extrapolated from a single survey/observation	Not Applicable	Native	Year-round resident	Not applicable	FWP
Rock Creek	Missouri River	0	0.658	Brook Stickleback	Unknown	Extrapolated from a single survey/observation	Not Applicable	Unknown	Unknown	Unknown	FWP
Rock Creek	Missouri River	0	1	Brook Trout	Rare	Extrapolated from a single survey/observation	Not Applicable	Introduced	Year-round resident	Not applicable	FWP
Rock Creek	Missouri River	0	0.658	Common Carp	Unknown	Extrapolated from a single survey/observation	Not Applicable	Introduced	Unknown	Unknown	Unknown
Rock Creek	Missouri River	0	0.729	Fathead Minnow	Unknown	Extrapolated from a single survey/observation	Not Applicable	Unknown	Unknown	Unknown	Unknown
Rock Creek	Missouri River	0	7	Flathead Chub	Unknown	Extrapolated from a single survey/observation	Not Applicable	Native	Year-round resident	Not applicable	FWP
Rock Creek	Missouri River	6	7	Lake Chub	Unknown	Extrapolated from a single survey/observation	Not Applicable	Native	Year-round resident	Not applicable	FWP
Rock Creek	Missouri River	0	7	Longnose Dace	Unknown	Extrapolated from a single survey/observation	Not Applicable	Native	Year-round resident	Not applicable	FWP
Rock Creek	Missouri River	6.05	7.05	Sucker	Unknown	Extrapolated from a single survey/observation	Not Applicable	Unknown	Year-round resident	Resident	FWP
Rock Creek	Missouri River	0	7	White Sucker	Unknown	Extrapolated from a single survey/observation	Not Applicable	Native	Year-round resident	Not applicable	FWP

APPENDIX F – TARGET DEPARTURE ANALYSIS

Table of Contents

F 1.0 Introduction.....	F-7
F 2.0 Target Departures by Stream.....	F-8
F 2.1 Alder Gulch (MT40E002_050)	F-8
F 2.1.1 Alder Gulch Sources	F-8
F 2.1.2 Alder Gulch Parameter Departures.....	F-9
F 2.1.3 Alder Gulch Supplemental Indicators.....	F-11
F 2.1.4 Alder Gulch TMDL Development Conclusions.....	F-12
F 2.2 Beaver Creek (MT40M001_011)	F-12
F 2.2.1 Beaver Creek Sources.....	F-13
F 2.2.2 Beaver Creek Parameter Departures	F-14
F 2.2.3 Beaver Creek Supplemental Indicators	F-15
F 2.2.4 Beaver Creek TMDL Development Conclusions	F-15
F 2.3 South Big Horn Creek (MT40I001_030)	F-16
F 2.3.1 South Big Horn Creek Sources.....	F-16
F.2.3.2 South Big Horn Creek Parameter Departures	F-17
F 2.3.3 South Big Horn Creek Supplemental Indicators	F-19
F 2.3.4 South Big Horn Creek TMDL Development Conclusions	F-19
F 2.4 King Creek (MT40I001_030).....	F-19
F 2.4.1 King Creek Sources	F-20
F 2.4.2 King Creek Parameter Departures	F-21
F 2.4.3 King Creek Supplemental Indicators	F-22
F 2.4.4 King Creek TMDL Development Conclusions	F-22
F 2.5 Lodge Pole Creek (MT40I001_050)	F-23
F 2.5.1 Lodge Pole Creek Sources	F-23
F 2.5.2 Lodge Pole Creek Parameter Departures.....	F-24
F 2.5.3 Lodge Pole Creek Supplemental Indicators.....	F-25
F 2.5.4 Lodge Pole Creek TMDL Development Conclusions.....	F-25
F 2.6 Mill Gulch (MT40E002_100).....	F-25
F 2.6.1 Mill Gulch Sources.....	F-26
F 2.6.2 Mill Gulch Parameter Departures	F-27
F 2.6.3 Mill Gulch Supplemental Indicators	F-28

F 2.6.4 Mill Gulch TMDL Development Conclusions F-29

F 2.7 Montana Gulch (MT40E002_010) F-29

 F 2.7.1 Montana Gulch Sources F-30

 F 2.7.2 Montana Gulch Parameter Departures..... F-31

 F 2.7.3 Montana Gulch Supplemental Indicators F-34

 F 2.7.4 Montana Gulch TMDL Development Conclusions F-34

F 2.8 Rock Creek (MT40E002_090) F-35

 F 2.8.1 Rock Creek Sources F-36

 F 2.8.2 Rock Creek Parameter Departures..... F-36

 F 2.8.3 Rock Creek Supplemental Indicators..... F-38

 F 2.8.4 Rock Creek TMDL Development Conclusions F-38

F 2.9 Ruby Gulch (MT40E002_070)..... F-39

 F 2.9.1 Ruby Gulch Sources F-39

 F 2.9.2 Ruby Gulch Parameter Departures F-40

 F 2.9.3 Ruby Gulch Supplemental Indicators F-43

 F 2.9.4 Ruby Gulch TMDL Development Conclusions F-43

F 2.10 Ruby Creek (MT40E002_060)..... F-44

 F 2.10.1 Ruby Creek Sources F-45

 F 2.10.2 Ruby Creek Parameter Departures F-46

 F 2.10.3 Ruby Creek Supplemental Indicators F-47

 F 2.10.4 Ruby Creek TMDL Development Conclusions F-48

F 2.11 Sullivan Creek (MT40E002_110) F-48

 F 2.11.1 Sullivan Creek Sources..... F-49

 F 2.11.2 Sullivan Creek Parameter Departures..... F-49

 F 2.11.3 Sullivan Creek Supplemental Indicators..... F-51

 F 2.11.4 Sullivan Creek TMDL Development Conclusions..... F-51

F 2.12 Swift Gulch Creek (MT40I002_010) F-52

 F 2.12.1 Swift Gulch Creek Sources..... F-52

 F 2.12.2 Swift Gulch Creek Parameter Departures F-53

 F 2.12.3 Swift Gulch Creek Supplemental Indicators..... F-56

 F 2.12.4 Swift Gulch Creek TMDL Development Conclusions F-57

F3.0 References..... F-57

LIST OF TABLES

Table F-1. Cadmium criteria exceedance numbers and percentages by flow condition in Alder Gulch ...	F-9
Table F-2. Copper criteria exceedance numbers and percentages by flow condition in Alder Gulch.....	F-10
Table F-3. Lead criteria exceedance numbers and percentage rates under high and low flow conditions in Alder Gulch.....	F-10
Table F-4. Zinc criteria exceedance numbers and percentage rates under high and low flow conditions in Alder Gulch.....	F-11
Table F-5. Cadmium criteria exceedance numbers and percentage rates under high and low flow conditions in Beaver Creek.	F-14
Table F-6. Lead criteria exceedance numbers and percentage rates under high and low flow conditions in Beaver Creek.....	F-15
Table F-7. Aluminum criteria exceedance numbers and percentage rates under high and low flow conditions at sites L-48 and L-48A in South Big Horn Creek.....	F-17
Table F-8. Cadmium criteria exceedance numbers and percentage rates under high and low flow conditions at sites L-48 and L-48A in South Big Horn Creek.....	F-17
Table F-9. Nickel criteria exceedance numbers and percentage rates under high and low flow conditions at sites L-48 and L-48A in South Big Horn Creek.....	F-18
Table F-10. Zinc criteria exceedance numbers and percentage rates under high and low flow conditions at sites L-48 and L-48A in South Big Horn Creek.....	F-18
Table F-11. Arsenic criteria exceedance numbers and percentage rates under high and low flow conditions at sites 503, L-5 and L-39 in King Creek.....	F-21
Table F-12. Cadmium criteria exceedance numbers and percentage rates under high and low flow conditions at sites 503, L-5 and L-39 in King Creek.....	F-21
Table F-13. Selenium criteria exceedance numbers and percentage rates under high and low flow conditions at sites L-5 and L-39 in King Creek.....	F-22
Table F-14. Cadmium criteria exceedance numbers and percentage rates under high and low flow conditions at sites Z-7 and Z-29 in Lodge Pole Creek.....	F-24
Table F-15. Copper criteria exceedance numbers and percentage rates under high and low flow conditions at sites Z-36, 506, L-22 and L-7 in Mill Gulch.....	F-27
Table F-16. Selenium criteria exceedance numbers and percentage rates under high and low flow conditions at sites, L-36, 506, and L-7 in Mill Gulch.....	F-28
Table F-17. Cadmium aquatic life and human health criteria exceedance numbers and percentage rates under high and low flow conditions at sites, 591, L-16, L-47 and L-2 in Montana Gulch.....	F-31
Table F-18. Copper aquatic life criteria exceedance numbers and percentage rates under high and low flow conditions at sites, 591, L-16, L-47 and L-2 in Montana Gulch.....	F-32
Table F-19. Cyanide aquatic life criteria exceedance numbers and percentage rates under high and low flow conditions at sites, 591, L-16, L-47 and L-2 in Montana Gulch.....	F-32
Table F-20. Nickel criteria exceedance numbers and percentage rates under high and low flow conditions at sites, 591, L-16, L-47 and L-2 in Montana Gulch.....	F-32
Table F-21. Selenium criteria exceedance numbers and percentage rates under high and low flow conditions at sites, 591, L-16, L-47 and L-2 in Montana Gulch.....	F-33
Table F-22. Zinc criteria exceedance numbers and percentage rates under high and low flow conditions at sites, 591, L-16, L-47 and L-2 in Montana Gulch.....	F-33
Table F-23. Cadmium criteria exceedance numbers and percentage rates under high and low flow conditions at sites Z-29, L-23, L-4, and L-1 in Rock Creek.....	F-36

Table F-24. Copper criteria exceedance numbers and percentage rates under high and low flow conditions at sites Z-29, L-23, L-4, and L-1 in Rock Creek	F-36
Table F-25. Lead criteria exceedance numbers and percentage rates under high and low flow conditions at sites Z-29, L-23, L-4, and L-1 in Rock Creek.....	F-37
Table F-26. Zinc criteria exceedance numbers and percentage rates under high and low flow conditions at sites Z-29, L-23, L-4, and L-1 in Rock Creek.....	F-37
Table F-27. Cadmium criteria exceedance numbers and percentage rates under high and low flow conditions at sites 667, Z-15, Z-100 and Z-1B in Ruby Gulch.....	F-40
Table F-28. Copper criteria exceedance numbers and percentage rates under high and low flow conditions at sites 667, Z-15, Z-100 and Z-1B in Ruby Gulch.....	F-41
Table F-29. Cyanide criteria exceedance numbers and percentage rates under high and low flow conditions at sites 667, Z-15, Z-100 and Z-1B in Ruby Gulch.....	F-41
Table F-30. Lead criteria exceedance numbers and percentage rates under high and low flow conditions at sites 667, Z-15, and Z-1B in Ruby Gulch.....	F-41
Table F-31. Selenium criteria exceedance numbers and percentage rates under high and low flow conditions at sites 667, Z-15, and Z-100 in Ruby Gulch	F-42
Table F-32. Zinc criteria exceedance numbers and percentage rates under high and low flow conditions at sites 667, Z-15, Z-100, and Z-1B in Ruby Gulch.....	F-42
Table F-33. Cadmium criteria exceedance numbers and percentage rates under high and low flow conditions at sites 505, 595, L-37, and D-4 in Sullivan Creek	F-49
Table F-34. Iron criteria exceedance numbers and percentage rates under high and low flow conditions at sites 595, L-37, and D-4 in Sullivan Creek	F-50
Table F-35. Lead criteria exceedance numbers and percentage rates under high and low flow conditions at sites 505, L-37, and D-4 in Sullivan Creek	F-50
Table F-36. Zinc criteria exceedance numbers and percentage rates under high and low flow conditions at sites 595, L-37, and D-4 in Sullivan Creek	F-51
Table F-37. Arsenic criteria exceedance numbers and percentage rates under high and low flow conditions at sites BKSS-2, BKSS-3, BKSS-9, L-19, L-49, and M37SWFGC01 in Swift Gulch Creek.....	F-53
Table F-38. Cadmium criteria exceedance numbers and percentage rates under high and low flow conditions at sites BKSS-2, BKSS-3, BKSS-9, L-19, L-49, and M37SWFGC01 in Swift Gulch Creek.....	F-54
Table F-39. Copper criteria exceedance numbers and percentage rates under high and low flow conditions at sites BKSS-2, BKSS-3, BKSS-9, L-19, L-49, and M37SWFGC01 in Swift Gulch Creek.....	F-54
Table F-40. Nickel criteria exceedance numbers and percentage rates under high and low flow conditions at sites BKSS-3, BKSS-9, L-19, L-49, and M37SWFGC01 in Swift Gulch Creek.....	F-55
Table F-41. Zinc criteria exceedance numbers and percentage rates under high and low flow conditions at sites BKSS-3, BKSS-9, L-19, L-49, and M37SWFGC01 in Swift Gulch Creek.....	F-56

LIST OF FIGURES

Figure F-1. Alder and Ruby gulches and locations of current condition and natural background sites ...	F-8
Figure F-2. Sulfate monitoring record for sites Z-2, Z-8, and Z-16 in Alder Gulch.	F-12
Figure F-3. Beaver Creek and the locations of current condition sites (Z-31, Z-39 and M41BVERC03) and natural background site Z-27	F-13
Figure F-4. South Big Horn Creek extending from the northeast, past the Swift Gulch Creek confluence, to the Fort Belknap Reservation boundary.....	F-16
Figure F-5. Boxplot graph of sulfate data distributions for sites L-21 (background), L-48 and L-48A compared to the 200 µg/L indicator value.	F-19

Figure F-6. King Creek and current condition sites extending from the August-Surprise-Queen Rose pit complex at the Landusky Mine to the Fort Belknap Reservation boundary F-20

Figure F-7. Boxplot graph of sulfate data distributions at selected monitoring points compared to the 200 µg/L indicator value F-22

Figure F-8. Lodge Pole Creek extending from the northern edge of the Zortman Mine disturbance to the Fort Belknap Reservation boundary F-23

Figure F-9. Boxplot graph of sulfate data distributions at selected natural background sites (Z-28 & Z-30) and current condition sites (Z-29 & Z-7) on Lodge Pole Creek. F-25

Figure F-10. Mill Gulch extending from the Landusky pit area, south, to its confluence with Rock Creek and existing condition sites L-36, 506, L-22, and L-7 F-26

Figure 9-11. Boxplot graph of sulfate data distributions at selected natural background sites (L-40 & RCSS-5) and four current condition sites on Mill Gulch compared to the 200 mg/L indicator value..... F-29

Figure F-12. Montana Gulch, natural background site L-40 and existing condition sites 591, L-16, L-47, and L-2..... F-30

Figure F-13. Boxplot graph of sulfate data distributions at natural background and current condition sites on Montanan Gulch compared to the 200 mg/L indicator value. F-34

Figure F-14. Extent of Rock Creek, impaired tributaries (left to right) Montana Gulch, Mill Gulch, and Sullivan Creek, and selected water quality monitoring sites..... F-35

Figure 9-15. Boxplot graph of sulfate data distributions at selected natural background and current condition sites on Rock Creek compared to the 200 mg/L indicator value..... F-38

Figure F-16. Boxplot graph of Ruby Gulch sulfate concentration at sites 667, Z-15, Z-100, and Z-1B compared to background levels and the sulfate indicator value of 200 µg/L..... F-43

Figure F-17. The Ruby Creek drainage with locations of monitoring sites and Goslin Flats land application disposal (LAD) area. F-45

Figure F-18. Boxplot graph of Ruby Creek sulfate concentration at sites Z-17, Z-32, and R-22 compared to background levels and the sulfate indicator value of 200 µg/L..... F-47

Figure F-19. Sullivan Creek (center), and current condition sites 505, 595, L-37, and D-4 F-49

Figure F-20. Boxplots of sulfate data distributions for current condition sites and combined background sites for Sullivan Creek..... F-51

Figure F-21. Swift Gulch Creek and locations of current condition sites BKSS-2, BKSS-3, BKSS-9, L-19, L-49, and M37SWFGC01, and natural background sites L-21, L-41, and L-45..... F-52

Figure F-22. Sulfate concentration in Swift Gulch Creek surface water at site L-19 F-56

F 1.0 INTRODUCTION

This appendix summarizes the departure of listed stream data from water quality targets and supplemental indicators described in **Section 5.4**. Water quality targets are the numeric criteria for chronic aquatic life (CAL), acute aquatic life (AAL) and human health (HH), contained in DEQ-7 (Montana Department of Environmental Quality, 2010) for metals and cyanide. Supplemental indicators include:

1. Numeric probable effects levels (PELs) for metals in stream sediments
2. Multi-metric index (MMI) and River Invertebrate Prediction and Classification System (RIVPACS) scores for macroinvertebrate samples
3. Water column sulfate concentration indicating the degree of sulfide mineral oxidation.

Map figures show the stream extent and (where possible) the locations of assessment and monitoring sites where the data originate. The precise locations and extent of mine facilities and features are illustrated in **Appendix A, Figure A-16** for the Zortman Mine area and **Figure A-17** for the Landusky Mine area.

To some degree, human influence has probably affected all streams in the planning area. However, a number of sites, selected by mining company or regulatory personnel, are intended to describe water quality with minimal mining influence. The analytical results from these “background” sites are compared to “existing” condition sites in order to illustrate the degree of departure from water quality criteria for each stream.

The target departure analysis for each stream also includes a discussion of the principal loading sources. These include geographic areas occupied by mine features such as waste rock repositories, leach pads, pad dikes, mine pits, abandoned mines. Sources also include water treatment process outfalls such as those for the Zortman, Landusky, and Swift Gulch Creek treatment plants.

The number of water quality analysis results varies widely by stream. Parameter-specific tables are used to summarize the criteria exceedance records of streams with large datasets. Each table gives the sample size, number of exceedances, and the exceedance rate percentages for each criteria comparison. The data are commonly reported with several method detection limits (MDLs) that have changed as analytical methods and laboratory equipment are upgraded. Earlier results have generally larger MDLs. Results with MDLs greater than the water quality criteria cannot be used in the departure analysis. Therefore, the sample size used to count chronic aquatic life exceedances may increase when counting exceedances of the larger acute aquatic life criteria. The sample sizes used to assess the departure from different criteria are identified in the “Sample Size” column of the summary tables. Single values for sample size appear in the “Sample Size” column where method detection limits have been low enough to assess departures from all water quality criteria.

Data departures are described in text rather than tables for small datasets or where a limited number of results dictate the need for TMDLs, as in the case of a single result that is twice the AAL criterion. Text is also used for datasets with a large number of homogenous results. This commonly applies to large numbers of results that are less than the MDLs.

The target departure analysis for hardness-dependent metals included only results with corresponding hardness values. Target departures are assessed for both high and low flow conditions. Where sufficient flow data is available, high and low flows are those greater or less than the median annual flow. Most of

the datasets lack flow data. In these cases, high flow records are those for samples collected during the months of April, May and June; low flow samples are those during July through March. The raw data used in the departure analysis is contained in **Appendix B**.

F 2.0 TARGET DEPARTURES BY STREAM

F 2.1 ALDER GULCH (MT40E002_050)

Alder Gulch is listed as impaired in the 2010 Integrated Report (Montana Department of Environmental Quality, Water Quality Planning Bureau, 2010) for cadmium, copper, lead, mercury, selenium, zinc, and pH. The segment is classified as C-3 and extends for 4.04 miles from its headwaters to its confluence with Ruby Gulch. Current water quality conditions are represented by sites Z-2, Z-8, and Z-16 (**Figure F-1**.)

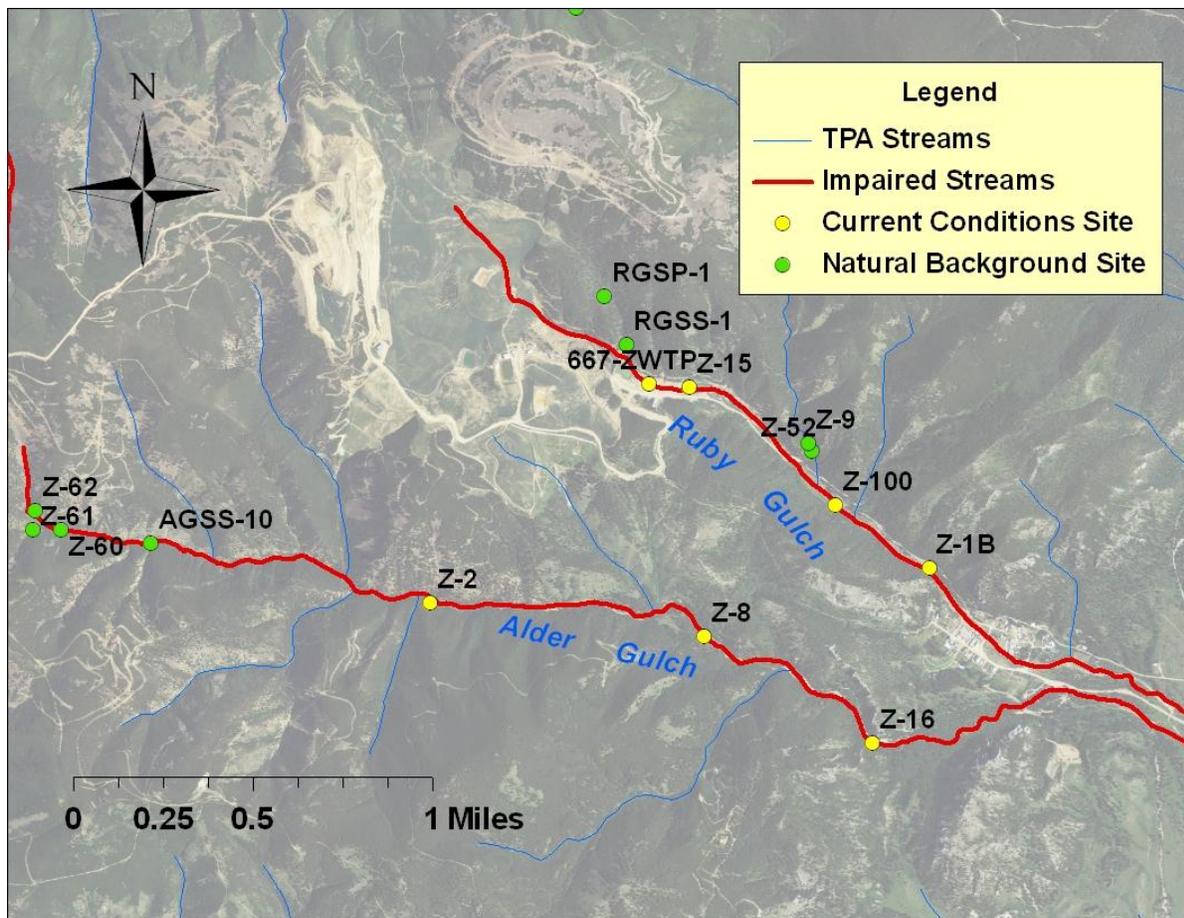


Figure F-1. Alder and Ruby gulches and locations of current condition and natural background sites.

F 2.1.1 Alder Gulch Sources

Placer mining first occurred in Alder Gulch during the 1880s. Historic load mining sources include the abandoned Hawkeye Mine located south of Alder Gulch in an unnamed tributary south of site AGSS-10 (Rossillon, 1991). Mine pits, a large waste rock dump, several leach pads, and supporting dikes of the Zortman Mine occur in northern Alder Gulch tributaries of Carter Gulch and Alder Spur. The eastern

branch of Carter Gulch contains the Alder Gulch Waste Rock Repository which contains 2.3 million cubic yards of material removed from Zortman Mine pits. The Carter Gulch Seepage Capture System, that collects nearly 10 million gallons of ARD per year, was located at the toe of this dump until destroyed after a May 21, 2011, landslide at the toe of the dump. East of Carter Gulch is Alder Spur, an ephemeral Alder Gulch tributary that contains the Alder Spur Seepage Capture System. The capture system is below the Z83 and Z84 leach pads and supporting dikes. Alder Spur may also receive drainage from the Z82 and Z76/81 leach pads located on the drainage divide between Alder Spur and Ruby Gulch.

The Alder Gulch dataset includes water column chemistry for comparison with Circular DEQ 7 human health (HH), acute aquatic life (AAL), and chronic aquatic life (CAL) criteria for surface waters. The age of the data ranges from 1978 to 1998 for sites Z-2 and Z-8, and 1990 to 1996 for site Z-16. The water column criteria exceedance records are summarized in the tables below for each metal impairment cause.

Monitoring sites Z-60, Z-61, Z-62, and AGSS-10 in upper Alder Gulch are selected as representing natural background water quality conditions. The sites were established from 1996 to 1998 to describe water quality with minimal mining effects.

F 2.1.2 Alder Gulch Parameter Departures

Cadmium (Cd)

There are 68 cadmium results for the three current condition monitoring sites. The values range from less than 0.1 to 172 µg/L. However, the method detection limit (MDL) for 25 records exceeds the CAL criterion and MDLs for two samples exceed the AAL criterion. Of the 43 cadmium results that can be compared to the CAL criteria, there are 26 exceedances. Of 66 results that can be compared to the AAL criteria, there are 17 exceedances. The HH criterion of 5 µg/L is exceeded in 19 samples. The number of cadmium criteria exceedances and exceedance rates, expressed as percentages, are given in **Table F-1** by flow condition.

Table F-1. Cadmium criteria exceedance numbers and percentages by flow condition in Alder Gulch

Flow Condition	Sample Size (CAL/AAL/HH)	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
High Flow	18/32/34	11	61	9	28	6	18
Low Flow	25/34/34	15	60	7	19	7	21
All Flows	43/66/68	26	60	17	25	13	19

Seven Cd results are available from the four background sites under flow conditions ranging from 3-40 gallons per minute (gpm). Six results have MDLs less than the CAL criterion. One of these six exceeded the CAL during high flows. No natural background sites exceeded the AAL criteria. Therefore, there is potential for natural background Cd concentrations to exceed CAL criteria during high flows.

For the current condition sites, exceedance percentages were greater than 10 for both aquatic life criteria. The high aquatic life exceedance rates, plus the HH exceedances indicated the need for an Alder Gulch cadmium TMDL.

Copper (Cu)

There are 66 copper results for sites Z-2, Z-8, and Z16, ranging from less than 1 to 2,010 µg/L. Fifty-eight results had MDLs small enough for comparison with CAL criteria. Twenty-one (36%) exceeded CAL

criteria and 16 of 63 results (25%) exceeded AAL criteria. The record contains a single low flow HH exceedance. High flow exceedances were roughly double those occurring during low flows. The number of copper criteria exceedances and exceedance rates, expressed as percentages, are given in **Table F-2** by flow condition.

Table F-2. Copper criteria exceedance numbers and percentages by flow condition in Alder Gulch.

Flow Conditions	Sample Size (CAL/AAL/HH)	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
High Flow	27/31/33	15	56	11	35	0	0
Low Flow	31/32/33	6	19	5	16	1	3
All Flows	58/63/66	21	36	16	25	1	2

Seven copper results obtained during May and June of 1996 and 1997 are available from sites Z-60, Z-61, Z-62, and AGSS-10 representing natural background concentrations. Except for site AGSS-10, all results exceed both CAL and AAL criteria. Only the CAL criterion was exceeded at AGSS-10. The results indicate that natural background copper concentrations in upper Alder Gulch may commonly exceed the aquatic life criteria. There were no HH exceedances among the data from the background sites.

Among the current condition sites, both CAL and AAL exceedance rates are greater than 10 percent under both flow conditions. The high exceedance rates plus the HH exceedance indicate the need for a copper TMDL in Alder Gulch.

Lead (Pb)

There are 69 lead results for sites Z-2, Z-8 and Z-16 that have corresponding hardness values. Many the results have MDLs that exceed the CAL target criteria. Therefore, the useful sample size for CAL comparisons is smaller than those for AAL and HH. The lead values range from less than 2 to 30 $\mu\text{g/L}$. **Table F-3** gives the sample size, number of criteria exceedances and exceedance rates, expressed as percentages, for lead in Alder Gulch.

Table F-3. Lead criteria exceedance numbers and percentage rates under high and low flow conditions in Alder Gulch.

Flow Conditions	Sample Size (CAL/AAL/HH)	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
High Flow	23/36/36	12	52	0	0	4	11
Low Flow	29/33/33	3	10	0	0	4	12
All Flows	52/69/69	15	29	0	0	8	12

Lead concentration data for the four natural background sites were all less than the MDL of 3 $\mu\text{g/L}$. This MDL is greater than the applicable CAL criterion of 1.0 $\mu\text{g/L}$, so compliance with the CAL criterion could not be determined. None of the results from natural background sites exceeded either the AAL or HH criteria.

The exceedance rates for the CAL criteria are greater than 10 percent and the record contains HH exceedances. Therefore, a lead TMDL is required for Alder Gulch.

Mercury (Hg)

The mercury dataset for Z-2, Z-8 and Z-16 includes 52 results with a single positive detection of 0.2 µg/L in a sample collected on May 14, 1991, from Alder Gulch below the confluence with Alder Spur. The remaining sample results are all less than MDLs that range from 0.2 to 2.0 µg/L. All mercury results are reported with MDLs greater than the HH criterion of 0.05 µg/L. The uncertainty introduced by the high MDLs, the previous listing for mercury, and the age of the data (1990-1997) indicate the need for a mercury TMDL in Alder Gulch.

Selenium (Se)

There are 71 analytical results for selenium among the three current condition sites. The data were collected from 1990 to 1998 and contain four positive detections. A single result of 184 µg/L on October 14, 1992, exceeded both aquatic life criteria and the HH criterion (50 µg/L) under high flow conditions. The three subsequent positive detections were all less than the CAL criterion of 5 µg/L.

The seven selenium results available for the four natural background sites are all less than the MDL of 1 µg/L, under a combination of high and low flow conditions. The selenium result of 184 µg/L is more than twice the AAL criteria (20 µg/L), exceeds the HH criterion and indicates the need for a selenium TMDL for Alder Gulch.

Zinc (Zn)

The zinc dataset contains 78 results ranging from less than 10 to 3,650 µg/L. All MDLs are less than the surface water Zn criteria. **Table F-4** gives the sample size, number of criteria exceedances and exceedance rates, expressed as percentages, for zinc in Alder Gulch.

Table F-4. Zinc criteria exceedance numbers and percentage rates under high and low flow conditions in Alder Gulch.

Flow Conditions	Sample Size	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
High Flow	39	10	26	10	30	0	0
Low Flow	39	7	18	7	16	2	5
All Flows	78	17	22	17	22	2	3

There were no aquatic life or human health criteria exceedances among nine Zn results obtained under both high and low flow conditions at the four natural background sites. The high exceedance rates for both CAL and AAL criteria and the occurrence of HH exceedances indicate the need for a zinc TMDL in Alder Gulch.

F 2.1.3 Alder Gulch Supplemental Indicators**Sulfate**

There are no sediment chemistry or macroinvertebrate metric data available for Alder Gulch. **Figure F-2** is a graph of sulfate concentrations for the three current condition monitoring sites. Sites Z-2 and Z-8 have records over the course of ZMI mining activity. Site Z-16 was sampled eight times between 1990 and 1996. The spike in sulfate coincides with completion of the Alder Gulch Waste Rock Repository in Carter Gulch. The surface of the repository was regraded in 1992 and the Carter Gulch and Alder Spur capture systems installed in 1997. The sulfate concentrations measured farthest downstream (Z-16) are similar to those at the start of ZMI mining. Farther upstream, elevated sulfate persisted later at sites

closer to the waste rock and leach pad sources. Sulfate concentrations in Alder Gulch indicate the effects of ARD.

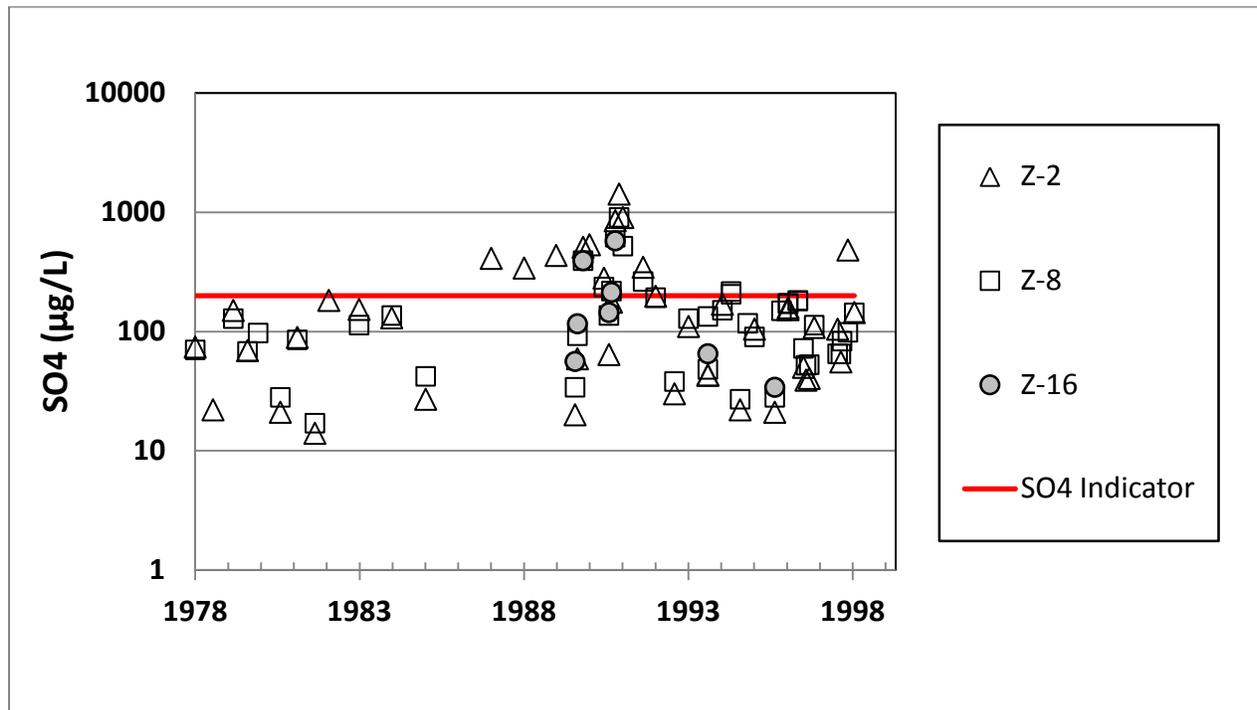


Figure F-2. Sulfate monitoring record for sites Z-2, Z-8, and Z-16 in Alder Gulch.

The sulfate data record combined with recent damage to the Carter Gulch capture system after partial failure of the Alder Gulch Waste Rock Repository suggest that mining sources are continuing to cause elevated metals loading to Alder Gulch.

F 2.1.4 Alder Gulch TMDL Development Conclusions

Elevated aquatic life criteria exceedance rates, combined with HH health exceedances support TMDL development for cadmium, copper, lead, and zinc. Cadmium will serve as a surrogate parameter to address the pH listing for Alder Gulch

The current Hg listing, past mercury placer mining sources in Alder Gulch, and age of the data record combine to require a Hg TMDL for Alder Gulch. A single selenium result exceeding the aquatic life and HH criteria, the previous selenium listing, and the lack of recent selenium data combine to require a selenium TMDL in Alder Gulch.

F 2.2 BEAVER CREEK (MT40M001_011)

Beaver Creek was listed as impaired in the 2010 Integrated Report (Montana Department of Environmental Quality, Water Quality Planning Bureau, 2010) for cadmium, iron, and lead. The segment is classified as B-3 and extends for 5.4 miles from its headwaters in the Little Rockies, northeastward to the Fort Belknap Reservation boundary. Current water quality conditions are represented by the records for sites Z-31, Z-39, and M41BEVRC03 (Figure F-3). Site Z-27, assumed to represent natural background conditions, is located in an ephemeral headwater tributary of Beaver Creek with no discernable mining sources. Site Z-30 is in the Lodge Pole Creek drainage to the west of Beaver Creek.

F 2.2.1 Beaver Creek Sources

The topography of Shell Butte separates the Beaver Creek drainage from the area disturbed by the Zortman Mine. Three abandoned mines occur in Beaver Creek. The Beaver Mine is in an ephemeral draw about 1,500 feet upslope and north of monitoring site Z-39 (**Figure F-3**). Mine features include a collapsed adit and un-vegetated spoils that are a conceivable source of metals in sediment. Two small mine disturbances occur on a topographic bench about 1,600 feet south of the stream channel at site Z-31. No features of either site are visible on aerial photographs and their influence on water quality is assumed to be minor. Placer mining occurred intermittently in the Little Rockies from the 1880s to about 1940 and the Beaver Creek alluvium was probably placer mined to some extent. No obvious evidence of placer mining was seen during the 2005 DEQ assessment.

A recreation road parallels the stream for most of its length. Recent traffic has been restricted to all-terrain vehicles. An access road from the Zortman Mine crosses the recreation road near site Z-39. Roadway segments near the stream are potential sources of runoff and sediment-bound metals.

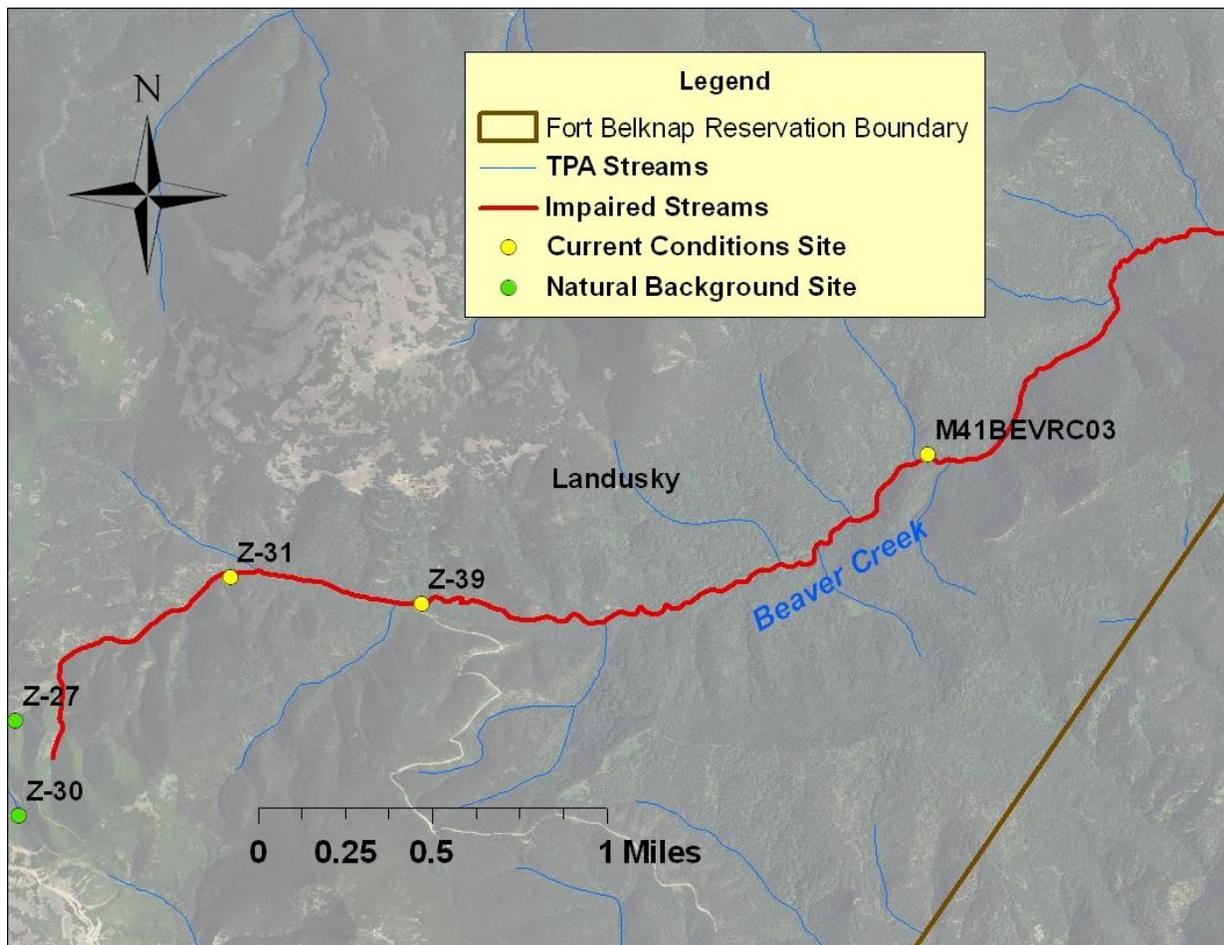


Figure F-3. Beaver Creek and the locations of current condition sites (Z-31, Z-39 and M41BVERC03) and natural background site Z-27

The Beaver Creek dataset for current conditions includes 19 water column chemistry records collected from 1990 to 1997 at site Z-31, 8 records for site Z-39 collected from 1994 to 1997, and 1 sample

collected during a DEQ assessment at site M41BEVRC03 in July of 2005. One sediment chemistry sample and one macroinvertebrate sample were collected during the DEQ assessment. Site Z-27 has water column chemistry data for 26 sampling events between 1990 and 2001.

F 2.2.2 Beaver Creek Parameter Departures

Cadmium

Table F-5 contains the water column cadmium exceedance summary for Beaver Creek for the three current condition sites. Seventeen cadmium results are available for the three sites. The MDL of 1 µg/L was too high to assess compliance with CAL criteria for eight results. The two CAL and AAL exceedances both occurred during high flow conditions on May 29, 1990. All samples since 1990 have contained less than detectable concentrations of cadmium.

Table F-5. Cadmium criteria exceedance numbers and percentage rates under high and low flow conditions in Beaver Creek.

Flow Conditions	Sample Size (CAL/AAL/HH)	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
High Flow	7/11/11	2	29	2	18	0	0
Low Flow	2/6/6	0	0	0	0	0	0
All Flows	9/17/17	2	22	2	12	0	0

No HH criteria were exceeded at the three current condition sites. Although the exceedance rates are greater than 10 percent for both the CAL and AAL criteria, the water quality trend is clearly toward improvement. Since the two positive detections in 1990, no cadmium analysis using adequate MDLs has exceeded any drinking water or aquatic life criteria.

The data record for site Z-27 contains 18 results for total recoverable cadmium. Five results have MDLs that exceeds the CAL criteria. Of the 13 remaining cadmium results, one high flow sample (on May 29, 1990) exceeded both aquatic life criteria and a second high flow sample in 1994 exceeded the CAL criterion. The 11 remaining samples, including the 10 most recent, have all met target criteria. The lack of human-caused sources at Z-27 is evidence that natural background cadmium concentrations may occasionally exceed aquatic life criteria during high flows. Despite the CAL and AAL exceedance rates for cadmium, the improving water quality trend warrants further monitoring rather than TMDL development at this time.

Iron (Fe)

There are 17 results for iron among the three current condition sites. All are below the 1,000 µg/L aquatic life criteria. Site Z-27, representing natural background conditions, has 15 iron results with one CAL exceedance in May of 1994. The data did not indicate that iron is affecting beneficial uses in Beaver Creek.

Lead

The dataset for lead in Beaver Creek consists of 10 high flow and 6 low flow results with corresponding hardness values. High MDLs prevent the use of several results in assessing compliance with the CAL criteria. All but the 2005 result from site M41BEVRC03 are dated from 1990 to 1997. The compliance record for lead in Beaver Creek is summarized in **Table F-6** for the three current conditions sites.

Table F-6. Lead criteria exceedance numbers and percentage rates under high and low flow conditions in Beaver Creek

Flow Conditions	Sample Size (CAL/AAL/HH)	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
High Flow	6/10/10	3	50	0	0	3	30
Low Flow	3/6/6	0	0	0	0	0	0
All Flows	9/16/16	3	33	0	0	3	19

The dataset includes three HH exceedances and three CAL exceedances, all occurring during high flows. AAL criteria were not exceeded in any sample. The CAL and HH exceedances indicate that a TMDL for lead is needed in Beaver Creek.

There are 18 lead results in the dataset for site Z-27. Nine results have MDLs low enough to assess CAL compliance and five of the nine exceed the CAL criteria. No samples among 18 exceed the AAL. Three results exceed the HH criterion. Considering the remoteness of the site from sources, the results suggest that natural background lead concentrations in Beaver Creek will occasionally exceed the most restrictive water quality criteria under both high and low flow conditions. The CAL exceedance rate of 33 percent and three HH exceedances indicate the need for a lead TMDL in Beaver Creek.

F 2.2.3 Beaver Creek Supplemental Indicators

Sulfate

There are 22 sulfate analysis results available from the three current condition sites and 17 results from site Z-27. All are less than the supplemental indicator value of 200 mg/L. The median concentration at current condition sites is 6.6 mg/L; the median concentration at site Z-27 is 5 mg/L.

Macroinvertebrate Metrics

The low valley MMI metric for the sample collected at site M41BEVRC03 is 54, compared to the minimum aquatic life use support value of 48. The metric does not indicate impairment of aquatic life uses.

Sediment Metals

The sediment sample from site M41BEVRC03 contained less than the MDL (0.5 µg/g) for cadmium. The lead concentration in the sediment sample (16.2 µg/g) is less than the NOAA recommended PEL of 91.3 µg/g. The iron concentration in the sediment sample was within the NOAA criterion of two percent.

F 2.2.4 Beaver Creek TMDL Development Conclusions

The cadmium listing for Beaver Creek may have resulted from samples collected on a single day, May 29, 1990. The 17 water samples collected from all four sites between 1996 and 1998 meet all target criteria during both high and low flows. Considering the age of the data, the lack of recent exceedances, and the possibility that natural background sources during high flows may exceed the most restrictive criteria, additional monitoring is a reasonable alternative to TMDL development for cadmium in Beaver Creek.

With the water quality exceedance rate at less than 10 percent, and no elevated iron detected in sediment, the iron records in Beaver Creek do not support development of an iron TMDL.

Three of nine lead values (33%) with sufficiently high MDLs exceed the CAL criteria and three HH criteria exceedances indicate the need for a lead TMDL.

F 2.3 SOUTH BIG HORN CREEK (MT40I001_030)

South Big Horn Creek impairment causes in the 2010 Integrated Report included aluminum, arsenic, cadmium, nickel, and zinc. The segment is classified as B-1 and extends for 1.4 miles from its headwaters, westward to the Fort Belknap Reservation boundary. Current water quality conditions are represented by the records for sites L-48 and L-48A (**Figure F-4**). Site L-21 is located just upstream of the confluence with Swift Gulch Creek. Human-caused sources are not evident in the South Big Horn Creek drainage above the Swift Gulch Creek confluence. Therefore, site L-21 conceivably represents natural background conditions in South Big Horn Creek. Sites L-49 and M37SWFGC01 in **Figure F-4** are on Swift Gulch Creek.

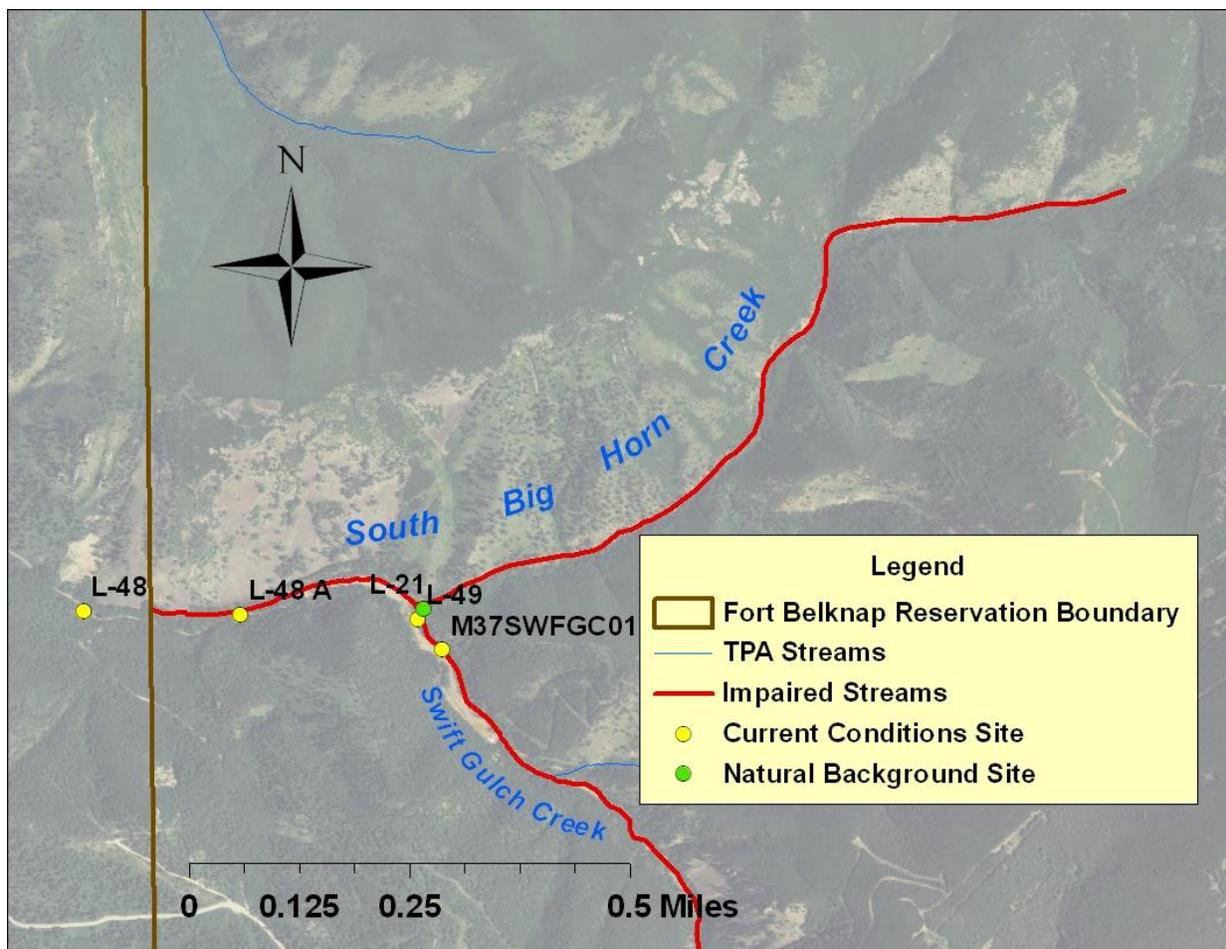


Figure F-4. South Big Horn Creek extending from the northeast, past the Swift Gulch Creek confluence, to the Fort Belknap Reservation boundary

F 2.3.1 South Big Horn Creek Sources

Evidence of placer mining occurs along the reach of South Big Horn Creek below the Swift Gulch Creek confluence. Other sources are downstream effects of ARD impacts to Swift Gulch Creek associated with the mine pit complex at the Landusky Mine.

F.2.3.2 South Big Horn Creek Parameter Departures

Aluminum

Six aluminum results in the pH range of 6.5-9.0 are available for sites L-48 and L-48A. Four have MDLs low enough to assess CAL compliance and one of these (25% of the total) exceeds the 87 µg/L CAL criterion. No sample exceeds the AAL criterion of 750 µg/L. The aluminum record for sites L-48 and L-48a is summarized in **Table F-7**. The CAL exceedance rate of 25 percent indicates the need for an aluminum TMDL.

Table F-7. Aluminum criteria exceedance numbers and percentage rates under high and low flow conditions at sites L-48 and L-48A in South Big Horn Creek

Flow Conditions	Sample Size	CAL Exceedance		AAL Exceedance	
		Number	%	Number	%
High Flow	0	0	0	0	0
Low Flow	4	1	25	0	0
All Flows	4	1	25	0	0

Thirteen aluminum analysis results, reported with an MDL of 100 µg/L, are available for background site L-21. These include two positive high flow detections in 1996 and 1997. The positive detections are followed by three results dating from May through August of 1997, and a series of eight samples collected during August 2008. All results since April, 1997, under both high and low flow conditions, have contained less than detectable amounts of aluminum. Assuming a concentration of 50 µg/L in samples containing less than the MDL, 50 µg/L becomes the median aluminum concentration at site L-21. This value is selected as the natural background concentration of aluminum in South Big Horn Creek.

Arsenic

There are 97 results for arsenic available for sites L-48 and L-48A. Over 70 percent of the results have been less than the 3 µg/L MDL. The record contains a single HH exceedance (33 µg/L) that occurred in a high flow sample in May of 2004. No HH exceedances have occurred in 88 subsequent samples from the two sites. Arsenic has not been detected in 33 samples collected at site L-21 from 1986 through 2008. No arsenic aquatic life criteria have been exceeded in any South Big Horn Creek sample. However, the 2004 HH criterion exceedance triggers the need for an arsenic TMDL in South Big Horn Creek.

Cadmium

The cadmium dataset for sites L-48 and L-48A contains 92 results obtained from 1997 through 2010. The cadmium exceedance record is summarized in **Table F-8**. The MDLs used for cadmium analysis have been low enough to allow comparisons with both aquatic life and human health criteria. Therefore, a single sample size value appears in the table for each flow condition.

Table F-8. Cadmium criteria exceedance numbers and percentage rates under high and low flow conditions at sites L-48 and L-48A in South Big Horn Creek

Flow Conditions	Sample Size	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
High Flow	42	26	62	0	0	0	0
Low Flow	50	34	68	0	0	4	8
All Flows	92	60	65	0	0	4	4

The CAL criteria have been consistently exceeded at the current condition sites under variable flows. There are no exceedances of the AAL criteria. The four exceedances of the HH criteria have all occurred under low flow conditions since 2007. At site L-21, two CAL exceedances occurred in 23 samples (9%) with sufficiently low MDLs. No AAL or HH exceedances occurred in any of 31 samples from site L-21. The data suggest that natural background concentrations of cadmium may occasionally exceed water quality criteria. The rate of CAL exceedances (65%) and the four HH criterion exceedances require a TMDL for cadmium.

Iron (Fe)

South Big Horn Creek was not listed for iron in the 2010 Integrated Report (Montana Department of Environmental Quality, Water Quality Planning Bureau, 2010). However, the data records for sites L-48 and L-48A contain 22 exceedances of the 1,000 µg/L CAL criteria among 100 samples collected between 2002 and 2011. All but one exceedance occurred during high flows. There are three iron exceedances among 37 Fe results at site L-21, indicating that natural background iron is occasionally elevated. The median iron concentration at Z-21 during high flow is 130 µg/L, and 12 µg/L during low flows. The aquatic life exceedance rate of 22 percent among current condition sites justifies an iron TMDL in South Big Horn Creek.

Nickel (Ni)

There are 98 records for nickel analysis for sites L-48 and L-48A. The exceedance record is summarized in **Table F-9**. No HH or aquatic life criteria for nickel were exceeded in any of 31 samples collected at site L-21.

The nickel dataset for existing condition sites has CAL criteria exceedance rates greater than 10 percent and numerous HH exceedances. A nickel TMDL is required for South Big Horn Creek.

Table F-9. Nickel criteria exceedance numbers and percentage rates under high and low flow conditions at sites L-48 and L-48A in South Big Horn Creek

Flow Conditions	Sample Size	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
High Flow	45	5	11	0	0	5	11
Low Flow	53	9	17	0	0	15	28
All Flows	98	14	14	0	0	20	20

Zinc

There are 91 zinc analysis results for sites L-48 and L-48A dating from 1997 through 2010. The zinc exceedance record is summarized in **Table F-10**.

Table F-10. Zinc criteria exceedance numbers and percentage rates under high and low flow conditions at sites L-48 and L-48A in South Big Horn Creek

Flow Conditions	Sample Size	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
High Flow	41	20	49	20	49	1	2
Low Flow	50	9	18	9	18	11	22
All Flows	91	29	32	29	32	12	13

No HH or aquatic life criteria for zinc are exceeded in any of 35 samples collected from site L-21. Both the aquatic life and HH criteria are exceeded by more than 10 percent of low flow samples and more than 10 percent of high flow samples exceed the aquatic life criteria. These exceedance rates, plus the HH exceedances, require a zinc TMDL in South Big Horn Creek.

F 2.3.3 South Big Horn Creek Supplemental Indicators

There are no macroinvertebrate metrics (MMI/RIVPACS) or sediment chemistry data available for South Big Horn Creek. **Figure F-5** shows the data distributions for sulfate at sites L-21, L-48, and L-48A.

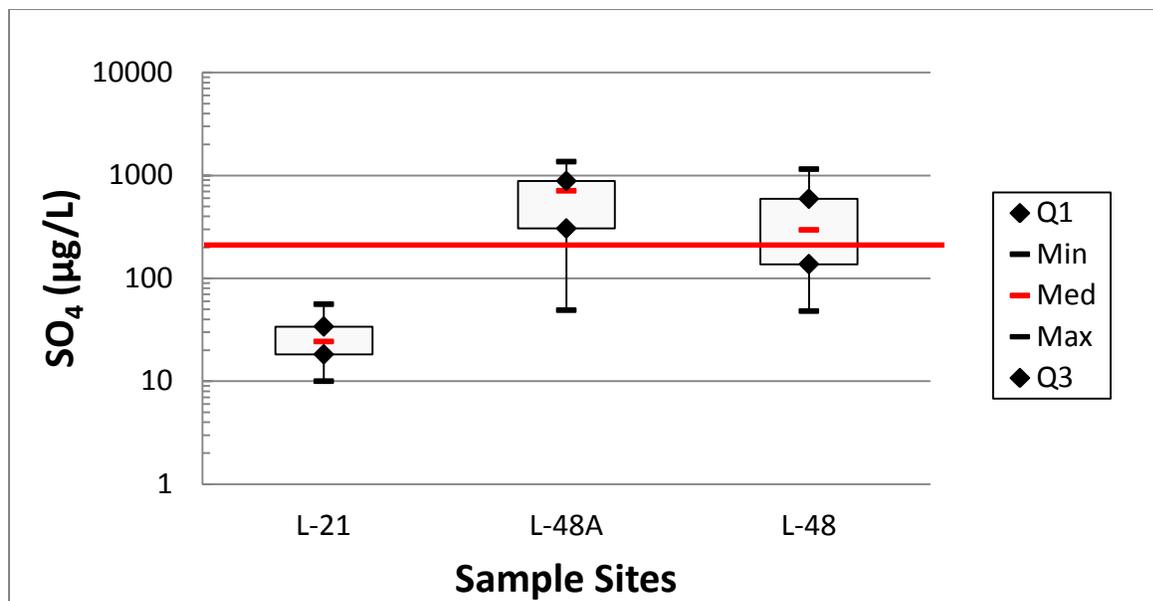


Figure F-5. Boxplot graph of sulfate data distributions for sites L-21 (background), L-48 and L-48A compared to the 200 $\mu\text{g/L}$ indicator value.

The graph shows the continued effect of sulfide oxidation on South Big Horn Creek surface water below the confluence with Swift Gulch Creek.

F 2.3.4 South Big Horn Creek TMDL Development Conclusions

The small dataset ($n=6$) from current condition sites, high MDLs, 25 percent CAL exceedance rate, and previous aluminum listing support an aluminum TMDL in South Big Horn Creek. Similarly, the high rates of CAL and HH exceedance for cadmium, iron, nickel, and zinc indicate that TMDLs are needed for these metals. Although only one HH exceedance has occurred for arsenic, it was detected within the most recent 10-year period of record for a stream with a current arsenic listing. These factors combine to also require an arsenic TMDL in South Big Horn Creek.

F 2.4 KING CREEK (MT40I001_030)

King Creek is listed in the 2010 Integrated Report as being impaired by selenium. The segment is classified as B-1 and extends for 0.9 mile from its headwaters near the Landusky Mine pit area to the Fort Belknap Reservation boundary (**Figure F-6**). In addition to the listing for selenium, a review of the King Creek water quality record identified elevated concentrations of arsenic and cadmium. Current water quality conditions are represented by the records for sites 503, L-5, and L-39.

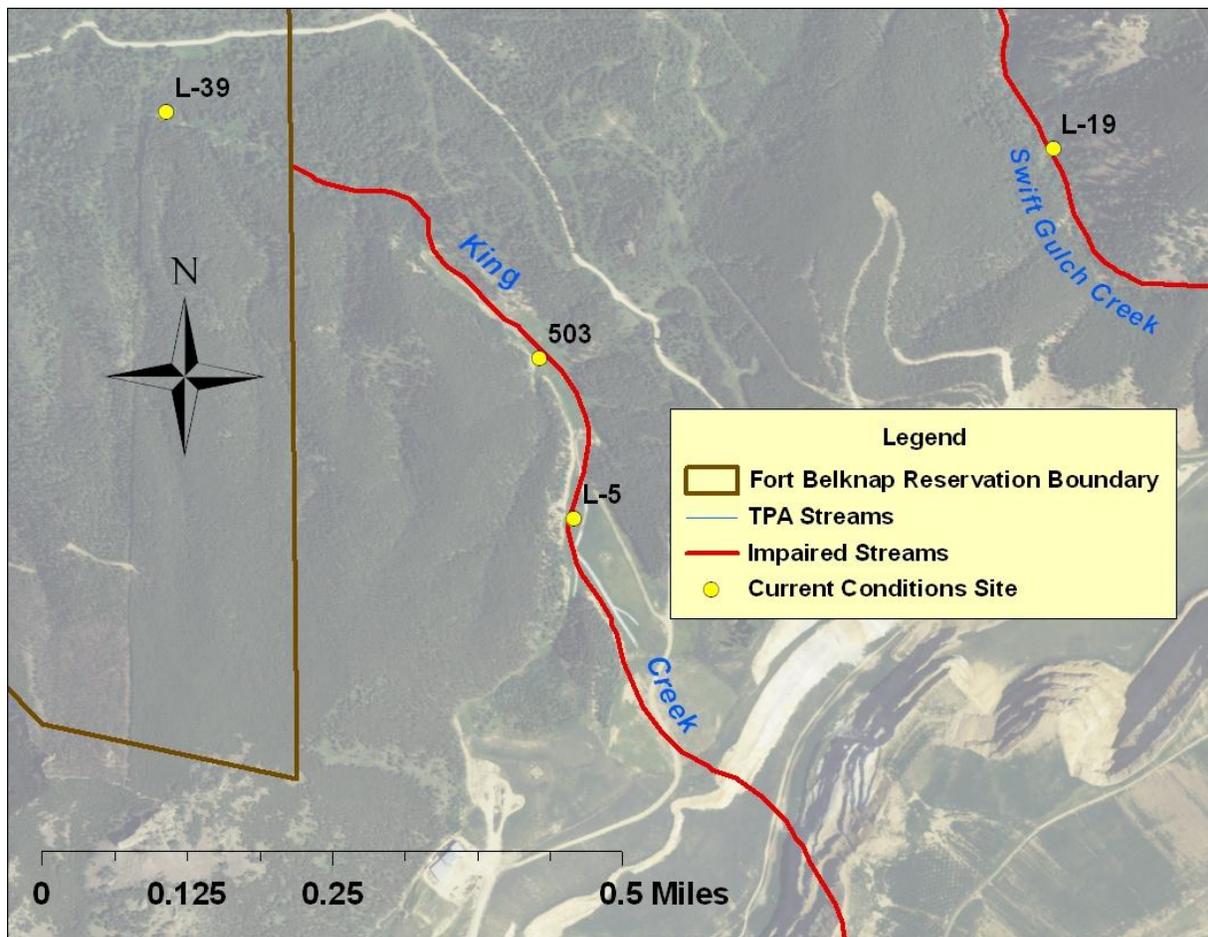


Figure F-6. King Creek and current condition sites extending from the August-Surprise-Queen Rose pit complex at the Landusky Mine to the Fort Belknap Reservation boundary

F 2.4.1 King Creek Sources

During the 1930s the August Mine and cyanide mill in upper King Creek deposited waste rock and tailings downstream. Between 1979 and 1984, ZMI operations created the August #2 Waste Rock Dump in the headwaters of King Creek. The dump was constructed in eastern and western lobes that totaled 1.3 million tons of mostly oxide mineralogy (Spectrum Engineering, Inc., 2006). The west lobe was covered with topsoil and revegetated in 1992. The eastern lobe was completely removed for Landusky pit backfill during 2002 to 2004. The historic August tailings were removed by a joint EPA-Army Corp of Engineers project in 2000. Current sources are stormwater runoff from disturbed areas at the top of the drainage, seepage through regarded and revegetated waste rock, and possibly seepage from the former August pit. Stormwater is retained by two rock check dams and the larger Cumberland Dam constructed about 2,200 feet from the top of the drainage. Groundwater flow is captured in an interception trench and routed to a passive treatment system for nutrient removal. Treated water discharges downstream to the impoundment behind the Cumberland Dam.

Early mining in the drainage precludes locating natural background sites in the King Creek drainage. Records dated from 1978 for sites L-5 and L-6 may reflect water quality prior to placement of the August #2 Waste Rock Dump, but are not likely to reflect natural background water quality because of historic

sources. An ephemeral headwaters reach of King Creek receives snowmelt and precipitation runoff from the undisturbed northeastern flank of Mission Peak. Site L-40, located in a headwater tributary of Montanan Gulch, drains the undisturbed southern slope of Mission Peak. Water quality at site L-40 is assumed as the best approximation of natural background conditions at the base of Mission Peak.

F 2.4.2 King Creek Parameter Departures

Arsenic

There are 99 arsenic results for sites 503, L-5 and L-39 for samples collected from 1982 to 2010. Seventy are since 2000. **Table F-11** summarizes the arsenic exceedance record for the past 10 years. The record contains five HH exceedances that occurred between 2001 and 2008. Three of the five exceedances occurred during high flows in 2001 and 2004. The most recent was 11 µg/L in a 2008 sample from the interception trench discharge at site L-5. Because of the HH exceedances, an arsenic TMDL is required for King Creek.

Table F-11. Arsenic criteria exceedance numbers and percentage rates under high and low flow conditions at sites 503, L-5 and L-39 in King Creek

Flow Conditions	Sample Size	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
High Flow	37	0	0	0	0	3	8
Low Flow	33	0	0	0	0	2	6
All Flows	70	0	0	0	0	5	7

Six samples from site L-40 contained less than detectable amounts of arsenic.

Cadmium

There are 70 results for cadmium in King Creek for sites 503, L-5 and L-39. The exceedance record is summarized in **Table F-12**. Nearly half of the cadmium results exceed the CAL criteria. Exceedances are evenly split between high and low flows. The four results exceeding the HH criterion are all from site L-5, the seepage discharge from intercepted stormwater and shallow groundwater near the head of the drainage. The CAL exceedance rates, together with the HH criterion exceedances, require a cadmium TMDL.

Table F-12. Cadmium criteria exceedance numbers and percentage rates under high and low flow conditions at sites 503, L-5 and L-39 in King Creek

Flow Conditions	Sample Size	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
High Flow	38	16	42	0	0	2	5
Low Flow	32	16	50	0	0	2	6
All Flows	70	32	46	0	0	4	6

Cadmium concentrations in L-40 samples were less than MDLs.

Selenium

There are 60 post-2000 results for selenium from sites L-5 and L-39. The criteria exceedance record under high and low flows is summarized in **Table F-13**.

Table F-13. Selenium criteria exceedance numbers and percentage rates under high and low flow conditions at sites L-5 and L-39 in King Creek

Flow Conditions	Sample Size	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
High Flow	30	19	63	8	27	1	3
Low Flow	30	22	73	17	57	1	3
All Flows	60	41	68	25	42	2	3

The exceedance rates for CAL and AAL criteria are greater than 10 percent and the dataset includes two HH exceedances. Nearly all selenium concentrations in samples from site L-5 exceed the CAL criterion and all AAL and HH exceedances are results from L-5. A selenium TMDL is required to King Creek.

F 2.4.3 King Creek Supplemental Indicators

There are no macroinvertebrate metrics (MMI/RIVPACS) or sediment chemistry data available for King Creek. **Figure F-7** shows the data distributions for sulfate at sites L-5, 503, and L-39. The graph shows the continued effect of sulfide oxidation in upper King Creek and the decreased concentrations downstream.

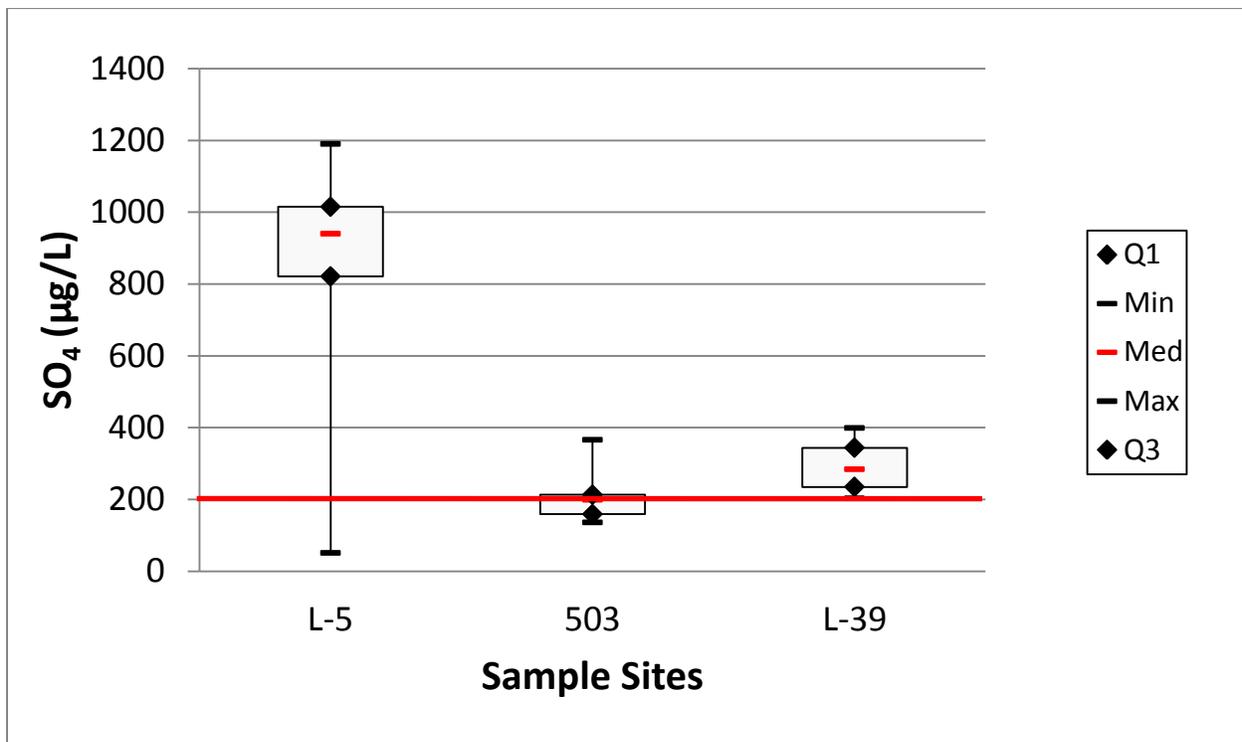


Figure F-7. Boxplot graph of sulfate data distributions at selected monitoring points compared to the 200 µg/L indicator value

F 2.4.4 King Creek TMDL Development Conclusions

Human health criteria exceedances for arsenic, cadmium and selenium, and aquatic life criteria exceedance rates for cadmium and selenium that are greater than 10 percent indicate the need for arsenic, cadmium and selenium TMDLs in King Creek.

F 2.5 LODGE POLE CREEK (MT40I001_050)

Lodge Pole Creek is listed as impaired for cadmium and mercury in the 2010 Integrated Report (Montana Department of Environmental Quality, Water Quality Planning Bureau, 2010). The stream is classified as B-1 and extends north for 4.3 miles from its headwaters along the northern margin of the Zortman Mine to the Fort Belknap Reservation boundary. Current water quality conditions are represented by records from sites Z-7 and Z-29 (Figure F-8). Site Z-29 is located on an unnamed eastern headwater tributary of Lodge Pole Creek. Most of the surface and groundwater monitoring stations for Lodge Pole Creek are along this tributary because it occurs in the drainage area disturbed by the northern extent of the Zortman Mine. Natural background conditions are represented by sites Z-28 and Z-30. These sites are located in the upper reaches of the unnamed tributary that are undisturbed except for an access road descending from the Zortman Mine into Beaver Creek. Site Z-27 in Figure F-8 is located in the headwaters of Beaver Creek.

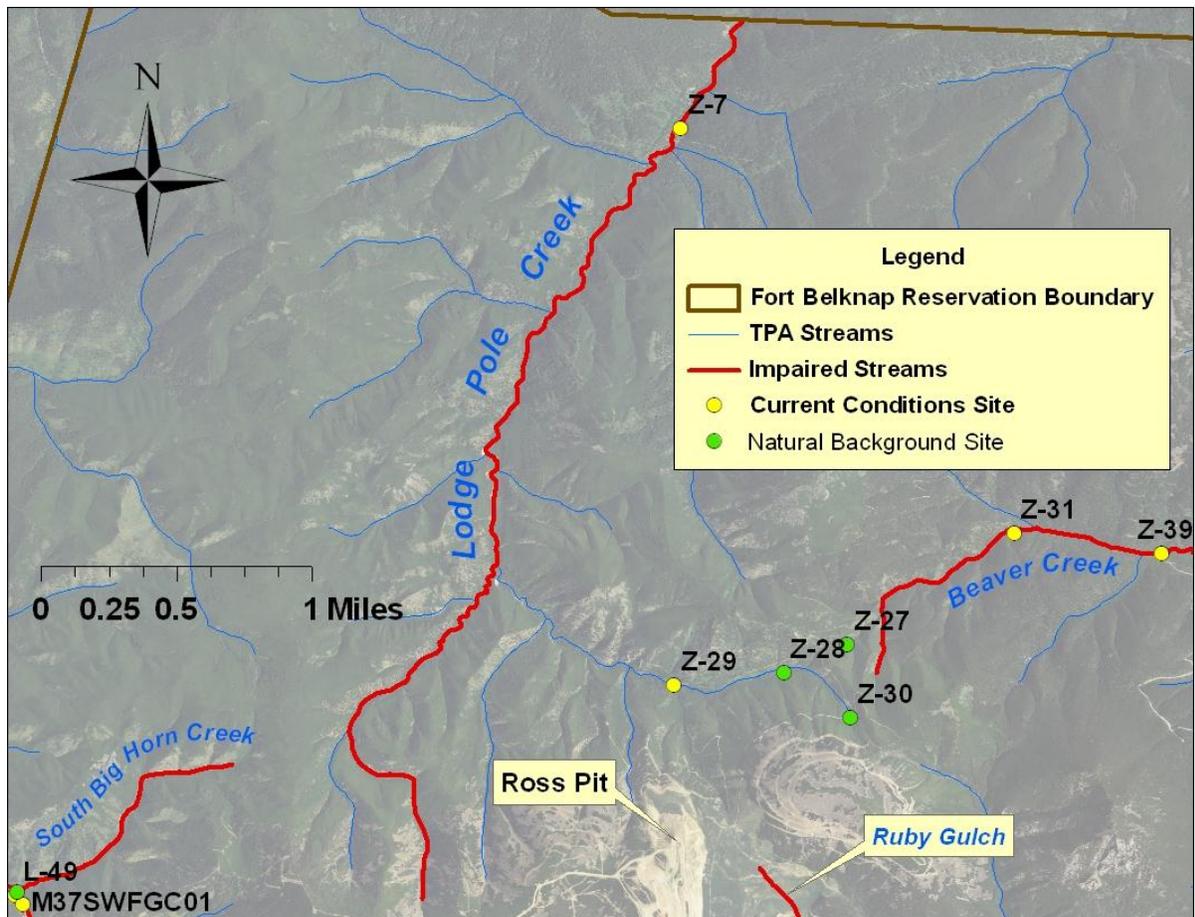


Figure F-8. Lodge Pole Creek extending from the northern edge of the Zortman Mine disturbance to the Fort Belknap Reservation boundary

F 2.5.1 Lodge Pole Creek Sources

The principal mining source of metals loading to Lodge Pole Creek is surface water draining from the Ross Pit area of the Zortman Mine. Site Z-29 is located just below the confluence of Glory Hole Creek and the unnamed eastern tributary of Lodge Pole Creek. The Ross Pit and related roadways and surface

disturbances are within the Glory Hole Creek drainage area. Farther east are disturbances on the north slope of Antoine Butte that may contribute sediment from historic abandoned mines. The Ross Pit is the northern most pit at the Zortman Mine. The pit area was re-graded, treated with lime and cover soil, and revegetated in 2004.

The data record for sites Z-29 and Z-7 includes 108 analytical results dating from 1978 to 1998. The most recent data is for sample collected at site Z-7 in April of 2004. All records for sites Z-28 and Z-30 are dated from 1990-1998.

F 2.5.2 Lodge Pole Creek Parameter Departures

Cadmium

The 63 cadmium results available from sites Z-29 and Z-7 include four positive detections and 59 results below the MDLs of 10, 1 and 0.1 µg/L. The cadmium criteria exceedance record is summarized in **Table F-14**.

Table F-14. Cadmium criteria exceedance numbers and percentage rates under high and low flow conditions at sites Z-7 and Z-29 in Lodge Pole Creek

Flow Conditions	Sample Size (CAL/AAL/HH)	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
High Flow	15/31/31	1	7	0	0	0	0
Low Flow	16/32/32	2	12.5	0	0	0	0
All Flows	31/63/63	3	10	0	0	0	0

Sites representing natural background conditions (Z-28 and Z-30) have 16 cadmium results with MDLs low enough to assess CAL compliance. Among these 16, there is one CAL exceedance and one AAL exceedance for data collected sporadically between 1991 and 1998, under mostly high flow conditions. There were no additional AAL or HH exceedances among the remaining 18 results reported with a 1 µg/L MDL. Natural background conditions for cadmium are not markedly different from those downstream of potential sources at sites L-29 and L-7 that cumulatively have three exceedances. Despite the low number of cadmium exceedances, the previous cadmium listing and the uncertainty in the aging dataset justify a cadmium TMDL for Lodge Pole Creek.

Mercury

The mercury listing for Lodge Pole Creek resulted from an extrapolation of HH exceedances measured at USGS gaging station 06154430 at the town of Lodge Pole, located five miles north (downstream) of the Fort Belknap boundary and outside of the planning area. There are 44 results for mercury from inside the planning area at sites Z-29 and Z-7. They are for samples collected from 1990 through 1996. All 44 results at these two sites are less than the reported MDLs. However, all MDLs exceed the HH and CAL criteria. Lower detection limits are required to assess use support for drinking water and aquatic life.

One of two samples collected at site Z-30 on May 15, 1991 contain detectable mercury (3 µg/L); the second sample contained less than 0.2 µg/L. Also on May 15, 1991, there was a positive mercury detection (0.2 µg/L) at site Z-28, located 300 feet downstream of Z-30. These two mercury detections occurred among a total of 24 samples collected from the two headwater sites from 1990 through 1996. There are no documented mining sources of mercury at either site, but historic use of mercury in placer mining cannot be ruled out. The previous mercury listing and uncertainty with the aging dataset justify a mercury TMDL for Lodge Pole Creek.

F 2.5.3 Lodge Pole Creek Supplemental Indicators

There are no macroinvertebrate metrics (MMI/RIVPACS) or sediment chemistry data available for Lodge Pole Creek. The 83 sulfate results for sites Z-29 and Z-7 range from 8 to 45 mg/L and average 24 mg/L (**Figure F-9**). The sulfate record does not indicate an influence of ARD on water quality. A similar sulfate record for sites Z-28 and Z-30 contains 36 results ranging from 4 to 53 mg/L, with an average of 13 mg/L. All sulfate concentrations are well below the indicator value of 200 mg/L.

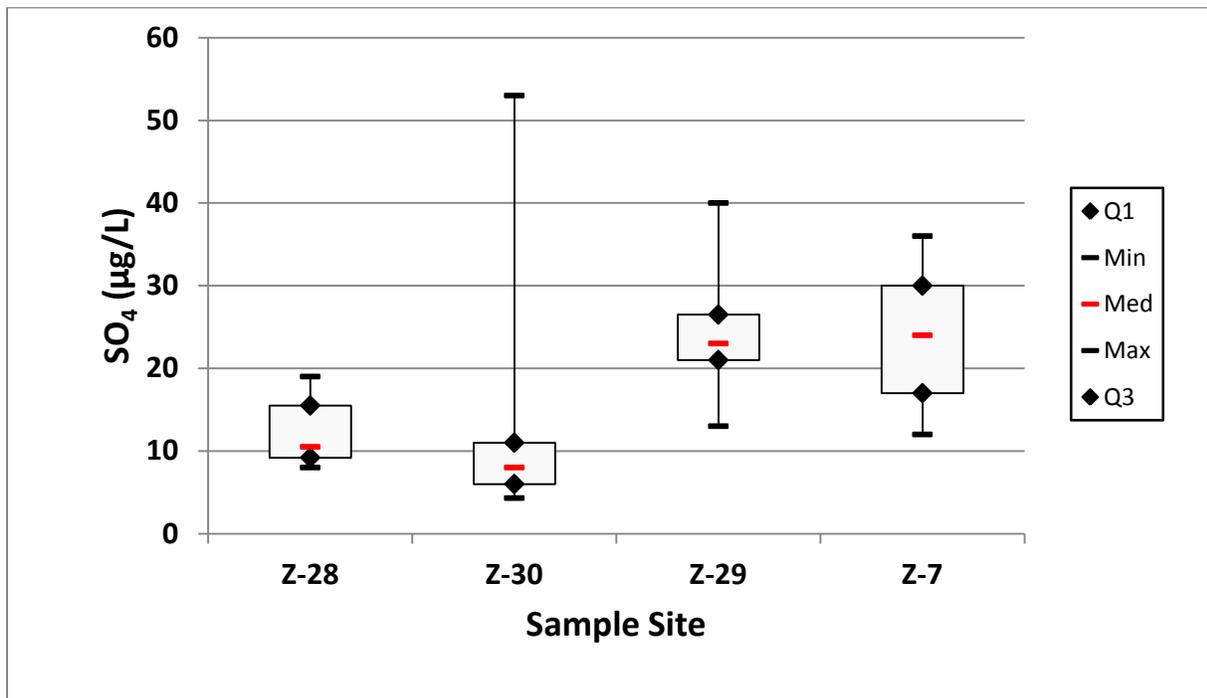


Figure F-9. Boxplot graph of sulfate data distributions at selected natural background sites (Z-28 & Z-30) and current condition sites (Z-29 & Z-7) on Lodge Pole Creek.

F 2.5.4 Lodge Pole Creek TMDL Development Conclusions

Despite the low overall CAL exceedance percentage and low sulfate levels, the current listings for cadmium and mercury, combined with the lack of recent data, support cadmium and mercury TMDLs for Lodge Pole Creek. The assumed valid extrapolation of mercury concentrations at USGS station 06154430 to upstream segments within the planning area, and high MDLs also combine to suggest the need for a mercury TMDL.

F 2.6 MILL GULCH (MT40E002_100)

Mill Gulch was listed as impaired by copper, mercury, lead, selenium, and pH in the 2010 Integrated Report (Montana Department of Environmental Quality, Water Quality Planning Bureau, 2010). Despite the C-3 use classification, drinking water use support is assessed in Mill Gulch because of established drinking water use downstream in the town of Landusky. Prior to ZMI mining operations, Mill Gulch extended for 1.7 miles from the crest of the Little Rockies, southward to its confluence with Rock Creek. The upper mile of the drainage is now occupied by the 1987 leach pad, the leach pad dike, and the 56-acre Mill Gulch Waste Rock Dump. The stream channel now extends from the toe of the waste rock

dump near site L-36, to Rock Creek (**Figure F-10**). Current water quality conditions are represented by the records for sites L-36, 506, L-22, and L-7.

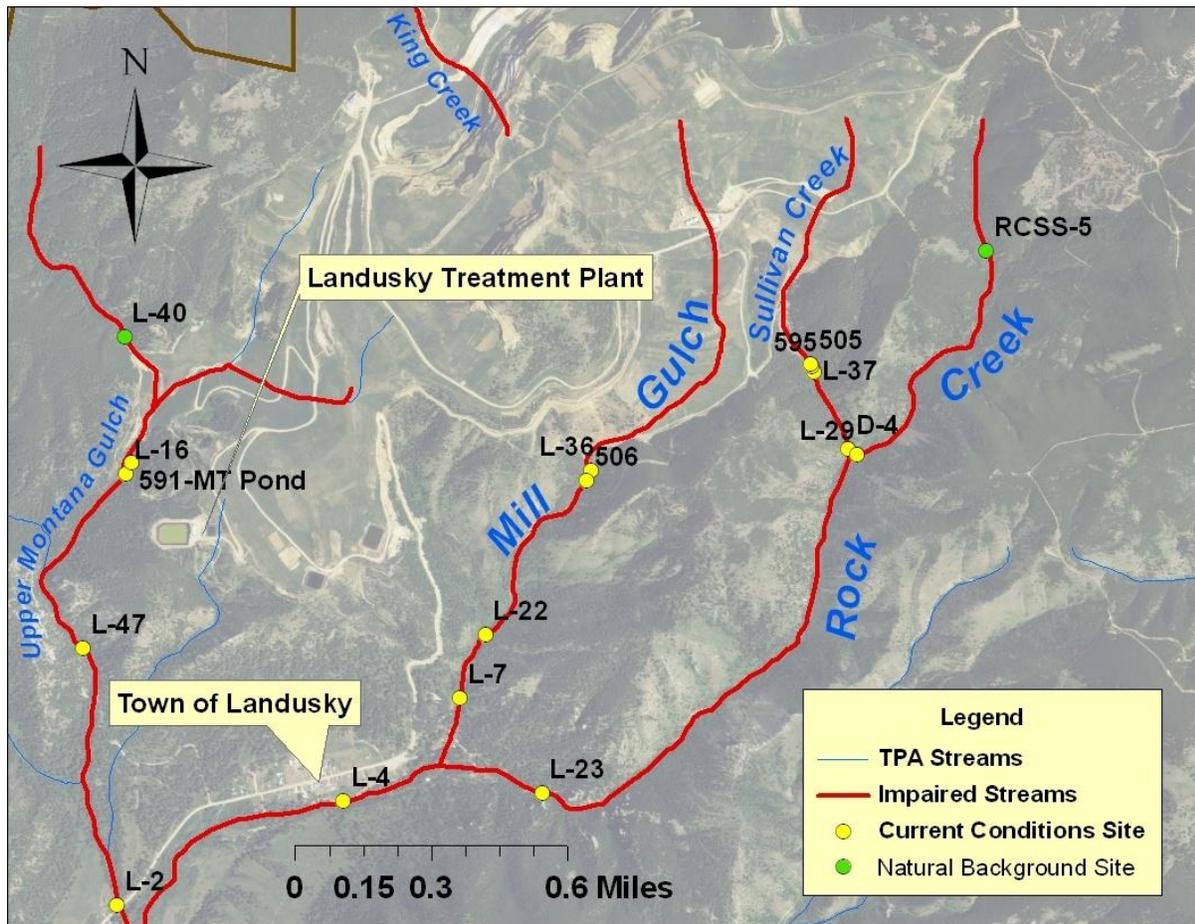


Figure F-10. Mill Gulch extending from the Landusky pit area, south, to its confluence with Rock Creek and existing condition sites L-36, 506, L-22, and L-7

F 2.6.1 Mill Gulch Sources

The main sources of metals loading to Mill Gulch are stormwater and subsurface drainage from the 1987 leach pad, the pad dike, and the Mill Gulch Waste Rock Dump. The dump contains 56 million tons of material placed from 1989 through 1992. Approximately 20 percent of its volume is thought to be sulfide waste rock (Spectrum Engineering, Inc., 2006). The Mill Gulch capture system was installed at the toe of the waste rock dump in September of 1997. Water is piped from the capture system to the Landusky wastewater treatment plant.

The entire Mill Gulch data set includes 279 records for sites, L-36, 506, and L-22 for samples collected between 1979 and 2010, and 66 records for site L-7 from 1979 through 1998. The Mill Creek departure analysis is based on more recent data that includes 55 records since 2000 for sites 506 and L-22, 8 records for site L-36 from 2002 through 2009, and 44 records from the most recent 10 years (1988-1998) for site L-7.

Samples from site L-36 are Mill Gulch capture system bypass discharges that become surface water in upper Mill Gulch. Samples from site 506 consist of stormwater in the Mill Creek channel below the

capture system. Site L-22 is a developed spring in the Mill Creek channel about 750 meters below the capture system. Samples from site L-7 are Mill Creek surface water about 250 meters below L-22.

The degree of mining disturbance in Mill Gulch prevents locating sites that represent natural background conditions. Conceivable natural background sites in this part of the Landusky Mine include site L-40 in an undisturbed tributary of Montana Gulch and site RCSS-5 located to the east in the upper reaches of Rock Creek.

F 2.6.2 Mill Gulch Parameter Departures

Copper

There are 83 results for copper in the existing condition dataset. Fifty-five of 83 have been from sites L-36, 506, and L-22 during the past 10 years. There are 24 copper results from site L-7 dated between 1990 and 1997. The departure analysis includes all 24 results for site L-7, plus the 55 from the other three sites that were obtained during the last 10 years. The criteria exceedance numbers and percentage rates are summarized in **Table F-15**.

Table F-15. Copper criteria exceedance numbers and percentage rates under high and low flow conditions at sites Z-36, 506, L-22 and L-7 in Mill Gulch

Flow Conditions	Sample Size	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
High Flow	41	2	5	2	5	2	5
Low Flow	42	6	15	6	15	0	0
All Flows	83	8	10	8	10	2	3

All exceedances in **Table F-15** occurred in samples from site L-36, the bypass of the seepage collection system in Mill Gulch. The eight AAL exceedances were more than double the AAL criteria. There were two HH exceedances. Dilution from groundwater or tributary flows reduces Mill Creek copper levels below all target criteria downstream of site L-36.

There are 12 copper results among the sites representing natural background conditions. Six of these exceed both the CAL and AAL criteria during high flows. No criteria were exceeded under low flow conditions and no samples exceeded the HH criteria. The results suggest that there is potential for background high flow copper concentrations to exceed the aquatic life criteria.

The human health exceedances and AAL exceedances at twice the AAL criteria values require a TMDL for copper in Mill Gulch.

Lead

There are 65 results for lead among the four current conditions sites in Mill Gulch. These include 41 results from sites L-36, 506, and L-22 that have been obtained within the last 10 years, plus all 24 results from site L-7. There are no CAL, AAL, or HH criteria exceedances in this dataset. All 12 lead results for the four natural background sites are less than the reported MDLs, although several MDLs exceed the CAL and HH criteria for lead. The samples are dated 1994 through 1997.

Since lead targets are not exceeded, a lead TMDL is not developed for Mill Gulch.

Mercury

The Mill Gulch dataset contains 46 results for mercury from sites L-22 and L-7. The data was collected from 1990 through 2006. All results are less than the reported MDLs. However, the MDLs (1, 0.2, and 0.6 µg/L), all exceed the 0.05 µg/L HH criterion for mercury. Because of the previous mercury listing and the uncertainty related to high MDLs, a TMDL is developed for mercury in Mill Gulch.

Selenium

There are 48 selenium results available for the four existing condition sites in Mill Gulch. Twenty-seven are for samples collected within the last 10 years from sites L-36, 506, and L-22. Among these 27, the 20 that have MDLs low enough to assess support for aquatic life are used in the departure analysis. **Table F-16** contains the selenium criteria exceedance summary for the existing condition sites in Mill Gulch.

Table F-16. Selenium criteria exceedance numbers and percentage rates under high and low flow conditions at sites, L-36, 506, and L-7 in Mill Gulch

Flow Conditions	Sample Size	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
High Flow	9	2	22	2	22	2	22
Low Flow	11	6	55	3	27	0	0
All Flows	20	8	40	5	25	2	10

Both CAL and AAL exceedance rates are greater than 10 percent, requiring a selenium TMDL for Mill Gulch.

There are 14 selenium results available for the four natural background sites. One result in 14 exceeds the CAL criterion.

F 2.6.3 Mill Gulch Supplemental Indicators

There are no macroinvertebrate metrics (MMI/RIVPACS) or sediment chemistry data available for Mill Gulch. There are 56 sulfate results for sites L-36, 506, and L-22 that have been obtained within the last 10 years. Half of these (28) have exceeded the indicator value of 200 mg/L. Among the four natural background sites there are 14 sulfate results; all are less than 200 mg/L, and have an average of 25 mg/L. The sulfate data distributions for background and current condition sites are illustrated in **Figure 9-11**. The figure shows the influence of capture system overflow at site L-36 on water quality throughout the segment. Water quality at site L-7 may be affected by metals sources related to the lower level leach pads and dikes at the Landusky Mine.

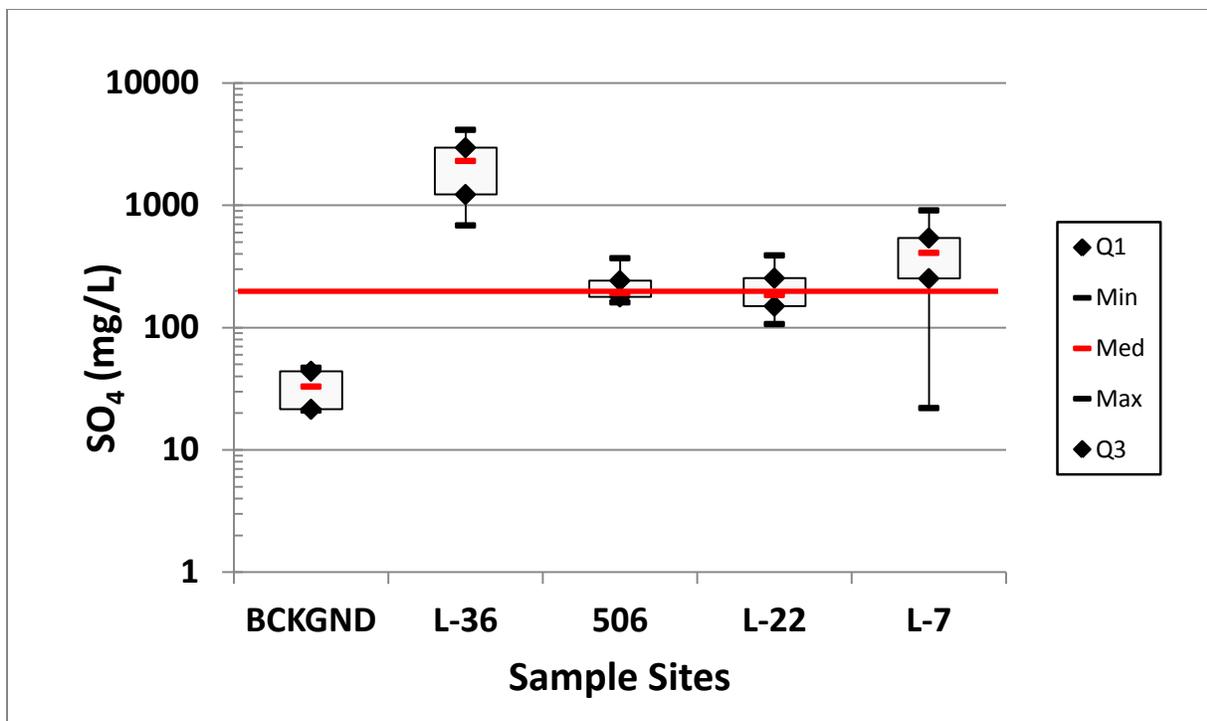


Figure 9-11. Boxplot graph of sulfate data distributions at selected natural background sites (L-40 & RCSS-5) and four current condition sites on Mill Gulch compared to the 200 mg/L indicator value.

F 2.6.4 Mill Gulch TMDL Development Conclusions

The exceedance rates for copper CAL and AAL criteria both slightly exceed 10 percent. The magnitudes of all eight AAL exceedances for copper are more than twice the criteria. The copper dataset for Mill Gulch includes two HH exceedances. The portion of the lead dataset with useful MDLs contains no exceedances. Although the mercury dataset contains recent results, the high MDLs do not allow comparison with the HH criterion. The exceedance rates for CAL and AAL criteria for selenium are greater than 10 percent, include AAL exceedances that are more than twice the criterion, and include HH exceedances. The sulfate data for Mill Gulch indicates continuing effects of ARD on surface water quality compared to background conditions. TMDLs will be developed for copper, mercury, and selenium in Mill Gulch. The lead dataset indicates that criteria are currently being met. Thus, a lead TMDL is not required. It is assumed that the pH impairment will be addressed by the TMDL for copper.

F 2.7 MONTANA GULCH (MT40E002_010)

Montana Gulch is a perennial stream draining the western third of the Landusky Mine. It is classified as C-3. Although surface water quality in this category is naturally marginal for drinking water, drinking water is considered a designated use and the target departure analysis is based on comparisons to the HH criteria. The stream is listed as impaired by arsenic, cadmium, copper, and pH in the 2010 Integrated Report (Montana Department of Environmental Quality, Water Quality Planning Bureau, 2010). A review of water quality data for the past 10 years of record recommended additional impairment listings for aluminum, cyanide, nickel, selenium, and zinc. The stream extends for two miles from the August-Surprise-Queen Rose pit complex at the Landusky Mine to its confluence with Rock Creek (Figure F-12).

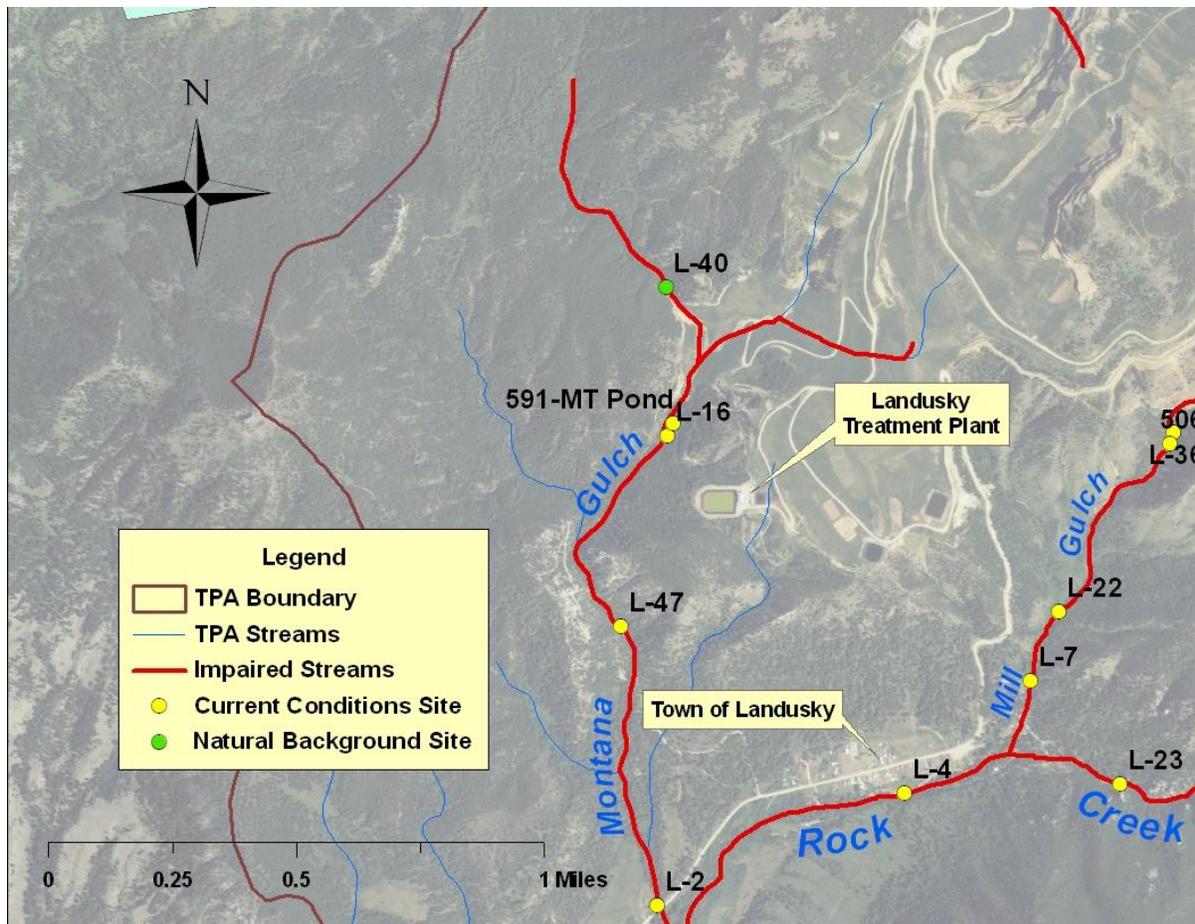


Figure F-12. Montana Gulch, natural background site L-40 and existing condition sites 591, L-16, L-47, and L-2

Current water quality conditions in Montana Gulch are represented by post-2000 records for sites 591, L-16, L-47, and L-2. Natural background conditions are represented by data for site L-40, a surface water monitoring point in an undisturbed western headwater tributary.

F 2.7.1 Montana Gulch Sources

The upstream-most metals loading source is the Montana Gulch Waste Rock Dump. Constructed between 1980 and 1988 in the central headwater tributary of Montana Gulch, this feature covers 29 acres and contains 8.5 million tons of unsorted oxide and sulfide materials (Spectrum Engineering, Inc., 2006). The dump covers the drain tunnel for the former August Mine, located near the divide between Montana Gulch and King Creek. The face of the dump received a layer of coversoil and was revegetated in 1989. The top of the dump was reclaimed in 2005. The upper Montana Gulch seepage capture system is located at the base of the dump.

The L85/86 leach pad, containing 5.3 million tons of mostly oxide ore, was constructed in Montana Gulch below the waste rock dump. The entire leach pad, its supporting dike and fill, and a lower seepage capture system were removed from Montana Gulch from 2003 to 2005. The eastern tributary of upper Montana Gulch contains the drain capture portal for the historic Gold Bug Mine and artesian well WS-3 that controls the groundwater levels in the upper gulch and Landusky pit area. Montana Gulch also contains portions of leach pads and supporting dikes dating from 1980-1984. The Frog Pond Capture

System is located in an ephemeral Montana Gulch tributary to the south of the Landusky wastewater treatment plant. The capture system flow is routed to the Landusky plant. Flow in the tributary below the capture system enters Montana Gulch upstream of monitoring site L-2.

Wastewater from both the Landusky wastewater treatment plant and the Landusky biological treatment plant is discharged to a 0.7-acre lined pond constructed in the bottom of Montana Gulch below the confluence of the three headwater tributaries. The Landusky treatment plant receives effluent from the following sources:

- The Gold Bug Mine portal
- Well WS-3
- Upper Montana Gulch capture system
- Mill Gulch capture system
- Sullivan Creek capture system
- The Frog Pond capture system
- The biological treatment plant.

The plant operates around the clock, discharging about 430 gpm (0.96 cfs). The perennial discharge from the Montana Gulch pond (site 591) enters Montana Gulch at about 530 gpm (1.2 cfs).

F 2.7.2 Montana Gulch Parameter Departures

Aluminum

The dissolved aluminum dataset contains four low flow results from samples collected during August through October of 2009. One sample, containing 7450 µg/L, is more than twice the AAL criterion of 750 µg/L. A TMDL is required for aluminum in Montana Gulch.

Arsenic

The arsenic dataset from the four existing condition sites contains 186 arsenic results. Although all results are less than either the CAL criterion (150 µg/L), or the AAL criterion (340 µg/L), 94 arsenic results (51%) exceed the 10 µg/L HH criterion. Thus, an arsenic TMDL is required for Montana Gulch. Arsenic has not been detected at site L-40.

Cadmium

There are 335 cadmium results with corresponding hardness values. All MDLs are sufficiently low to allow comparison of results with both the CAL and AAL criteria. The cadmium exceedance summary is provided in **Table F-17**.

Table F-17. Cadmium aquatic life and human health criteria exceedance numbers and percentage rates under high and low flow conditions at sites, 591, L-16, L-47 and L-2 in Montana Gulch

Flow Conditions	Sample Size	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
High Flow	90	71	79	7	8	19	21
Low Flow	245	129	53	22	9	32	13
All Flows	335	200	60	29	9	51	15

The CAL criteria are exceeded in 60 percent, and AAL criteria are exceeded in nine percent of the samples. There are 51 exceedances of the HH criterion (15%). High flow Cd exceedances are more

common than those at low flow. Since the aquatic life exceedance rates are greater than 10 percent and the record contains HH exceedances, a cadmium TMDL is required for Montana Gulch.

Copper

There are 335 copper results with corresponding hardness values. Copper MDLs allow comparison with both CAL and AAL criteria. There are no HH exceedances for copper. The aquatic life copper exceedance summary is provided in **Table F-18**.

Table F-18. Copper aquatic life criteria exceedance numbers and percentage rates under high and low flow conditions at sites, 591, L-16, L-47 and L-2 in Montana Gulch

Flow Conditions	Sample Size	CAL Exceedance		AAL Exceedance	
		Number	%	Number	%
High Flow	91	2	2	0	0
Low Flow	244	2	1	1	0.4
All Flows	335	4	1	1	0.3

Copper exceedances of both CAL and AAL criteria are well below 10 percent under all flow conditions. Therefore, a copper TMDL is not needed for Montana Gulch. Total recoverable concentrations of Cu were not detected at site L-40.

Cyanide (CN)

There are 465 cyanide results in the Montana Gulch dataset for existing condition sites. **Table F-19** contains the cyanide exceedance summary for aquatic life criteria. The HH cyanide criterion of 140 µg/L was exceeded in one low flow sample.

Table F-19. Cyanide aquatic life criteria exceedance numbers and percentage rates under high and low flow conditions at sites, 591, L-16, L-47 and L-2 in Montana Gulch

Flow Conditions	Sample Size	CAL Exceedance		AAL Exceedance	
		Number	%	Number	%
High Flow	126	6	5	6	5
Low Flow	339	48	14	33	10
All Flows	465	54	16	39	8

The CAL criterion for cyanide was exceeded in 12 percent of samples. Similar to cadmium, cyanide exceedances are concentrated during low flows. Because of the CAL exceedance rate is greater than 10 percent and the record contains a HH exceedance, a TMDL for cyanide is required in Montana Gulch.

Nickel

There are 145 nickel results in the Montana Gulch dataset for existing conditions. **Table F-20** contains the nickel exceedance summary for aquatic life and HH criteria. There are 27 nickel results that exceed the 100 µg/L HH criterion.

Table F-20. Nickel criteria exceedance numbers and percentage rates under high and low flow conditions at sites, 591, L-16, L-47 and L-2 in Montana Gulch.

Flow Conditions	Sample Size (CAL/AAL/HH)	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
High Flow	42	5	12	0	0	0	0

Table F-20. Nickel criteria exceedance numbers and percentage rates under high and low flow conditions at sites, 591, L-16, L-47 and L-2 in Montana Gulch.

Flow Conditions	Sample Size (CAL/AAL/HH)	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
Low Flow	(101/103/103)	16	16	0	0	27	26
All Flows	(143/145/145)	21	15	0	0	27	19

The CAL criteria for nickel were exceeded in 21 of 143 samples (15 percent). The AAL criteria were not exceeded in any sample. Nickel exceedances are concentrated during low flows. There were three nickel HH exceedances at monitoring points downstream of the Montana Gulch pond overflow. With a 15 percent CAL exceedance rate and the HH exceedances, a nickel TMDL is required for Montana Gulch.

Selenium

There are 146 selenium results in the Montana Gulch dataset for existing condition sites. **Table F-21** contains the selenium exceedance summary for aquatic life and HH criteria. Fifteen selenium results exceed the 50 µg/L HH criterion.

Table F-21. Selenium criteria exceedance numbers and percentage rates under high and low flow conditions at sites, 591, L-16, L-47 and L-2 in Montana Gulch.

Flow Conditions	Sample Size	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
High Flow	42	29	69	16	38	4	10
Low Flow	104	60	58	29	28	11	11
All Flows	146	89	61	45	31	15	11

The CAL criterion for selenium was exceeded in 89 samples (61%), and the AAL criterion was exceeded in 45 samples (31%). Exceedances were evenly distributed over both flow conditions. The high aquatic life exceedance rates and the HH exceedances require a TMDL for selenium in Montana Gulch.

At background site L40, the CAL criterion was exceeded in one high flow sample, indicating the possibility of elevated natural background selenium under high flows.

Zinc

There are 334 zinc results in the Montana Gulch dataset for existing condition sites. **Table F-22** contains the zinc exceedance summary for aquatic life and HH criteria.

Table F-22. Zinc criteria exceedance numbers and percentage rates under high and low flow conditions at sites, 591, L-16, L-47 and L-2 in Montana Gulch

Flow Conditions	Sample Size	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
High Flow	90	6	7	6	7	3	3
Low Flow	244	13	6	13	6	0	0
All Flows	334	19	5	19	5	3	1

The aquatic life criteria for zinc were exceeded in 19 of 334 results (6%). Although overall exceedance rates are below 10 percent, four zinc results for pond overflow samples were more than double the

aquatic life criteria, and three results exceeded the 2,000 µg/L HH criterion. Thus, a zinc TMDL is required for Montana Gulch. There are no zinc exceedances at background site L-40.

F 2.7.3 Montana Gulch Supplemental Indicators

There are no macroinvertebrate metrics (MMI/RIVPACS) or sediment chemistry data available for Montana Gulch. There are 301 sulfate results among sites 591, L-16, L-47, and L-2. All exceed the 200 mg/L target value. The sulfate data distributions for background (site L-40) and current condition sites are illustrated in **Figure F-13**.

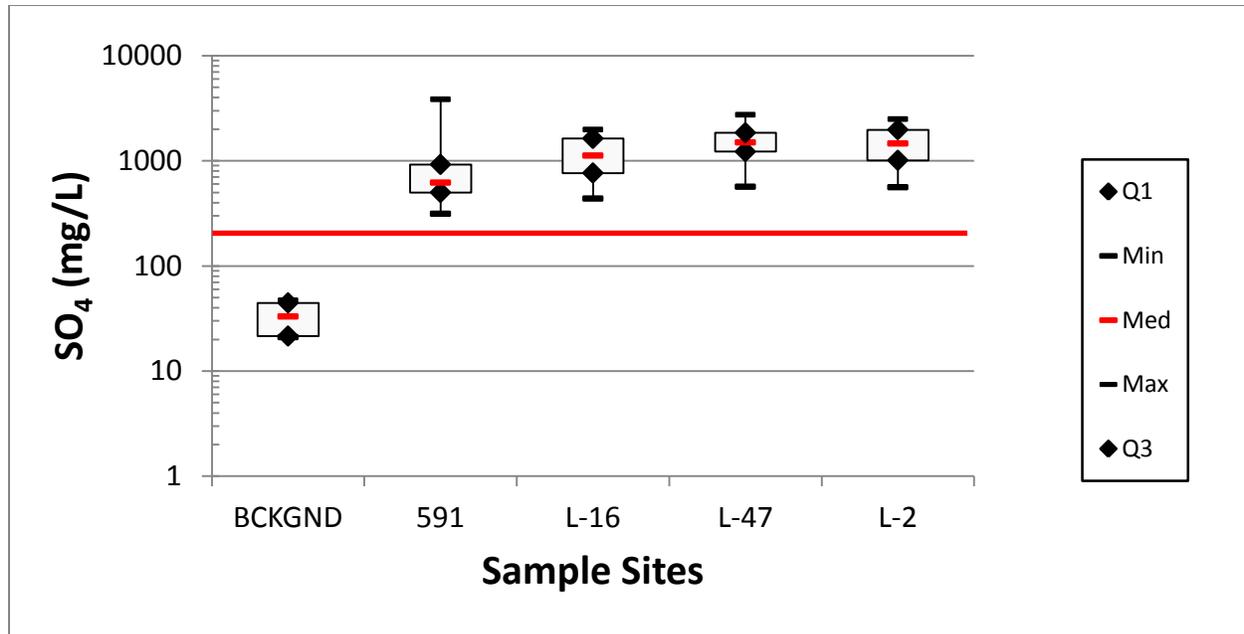


Figure F-13. Boxplot graph of sulfate data distributions at natural background and current condition sites on Montana Gulch compared to the 200 mg/L indicator value.

The six background sulfate results average 33 mg/L and none exceed the 200 mg/L target value. The increase between background sulfate and current condition sites is the influence of the Landusky WWTP effluent on Montana Gulch surface water downstream of the retention pond discharge.

F 2.7.4 Montana Gulch TMDL Development Conclusions

The existing condition dataset supports TMDL development for aluminum, arsenic, cadmium, cyanide, nickel, selenium, and zinc. Cadmium, cyanide and nickel concentrations exceed the 10 percent exceedance rate for the CAL criteria. Selenium concentrations were above the 10 percent exceedance rate for both CAL and AAL criteria. Several zinc results were more than twice the aquatic life criteria. The HH criteria were exceeded for arsenic, cadmium, cyanide, nickel, selenium and zinc. Cadmium will be used as a surrogate parameter to address the pH impairment listing.

Copper exceedance rates are well under 10 percent for both the CAL and AAL criteria and there were no HH exceedances. The data do not support TMDL development for copper in Montana Gulch.

F 2.8 ROCK CREEK (MT40E002_090)

Rock Creek and its three tributaries of Montana Gulch, Mill Gulch, and Sullivan Creek drain nearly the entire Landusky Mine. **Figure F-14** shows the extent of impaired waters at the Landusky mine and the locations of current condition and background monitoring sites. Rock Creek is an intermittent stream as it flows into the town of Landusky. It is classified as C-3. The HH criteria are considered in assessing Rock Creek metals impairments and the need for TMDLs. Several Landusky wells supply drinking water to residents.

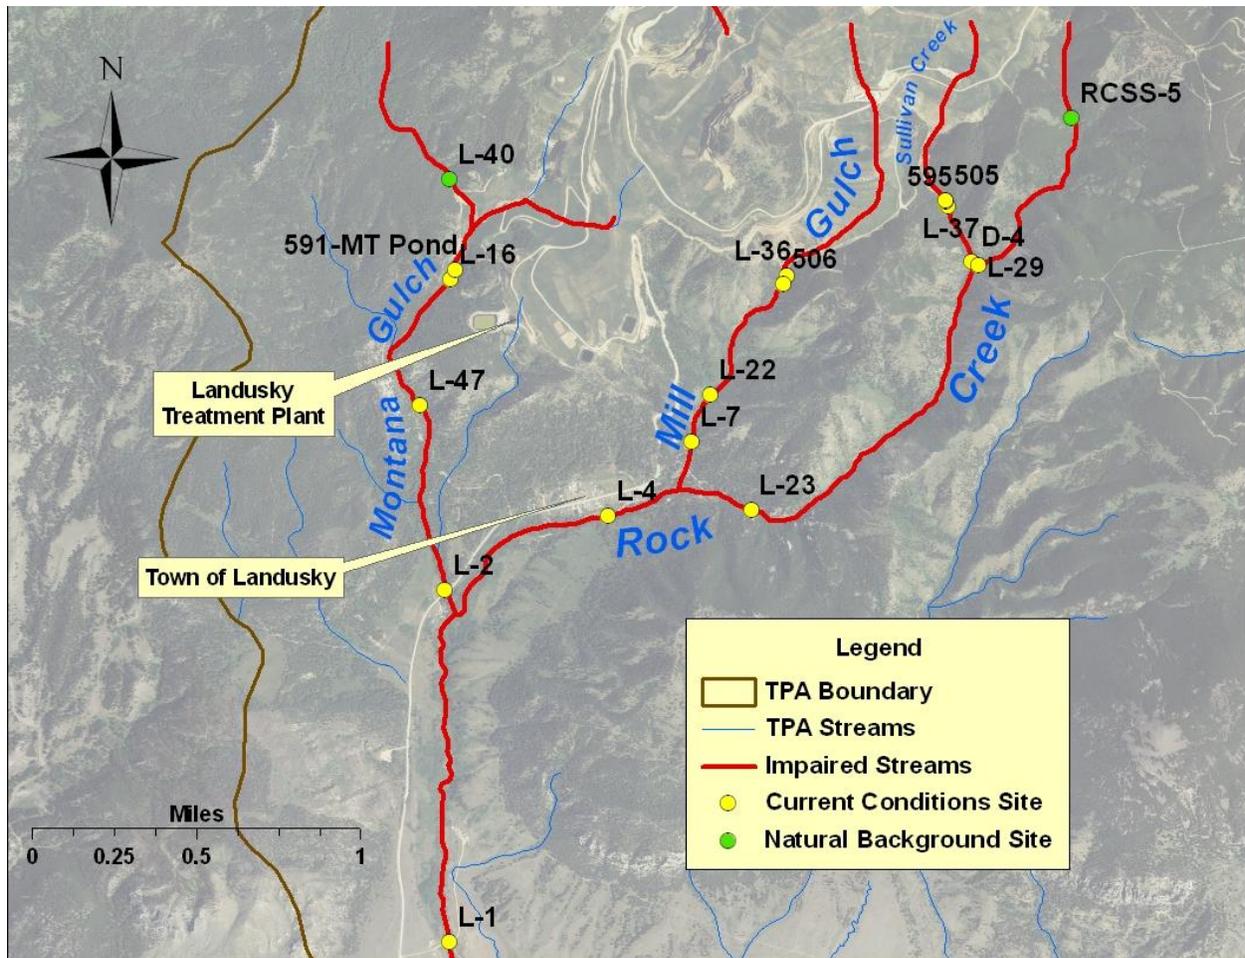


Figure F-14. Extent of Rock Creek, impaired tributaries (left to right) Montana Gulch, Mill Gulch, and Sullivan Creek, and selected water quality monitoring sites

Rock Creek is listed in the 2010 Integrated Report (Montana Department of Environmental Quality, Water Quality Planning Bureau, 2010) as impaired by cadmium, copper, lead, mercury, selenium, zinc, and pH. Water quality data for sites L-29, L-23, L-4, and L-1 is assumed to represent existing conditions. The dataset contains 168 records dating from 1977 to 2004. The size of the dataset for any single parameter is variable. Data collected during the ten most recent years of record is used in the analysis when available.

Site RCSS-5, located in the Rock Creek headwaters, and sites Z-60, Z-61, and Z-62, in the upper reaches of Alder Gulch (**Figure F-1**), are assumed to represent natural background conditions in Rock Creek.

F 2.8.1 Rock Creek Sources

Metals loading sources of to Rock Creek include those described above for Mill Gulch and Montana Gulch. The reach of Rock Creek above the Sullivan Creek confluence may be affected by surface runoff and seepage from the eastern extent of the L91 leach pad, pad underlayment, and dike materials. Downstream of the Sullivan Creek confluence, Rock Creek is influenced by nearly the entire L91 leach pad and dike located at the top of Sullivan Creek. Below Mill Gulch, Rock Creek is affected by Mill Gulch sources, stream-side tailings from historic mills in the town of Landusky, and Montana Gulch sources.

F 2.8.2 Rock Creek Parameter Departures

Cadmium

Among the four existing condition sites there are 71 cadmium results with corresponding hardness values. The cadmium values ranged from 0.1 to 12 µg/L. The cadmium exceedance summary for both aquatic life and HH criteria is provided in **Table F-23**. Cadmium MDLs greater than the CAL criteria reduced the sample size available for CAL target comparisons.

Table F-23. Cadmium criteria exceedance numbers and percentage rates under high and low flow conditions at sites Z-29, L-23, L-4, and L-1 in Rock Creek

Flow Conditions	Sample Size (CAL/AAL/HH)	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
High Flow	28/40/40	4	25	1	3	1	3
Low Flow	15/31/31	3	20	0	0	0	0
All Flows	43/71/71	7	16	1	1	1	1

The existing condition Rock Creek cadmium record contains frequent high flow cadmium concentrations exceeding the CAL criteria and a high flow HH exceedance. Among seven cadmium results for the natural background sites, there was one high flow CAL exceedance (0.2 µg/L). The 16 percent CAL exceedance rate and the human health exceedance indicate that a cadmium TMDL is needed for Rock Creek.

Copper

Among the four existing condition sites there are 74 copper results ranging from less than 1 to 58 µg/L. Five of 74 results have MDLs greater than the CAL criteria. The copper exceedance summary for both aquatic life and HH criteria is provided in **Table F-24**.

Table F-24. Copper criteria exceedance numbers and percentage rates under high and low flow conditions at sites Z-29, L-23, L-4, and L-1 in Rock Creek

Flow Conditions	Sample Size (CAL/AAL/HH)	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
High Flow	35/33/37	9	26	6	17	0	0
Low Flow	34/37/37	3	9	2	6	0	0
All Flows	69/70/74	12	17	8	12	0	0

The exceedance rates for both aquatic life criteria were greater than 10 percent, indicating the need for a copper TMDL in Rock Creek. Exceedance rates are much higher during high flows. The seven copper results for the background sites are all from high flow samples. Both the CAL and AAL criteria were

exceeded in all seven samples. Therefore, there may be potential for naturally high copper concentrations in Rock Creek during high flows.

Lead

Among the four existing condition sites there are 70 lead results with corresponding hardness values. Fifty-six results have MDLs greater than the CAL criteria. The lead values ranged from less than 2 to 80 µg/L. The lead exceedance summary for aquatic life and HH criteria is provided in **Table F-25**.

Table F-25. Lead criteria exceedance numbers and percentage rates under high and low flow conditions at sites Z-29, L-23, L-4, and L-1 in Rock Creek

Flow Conditions	Sample Size (CAL/AAL/HH)	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
High Flow	30/36/36	5	17	0	0	1	3
Low Flow	26/34/34	3	12	0	0	1	4
All Flows	56/70/70	8	14	0	0	2	4

The CAL criteria exceedance rate of 14 percent and two HH criterion exceedances indicate that a lead TMDL is needed in Rock Creek. The seven lead results for the background sites are all less than the MDL of 3 µg/L. The results cannot be used to assess CAL compliance, but no results from background sites exceeded the AAL or HH criteria.

Mercury

There are 44 mercury results for the existing condition sites on Rock Creek. All results are less than reported MDLs that range from 0.2 to 1 µg/L. All MDLs are greater than the 0.05 µg/L HH criterion. Of the 12 results with MDLs less than 1 µg/L, all are less than aquatic life criteria. The seven results from the four background site are all less than 0.6 µg/L. Given the previous mercury listing, extensive mining sources, and uncertainty caused by high MDLs, a mercury TMDL is developed for Rock Creek.

Selenium

There are 72 results for selenium among the current condition sites. Only 14 of these samples contained detectable selenium. Of these 14, one result (9 µg/L) in a sample from site L-1 in August of 2004 exceeded the CAL criterion. Except for the one 2004 sample, the selenium dataset for Rock Creek is pre-2000. The single recent exceedance in an aging dataset raises uncertainty about the current selenium status in a selenium-listed stream. The level of uncertainty justifies a selenium TMDL for Rock Creek. Selenium has not been detected in nine samples collected from the background sites.

Zinc

Among the four existing condition sites there are 77 zinc results with corresponding hardness values and MDLs greater than the CAL criteria. The zinc results are dated during the 1990s and range from less than 10 to 1,040 µg/L. The zinc exceedance summary for aquatic life and HH criteria is provided in **Table F-26**.

Table F-26. Zinc criteria exceedance numbers and percentage rates under high and low flow conditions at sites Z-29, L-23, L-4, and L-1 in Rock Creek

Flow Conditions	Sample Size	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
High Flow	43	3	7	3	7	0	0
Low Flow	34	1	0	1	0	0	0

Table F-26. Zinc criteria exceedance numbers and percentage rates under high and low flow conditions at sites Z-29, L-23, L-4, and L-1 in Rock Creek

Flow Conditions	Sample Size	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
All Flows	77	4	5	4	5	0	0

Although the overall zinc exceedance rates are low, the occurrence of a result (1,040 $\mu\text{g/L}$) greater than twice the aquatic life criterion (388 $\mu\text{g/L}$), requires development of a zinc TMDL for Rock Creek. There were no exceedances among the nine zinc results for the background sites.

F 2.8.3 Rock Creek Supplemental Indicators

There are no macroinvertebrate metrics (MMI/RIVPACS) or sediment chemistry data available for Rock Creek. There are 103 sulfate results among the current condition sites. The data distributions of sulfate from background and current condition monitoring sites are illustrated in **Figure 9-15**. Twenty-eight (27%) of these exceed the proposed 200 $\mu\text{g/L}$ threshold value. Twenty-seven of the 28 samples that exceeded the sulfate threshold were from site L-1, which is located near the sedimentary plains reach of Rock Creek. This location likely has a higher ambient sulfate concentration than surface water in the mountain reaches. Nine sulfate results are available for the background sites. None exceed the 200 $\mu\text{g/L}$ threshold and the average value is 19 $\mu\text{g/L}$. The significant increase in sulfate between the background sites and site L-29 is likely the effects of the L91 leach pad in Sullivan Creek.

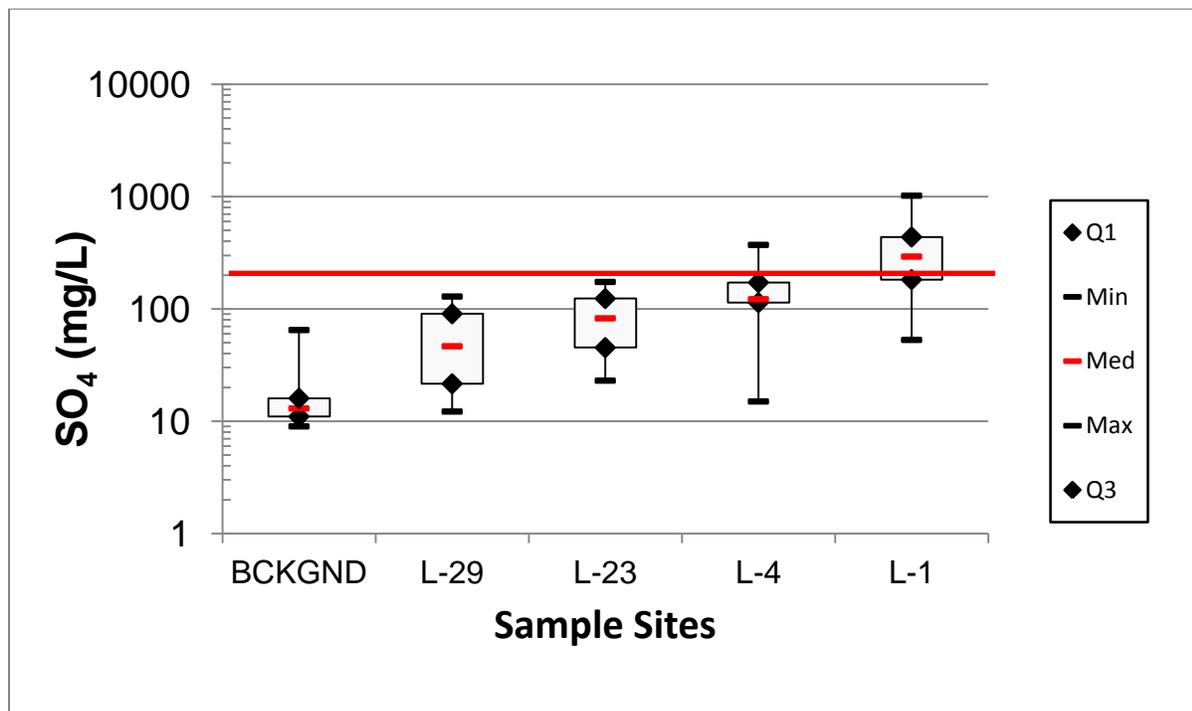


Figure 9-15. Boxplot graph of sulfate data distributions at selected natural background and current condition sites on Rock Creek compared to the 200 mg/L indicator value.

F 2.8.4 Rock Creek TMDL Development Conclusions

The existing condition datasets for cadmium, copper, and lead exceed the 10 percent CAL exceedance threshold, mostly during high flows. The rate of AAL criteria exceedance for copper was also over 10

percent. Human health criteria are exceeded for both cadmium and lead. These conditions support the need for cadmium, copper, and lead TMDLs.

The entire mercury dataset is pre-1998 and has MDLs that are too high to allow a compliance assessment of the HH criterion. A TMDL for mercury will be developed in response to the uncertainty in HH compliance for a stream with a previous mercury listing.

An aging dataset is also an issue for interpreting selenium impairment. The only result available for the past 13 years exceeds the CAL criterion, so a selenium TMDL will be developed to address the listing.

A zinc result of more than twice the aquatic life criteria justifies a zinc TMDL. Since metals impairments are linked to low pH conditions, cadmium will serve as a surrogate parameter to address the pH listing.

F 2.9 RUBY GULCH (MT40E002_070)

Ruby Gulch is listed as impaired in the 2010 Integrated Report (Montana Department of Environmental Quality, Water Quality Planning Bureau, 2010) for cadmium, chromium, copper, lead, mercury, selenium, zinc, and pH. The segment is classified as C-3 and extends for 2.9 miles from its headwaters to its confluence with Alder Gulch. Prior to ZMI mining operations, Ruby Gulch flowed at its headwaters from several springs discharging from extensive historic underground mine workings. Along its lower reach near the town of Zortman, it flows largely in response to significant precipitation or snowmelt.

Ruby Gulch receives the outfall from the Zortman wastewater treatment plant (site 667) about 200 meters upstream of site Z-15 (**Figure F-1**). From upstream to downstream, current water quality conditions are represented by the plant discharge and sites Z-15, Z-100, and Z-1B. Background conditions are represented by sites RGSP-1, RGSS-1, Z-9 and Z-52 that are surface water monitoring points in drainages from the undisturbed eastern half of the Ruby Gulch watershed.

F 2.9.1 Ruby Gulch Sources

The principal current source of metals loading to Ruby Gulch is the Zortman wastewater treatment plant. The plant receives effluent from three seepage capture systems; the Carter Gulch capture, the Alder Spur capture and the Ruby capture. The Carter Gulch capture collected seepage from beneath the Alder Gulch Waste Rock Dump until the system was destroyed by a slope failure near the base of the dump in May of 2011. The Alder Spur capture system collects seepage from the Z83 and Z84 leach pads and dikes. The Ruby capture system includes an 8.9 million gallon lined pond constructed in upper Ruby Gulch. The pond collects seepage from upslope springs that were covered by the Z85/Z86 leach pad and dike system. The pond also receives seepage from two underground mine adits located near the southwestern edge of the Z85/Z86 leach pad.

The Zortman treatment plant began operating in June of 1994. For the past five years the annual effluent volume has averaged about 87 million gallons during part-time operations. According to Spectrum Engineering (2006) the plant operates approximately 72 hours per week. The effluent is discharged from outfall 667 into the channel of Ruby Gulch upstream from monitoring site Z-15.

F 2.9.2 Ruby Gulch Parameter Departures

Aluminum

Although not listed in 2010 for aluminum, a review of the metals dataset for Ruby Gulch identified a number of standards exceedances. There are 11 results for aluminum in samples having a pH range of from 6.5 to 9.0. Four of 11 results have MDLs that exceed the CAL criterion. Of the remaining seven results, six (86%) exceed the CAL criterion. Three of 11 samples (27%) exceed the AAL criterion.

Cadmium

There are 422 results for cadmium for the four current condition sites that date from 1990 to 2010. Data from the most recent 10 years for each site brings the total down to 313 results dating from 1995 to 2010. The cadmium exceedance summary for aquatic life criteria is provided for the existing condition sites in **Table F-27**.

Table F-27. Cadmium criteria exceedance numbers and percentage rates under high and low flow conditions at sites 667, Z-15, Z-100 and Z-1B in Ruby Gulch

Flow Conditions	Sample Size	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
High Flow	105	90	86	22	21	33	31
Low Flow	208	183	88	58	29	78	38
All Flows	313	273	87	80	26	111	35

There are five cadmium results dating from 1994 to 1997 for the four background sites. Cadmium has not been detected in samples from these sites.

The CAL criteria are exceeded in 87 percent of Ruby Gulch samples and the AAL criteria are exceeded in 26 percent of samples. Three results are more than double the AAL criteria and the HH criterion is exceeded in 35 percent of the samples. The rate of aquatic life and HH criteria exceedances requires a cadmium TMDL in Ruby Gulch. Cadmium will serve as the surrogate parameter for addressing pH conditions in Ruby Gulch.

Chromium (Cr)

The assessment record for Ruby Gulch contains documentation of a single CAL exceedance for chromium in a sample from an upper Ruby Gulch well during a 1994 sampling event. There are 21 surface water chromium results for sites Z-15 and Z-1b that date from 1990 through 1996. There are no chromium criteria exceedances among these samples. The dataset for Ruby Gulch contains no results for chromium during the past 15 years. The assumed validity of the previous chromium listing and age of the existing chromium dataset justify development of a chromium TMDL for Ruby Gulch.

Copper

There are 313 results for copper for the four current condition sites that date from 1995 to 2010. The aquatic life exceedance summary for copper is provided in **Table F-28**. There are no HH exceedances for copper. There are five copper results dating from 1994 to 1997 for the four background sites. Copper has not been detected at these sites.

Table F-28. Copper criteria exceedance numbers and percentage rates under high and low flow conditions at sites 667, Z-15, Z-100 and Z-1B in Ruby Gulch

Flow Conditions	Sample Size (CAL/AAL/HH)	CAL Exceedance		AAL Exceedance	
		Number	%	Number	%
High Flow	105	14	13	14	13
Low Flow	208	7	3	3	1
All Flows	313	21	7	17	5

Copper aquatic life criteria exceedances rates are less than 10 percent of a large and current dataset. A copper TMDL is not required for Ruby Gulch.

Cyanide

The existing condition sites have 408 cyanide results dating from 1995 to 2011. The record contains no HH exceedances for cyanide. The aquatic life exceedance summary for cyanide is provided in **Table F-29**.

Table F-29. Cyanide criteria exceedance numbers and percentage rates under high and low flow conditions at sites 667, Z-15, Z-100 and Z-1B in Ruby Gulch

Flow Conditions	Sample Size (CAL/AAL/HH)	CAL Exceedance		AAL Exceedance	
		Number	%	Number	%
High Flow	134	38	28	16	12
Low Flow	274	72	26	3	1
All Flows	408	110	27	19	5

The CAL criterion for cyanide is exceeded in 110 samples (27%) and the AAL criterion was exceeded in 19 samples. Exceedances were evenly divided between high and low flow conditions. Twelve of the 19 AAL exceedances were more than twice the 22 µg/L criterion. All but one of the exceedances occurred in the Zortman wastewater treatment plant outfall. The high CAL exceedance rate and occurrences of values twice the AAL criterion require a cyanide TMDL in Ruby Gulch.

Lead

There are 257 results for lead, dating from 1995 to 2010, at three of the four current condition sites. The exceedance summary is summarized in **Table F-30**. The analysis included seven results for site Z-1B. Five of the seven site Z-1B results exceed both the aquatic life and HH criteria for lead. No lead exceedances occurred at sites 667 and Z-15.

Table F-30. Lead criteria exceedance numbers and percentage rates under high and low flow conditions at sites 667, Z-15, and Z-1B in Ruby Gulch

Flow Conditions	Sample Size (CAL/AAL/HH)	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%		
High Flow	91	4	4	1	1	4	4
Low Flow	166	1	1	0	0	1	1
All Flows	257	5	2	1	0	5	2

There are five lead results dating from 1994 to 1997 for the four background sites. The MDLs reported with the two samples from 1994 and 1995 exceed the CAL criteria. Lead was not detected in the

remaining three samples. No exceedances of AAL criteria for lead have occurred in data from the past ten years. Although the exceedances occurred in older data, only one sample has been collected during the past 10 years from site Z-1B, where the exceedances are concentrated. The uncertainty regarding the current water quality at site Z-1B, the HH exceedances, and the previous lead listing prompt development of a lead TMDL in Ruby Gulch.

Mercury

Among 47 mercury results for the existing condition sites in Ruby Gulch, there is a single positive detection of 2.0 µg/L in a 2003 sample of the Zortman treatment plant outfall. The result exceeds both the HH and AAL criteria. Mercury was not detected in samples from the background sites. The previous listing, presence of mining sources, and uncertainty associated with the single elevated result in the treatment plant outfall justify a mercury TMDL for Ruby Gulch.

Selenium

There are 177 results for selenium from three of the four the current condition sites. No selenium data are available for site Z-1B. **Table F-31** summarizes the selenium aquatic life exceedance record for Ruby Gulch. The record contains no HH exceedances.

Table F-31. Selenium criteria exceedance numbers and percentage rates under high and low flow conditions at sites 667, Z-15, and Z-100 in Ruby Gulch

Flow Conditions	Sample Size	CAL Exceedance		AAL Exceedance	
		Number	%	Number	%
High Flow	53	28	53	0	0
Low Flow	124	76	61	0	0
All Flows	177	104	59	0	0

All but two exceedances occurred at site 667, the Zortman wastewater treatment plant discharge. The rate of CAL exceedances is greater than 10 percent under both high and low flow conditions, requiring a selenium TMDL for Ruby Gulch. Selenium criteria are not exceeded in any of the six results from the background condition sites.

Zinc

There are 312 results for zinc among the four current condition sites. The results date from 1995 to 2010. The zinc exceedance summary for Ruby Gulch is provided in **Table F-32**.

Table F-32. Zinc criteria exceedance numbers and percentage rates under high and low flow conditions at sites 667, Z-15, Z-100, and Z-1B in Ruby Gulch

Flow Conditions	Sample Size (CAL/AAL/HH)	CAL Exceedance		AAL Exceedance	
		Number	%	Number	%
High Flow	105	4	4	4	4
Low Flow	207	2	1	2	1
All Flows	312	6	2	6	2

There are six exceedances among 312 zinc results. Five of these six occurred at site Z-1B in samples dated from 1995 to 1997. All of the AAL exceedances at Z-1B are more than twice the criteria value and include one HH exceedance. Although there are no exceedances among 307 samples collected since 1997, only one sample has been from site Z-1B. The previous listing for Zn in Ruby Gulch, the uncertainty

regarding the current water quality at site Z-1B, and the HH exceedance prompt development of a TMDL in Ruby Gulch. There are no zinc exceedances among five results for the background sites.

F 2.9.3 Ruby Gulch Supplemental Indicators

Although there is no sediment chemistry or macroinvertebrate metric data available for Ruby Gulch, the sulfate data distributions shown in **Figure F-16** illustrate the effects of sulfide oxidation on water quality throughout the segment.

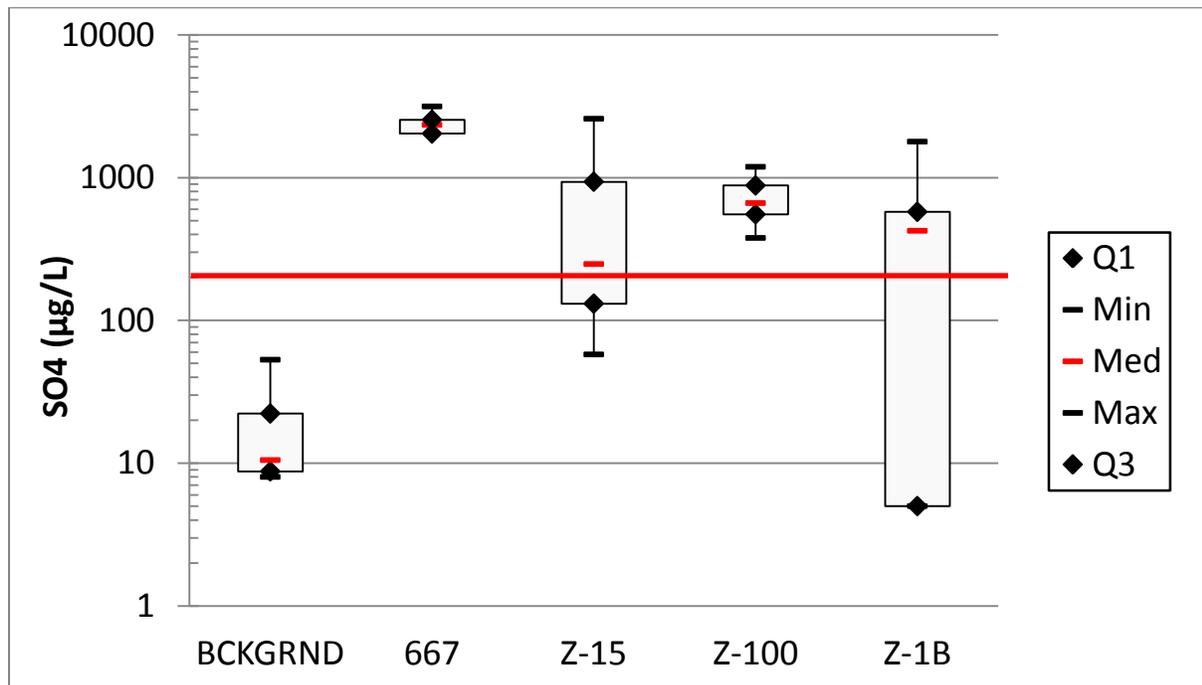


Figure F-16. Boxplot graph of Ruby Gulch sulfate concentration at sites 667, Z-15, Z-100, and Z-1B compared to background levels and the sulfate indicator value of 200 µg/L

F 2.9.4 Ruby Gulch TMDL Development Conclusions

The cadmium exceedance rates for the CAL and AAL criteria are greater than 10 percent. Twenty-nine 29 cadmium results are more than double the AAL criteria and 111 results exceed the HH criteria. The cadmium data indicate the need for a cadmium TMDL. Cadmium will serve as a surrogate parameter to address the Ruby Gulch listing for pH.

The assessment record for chromium in Ruby Gulch indicates that the listing is based on a groundwater sample from the upper portion of the drainage. Exchanges between groundwater and surface water in the Ruby Gulch headwaters are expressed in spring discharges in the upper gulch that were covered by the Z85-86 leach pad and dike. Despite the basis for the listing, it is conceivable that surface water chromium was elevated below the springs prior to construction of the leach pad and dike. The Z-L ACCESS dataset for chromium in Ruby Gulch is dated pre-1997 and contains no chromium exceedances. Assuming that the listing is valid, recent data to document current chromium concentrations are not available and a chromium TMDL is required for Ruby Gulch.

The copper exceedance rates for aquatic life criteria are less than 10 percent. The dataset is a continuous record of surface water copper from 2001 to the present and does not indicate the need for a copper TMDL.

Although the CAL exceedance rate for lead is less than 10 percent, the record for site Z-1B contains several values that are more than twice the AAL criteria for lead and includes HH exceedances. Lacking more recent data for site Z-1B, and considering the previous lead listing for Ruby Gulch, a lead TMDL is needed.

A lengthy record for cyanide in Ruby Gulch includes repeated exceedances of the CAL criterion through 2007. The CAL exceedance rate is greater than 10 percent, indicating the need for a cyanide TMDL.

A positive mercury detection of 2.0 µg/L in a 2003 sample exceeds both HH and aquatic life criteria. The uncertainty introduced by this result and the aging dataset supports a mercury TMDL.

The rate of CAL exceedances (59%) for selenium, mostly in the Zortman wastewater treatment plant outfall, indicated the need for a selenium TMDL.

Although the exceedance rate for aquatic life Zn criteria is less than 10 percent. Results for site Z-1B, located near the town of Zortman, include both aquatic life and HH exceedances, indicating the need for a zinc TMDL.

To summarize, metals TMDLs needed in Ruby Gulch include those for aluminum, cadmium, chromium, lead, mercury, selenium, and zinc. Cadmium will serve as a surrogate parameter for the pH impairment listing. A TMDL will also be developed for the toxin cyanide.

F 2.10 RUBY CREEK (MT40E002_060)

Ruby Creek is listed as impaired in the 2010 Integrated Report (Montana Department of Environmental Quality, Water Quality Planning Bureau, 2010) for aluminum, cadmium, copper, lead, mercury, selenium, zinc, and pH. The segment is classified as C-3 and extends for 4.6 miles from the confluence of Ruby and Alder gulches to the confluence with CK Creek (**Figure F-17**). Flow in Ruby Creek is largely in response to significant precipitation or snowmelt. Thus, the dataset consists of results for samples collected under high flow conditions. The entire length of Ruby Creek is outside of the igneous core of the Little Rockies mountain range. The Ruby Creek alluvium is underlain by Cretaceous marine shale and sandstone sediments.

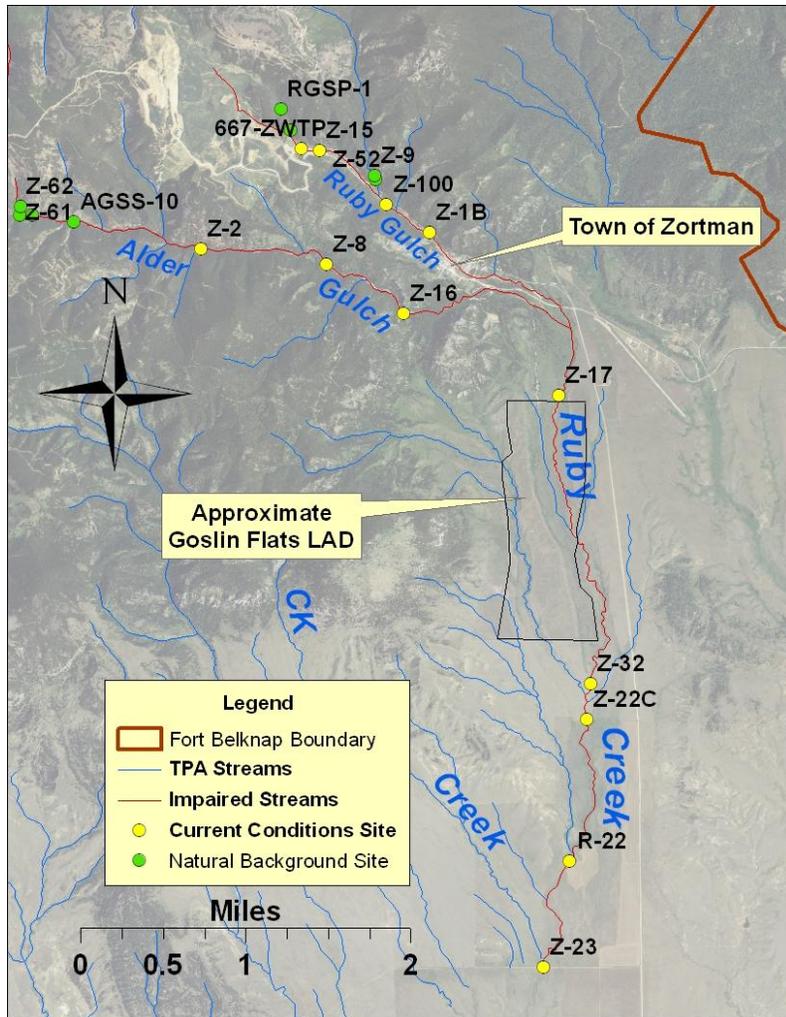


Figure F-17. The Ruby Creek drainage with locations of monitoring sites and Goslin Flats land application disposal (LAD) area.

Current water quality conditions are represented by results from sites Z-17, Z-32, Z-22C, R-22, and Z-23 (**Figure F-17**). The record for site Z-17 consists of three high flow samples collected during the spring of 1990 and 1991. There are 12 records for site Z-32 that include several low flow sampling events. The record for site Z-22C contains a single sampling event on July 13, 2010. Site R-22 has 30 records dating from 2000 through 2010. Like Z-22C, site Z-23 has data for a single sample collected on July 13, 2010. Site Z-23 is on CK Creek 100 meters downstream of its confluence with Ruby Creek. Background conditions are represented by those described above in **Sections F.2.1 and F.2.9** for Alder Gulch and Ruby Gulch.

F 2.10.1 Ruby Creek Sources

The principal metals loading sources are from the Zortman Mine that are described above for Ruby and Alder gulches. Portions of the 410-acre Goslin Flats LAD area occur on both banks of Ruby Creek. Discharges to the LAD area originate as leach pad drainage from both the Zortman or Landusky mines and are piped to the LAD area at an annual rate of about 55 million gallons. Past application has caused elevated cyanide, nitrate, selenium and other metals in shallow groundwater and in channel seeps, springs and ponds in Ruby Creek below the Goslin Gulch confluence.

F 2.10.2 Ruby Creek Parameter Departures

Aluminum

The dissolved aluminum record for Ruby Creek, within the pH range of 6.5 to 9.0, consists of a single sample collected at site Z-32 during high flow (220 gpm) in August of 1997. The result was less than 100 µg/L, an MLD that is greater than the CAL criterion of 87 µg/L. The aluminum listing for Ruby Creek appears to stem from a total recoverable concentration of 64.1 mg/L measured during high flows on May 19, 1991. The dissolved aluminum record from the background condition sites consists of seven high flow results from upper Alder Gulch ranging from 200 to 400 µg/L, all exceeding the CAL criterion. The high flow bias in the background condition results, the previous Al listing, and high MDLs justify an aluminum TMDL for Ruby Creek.

Cadmium

There are 45 results for cadmium in the Ruby Creek data record for current condition sites. The results are for samples from 1990 through 2011. All but two have MDLs less than the CAL criteria. Three values from sites Z-17 and Z-32 are greater than the HH criterion of 5 µg/L and are twice the AAL criterion, indicating the need for a cadmium TMDL in Ruby Creek.

There are 12 cadmium results among the background sites, all are for high flow conditions. Six of 12 have MDLs greater than the CAL criteria. Of the remaining six, three exceed the CAL criterion. There are no AAL or HH exceedances among the results from the background sites. Cadmium serves as a surrogate parameter for addressing the pH impairment in Ruby Creek.

Copper

There are 44 copper results for current condition sites. As with cadmium, several (3) results are twice the AAL criterion for copper, and two results exceed the HH criterion. A copper TMDL is required for Ruby Creek.

There are 12 copper results from the background sites. As with cadmium, all are from high flow samples. Ten results are reported with MDLs greater than the CAL criteria. Among these 10, there are seven CAL exceedances and six AAL exceedances. There are no HH exceedances among the background sites.

Lead

There are nine lead results available for sites Z-17, Z-32, and R-22. Three of nine (30%) exceed the CAL and HH criteria, requiring a lead TMDL for Ruby Creek. There are no exceedances of the AAL criteria for lead.

There are 12 lead results among the background sites. All report less than detectable amounts, but MDLs exceed the CAL criteria for 11 of the 12 results. There are no HH or AAL criteria exceeded in samples from background sites.

Mercury

There are 13 mercury results available for sites Z-17, Z-32, and R-22. Twelve of 13 exceed the both the HH and CAL criteria. Two results exceed the AAL criterion. A mercury TMDL is required for Ruby Creek.

There are 12 mercury results from background sites. Two of the MDLs exceed the CAL criterion and all MDLs exceed the HH criterion.

Selenium

There are 43 selenium results for current condition sites on Ruby Creek, with 30 of these coming from site R-22, a spring discharging into the channel bottom. All results from site R-22 exceed both the CAL and AAL criteria, and the HH criterion for selenium, requiring a selenium TMDL for Ruby Creek. The water quality for site R-22 probably reflects that of the shallow aquifer beneath the LAD area. There are 15 selenium results from background sites. All background results are less than the MDLs and all MDLs are less than the CAL criterion.

Zinc

There are 45 zinc results available for current condition sites. Thirty of these exceed the HH criterion and are more than twice the aquatic life criterion, requiring a zinc TMDL for Ruby Creek. There are 12 zinc results available for the background sites. All are less than the most restrictive target, the aquatic life criteria.

F 2.10.3 Ruby Creek Supplemental Indicators

There is no sediment chemistry or macroinvertebrate metric data available for Ruby Creek. **Figure F-18** illustrates the sulfate data distributions for the combined background sites and three current condition sites. The plots indicate the effects of ARD in Alder and Ruby gulches on the downstream sulfate concentrations in Ruby Creek and shallow groundwater discharging to the Ruby Creek channel at site R-22.

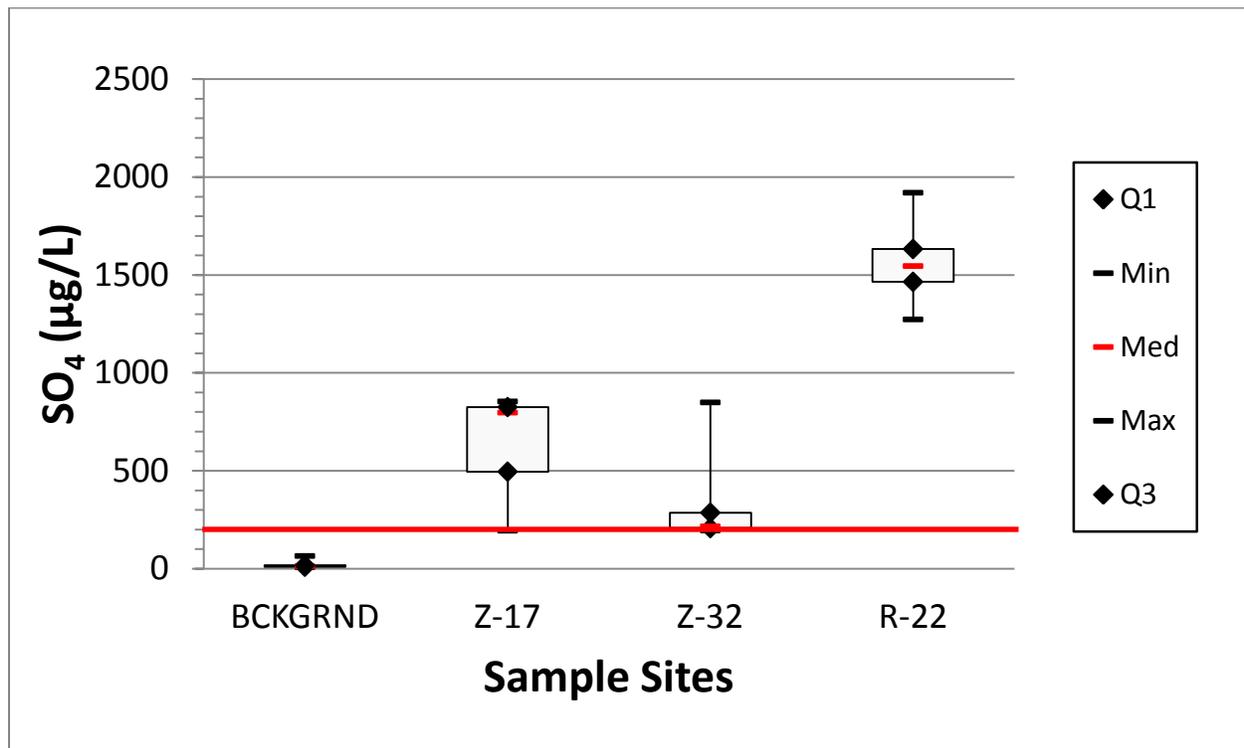


Figure F-18. Boxplot graph of Ruby Creek sulfate concentration at sites Z-17, Z-32, and R-22 compared to background levels and the sulfate indicator value of 200 $\mu\text{g/L}$

F 2.10.4 Ruby Creek TMDL Development Conclusions

The single Al result of less than 100 µg/L is not sufficient to assess compliance with the CAL criterion of 87 µg/L. Despite the basis of the 2000 listing on a total recoverable concentration and the possibility that background Al levels may exceed the CAL criterion during high flows, the previous listing, small dataset, and age of the data (1998) justify development of an aluminum TMDL.

The CAL criteria for cadmium are exceeded in 3 of 43 samples having adequate MDLs. These same samples are also more than double the AAL criteria. Although the data suggest that background Cd concentrations may occasionally exceed CAL criteria during high flow, the magnitude of the exceedances at current condition sites require a cadmium TMDL. As with cadmium, the exceedance rates for the copper CAL and AAL criteria are less than 10 percent, but include values that exceed the HH criterion and are twice the AAL criterion. Thus, the data show a need for a copper TMDL. The CAL criteria for lead are exceeded in 30 percent of the samples, indicating the need for a lead TMDL. All 12 of the mercury results exceed the CAL criteria, indicating that a mercury TMDL is needed. Thirty-seven of 44 selenium results (84%) exceed the CAL criterion, include many HH exceedances, and indicate the need for a selenium TMDL. Three of 44 Zn results exceed the HH criterion and exceed the aquatic life criteria by greater than a factor of two, indicating the need for a Zn TMDL. To summarize, TMDLs will be developed for the following metals in Ruby Creek: aluminum, cadmium, copper, mercury, lead, selenium, and zinc. The TMDL for cadmium serves as a surrogate to address the pH listing.

F 2.11 SULLIVAN CREEK (MT40E002_110)

Sullivan Creek is the west branch of the Rock Creek headwaters at the Landusky Mine. The stream currently extends from the base of the L91 leach pad dike to its confluence with Rock Creek (**Figure F-19**).

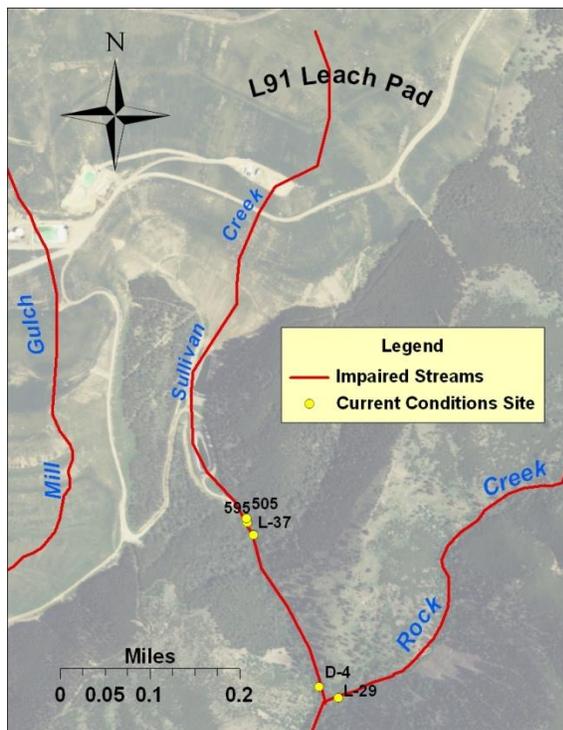


Figure F-19. Sullivan Creek (center), and current condition sites 505, 595, L-37, and D-4

Sullivan Creek is listed in the 2010 Integrated Report (Montana Department of Environmental Quality, Water Quality Planning Bureau, 2010) as impaired by flow alterations, stream-side vegetative alterations, fish passage barriers, and substrate habitat alterations. A review of the Sullivan Creek water quality data determined that impairment is also caused by the metals cadmium, iron, lead, selenium and zinc. Current water quality conditions are represented by the records for sites 505, 595, D-4, and L-37. Background water quality is represented by sites Z-60, Z-61, and Z-62 in upper Alder Gulch, site RCSS-5 in upper Rock Creek, and site L-40 in upper Montana Gulch.

F 2.11.1 Sullivan Creek Sources

The main source of metals loading to Sullivan Creek is the L91 leach pad and supporting dike. The upper 50 percent of the pre-mine drainage of Sullivan Creek is occupied by the L91 dike, consisting of 3.8 million tons of waste rock fill, and the leach pad, containing 65 million tons of ore (Spectrum Engineering, Inc., 2006). Both structures were built from sulfide materials. The Sullivan Creek capture system and heated pump house were constructed at the base of the L91 dike and have operated since September, 1997. Captured seepage is stored in a lined, 1.8 million gallon holding pond built in the drainage bottom. Stored water is pumped to the Landusky treatment plant. Other Sullivan Creek sources include storm runoff from the dike and pad face and from local roadways.

F 2.11.2 Sullivan Creek Parameter Departures**Cadmium**

There are 34 cadmium results, dating from 1995 to 2010, for the four current condition sites in Sullivan Creek. Two of these results are reported with MDLs greater than the CAL criteria. The criteria exceedance summary is provided in **Table F-33**.

Table F-33. Cadmium criteria exceedance numbers and percentage rates under high and low flow conditions at sites 505, 595, L-37, and D-4 in Sullivan Creek

Flow Conditions	Sample Size (CAL/AAL/HH)	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
High Flow	21/22/22	8	38	2	9	2	9
Low Flow	11/12/12	3	27	0	0	0	0
All Flows	32/34/34	11	34	2	6	2	6

The CAL exceedance rate is greater than 10 percent and the record includes two high flow HH exceedances for the current condition sites. The CAL exceedance rate and occurrence of HH exceedances require a cadmium TMDL.

Among the background condition sites, nine results had MDLs above the CAL criteria, with one exceedance. Thirteen results are available from the background sites for comparison with AAL and HH criteria, and there are no exceedances.

Iron

There are 27 iron results for three of the four existing condition sites. Results for iron are not available for site 505. The exceedance summary for iron is provided in **Table F-34**.

Table F-34. Iron criteria exceedance numbers and percentage rates under high and low flow conditions at sites 595, L-37, and D-4 in Sullivan Creek

Flow Conditions	Sample Size	Aquatic Life Criterion Exceedance	
		Number	%
High Flow	17	2	12
Low Flow	10	2	20
All Flows	27	4	15

The rate of exceedance of the 1,000 µg/L aquatic life criterion is 15 percent across both flow conditions, requiring an iron TMDL for Sullivan Creek. Low flow exceedances occur at nearly twice the rate of high flow exceedances. Among 13 results for iron at the background sites, there is one high flow exceedance at site RCSS-5 in upper Rock Creek.

Lead

There are 30 results for lead among three of the four current condition sites. The lead exceedance summary is provided in **Table F-35**.

Table F-35. Lead criteria exceedance numbers and percentage rates under high and low flow conditions at sites 505, L-37, and D-4 in Sullivan Creek

Flow Conditions	Sample Size	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
High Flow	18	6	33	0	0	4	22
Low Flow	12	3	25	0	0	2	17
All Flows	30	9	30	0	0	6	20

The overall CAL exceedance rate is 30 percent and there are six exceedances of the HH criterion. Thus, a lead TMDL is required for Sullivan Creek. Among the background sites, lead was not detected in any of the five results reported with MDLs low enough for comparisons with CAL criteria. There are 13 results for lead reported with MDLs greater than the AAL criteria. Lead is not detected in any of these 13 samples.

Selenium

There are 30 selenium results available from sites 595, L-37, and D-4, for both high and low flow conditions. For the 15 samples collected from the current condition sites during the past decade, two results (13%) exceeded the CAL criterion during high flow. With the exceedance rate greater than 10 percent, a selenium TMDL is required for Sullivan Creek. The four most recent (2008-2010) high flow selenium results indicate that selenium concentrations commonly exceed the CAL criterion below the capture system. No results exceeded either the AAL or HH criteria for selenium at current condition sites. Among 15 selenium results available from the five background sites, there is one high flow CAL exceedance. The most recent samples for the background sites were collected in 1998.

Zinc

There are 34 zinc results available from the four current condition sites. The exceedance summary is provided in **Table F-36**.

Table F-36. Zinc criteria exceedance numbers and percentage rates under high and low flow conditions at sites 595, L-37, and D-4 in Sullivan Creek

Flow Conditions	Sample Size	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
High Flow	22	4	18	4	18	0	0
Low Flow	12	1	8	1	8	0	0
All Flows	34	5	15	5	15	0	0

Fifteen percent of the zinc results from current condition sites exceeded the CAL criteria, requiring a zinc TMDL for Sullivan Creek. Most exceedances occur during high flows. Three of the four aquatic life exceedances were more than double the value of the criteria. There are no exceedances among the 13 zinc results available from the five background sites.

F 2.11.3 Sullivan Creek Supplemental Indicators

There is no sediment chemistry or macroinvertebrate metric data available for Sullivan Creek. **Figure F-20** illustrates the sulfate data distributions for each current condition site and the combined background sites. The plots indicate the effects of ARD on sulfate concentrations downstream of site 505 and the effects of dilution at site D-4 just above the confluence with Rock Creek.

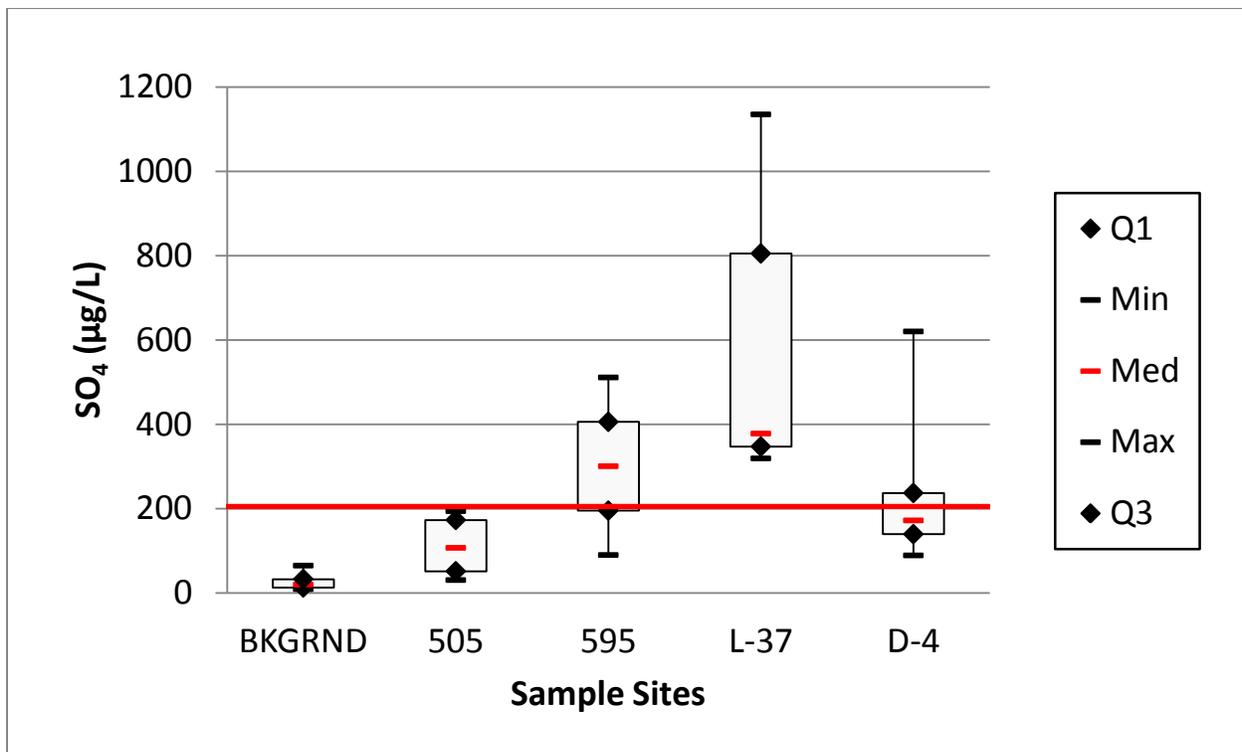


Figure F-20. Boxplots of sulfate data distributions for current condition sites and combined background sites for Sullivan Creek

F 2.11.4 Sullivan Creek TMDL Development Conclusions

The exceedance rates for at least one of the aquatic life criteria are greater than 10 percent for cadmium, iron, lead, selenium, and zinc. The HH criteria are exceeded for both cadmium and lead. Over half of the selenium data points are over 10 years old. The four most recent (2008-2010) high flow Se

results indicate that selenium concentrations commonly exceed the CAL criterion below the capture system. Sulfate concentrations also indicate the effects of ARD below the capture system. The data support development of TMDLs for cadmium, iron, lead, selenium and zinc in Sullivan Creek.

F 2.12 SWIFT GULCH CREEK (MT40I002_010)

Swift Gulch Creek is listed as impaired in the 2010 Integrated Report (Montana Department of Environmental Quality, Water Quality Planning Bureau, 2010) for aluminum, arsenic, cadmium, copper, cyanide, iron, lead, nickel, thallium, zinc, and pH. The segment is classified as B-1 and extends for 1.7 miles from its headwaters to its confluence with South Big Horn Creek. Current water quality conditions are represented by sites BKSS-2, BKSS-3, BKSS-9, L-19, L-49, and M37SWFGC01 (Figure F-21).

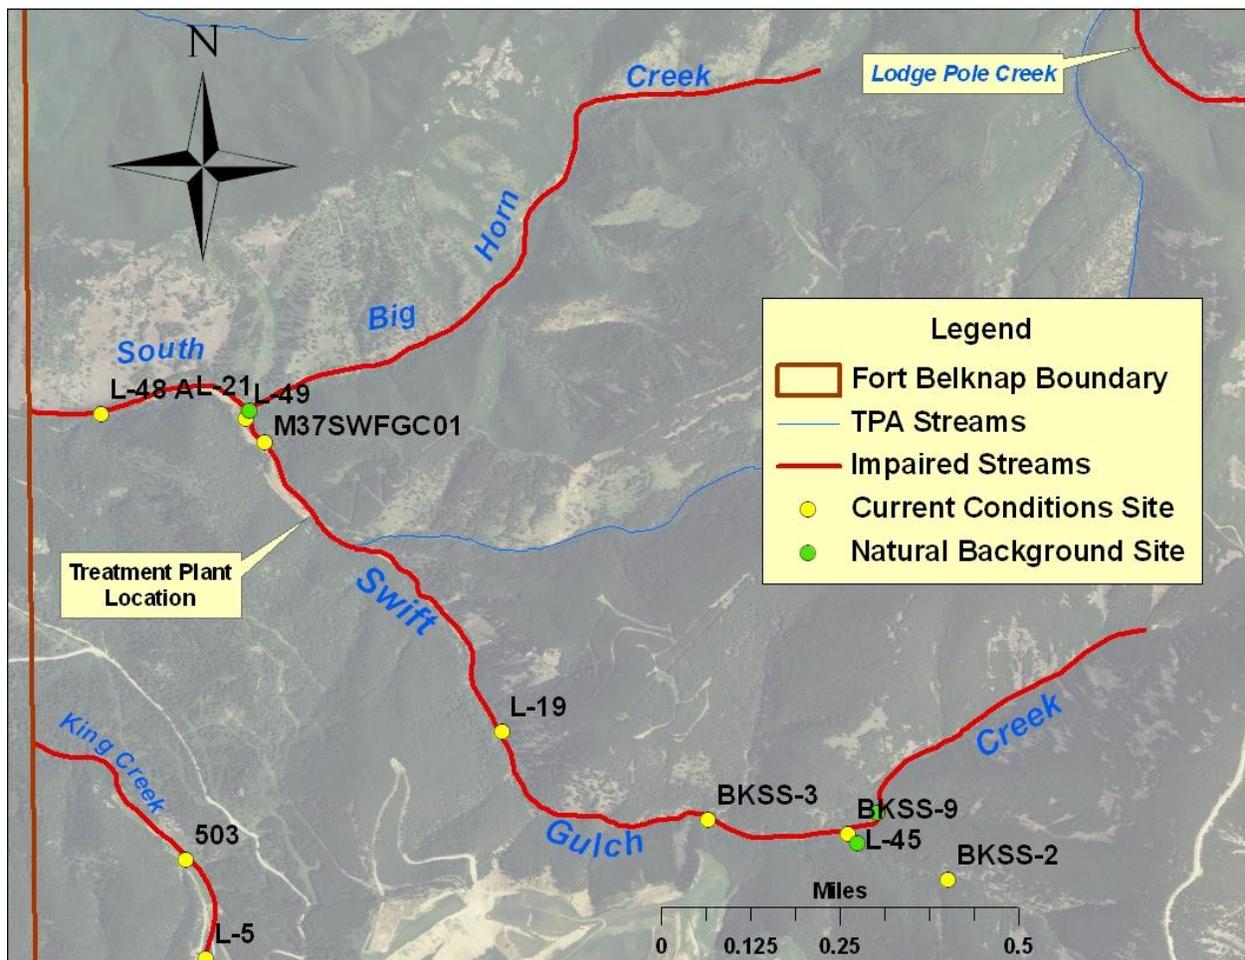


Figure F-21. Swift Gulch Creek and locations of current condition sites BKSS-2, BKSS-3, BKSS-9, L-19, L-49, and M37SWFGC01, and natural background sites L-21, L-41, and L-45.

F 2.12.1 Swift Gulch Creek Sources

The principal source of metals loading to Swift Gulch Creek is ARD-affected groundwater beneath the August-Little Ben-Surprise-Queen Rose pit complex at the Landusky Mine. The oxidation of sulfide rocks in and below the pit area causes acidification of local groundwater that is connected to Swift Gulch Creek surface water through a southwest-to-northeast trending shear zone. The ARD-affected groundwater enters the creek through several springs along the streambank between sites BKSS-9 and

L-19. Mining along the ridge on the south side of the gulch resulted in approximately 30 acres of disturbed area draining north into the gulch. Conceivable sources of cyanide to Swift Gulch Creek include the L87 and L91 leach pads constructed at the crest of the ridge on the south side of the gulch.

Deteriorating water quality in Swift Gulch Creek prompted construction of a third lime infusion treatment plant in 2010. The plant, located 300 meters upstream of the South Big Horn Creek confluence, is designed to treat ARD affected water at a rate of from 50 to 100 gallons per minute and return treated water to the stream channel. Extremely high precipitation and streamflow during the spring of 2011 disrupted the two capture systems upstream of the plant. Plant operations have been suspended pending repair of the capture systems.

F 2.12.2 Swift Gulch Creek Parameter Departures

Aluminum

Among the five existing condition sites, there are 22 results for dissolved aluminum in samples having a pH range from 6.5 to 9.0. The sample dates range from 1996 to 2009. Sixteen of the 22 samples have MDLs that exceed the CAL aluminum criterion of 87 µg/L. All six aluminum results with positive detections exceed the CAL criterion. Dissolved aluminum in the remaining six results ranges from 100 to 590 µg/L. All results greater than 100 µg/L are for high flow samples. An aluminum TMDL is required for Swift Gulch Creek

There are 15 results for dissolved aluminum from the three background sites. Eleven are less than the 100 µg/L detection limit. The remaining four samples each contain 200 µg/L and were collected during high flow.

Arsenic

There are 195 results for arsenic among the six existing condition sites. The sample dates occur between 1986 and 2011. **Table F-37** summarizes the arsenic exceedance record for these sites..

Table F-37. Arsenic criteria exceedance numbers and percentage rates under high and low flow conditions at sites BKSS-2, BKSS-3, BKSS-9, L-19, L-49, and M37SWFGC01 in Swift Gulch Creek

Flow Conditions	Sample Size	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
High Flow	85	0	0	0	0	41	48
Low Flow	110	0	0	0	0	71	65
All Flows	195	0	0	0	0	112	57

The 10 µg/L HH criterion is exceeded in 112 of 195 samples (57%), indicating the need for an arsenic TMDL for Swift Gulch Creek. Most As exceedances occur under low flow conditions. The CAL and AAL criteria were not exceeded in any sample. There were no arsenic criteria exceedances among 35 samples available for the three background sites.

Cadmium

There are 176 cadmium results for the six existing condition sites. Method detection limits in excess of the CAL and AAL criteria result in smaller sample sizes compared to that for the HH criterion. The exceedance summary is provided in **Table F-38** for each of the three criteria.

Table F-38. Cadmium criteria exceedance numbers and percentage rates under high and low flow conditions at sites BKSS-2, BKSS-3, BKSS-9, L-19, L-49, and M37SWFGC01 in Swift Gulch Creek

Flow Conditions	Sample Size (CAL/AAL/HH)	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
High Flow	74/79/80	60	81	25	32	10	14
Low Flow	89/96/96	79	89	6	8	5	5
All Flows	163/175/176	139	85	31	26	15	8

Exceedance rates for both CAL and AAL criteria are greater than 10 percent and 15 results exceed the HH criterion. Eight results were more than double the AAL criteria. A TMDL for cadmium is required for Swift Gulch Creek. The AAL and HH criteria were more often exceeded during high flow conditions.

Among the three background condition sites, two samples in 25 exceeded the CAL criteria. Samples from background sites did not exceed either the AAL or HH criteria.

Copper

There are 176 copper results available for the six current condition sites. The exceedance summary is provided in **Table F-39**. The exceedance rates of both the CAL and AAL criteria are greater than 10 percent. Two results were more than double the AAL criteria and two results exceeded the HH criterion. Thus, a copper TMDL is required for Swift Gulch Creek.

Table F-39. Copper criteria exceedance numbers and percentage rates under high and low flow conditions at sites BKSS-2, BKSS-3, BKSS-9, L-19, L-49, and M37SWFGC01 in Swift Gulch Creek

Flow Conditions	Sample Size (CAL/AAL/HH)	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
High Flow	77/79/80	21	27	21	27	0	0
Low Flow	96/96/96	19	20	6	6	2	2
All Flows	173/175/176	40	23	27	15	2	1

Of the 32 copper results for the three background sites that have MDLs less than the CAL criteria, three (9%) exceeded the CAL criteria during high flows. The same three samples also exceeded the AAL criteria. There were no HH exceedances among samples from the background sites.

Cyanide

Among five of the six current condition sites there are 133 cyanide results dated from 1997 to 2007. Of this dataset, 125 results are less than the MDLs. The eight positive detections occurred from 1998 through 2003 and are distributed among the five sites. All exceed the 5.2 µg/L CAL criterion. The most recent detection, 75 µg/L at site BKSS-3 in March of 2003, is more than double the AAL criterion of 22 µg/L. This result requires a cyanide TMDL for Swift Gulch Creek. There have been 47 non-detections among three of the sites from March, 2003, through May of 2007. Cyanide has not been detected in 29 samples collected from the three background sites.

Iron

The iron dataset includes 196 results from the six current condition sites. There are 48 exceedances among 88 high flow results (55%) and 66 exceedances among 108 low flow results (61%). These exceedance rates require an iron TMDL for Swift Gulch Creek. The corresponding dataset from the background sites contains 10 results from two sites with one high flow exceedance.

Lead

There are 61 results for lead among three of six current conditions sites over the most recent 10-year period. Forty-seven of these results are less than MDLs. Of the 14 positive detections, none have exceeded water quality criteria. Therefore, a lead TMDL is not developed for Swift Gulch Creek.

Nickel

There are 169 results for nickel from five of the six current condition sites. The exceedance summary for nickel is provided in **Table F-40**.

Table F-40. Nickel criteria exceedance numbers and percentage rates under high and low flow conditions at sites BKSS-3, BKSS-9, L-19, L-49, and M37SWFGC01 in Swift Gulch Creek

Flow Conditions	Sample Size	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
High Flow	70	11	16	0	0	19	27
Low Flow	99	48	48	0	0	51	52
All Flows	169	59	35	0	0	70	41

The CAL exceedance rate is greater than 10 percent, with most exceedances occurring during low flow. There are 70 HH exceedances, also predominantly during low flow. A nickel TMDL is required for Swift Gulch Creek.

There are 30 Ni results among the three background sites during the past 10 years. Twenty-eight of these have been less than MDLs. The two positive detections are less than all applicable criteria.

Selenium

There are 103 results for selenium from five of six current conditions sites during the most recent 10 years. Water quality criteria have not been exceeded in any sample. There are 33 selenium results during the past 10 years from the three background sites with one CAL exceedance. A selenium TMDL is not required for selenium in Swift Gulch Creek.

Thallium (Tl)

There are four results for thallium from samples collected at four current condition sites in 1996 and 1997. All are less than the MDL of 3 µg/L. The listing probably stems from an interpretation of these results as positive detections in a dataset that often lacks quality control flags. The detection limit of 3 µg/L is greater than the HH criterion of 0.24 µg/L. Given the previous listing and age of the thallium dataset, a thallium TMDL is developed for Swift Gulch Creek.

Zinc

There are 173 results for Zn obtained from five of the six current condition sites. The exceedance record is summarized in **Table F-41**.

Table F-41. Zinc criteria exceedance numbers and percentage rates under high and low flow conditions at sites BKSS-3, BKSS-9, L-19, L-49, and M37SWFGC01 in Swift Gulch Creek

Flow Conditions	Sample Size	CAL Exceedance		AAL Exceedance		HH Exceedance	
		Number	%	Number	%	Number	%
High Flow	76	49	64	49	64	2	3
Low Flow	97	63	65	63	65	35	36
All Flows	173	112	65	112	65	37	21

Aquatic life exceedances for Zn are greater than 10 percent of samples and the dataset includes 37 HH exceedances. Therefore, a zinc TMDL is required for Swift Gulch Creek. There are 37 Zn results among the three background sites. No water quality criteria for Zn are exceeded in any of these samples.

F 2.12.3 Swift Gulch Creek Supplemental Indicators

Sulfate

Figure F-22 illustrates the sulfate concentration record for site L-19 in Swift Gulch Creek. The data show a marked increase during 1990 above initial single digit values. The 200 µg/L indicator value first was first exceeded in 1995. The graph illustrates the worsening effect of ARD, interrupted by periodic high flow dilution.

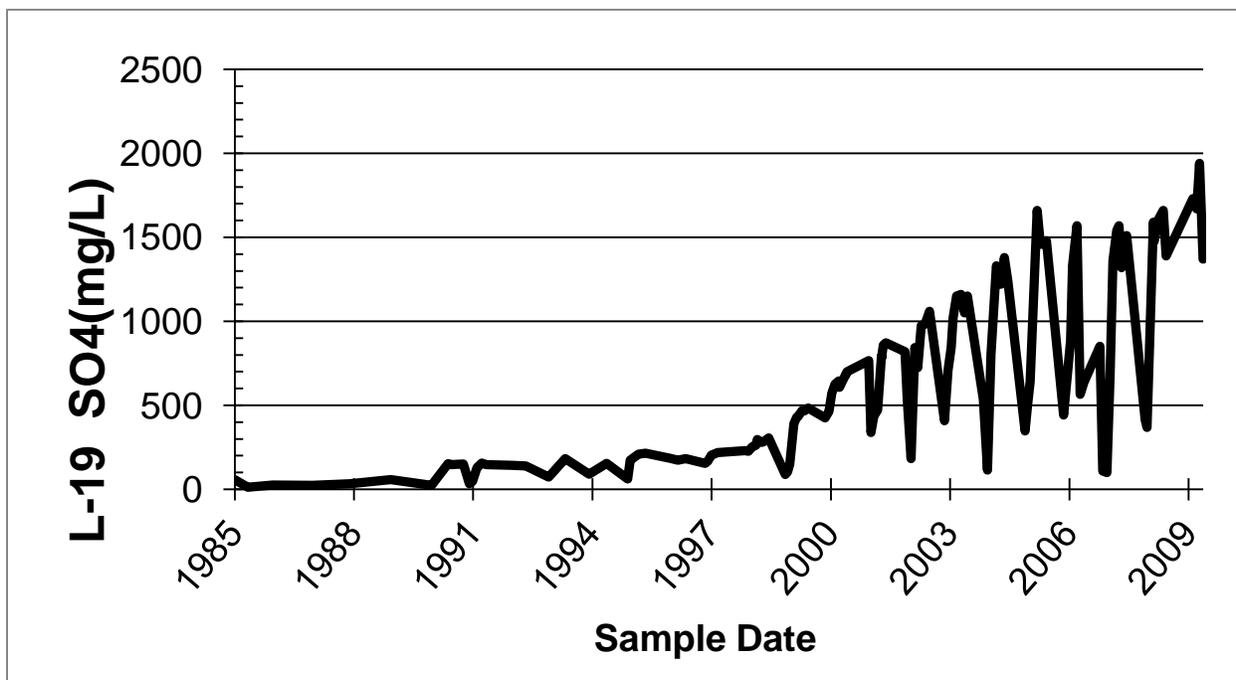


Figure F-22. Sulfate concentration in Swift Gulch Creek surface water at site L-19

There are no available sediment chemistry data for Swift Gulch Creek. A macroinvertebrate assessment completed for a sample collected at site MT37SWFGC01 in 2005 had a low valley MMI score of 72.4, that meets the minimum indicator value of 48. The sample scored a RIVPACS score of 0.79, just below the 0.8 target value

F 2.12.4 Swift Gulch Creek TMDL Development Conclusions

The exceedance rates for either the CAL or AAL criteria are greater than 10 percent for cadmium, copper, iron, nickel, and zinc. The MDLs for dissolved aluminum are greater than the CAL criterion. All six positive detections for dissolved aluminum exceed the CAL criterion. Fifty-seven percent of arsenic results exceed the HH criterion. A March, 2003, result of 75 µg/L for cyanide is more than double the 22 µg/L AAL criterion. Despite the possible false positive result for thallium, the MDL reported with the thallium results is greater than the HH criterion. The criteria exceedance rates or the uncertainty introduced by high MDLs for previously listed impairment causes, support TMDL development for aluminum, arsenic, cadmium, copper, iron, nickel, thallium, and zinc. Cadmium will serve as a surrogate parameter to address the pH impairment. The datasets for the previously listed causes lead and selenium have aquatic life exceedance rates of less than 10 percent and contain no HH exceedances. The data do not support the need for either lead or selenium TMDLs.

F3.0 REFERENCES

- Montana Department of Environmental Quality. 2010. Circular DEQ-7: Montana Numeric Water Quality Standards. Helena, MT: Montana Department of Environmental Quality.
<http://www.deq.state.mt.us/wqinfo/Standards/CompiledDEQ-7.pdf>.
- Montana Department of Environmental Quality, Water Quality Planning Bureau. 2010. Montana 2010 Final Water Quality Integrated Report. Helena, MT: Montana Department of Environmental Quality, Planning, Prevention and Assistance Division, Water Quality Planning Bureau. Report WQPBDMSRPT-03 Rev.
- Rossillon, M. 1991. Cultural Resource Inventory in the Little Rocky Mountains in and Adjacent to Pegasus Gold Corporation's Proposed Zortman Mine Expansion Project. Butte, MT: Renewable Technologies, Inc.
- Spectrum Engineering, Inc. 2006. Final Engineering Evaluation/Cost Analysis for Water Management at the Zortman and Landusky Mines, Phillips County, Montana.

